

(SUBMIT IN TRIPLICATE)

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

Budget Bureau No. 42-R358.4.
Approval expires 12-31-60.

Land Office Santa Fe, N.M.

Lease No. OF 078067

Unit Carson

SUNDRY NOTICES AND REPORTS ON WELLS


NOTICE OF INTENTION TO DRILL		SUBSEQUENT REPORT OF WATER SHUT-OFF	
NOTICE OF INTENTION TO CHANGE PLANS		SUBSEQUENT REPORT OF SHOOTING OR ACIDIZING	
NOTICE OF INTENTION TO TEST WATER SHUT-OFF		SUBSEQUENT REPORT OF ALTERING CASING	
NOTICE OF INTENTION TO RE-DRILL OR REPAIR WELL		SUBSEQUENT REPORT OF RE-DRILLING OR REPAIR	
NOTICE OF INTENTION TO SHOOT OR ACIDIZE		SUBSEQUENT REPORT OF ABANDONMENT	
NOTICE OF INTENTION TO PULL OR ALTER CASING		SUPPLEMENTARY WELL HISTORY	
NOTICE OF INTENTION TO ABANDON WELL			
Notice of Conversion to Injector	X		

(INDICATE ABOVE BY CHECK MARK NATURE OF REPORT, NOTICE, OR OTHER DATA)

January 6, 1962

Well No. 22-11 is located 196 ft. from N line and 196 ft. from E line of sec. 11

11 (1/4 Sec. and Sec. No.) 25N (Twp.) 12W (Range) N.M.P.M. (Meridian)
Histi (Field) San Juan (County or Subdivision) New Mexico (State or Territory)
New Mexico

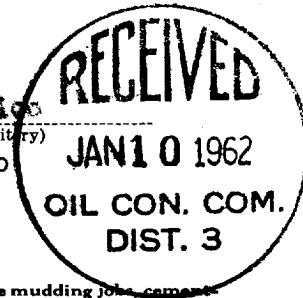

The elevation of the Kelly Bushing San Juan 636.9 ft.

DETAILS OF WORK

(State names of and expected depths to objective sands; show sizes, weights, and lengths of proposed casings; indicate mudding jobs, cementing points, and all other important proposed work)

TD 5060, PUDD 5049; Casing 8-5/8 @ 107, 4-1/2 5053; Perfs 4 (1/2 holes/ft.) in intervals 4918-50, 4964-4998, 5002-12.

Plan of Work

1. Pressure test tubing with 1000 psi for 15 min.
2. Pull tubing and bail clean.
3. Run 2-3/8" open-ended tubing to bottom and swab while running clean Point Look-water (treated with Triton X-100 detergent) down casing. When fluid cleans casing, pull tubing.
4. Run 2-3/8" tubing with packer ten feet above perforations.
5. Pump 50 bbls. of inhibited water down annulus to displace uninhibited fluid. Set packer and fill with inhibited water.
6. Run pressure and temperature surveys as directed.

I understand that this plan of work must receive approval in writing by the Geological Survey before operations may be commenced.

Company Shell Oil Company

Address P. O. Box 1200

Farmington, N. M.

Original Signed By
W. M. MARSHALL

By W. M. Marshall

Title Division Exploitation Engineer