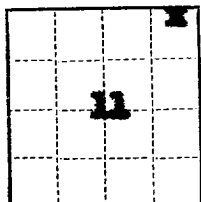


(SUBMIT IN TRIPLICATE)

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEYLand Office **Santa Fe**
Lease No. **078153**
Unit **Shipp**

SUNDRY NOTICES AND REPORTS ON WELLS

NOTICE OF INTENTION TO DRILL		SUBSEQUENT REPORT OF WATER SHUT-OFF	
NOTICE OF INTENTION TO CHANGE PLANS		SUBSEQUENT REPORT OF SHOOTING OR ACIDIZING	
NOTICE OF INTENTION TO TEST WATER SHUT-OFF		SUBSEQUENT REPORT OF ALTERING CASING	
NOTICE OF INTENTION TO RE-DRILL OR REPAIR WELL		SUBSEQUENT REPORT OF RE-DRILLING OR REPAIR	
NOTICE OF INTENTION TO SHOOT OR ACIDIZE		SUBSEQUENT REPORT OF ABANDONMENT	
NOTICE OF INTENTION TO PULL OR ALTER CASING		SUPPLEMENTARY WELL HISTORY	
NOTICE OF INTENTION TO ABANDON WELL		Running surface Casing	II

(INDICATE ABOVE BY CHECK MARK NATURE OF REPORT, NOTICE, OR OTHER DATA)


November 29, 1956

Well No. **2** is located **760** ft. from **(N)** line and **660** ft. from **(E)** line of sec. **11****NE, NE, Sec 11**
(1/4 Sec. and Sec. No.)**25 N**
(Twp.)**13 W**
(Range)**NNPM**
(Meridian)**Bisti-Gallup Extension**
(Field)**San Juan**
(County or Subdivision)**New Mexico**
(State or Territory)The elevation of the derrick floor above sea level is **6280** ft. **GL**

DETAILS OF WORK

(State names of and expected depths to objective sands; show sizes, weights, and lengths of proposed casings; indicate mudding jobs, cementing points, and all other important proposed work)

Drilled 13-3/4" hole to 223'KB. Conditioned hole and ran 9-5/8" Armo spiral weld casing, equipped with Texas pattern Shoe, landed at 214'KB and cemented with 200 sac 2% GACL cement. Displaced cement to 194'KB with good returns to surface. Waited 24 hours, drilled out cement and tested surface casing with 500 PSI for 30 minutes. Held OK.

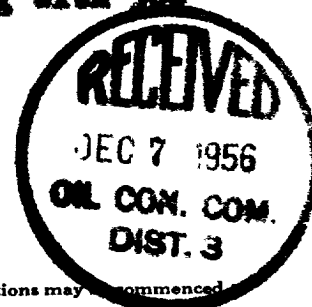

I understand that this plan of work must receive approval in writing by the Geological Survey before operations may be commenced.

Company **The British-American Oil Producing Company**Address **Box 180****Denver 1, Colorado**Original Signed by:
Thomas M. Hogan

By

Title **District Superintendent**

