

State of New Mexico  
Energy, Minerals and Natural Resources Department  
Oil Conservation Division

Sundry Notices and Reports on Wells

1. Type of Well  
GAS

2. Name of Operator

**BURLINGTON  
RESOURCES**

OIL & GAS COMPANY

3. Address & Phone No. of Operator

PO Box 4289, Farmington, NM 87499 (505) 326-9700

4. Location of Well, Footage, Sec., T, R, M

960' FNL, 1650' FEL, Sec. 24, T-27-N, R-6-W, NMPM, Rio Arriba County

API # (assigned by OCD)

30-039-25218

5. Lease Number

Fee

6. State Oil&Gas Lease #

7. Lease Name/Unit Name

San Juan 28-6 Unit NP

8. Well No.

429

9. Pool Name or Wildcat

Basin Fruitland Coal

10. Elevation:

Type of Submission

☐ Notice of Intent

☒ Subsequent Report

☐ Final Abandonment

Type of Action

☒ Abandonment

☐ Recompletion

☐ Plugging Back

☐ Casing Repair

☐ Altering Casing

☐ Other -

☐ Change of Plans

☐ New Construction

☐ Non-Routine Fracturing

☐ Water Shut off


☐ Conversion to Injection

13. Describe Proposed or Completed Operations

4-10-97 MIRU. ND WH. NU BOP. TOOH w/92 jts 2 3/8" tbgs. TIH w/gauge ring to 3028'. TOOH. TIH w/CIBP, set @ 2817'. Load hole w/wtr. PT csg to 500 psi/15 min, OK. Establish circ. Plug #1: pump 12 sx Class "B" neat cmt on top of CIBP @ 2767-2817'. TOOH to 2387'. Establish circ. Plug #2: pump 28 sx Class "B" neat cmt @ 2387-2599'. TOOH to 1300'. Establish circ. Plug #3: pump 12 sx Class "B" neat cmt @ 1300-1415'. TOOH. Establish circ down csg & out bradenhead. Plug #4: pump 30 sx Class "B" neat cmt down csg & out bradenhead. Circ 1 bbl cmt to surface. WOC. ND BOP. Cut off WH. Fill csg w/16 sx Class "B" neat cmt. Install dry hole marker w/10 sx Class "B" neat cmt.

4-11-97 RD. Rig released. Well plugged and abandoned 4-11-97.


SIGNATURE

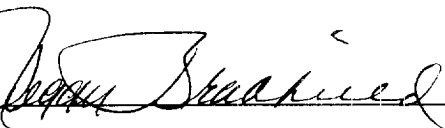

Regulatory Administrator April 21, 1997

(This space for State Use)

Approved by

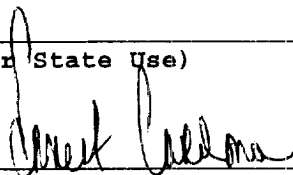

Title

Deputy O&G Inspector

Date

5-8-97