


Form 9-331a  
(7-1-55)

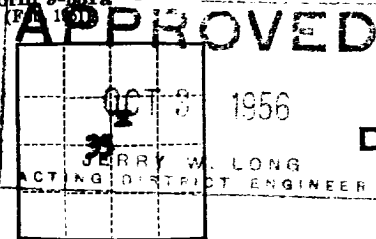

(SUBMIT IN TRIPLICATE)

UNITED STATES  
DEPARTMENT OF THE INTERIOR  
GEOLOGICAL SURVEY

Land Office Santa Fe  
Lease No. 078155  
Unit Govt. Marye

SUNDRY NOTICES AND REPORTS ON WELLS

NOTICE OF INTENTION TO DRILL	SUBSEQUENT REPORT OF WATER SHUT-OFF	
NOTICE OF INTENTION TO CHANGE PLANS	SUBSEQUENT REPORT OF SHOOTING OR ACIDIZING	
NOTICE OF INTENTION TO TEST WATER SHUT-OFF	SUBSEQUENT REPORT OF ALTERING CASING	
NOTICE OF INTENTION TO RE-DRILL OR REPAIR WELL	SUBSEQUENT REPORT OF RE-DRILLING OR REPAIR	
NOTICE OF INTENTION TO SHOOT OR ACIDIZE	SUBSEQUENT REPORT OF ABANDONMENT	
NOTICE OF INTENTION TO PULL OR ALTER CASING	SUPPLEMENTARY WELL HISTORY	
NOTICE OF INTENTION TO ABANDON WELL	<u>Running Production Casing</u>	<u>X</u>

(INDICATE ABOVE BY CHECK MARK NATURE OF REPORT, NOTICE, OR OTHER DATA)

August 16, 1956

Govt. Marye  
Well No. B-1 is located 1980 ft. from N line and 1980 ft. from E line of sec. 35  
SW NE Sec. 35 26N 13W R.M.P.M.  
( $\frac{1}{4}$  Sec. and Sec. No.) (Twp.) (Range) (Meridian)  
Bisti-Gallup San Juan New Mexico  
(Field) (County or Subdivision) (State or Territory)

The elevation of the derrick floor above sea level is 6217 ft. G. 1.

DETAILS OF WORK

(State names of and expected depths to objective sands; show sizes, weights, and lengths of proposed casings; indicate mudding jobs, cementing points, and all other important proposed work)

Drilled to total depth of 5075' KB, completed logs, conditioned hole, and run 197 joints (5095')  $\frac{5}{8}$ ", 14#, J-55. Casing landed at 5074' KB. Casing equipped w/Baker Shoe, G I Baffle, Centralizers & Scrubbers, and cemented with 125 sac  $\frac{3}{4}$  Gal Cement. Pumped plug to Float Collar at 5006' KB. Ran Temperature survey and found top of cement behind casing at 4905' KB.

I understand that this plan of work must receive approval in writing by the Geological Survey before operations may be commenced.

Company The British-American Oil Producing Company

Address Box 180

Denver, Colorado

By

Original signed by:  
Thomas M. Hogan

Thomas M. Hogan  
Title District Superintendent

