

**UNITED STATES  
DEPARTMENT OF THE INTERIOR  
GEOLOGICAL SURVEY**

SUBMIT IN TRIPLICATE\*  
(Other instructions on reverse side)

Form approved.  
Budget Bureau No. 42-R1424.

5. LEASE DESIGNATION AND SERIAL NO.

**SF-078092**

6. IF INDIAN, ALLOTTEE OR TRIBE NAME

7. UNIT AGREEMENT NAME

8. FARM OR LEASE NAME

**Douthitt Federal**

9. WELL NO.

**1**

10. FIELD AND POOL, OR WILDCAT

**Basin Dakota**

11. SEC., T., R., M., OR BLK. AND SURVEY OR AREA

**27-27N-11W**

**NMPM**

14. PERMIT NO.

15. ELEVATIONS (Show whether DF, RT, GR, etc.)

**6370' GR**

12. COUNTY OR PARISH

**San Juan**

13. STATE

**New Mexico**

16. Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO :

TEST WATER SHUT-OFF   
FRACTURE TREAT   
SHOOT OR ACIDIZE   
REPAIR WELL

PULL OR ALTER CASING   
MULTIPLE COMPLETE   
ABANDON\*   
CHANGE PLANS

SUBSEQUENT REPORT OF :

WATER SHUT-OFF   
FRACTURE TREATMENT   
SHOOTING OR ACIDIZING

REPAIRING WELL   
ALTERING CASING   
ABANDONMENT\*

(Other)


(Other)

(NOTE: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)\*

Move in, rig up, pump in 100 bbls. fresh water down tbg. and kill well. Pull tbg., run casing inspection tool to T.D. and determine if csg. is still in good condition throughout Dakota section. If good, run Baker Model "D" packer w/7000# bump-out plug on wire line and set @ 10 to 20' above top perforation in well. Run tbg. back with Baker Model "D" mandrell and enough integral 1-1/4" tbg. open-ended below mandrell to open packer and pump in approx. 120 bbls. low grade crude, mixed with Ken-Pack; completely fill annulus and pump same out holes in casing. Displace 20 to 24 bbls. fresh water down tubing, slack tubing off, open packer, set tubing down, run swab.

Return well to production.

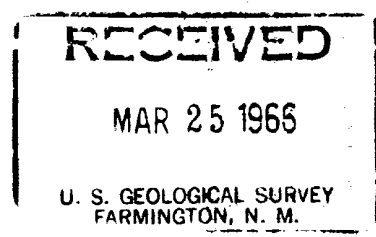

18. I hereby certify that the foregoing is true and correct

SIGNED JOHN T. HAMPTON

TITLE Manager

DATE March 23, 1966

(This space for Federal or State office use)

APPROVED BY \_\_\_\_\_  
CONDITIONS OF APPROVAL, IF ANY:

TITLE \_\_\_\_\_

DATE \_\_\_\_\_

## Instructions

**General:** This form is designed for submitting proposals to perform certain well operations, and reports of such operations when completed, as indicated, on Federal and Indian lands pursuant to applicable Federal law and regulations, and, if approved or accepted by any State, on all lands in such State, pursuant to applicable State law and regulations. Any necessary special instructions concerning the use of this form and the number of copies to be submitted, particularly with regard to local, area, or regional procedures and practices, either are shown below or will be issued by, or may be obtained from, the local Federal and/or State office.

**Item 4:** If there are no applicable State requirements, locations on Federal or Indian land should be described in accordance with Federal requirements. Consult local State or Federal office for specific instructions.

**Item 17:** Proposals to abandon a well and subsequent reports of abandonment should include such special information as is required by local Federal and/or State offices. In addition, such proposals and reports should include reasons for the abandonment; data on any former or present productive zones, or other zones with present significant fluid contents not sealed off by cement or otherwise; depths (top and bottom) and method of placement of cement plugs; mud or other material placed below, between and above plugs; amount, size, method of parting of any casing, liner or tubing pulled and the depth to top of any left in the hole; method of closing top of well; and date well site conditioned for final inspection looking to approval of the abandonment.

U.S. GOVERNMENT PRINTING OFFICE: 1963-O-685229