

STATE OF NEW MEXICO
OIL CONSERVATION
COMMISSION
DISTRICT NO. 3
Phone 99 P. O. Box 697
AZTEC, NEW MEXICO

(SUBMIT IN TRIPLICATE)
UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

Land Office
080362-4
Lease No.
No. 4 Sec. 16 T. 2S
R. 1E W. 4E

SUNDRY NOTICES AND REPORTS ON WELLS

SEP 21 1951

NOTICE OF INTENTION TO DRILL	SUBSEQUENT REPORT OF WATER SHUT-OFF
NOTICE OF INTENTION TO CHANGE PLANS	SUBSEQUENT REPORT OF SHOOTING OR ACIDIZING
NOTICE OF INTENTION TO TEST WATER SHUT-OFF	SUBSEQUENT REPORT OF ALTERING CASING
NOTICE OF INTENTION TO RE-DRILL OR REPAIR WELL	SUBSEQUENT REPORT OF REDRILLING OR REPAIR
NOTICE OF INTENTION TO SHOOT OR ACIDIZE	SUBSEQUENT REPORT OF ABANDONMENT
NOTICE OF INTENTION TO PULL OR ALTER CASING	SUPPLEMENTARY WELL HISTORY
NOTICE OF INTENTION TO ABANDON WELL	

(INDICATE ABOVE BY CHECK MARK NATURE OF REPORT, NOTICE, OR OTHER DATA)

Schwerdtfeger #10
C 34 T. 2S

September 18, 1951

Well No. 10 is located 990 ft. from ^(N) line and 1650 ft. from ^(E) line of sec. 16
T. 2S R. 1E W. 4E

J. K. Conner

(Twp.)

(Range)

(Meridian)

New Mexico

(Field)

(County or Subdivision)

(State or Territory)

The elevation of the derrick floor above sea level is 6237' ft. 6228' Ord. Level

DETAILS OF WORK

(State names of and expected depths to objective sands; show sizes, weights, and lengths of proposed casings; indicate mudding jobs, cementing points, and all other important proposed work)

1. On 8/5/51 ran 89 joints of 5 1/2" O.D., 13, 14, 15.5 and 17 1/2" ft. J & L casing set at 1942' KB and cemented with 128 sacks of regular cement. Plug down 4:30 A.M. 8/6/51.
2. Moved off rotary tools.
3. Moved in cable tools 8/11/51.
4. Bled water on 8/13/51. Didn't find plug. Found soft cement at 1890-1930'. Cleaned to 2003' KB. Well making water on 8/14/51.
5. Squeezed on 8/15/51. Plugged back with gravel and Cal seal to 14' below shoe. Set Halliburton 10 squeeze packer at 1894'. Squeezed with 78 sacks of regular cement. 63 sacks were set below the packer and 35 sacks dumped on top. Circulating pressure was 1000' and the maximum pressure 1000'.

I understand that this plan of work must receive approval in writing by the Geological Survey before operations may be commenced.

THE FRONTIER REFINING COMPANY


Company
410 BOYAN BUILDING

Address
DENVER, COLORADO

By Lawman J. Gilbrath
Lawman J. Gilbrath, Geologist
Title

Land Office _____
Lease No. _____
Unit _____

(SUBMIT IN TRIPLICATE)
UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

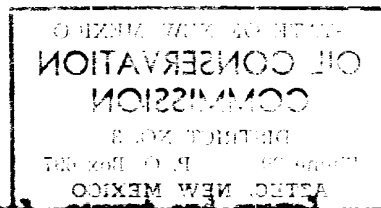

6. Drilled Cal. 15/21/8 no traces; drilled 15/21/8 no
7. Drilled 15/21/8 no traces; drilled 15/21/8 no
8. Drilled 15/21/8 no traces; drilled 15/21/8 no

NOTICE OF INTENTION TO ABANDON WELL	
NOTICE OF INTENTION TO PULL OR ALTER CASING	
NOTICE OF INTENTION TO SHOOT OR ACIDIZE	
NOTICE OF INTENTION TO RE-DRILL OR REPAIR WELL	
SUBSEQUENT REPORT OF ALTERING CASING	
SUBSEQUENT REPORT OF SHOOTING OR ACIDIZING	
SUBSEQUENT REPORT OF WATER SHUT-OFF	
SUPPLEMENTARY WELL HISTORY	

(INDICATE ABOVE BY CHECK MARK NATURE OF REPORT, NOTICE, OR OTHER DATA)

Well No. _____ is located _____ ft. from _____ line and _____ ft. from _____ line of sec. _____
(Field) (County or Subdivision) (State or Territory)

The elevation of the derrick floor above sea level is _____ ft.

DETAILS OF WORK

(State names of and expected depths to objective sands; show sizes, weights, and lengths of proposed casing; indicate mudlogging jobs, cementing points, and all other important proposed work)

I understand that this plan of work must receive approval in writing by the Geological Survey before operations may be commenced.

By _____ Title _____
Address _____
Company _____