

UNITED STATES
DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT

SUBMIT IN TRIPLICATE*
(Other instructions on re-
verse side)

Budget Bureau No. 1004-0135
Expires August 31, 1985

5. LEASE DESIGNATION AND SERIAL NO.

SF-077941

6. IF INDIAN, ALLOTTEE OR TRIBE NAME

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir.
Use "APPLICATION FOR PERMIT" for such proposals.)

1. OIL WELL ☐ GAS WELL ☒ OTHER

2. NAME OF OPERATOR

Amoco Production Co.

3. ADDRESS OF OPERATOR

501 Airport Drive, Farmington, N M 87401

4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements.*
See also space 17 below.)
At surface

2090' FSL x 1680' FWL

RECEIVED

AUG 19 1985

14. PERMIT NO.

15. ELEVATIONS (Show whether DF, RT, GR, etc.)

5900' RDB

7. UNIT AGREEMENT NAME

8. FARM OR LEASE NAME

C. A. McAdams "C"

9. WELL NO.

2

10. FIELD AND POOL, OR WILDCAT

Basin Dakota

11. SEC., T., R., M., OR BLK. AND
SURVEY OR AREA

NE/SW Sec5, T27N, R10W

12. COUNTY OR PARISH 13. STATE

San Juan

NM

16.

Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

TEST WATER SHUT-OFF

FRACTURE TREAT

SHOOT OR ACIDIZE

REPAIR WELL

(Other)

PULL OR ALTER CASING

MULTIPLE COMPLETE

ABANDON*

CHANGE PLANS

SUBSEQUENT REPORT OF:

WATER SHUT-OFF

FRACTURE TREATMENT

SHOOTING OR ACIDIZING

(Other)

REPAIRING WELL

ALTERING CASING

ABANDONMENT*

(NOTE: Report results of multiple completion on Well
Completion or Recompletion Report and Log form.)

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any
proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones perti-
nent to this work.)*

Amoco Production Company requests approval to repair subject well
according to the attached procedure.

18. I hereby certify that the foregoing is true and correct

SIGNED

BDS Shaw

TITLE Adm. Supervisor

(This space for Federal or State office use)

APPROVED BY

CONDITIONS OF APPROVAL, IF ANY:

TITLE

APPROVED

DATE 8-14-85

AUG 20 1985

DATE

for the BLM
FARMINGTON RESOURCE AREA

*See Instructions on Reverse Side

NMOCG

FARMINGTON DISTRICT WORKOVER

DATE: 8/6/85

OPERATIONS TO BE PERFORMED: (CIRCLE ONE)

RECOMPLETION

REPAIR

SERVICE

LEASE AND WELL C.A. McAdams C. No. 2FIELD Basin DakotaFORMATION DakotaLOGS Sonic x Induction LogsLOCATION SW/4, Sec 5, T27N, R10WSan Juan County, New MexicoCOMP. DATE 5/64EL: 5900' KBTD: 6419'PBD: 6383'CSG: 4-1/2" 10.5 # J-55 @ 6419'8-7/8" 24.0 # J-55 @ 353'COMP. INT. 6336-6204ORIG. STIM. 87,300 gal. x 10,000' SWIP 5433 MCFDCURRENT PROD. INT. SamePURPOSE: Repair Casing LeakDBB
BJW

DAB

8 PERMITTING DESK

~~MCH~~
~~RGH~~
~~BVD~~
~~GMK~~GOM
TWE


ENGR

JT

Note: Work well in t. Formation
is sensitive to water.

WELLBORE SKETCH

PROCEDURE

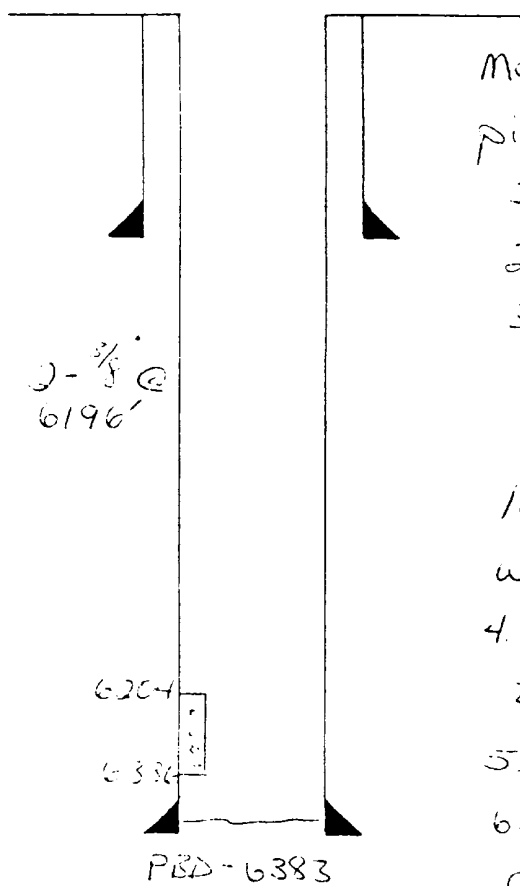

Water analysis indicates casing leak in Mesaverde (3300-4450'). Tubing stop for piston set @ 6135'.

1. mirusu. TOH with 2-3/8" tbg.

2. T1H with BP, packer, and 2-3/8" tbg.

3. Set BP at 6150'. Load hole with 2% KCl water. Pressure test casing to 1000 psi. If casing will not hold pressure, locate hole with packer. Squeeze hole with 50 sx Class B Neat.

4. Drill out cement and pressure test casing to 1000 psi. Unload hole with N₂.

5. Retrieve BP at 6150'.

6. T1H with sawtooth collar, seating nipple, and 2-3/8" tbg. Clean out to PBD with N₂. Land tbg at 6340'.

DISTRICT MANAGER

W. H. Holcomb

DISTRICT ENGINEER

W. J. Bell 080485

DISTRICT FOREMAN

Bonny for W. J. Bell

ENGINEER

Morris J. Bell ext 244 (598-9751)

DATE

8/9/85

ENG SPE

ENG 40