

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

SUBMIT IN TRIPLICATE*
(Other instructions on re-
verse side)

Form approved.
Budget Bureau No. 42-R1424.

5. LEASE DESIGNATION AND SERIAL NO.

I-149-Ind-84/3

6. IF INDIAN, ALLOTTEE OR TRIBE NAME

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir.
Use "APPLICATION FOR PERMIT—" for such proposals.)

1.

OIL WELL ☐ GAS WELL ☒ OTHER

2. NAME OF OPERATOR

El Paso Natural Gas Company

3. ADDRESS OF OPERATOR

Box 990, Farmington, New Mexico

4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements.*

See also space 17 below.)
At surface

1550'S, 990'W

7. UNIT AGREEMENT NAME

Esmerfanito Unit

8. FARM OR LEASE NAME

9. WELL NO.

E2 (M)

10. FIELD AND POOL, OR WILDCAT

Blanco M.V. Basin Dakota

11. SEC., T., R., M., OR BLK. AND
SURVEY OR AREA

Sec. 25, T-27-N, R-9-W

N.M.L.M.

14. PERMIT NO.

15. ELEVATIONS (Show whether DF, RT, OR, etc.)

6270' GL

12. COUNTY OR PARISH

San Juan

13. STATE

New Mexico

16.

Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

TEST WATER SHUT-OFF

☐
☐
☐
☐
☐

PULL OR ALTER CASING

☐
☐
☐
☐
☐

FRACTURE TREAT

MULTIPLE COMPLETE

SHOOT OR ACIDIZE

ABANDON*

REPAIR WELL

CHANGE PLANS

(Other)

SUBSEQUENT REPORT OF:

WATER SHUT-OFF

☐
☐
☐
☐
☐

REPAIRING WELL

☐
☐
☐
☐
☐

FRACTURE TREATMENT

ALTERING CASING

SHOOTING OR ACIDIZING

ABANDONMENT*



(Other)

(NOTE: Report results of multiple completion on Well
Completion or Recompletion Report and Log form.)

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)*

On 10-6-65 spotted 500 gallons 7 1/2% Acetic acid, perforated Dakota 6736-32' w/2 SFF; 6706-16', 6620-28', 6602-10' w/1 SFF; 6536-40' w/4 SFF, fraced w/30,000# 20/40 sand and 50,400 gallons water, 1 1/2% CHI 2 1/2% J-100/1000 gallons. Max. pr. 4500#, BDF 1800#, tr. pr. 3000-3700-3900-4000#. Dropped 3 sets of 8 balls each. Balled off on third drop, released and continued frac. Flush w/5568 gallons water. I.R. 30.4 BPM. ISIP 2200#. Set bridge plug at 4590'.

Perf. Mesa Verde 4560-56', 4523-27' w/4 SFF, 4496-4504, 4478-70' w/2 SFF, fraced w/44,940 gallons water, 2 1/2% FR-2/1000 gallons, 40,000# 20/40 sand. Max. pr. 2300#, BDF 1260#, tr. pr. 1600-2000-2300#. Dropped 3 sets of 16 balls each. Flush w/5166 gallons water. I.R. 73.1 BPM. ISIP 1000# to vacuum.

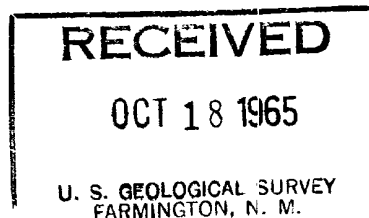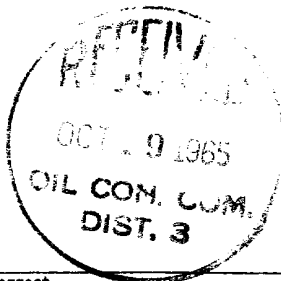

18. I hereby certify that the foregoing is true and correct

Original signed by

SIGNED Carl E. Matthews

TITLE petroleum engineer

DATE 10-15-65

(This space for Federal or State office use)

APPROVED BY

TITLE

DATE

CONDITIONS OF APPROVAL, IF ANY:

*See Instructions on Reverse Side

Instructions

General: This form is designed for submitting proposals to perform certain well operations, and reports of such operations when completed, as indicated, on Federal and Indian lands pursuant to applicable Federal law and regulations, and, if approved or accepted by any State, on all lands in such State, pursuant to applicable State law and regulations. Any necessary special instructions concerning the use of this form and the number of copies to be submitted, particularly with regard to local, area, or regional procedures and practices, either are shown below or will be issued by, or may be obtained from, the local Federal and/or State office.

Item 4: If there are no applicable State requirements, locations on Federal or Indian land should be described in accordance with Federal requirements. Consult local State or Federal office for specific instructions.

Item 17: Proposals to abandon a well and subsequent reports of abandonment should include such special information as is required by local Federal and/or State offices. In addition, such proposals and reports should include reasons for the abandonment; data on any former or present productive zones, or other zones with present significant fluid contents not sealed off by cement or otherwise; depths (top and bottom) and method of placement of cement plugs; mud or other material placed below, between and above plugs; amount, size, method of parting of any casing, liner or tubing pulled and the depth to top of any left in the hole; method of closing top of well; and date well site conditioned for final inspection looking to approval of the abandonment.