

UNITED STATES  
DEPARTMENT OF THE INTERIOR  
BUREAU OF LAND MANAGEMENT

FORM APPROVED

Budget Bureau No. 1004-0135  
Expires: March 31, 1993

5. Lease Designation and Serial No.

NM 33034

6. If Indian, Allottee or Tribe Name

**SUNDRY NOTICES AND REPORTS ON WELLS**

Do not use this form for proposals to drill or to deepen or reentry to a different reservoir.

Use "APPLICATION FOR PERMIT - " for such proposals

SUBMIT IN TRIPLICATE

1. Type of Well

☐ Oil Well

☒ Gas Well

☐ Other

2. Name of Operator


Northstar Oil and Gas Corp.

3. Address and Telephone No.

P.O. Box 93, Farmington, NM 87499 (505) 387-5751

4. Location of Well (Footage, Sec., T., R., M., or Survey Description)

790' FSL & 1850' FEL  
Section 8, T27N, R13W NMPM

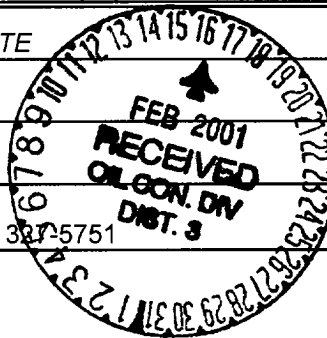

7. If Unit or CA, Agreement Designation

8. Well Name and No.

Gass #2

9. API Well No.

30-045-24598

10. Field and Pool, or Exploratory Area

WAW Fruitland Sand-P.C.

11. County or Parish, State

San Juan Co., NM

12 CHECK APPROPRIATE BOX(S) TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA

TYPE OF SUBMISSION	TYPE OF ACTION	
<input type="checkbox"/> Notice of Intent	<input checked="" type="checkbox"/> Abandonment	<input type="checkbox"/> Change of Plans
<input type="checkbox"/> Subsequent Report	<input type="checkbox"/> Recompletion	<input type="checkbox"/> New Construction
<input checked="" type="checkbox"/> Final Abandonment Notice	<input type="checkbox"/> Plugging Back	<input type="checkbox"/> Non-Routine Fracturing
	<input type="checkbox"/> Casing Repair	<input type="checkbox"/> Water Shut-Off
	<input type="checkbox"/> Altering Casing	<input type="checkbox"/> Conversion to Injection
	<input type="checkbox"/> Other _____	<input type="checkbox"/> Dispose Water

(Note: Report results of multiple completion on Well Completion or Recompletion Report and Log Form.)

13. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)\*

The well was abandoned as follows:

- 1) 1-1/4" tubing was pulled from well and hauled to yard.
- 1) American Energy tied onto 27/8" casing and established injection with 4 barrels of water.
- 2) Pumped 15 sx Class H neat cement followed by 5 sx Class H cement with 10# celophane flakes.
- 3) Pumped 35 additional sx class H neat cement. Shut in when pump pressure reached 1000#.
- 3) Cut off surface and production casing 4' below ground level and weld on abandonment marker with well ID
- 4) Clean up location in preparation for plowing by NAPI  
note - Riser and meter run for Gass #2 remain on location.

Cutoff of casing and plate installation witnessed by Mr. Ron Snow - BLM, Farmington.

14. I hereby certify that the foregoing is true and correct

Signed

*John C. Conliffe*

Title President

Date

February 14, 2001

(This space for Federal or State office use)

Approved by

Title

Date

Conditions of approval, if any:

Title 18 U.S.C. Section 1001, makes it a crime for any person knowingly and willfully to make to any department or agency of the United States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction.

CERTIFIED FOR RECORD

10000

FEB 14 2001

OFFICE  
SM