

2-Redfern  
1-Phillips  
1-Ohio  
1-File

(SUBMIT IN TRIPLICATE)

Budget Bureau No. 42-R358.4.  
Approval expires 12-31-60.

Land Office Santa Fe  
Lease No. N.M. 013365  
Unit \_\_\_\_\_

	X		

UNITED STATES  
DEPARTMENT OF THE INTERIOR  
GEOLOGICAL SURVEY

SUNDRY NOTICES AND REPORTS ON WELLS

NOTICE OF INTENTION TO DRILL.....	SUBSEQUENT REPORT OF WATER SHUT-OFF.....	X
NOTICE OF INTENTION TO CHANGE PLANS.....	SUBSEQUENT REPORT OF SHOOTING OR ACIDIZING.....	
NOTICE OF INTENTION TO TEST WATER SHUT-OFF.....	SUBSEQUENT REPORT OF ALTERING CASING.....	
NOTICE OF INTENTION TO RE-DRILL OR REPAIR WELL.....	SUBSEQUENT REPORT OF RE-DRILLING OR REPAIR.....	
NOTICE OF INTENTION TO SHOOT OR ACIDIZE.....	SUBSEQUENT REPORT OF ABANDONMENT.....	
NOTICE OF INTENTION TO PULL OR ALTER CASING.....	SUPPLEMENTARY WELL HISTORY.....	
NOTICE OF INTENTION TO ABANDON WELL.....		

(INDICATE ABOVE BY CHECK MARK NATURE OF REPORT, NOTICE, OR OTHER DATA)

August 5, 1959


Phillips  
Well No. # 1 is located 1190 ft. from [N] line and 1630 ft. from [W] line of sec. 16  
NE/4 NW/4 Sec. 16 28N 11W NMPM  
(1/4 Sec. and Sec. No.) (Twp.) (Range) (Meridian)  
Undesignated San Juan New Mexico  
(Field) (County or Subdivision) (State or Territory)

The elevation of the ~~derrick roof~~ <sup>ground</sup> above sea level is 5570 ft.

DETAILS OF WORK

(State names of and expected depths to objective sands; show sizes, weights, and lengths of proposed casings; indicate mudding jobs, cementing points, and all other important proposed work)

Drilled 13 3/4" hole to 240 Ran 9 5/8" 32.30# H-40 csg. T.E.219.07 set @ 230' RKB cement w/150sx. 2% CaCl POB 11:00 A.M. 12-19-59. Cement to surface. Drilled 7 7/8" hole to 6245. Ran 5 1/2" 15.5# J-55 csg. T.E. 6245 Set at 6241 Cement first stage w/ 200 sx. 4% gel. 50 sx. reg. POB 10:30 P.M. 1-8-59 Cement second stage through stage collar C1964 w/125 sx. 4% gel. POB 8:00 A.M. 1-9-59.

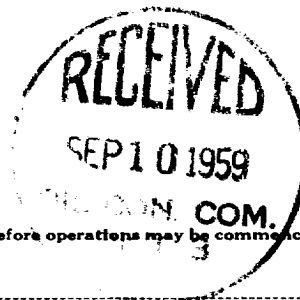

I understand that this plan of work must receive approval in writing by the Geological Survey before operations may be commenced.

Company Redfern and Herd

Address Box 1747

Midland, Texas

By Original signed by T. A. Dugan

Title Consulting Engineer