

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEYSUBMIT IN TRIPLICATE*
(Other instructions on re-
verse side)Form approved.
Budget Bureau No. 42-B1424.

5. LEASE DESIGNATION AND SERIAL NO.

Santa Fe 047017-4

6. IF INDIAN, ALLOTTEE OR TRIBE NAME

7. UNIT AGREEMENT NAME

8. FARM OR LEASE NAME

Angel Peak

9. WELL NO.

18

10. FIELD AND POOL, OR WILDCAT

Fulcher Knts

11. SEC., T., R., M., OR BLK. AND
SURVEY OR AREA
Sec. 12, T28N, R11W,
N.M.P.M.

12. COUNTY OR PARISH

San Juan

13. STATE

New Mexico

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir.
Use "APPLICATION FOR PERMIT—" for such proposals.)1. OIL WELL ☐ GAS WELL ☒ OTHER

2. NAME OF OPERATOR

Southern Union Production Company

3. ADDRESS OF OPERATOR

P. O. Box 808, Farmington, New Mexico

4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements.*
See also space 17 below.)
At surface990 feet from the South line and 990 feet from the
West line

14. PERMIT NO.

15. ELEVATIONS (Show whether DF, RT, GR, etc.)

5770 D.F.

16. Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

TEST WATER SHUT-OFF

PULL OR ALTER CASING

FRACTURE TREAT

MULTIPLE COMPLETE

SHOOT OR ACIDIZE

ABANDON*

REPAIR WELL

CHANGE PLANS

(Other)

XXXXXXXXXXXX

SUBSEQUENT REPORT OF:

WATER SHUT-OFF

REPAIRING WELL

FRACTURE TREATMENT

ALTERING CASING

SHOOTING OR ACIDIZING

ABANDONMENT*

(Other)


Re-work well

XX

(NOTE: Report results of multiple completion on Well
Completion or Recompletion Report and Log form.)

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)*

1. Pulled 1" tbg. Ran csg. corrosion survey. Casing was corroded from surf to 600 ft.
2. Cleaned out hole to 197 1/4 ft. R.K.B.
3. Ran 63 jts. 3-1/2" 9.2# tbg. as csg. Landed at 197 1/4 R.K.B. Cement w/250 cu. ft. Class "C" 8% Gel. 6-1/2# gilsonite and 2% C.C. plus 25 sacks Class "0" latex. Plug down 10:00 a.m. 8/4/64. Top em. at 600 ft. by temp. survey.
4. Cleaned out to P.B.T.D. 1942 ft. R.K.B.
5. Per. 1 shot/foot 1850-1862, 1865-1869, 1877-1885, 1888-1897, 1900-1916. Sand water and CO₂ fraced w/ 20,000# 20-40 sand and 40,000# 10-20 sand and 37,000 gallons water plus 18 tons CO₂.
6. Ran 91 jts. 1" tubing. Landed at 1871 ft. R.K.B. 8/7/64.
7. S.I. for retest after workover.

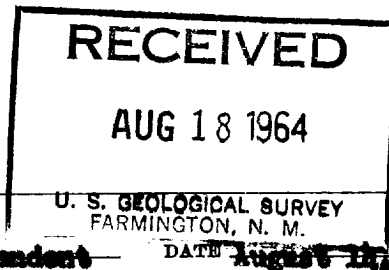

18. I hereby certify that the foregoing is true and correct.

SIGNED

Gilbert D. Noland, Jr.

TITLE

Drilling Superintendent

DATE

August 18, 1964

(This space for Federal or State office use)

APPROVED BY

TITLE

DATE

CONDITIONS OF APPROVAL, IF ANY:

*See Instructions on Reverse Side

Instructions

General: This form is designed for submitting proposals to perform certain well operations, and reports of such operations when completed, as indicated, on Federal and Indian lands pursuant to applicable Federal law and regulations, and, if approved or accepted by any State, on all lands in such State, pursuant to applicable State law and regulations. Any necessary special instructions concerning the use of this form and the number of copies to be submitted, particularly with regard to local, area, or regional procedures and practices, either are shown below or will be issued by, or may be obtained from, the local Federal and/or State office.

Item 4: If there are no applicable State requirements, locations on Federal or Indian land should be described in accordance with Federal requirements. Consult local State or Federal office for specific instructions.

Item 17: Proposals to abandon a well and subsequent reports of abandonment should include such special information as is required by local Federal and/or State offices. In addition, such proposals and reports should include reasons for the abandonment; data on any former or present productive zones, or other zones with present significant fluid contents not sealed off by cement or otherwise; depths (top and bottom) and method of placement of cement plugs; mud or other material placed below, between and above plugs; amount, size, method of parting of any casing, liner or tubing pulled and the depth to top of any left in the hole; method of closing top of well; and date well site conditioned for final inspection looking to approval of the abandonment.