

OIL CONSERVATION COMMISSION
3 DISTRICT

OIL CONSERVATION COMMISSION
BOX 871
SANTA FE, NEW MEXICO

DATE 2-26-64

Re: Proposed NSP _____

Proposed NWU _____

Proposed NSL _____

Proposed NFO _____

Proposed ~~DC~~ Proposed to be placed in production

Gentlemen:

I have examined the application dated 2-12-64
for the Mr. Chairman El H. P. Khan #7 N-35-23-11
Operator Lease and Well No. S-T-R

and my recommendations are as follows:

Approve as soon as action to repair
casing leak opposite observation formation

Yours very truly,

Henry C. Arnold

PAN AMERICAN PETROLEUM CORPORATION

P. O. Box 480, Farmington, New Mexico
February 10, 1964

File: N-87-986.510.1

Subject: Application of Pan American
Petroleum Corporation For
Administrative Approval of a
Tubingless Completion
Basin Dakota Pool
San Juan County, New Mexico

Mr. A. L. Porter, Jr.
New Mexico Oil Conservation Commission
P. O. Box 2088
Santa Fe, New Mexico

Dear Sir:

Pan American Petroleum Corporation hereby makes Administrative Application for Approval to effect a tubingless completion as a means of casing repair in its E. H. Pipkin No. 9 well, Basin Dakota Gas Pool, San Juan County, New Mexico. The attached map shows the location of E. H. Pipkin No. 9 in Unit N, Section 35, T-28-N, R-11-W, and the location of other nearby wells in the Basin Dakota Pool.

E. H. Pipkin No. 9 was completed as a Basin Dakota Pool gas well on February 14, 1961. As may be seen on the attached sketch of the well, 4-1/2-inch casing was set at 6475 feet and the well was selectively perforated for completion in the Dakota formation. The 4-1/2-inch casing was cemented by the two-stage method with the stage tool set at 2021 feet, just below the Pictured Cliffs zone.

A leak has occurred in the 4-1/2-inch casing opposite the Mesa-verde interval (3300 to 4500 feet). In order to effect a casing repair, it is proposed to run a full string of 2-7/8-inch tubing inside the existing 4-1/2-inch casing, land it just above the Dakota perforations and cement it to the surface. The mechanical condition of the well following this repair is shown on the attached sketch.

In connection with this application, applicant also states that the well is not a wildcard, and that it will not be a dual completion.

Yours very truly,

PAN AMERICAN PETROLEUM CORPORATION

Original Signed by
T. M. CURTIS

T. M. Curtis
District Superintendent

GWE:en
Attach.

cc: Mr. E. G. Arnold
N.M. O.C.C.
Aztec, New Mexico




100-443887-1000

PAN AMERICAN PETROLEUM CORP

E.H. Pickin No. 3


T90 FSL & 1735 FWL SEC. 35, T28-N, R10-W
BASIN DAKOTA POOL
San Juan Co., New Mexico

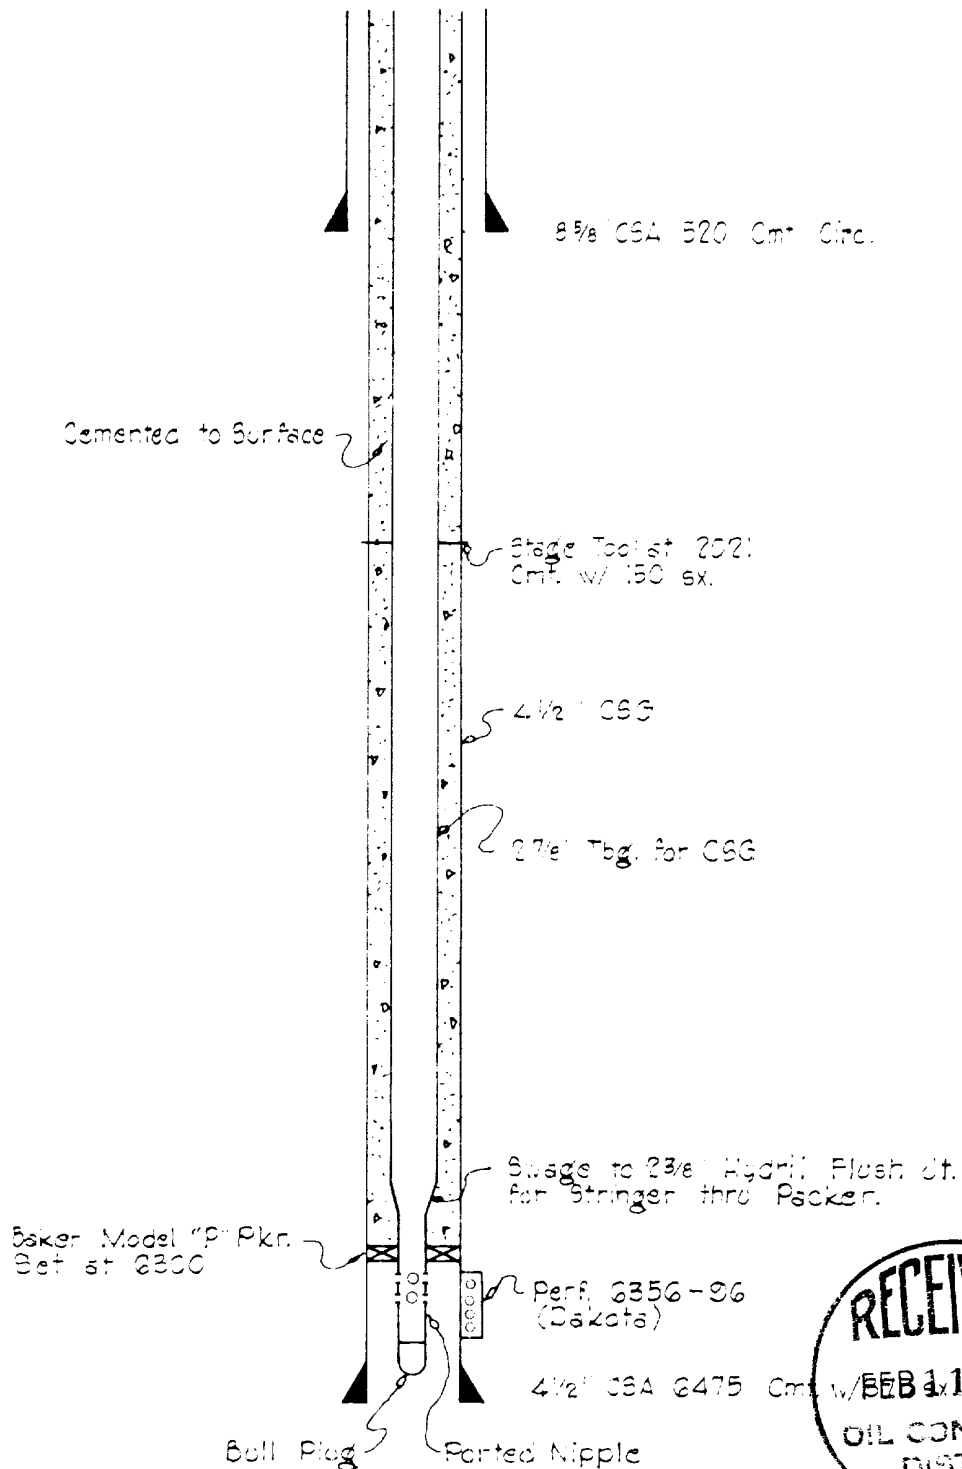

PAN AMERICAN PETROLEUM CORPORATION

SCALE:

DRG
NO

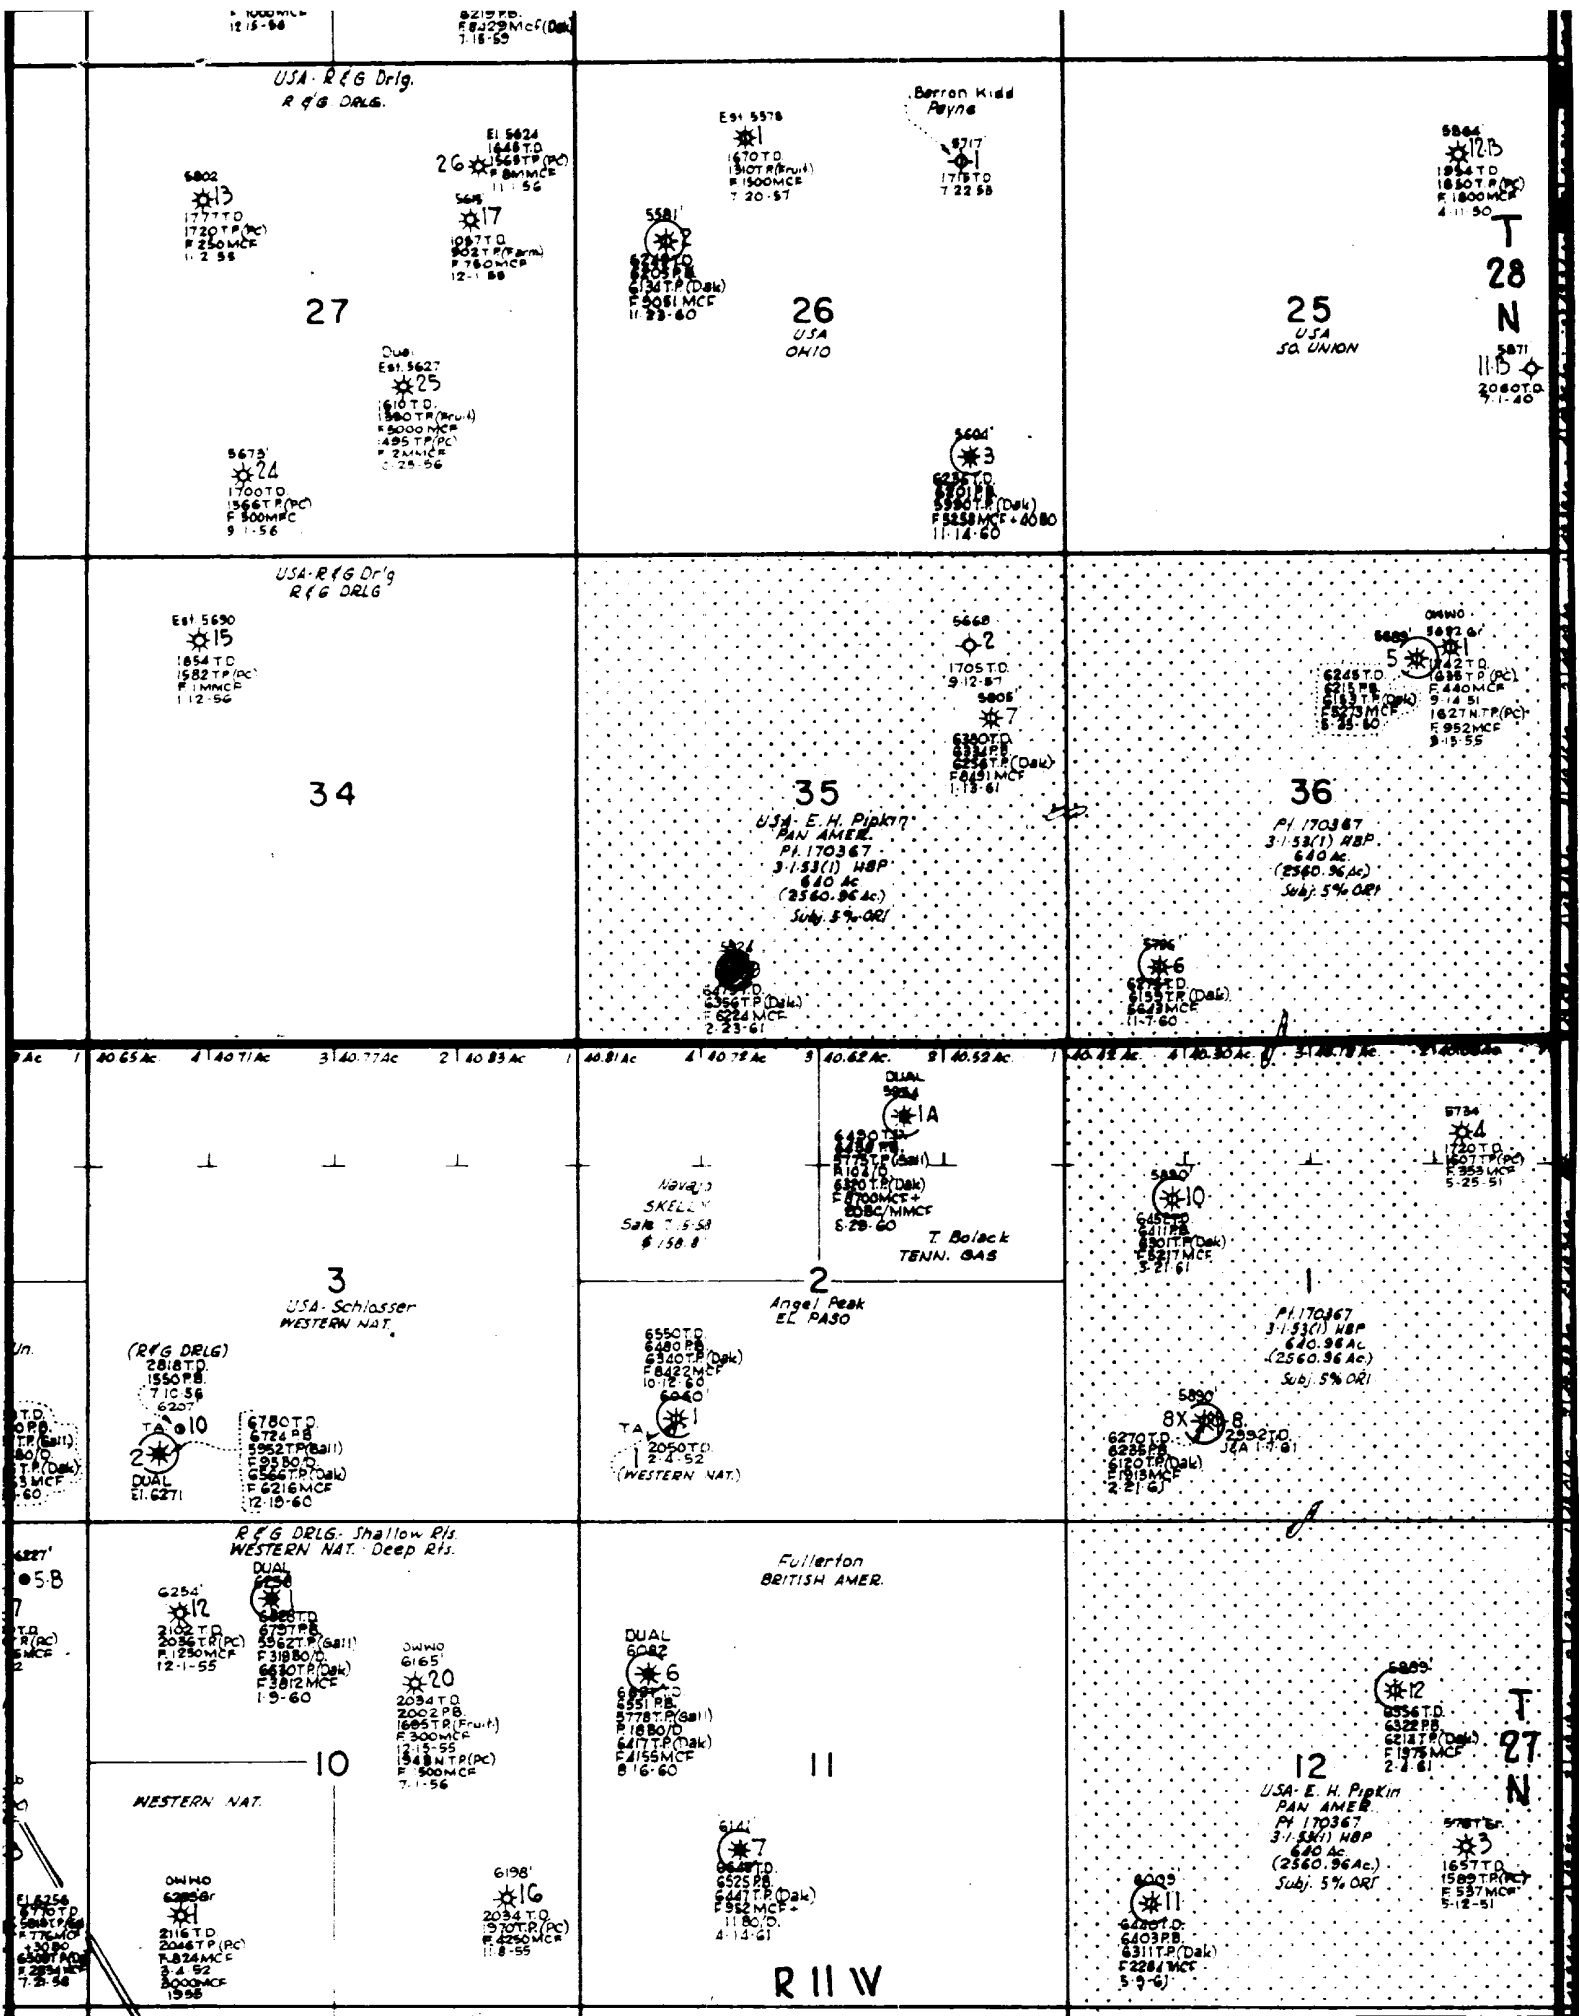

PAN AMERICAN PETROLEUM CORPORATION
FARMINGTON, NEW MEXICO

PORTION OF BASIN DAKOTA POOL SAN JUAN CO., N.MEX.



E.H. Pipkin Well No. 9



Other Basin Dakota Wells

