

State of New Mexico  
Energy, Minerals and Natural Resources Department  
Oil Conservation Division

**Sundry Notices and Reports on Wells**


<b>1. Type of Well</b> GAS	<b>API # (assigned by OCD)</b> 30-045-09387 <b>5. Lease Number</b> FEE <b>6. State Oil&amp;Gas Lease #</b>  <b>7. Lease Name/Unit Name</b> Vasaly Com
<b>2. Name of Operator</b> <b>BURLINGTON</b> <b>RESOURCES</b> OIL & GAS COMPANY	
<b>3. Address &amp; Phone No. of Operator</b> PO Box 4289, Farmington, NM 87499 (505) 326-9700	<b>8. Well No.</b> #1 <b>9. Pool Name or Wildcat</b> Blanco MV/Basin DK
<b>4. Location of Well, Footage, Sec., T, R, M</b> 970' FNL, 1090' FEL, Sec. 22, T-30-N, R-11-W, NMPM, San Juan County, NM	<b>10. Elevation:</b>

Type of Submission	Type of Action
<input type="checkbox"/> Notice of Intent	<input type="checkbox"/> Abandonment
<input checked="" type="checkbox"/> Subsequent Report	<input checked="" type="checkbox"/> Recompletion
<input type="checkbox"/> Final Abandonment	<input type="checkbox"/> Plugging Back
	<input type="checkbox"/> Casing Repair
	<input type="checkbox"/> Altering Casing
	<input checked="" type="checkbox"/> Other - Commingle
	<input type="checkbox"/> Change of Plans
	<input type="checkbox"/> New Construction
	<input type="checkbox"/> Non-Routine Fracturing
	<input type="checkbox"/> Water Shut off
	<input type="checkbox"/> Conversion to Injection

**13. Describe Proposed or Completed Operations**

1-20-99 MIRU. ND WH. NU BOP. SDON.  
1-21-99 TOO H w/2 3/8" tbgs. TIH w/CIBP & pkr, set CIBP @ 5010', set pkr @ 5000'.  
PT CIBP to 3800 psi/15 min, OK. Rls pkr & TOO H. TIH, ran CBL @  
5010-1700'. Cmt found @ 4950-4320', 4320-4150', 4150-4030', &  
4030-3170'. TOO H. SDON.  
1-22-99 TIH w/perf gun. Perf Pt. Lookout w/2 SPF @ 4598-4882' w.18 0.29" diameter  
holes total. TOO H w/gun. TIH w/4 1/2" pkr. PT surface lines to 6500 psi.  
Set pkr @ 4497'. Brk dwn perms w/25 bbl 15% HCL. Frac Pt. Lookout w/  
1184 bbl 20# x-link gel, 100,000# 20/40 AZ snd. Rls pkr & TOO H. SDON.  
1-23-99 TIH w/4 1/2" CIBP, set @ 4560'. TOO H. TIH w/perf gun. Perf Menefee w/1 SPF  
@ 4268-4523' w/15 0.29" diameter holes total. TOO H w/gun. TIH w/pkr,  
set @ 4547'. PT CIBP to 3800 psi/5 min, OK. Rls pkr & reset @ 4180'.  
Brk dwn perms w/1050 gal 15% HCL. Frac Menefee w/866 bbl 20# x-link gel,  
80,000# 20/40 AZ snd. Flow back well.  
1-25-99 Rls pkr & TOO H. TIH w/3 7/8" mill, tag up @ 4461'. CO @ 4461' to CIBP @  
4560'. Flow well naturally. Blow well.  
1-26-99 Flow well. D/O CIBP @ 4560'. Blow well. Flow well naturally.  
1-27-99 Flow well naturally.  
1-28-99 Flow well. D/O CIBP @ 5004'. Circ hole clean. Flow well.  
1-29-99 CO to 6904'. Circ hole clean. TOO H w/mill. SDON.  
1-30-99 TIH w/219 jts 2 3/8" 4.7# J-55 EUE tbgs, set @ 6879' KB. ND BOP. NU WH.  
RD. Rig released.

SIGNATURE

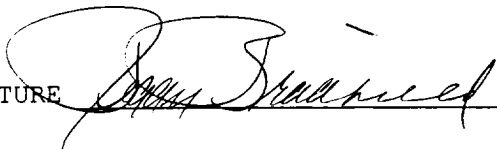

Regulatory Administrator February 2, 1999

vkh

(This space for State Use)

ORIGINAL SIGNED BY ERNIE BUSCH

DEPUTY OIL & GAS INSPECTOR, DIST. 43

Approved by

Title

Date

FEB 11 1999