

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

SUBMIT IN TRIPLICATE*
(Other instructions on re-verse side)

Form approved.
Budget Bureau No. 42-R1424.

5. LEASE DESIGNATION AND SERIAL NO.

SF0 81299-A

6. IF INDIAN, ALLOTTEE OR TRIBE NAME

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir.
Use "APPLICATION FOR PERMIT—" for such proposals.)

1.

OIL WELL ☒ GAS WELL ☐ OTHER ☐

2. NAME OF OPERATOR

Clinton Oil Company

3. ADDRESS OF OPERATOR

P. O. Box 2434, Casper, WY 82601

4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements.*
See also space 17 below.)
At surface

660' FSL & 1980' FEL

14. PERMIT NO.

15. ELEVATIONS (Show whether DF, RT, GR, etc.)

5407' G. L.

7. UNIT AGREEMENT NAME

J. J. Lommori "B"

8. FARM OR LEASE NAME

N. E. Hogback Unit

9. WELL NO.

19

10. FIELD AND POOL, OR WILDCAT

Horseshoe Gallup

11. SEC., T., R., M., OR BLK. AND SURVEY OR AREA

Sec. 13-30N-16W

12. COUNTY OR PARISH

San Juan

13. STATE

N. Mexico

16.

Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

TEST WATER SHUT-OFF ☐

FRACTURE TREAT ☐

SHOOT OR ACIDIZE ☐

REPAIR WELL ☐

(Other) ☐

PULL OR ALTER CASING ☐

MULTIPLE COMPLETE ☐

ABANDON* ☐

CHANGE PLANS ☐

SUBSEQUENT REPORT OF:

WATER SHUT-OFF ☐

FRACTURE TREATMENT ☐

SHOOTING OR ACIDIZING ☐

(Other) ☐

REPAIRING WELL ☐

ALTERING CASING ☐

ABANDONMENT* ☒

(Note: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)*

Place sand plug 4027-3850'.

Place top rubber cement plug on top of sand.

Spot 15 sks. plug on top of sand 3850-3730'.

5 1/2" casing parted at 1700'.

Spot 25 sks. plug 1650-1750'.

Pull & lay down casing.


Spot 30 sks. plug 780-680' (Menefee 730-2295')

Spot 20 sks. plug 209-159'.

Spot 10 sks. surface plug.

Erect dry hole marker.

U. S. G. S. will be notified when location is cleaned up and ready for final inspection.

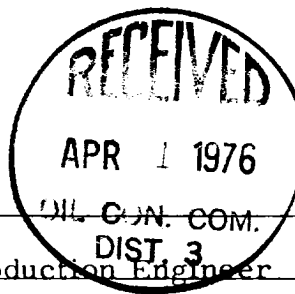

18. I hereby certify that the foregoing is true and correct

SIGNED

James B. Barner

TITLE

Production Engineer

DATE

August 2, 1974

(This space for Federal or State office use)

APPROVED BY

TITLE

DATE

CONDITIONS OF APPROVAL, IF ANY: