

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

SUBMIT IN TRIPLICATE*
(Other instructions on re-
verse side)

Form approved.
Budget Bureau No. 42-R1424.

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir.
Use "APPLICATION FOR PERMIT—" for such proposals.)

1. OIL WELL <input checked="" type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER <input type="checkbox"/>		5. LEASE DESIGNATION AND SERIAL NO. NM 04407
2. NAME OF OPERATOR Clinton Oil Company		6. IF INDIAN, ALLOTTEE OR TRIBE NAME
3. ADDRESS OF OPERATOR P. O. Box 2434 - Casper, Wyoming 82601		7. UNIT AGREEMENT NAME J. W. Aidlin "B"
4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements.* See also space 17 below.) At surface 1970' FNL and 680' FWL		8. FARM OR LEASE NAME NE Hogback Unit
14. PERMIT NO.		9. WELL NO. 10
15. ELEVATIONS (Show whether DF, RT, GR, etc.) 5424' GL		10. FIELD AND POOL, OR WILDCAT Horseshoe Gallup
		11. SEC., T., R., M., OR BLK. AND SURVEY OR AREA Sec. 14-T30N-R16W
		12. COUNTY OR PARISH San Juan
		13. STATE N. Mexico

18. Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

TEST WATER SHUT-OFF <input type="checkbox"/>	PULL OR ALTER CASING <input type="checkbox"/>
FRACTURE TREAT <input type="checkbox"/>	MULTIPLE COMPLETE <input type="checkbox"/>
SHOOT OR ACIDIZE <input type="checkbox"/>	ABANDON* <input checked="" type="checkbox"/>
REPAIR WELL <input type="checkbox"/>	CHANGE PLANS <input type="checkbox"/>
(Other) <input type="checkbox"/>	

SUBSEQUENT REPORT OF:

WATER SHUT-OFF <input type="checkbox"/>	REPAIRING WELL <input type="checkbox"/>
FRACTURE TREATMENT <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
SHOOTING OR ACIDIZING <input type="checkbox"/>	ABANDONMENT* <input type="checkbox"/>
(Other) <input type="checkbox"/>	

(NOTE: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)*

Casing: 8-5/8" - set at 98' w/80 sacks of cement
5-1/2" - set at 2546' w/130 sacks of cement

Perf: 2388'-2422' Upper Gallup
2447'-2453' Lower Gallup

Propose to plug back with sand from PBTD - 2502'-2350'

Place 15 sack cement plug from 2350' - 2230'

Shoot off 5-1/2" casing. Pull and lay down.


Place cement plug 50' inside of 5-1/2" casing stub and 50' above stub

Place 50 sack cement plug from 450'-600' (Pt. Lookout 508'-850')

Place 35 sack cement plug from 98' - GL

Install dry hole marker

Clean up location

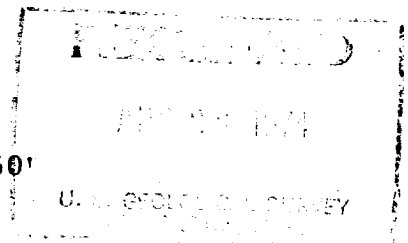

18. I hereby certify that the foregoing is true and correct

SIGNED

W. J. [Signature]

TITLE

Rocky Mtn Dist. Mgr

DATE

(This space for Federal or State office use)

APPROVED BY

TITLE

DATE

CONDITIONS OF APPROVAL, IF ANY: