

**UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY**

SUBMIT IN TRIPLICATE*
(Other instructions on reverse side)

Form approved.
Budget Bureau No. 42-R1424.

SUNDRY NOTICES AND REPORTS ON WELLS
(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir.
Use "APPLICATION FOR PERMIT—" for such proposals.)

1. OIL WELL GAS WELL OTHER

2. NAME OF OPERATOR
Aztec Oil & Gas Company

3. ADDRESS OF OPERATOR
P. O. Drawer 570, Farmington, New Mexico

4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements.*
See also space 17 below.)
At surface
1920' FNL & 755' FWL
Section 34, T31N, R8W

14. PERMIT NO. _____ 15. ELEVATIONS (Show whether DF, RT, GR, etc.)
6234' GR

5. LEASE DESIGNATION AND SERIAL NO.
SF-079037

6. IF INDIAN, ALLOTTEE OR TRIBE NAME

7. UNIT AGREEMENT NAME

8. FARM OR LEASE NAME
Hale

9. WELL NO.
#3-A

10. FIELD AND POOL, OR WILDCAT
Blanco Mesa Verde

11. SEC., T., R., M., OR BLK. AND SURVEY OR AREA
Section 34, T31N, R8W

12. COUNTY OR PARISH
San Juan

13. STATE
New Mexico

16. Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data


NOTICE OF INTENTION TO:		SUBSEQUENT REPORT OF:	
TEST WATER SHUT-OFF <input type="checkbox"/>	PULL OR ALTER CASING <input type="checkbox"/>	WATER SHUT-OFF <input type="checkbox"/>	REPAIRING WELL <input type="checkbox"/>
FRACTURE TREAT <input type="checkbox"/>	MULTIPLE COMPLETE <input type="checkbox"/>	FRACTURE TREATMENT <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
SHOOT OR ACIDIZE <input type="checkbox"/>	ABANDON* <input type="checkbox"/>	SHOOTING OR ACIDIZING <input type="checkbox"/>	ABANDONMENT* <input type="checkbox"/>
REPAIR WELL <input type="checkbox"/>	CHANGE PLANS <input type="checkbox"/>	(Other) <u>CASING REPORT</u> <input checked="" type="checkbox"/>	

(NOTE: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)*

9-22-76 Ran 98 joints of 7", 20#, K-55, 8rd casing. Total 3420.57'. Shoe set at 3430', float collar at 3378'. Cemented with 100 sacks Class "B" 65/35 with 12% gel followed by 70 sacks Class "B" with 2% CaCl. Plug down 2:30 A.M.

9-27-76 Ran 75 jts of 4½", 10.50#, K-55, 8rd casing. Total 2493'. Shoe set at 5785', float collar at 5751', liner hanger at 3275'. Cemented with 20 barrels gel water and 240 sacks Class "B" with 4% gel and ¼ cubic foot of fine gilsonite per sack and .6 of 1% of Halad 9. Plug down at 2:00 P.M.

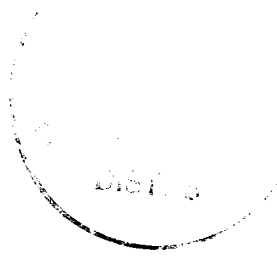

OCT 1 1976

18. I hereby certify that the foregoing is true and correct

SIGNED [Signature] TITLE District Production Manager DATE 9-28-76

(This space for Federal or State office use)

APPROVED BY _____ TITLE _____ DATE _____
CONDITIONS OF APPROVAL, IF ANY: