

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir. Use Form 9-331-C for such proposals.)

1. oil ☐ well gas ☒ well other

2. NAME OF OPERATOR

EL PASO NATURAL GAS COMPANY

3. ADDRESS OF OPERATOR

Box 990, Farmington, New Mexico 87401

4. LOCATION OF WELL (REPORT LOCATION CLEARLY. See space 17 below.)

1760'S, 1480'E

AT SURFACE:

AT TOP PROD. INTERVAL:

AT TOTAL DEPTH:

16. CHECK APPROPRIATE BOX TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA

REQUEST FOR APPROVAL TO:

SUBSEQUENT REPORT OF:

TEST WATER SHUT-OFF ☐

FRACTURE TREAT ☐

SHOOT OR ACIDIZE ☐

REPAIR WELL ☐

PULL OR ALTER CASING ☐

MULTIPLE COMPLETE ☐

CHANGE ZONES ☐

ABANDON* ☐

(other)

☒

☒

☐

☐

☐

☐

☐

☐

5. LEASE

SF 078386

6. IF INDIAN, ALLOTTEE OR TRIBE NAME

7. UNIT AGREEMENT NAME

San Juan 32-9 Unit

8. FARM OR LEASE NAME

San Juan 32-9 Unit

9. WELL NO.

19A

10. FIELD OR WILDCAT NAME

Blanco Mesa Verde

11. SEC., T., R., M., OR BLK. AND SURVEY OR AREA
Sec. 17, T-31-N, R-9-W
N.M.P.M.

12. COUNTY OR PARISH

San Juan

13. STATE

New Mexico

14. API NO.

15. ELEVATIONS (SHOW DF, KDB, AND WD)
6532' GL

(NOTE: Report results of multiple completion or zone change on Form 9-330.)

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)*

5-15-78 T.D. 3833'. Ran 128 joints 7", 20#, K-55 intermediate casing, 3822' set at 3833'. Cemented with 417 cu. ft. cement. W.O.C. 12 hours, held 1200#/30 minutes. Top of cement at 2350'.

5-18-78 T.D. 6087'. Ran 72 joints 4 1/2", 10.5#, K-55 casing liner, 2381' set 3706-6087'. Float collar set at 6069'. Cemented with 417 cu. ft. cement. WOC. 18 hours.

7-20-78 P.B.T.D. 6069'. Tested casing to 4000#, O.K. Perfed Lower P.L. 5750-60 5774-80, 5790-96, 5868-74, 5904-14, 5920-32, 5956-72, 5986-94, 6002-14 w/10 SPZ. Fraced with 68,000# 20/40 sand and 92,500 gallons water. Dropped 3 sets of 15 balls each. Flushed with 8000 gallons water. Perfed Main P.L. 5618-38 w/20 holes, 5658-82 w/ 24 holes, 5700-08 w/10 holes, 5718-26 w/10 holes. Fraced with 60,000# 20/40 sand and 72,000 gallons water. Dropped (OVER) Subsurface Safety Valve: Manu. and Type Set @ Ft.


18. I hereby certify that the foregoing is true and correct

SIGNED J. J. Lisco TITLE Drilling Clerk DATE 7/31/78

(This space for Federal or State office use)

APPROVED BY _____ TITLE _____ DATE _____
CONDITIONS OF APPROVAL, IF ANY:

*See Instructions on Reverse Side

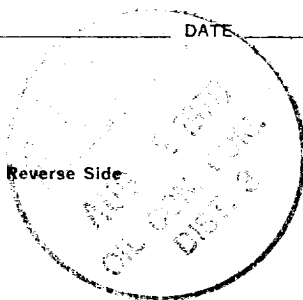

Instructions

General: This form is designed for submitting proposals to perform certain well operations, and reports of such operations when completed, as indicated, on Federal and Indian lands pursuant to applicable Federal law and regulations, and, if approved or accepted by any State, on all lands in such State, pursuant to applicable State law and regulations. Any necessary special instructions concerning the use of this form and the number of copies to be submitted, particularly with regard to local, area, or regional procedures and practices, either are shown below or will be issued by, or may be obtained from, the local Federal and/or State office.

Item 4: If there are no applicable State requirements, locations on Federal or Indian land should be described in accordance with Federal requirements. Consult local State or Federal office for specific instructions.

Item 17: Proposals to abandon a well and subsequent reports of abandonment should include such special information as is required by local Federal and/or State offices. In addition, such proposals and reports should include reasons for the abandonment; data on any former or present productive zones, or other zones with present significant fluid contents not sealed off by cement or otherwise; depths (top and bottom) and method of placement of cement plugs; mud or other material placed below, between and above plugs; amount, size, method of parting of any casing, liner or tubing pulled and the depth to top of any left in the hole; method of closing top of well; and date well site conditioned for final inspection looking to approval of the abandonment.

GPO : 1976 O - 214-149

5 sets of 10 balls each. Flushed with 8,000 gal. water.
Perforated C.H. & Men. 5182-90, 5210-30, 5236-44, 5256-70,
5290-5300, 5360-66, 5510-22, 5530-38 w/16 SPZ. Fraced with
86,000# 20/40 sand and 96,400 gallons water. Dropped 7
sets of 16 balls each. Flushed with 7350 gal. water.