

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

SUBMIT IN TRIPLICATE*
(Other instructions on re-
verse side)


Form approved.
Budget Bureau No. 42-R1424

LEASE DESIGNATION AND SERIAL NO.
A00-C-1420-1726

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir.
Use "APPLICATION FOR PERMIT—" for such proposals.)

1. ☐ OIL WELL ☐ GAS WELL ☐ OTHER Dry Hole		6. IF INDIAN, ALLOTTEE OR TRIBE NAME Ute Mt. Ute	
2. NAME OF OPERATOR Energy Reserves Group, Incor.		7. UNIT AGREEMENT NAME	
3. ADDRESS OF OPERATOR Box 3250, Casper, Wyoming 82602		8. FARM OR LEASE NAME Fed Ute 35	
4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements. See also space 17 below.) At surface 2100 FNL, 800' FEL		9. WELL NO. 1	
14. PERMIT NO.		10. FIELD AND POOL, OR WILDCAT Verde Gallup	
15. ELEVATIONS (Show whether DF, RT, GR, etc.) 5425 GR.		11. SEC., T., R., M., OR BLK. AND SURVEY OR AREA Sec 35-T-31N-R15W	
		12. COUNTY OR PARISH San Juan	
		13. STATE N.M.	

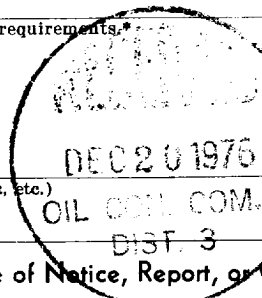

16. Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:		SUBSEQUENT REPORT OF:	
TEST WATER SHUT-OFF ☐	PULL OR ALTER CASING ☐	WATER SHUT-OFF ☐	REPAIRING WELL ☐
FRACTURE TREAT ☐	MULTIPLE COMPLETE ☐	FRACTURE TREATMENT ☐	ALTERING CASING ☒
SHOOT OR ACIDIZE ☐	ABANDON* ☐	SHOOTING OR ACIDIZING ☐	ABANDONMENT* ☐
REPAIR WELL ☐	CHANGE PLANS ☐	(Other) ☐	

(NOTE: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)*

1. Circulated oil from casing. Spotted 50 sx. cement plug across perfs. Squeezed 25 sx into perfs @ 500 psi. Pulled Tubing.
2. Free pointed & shot 4 1/2 casing off @ 3200'. Laid down casing.
3. Ran tubing to 3250', spotted 30 sx cement plug to 3150'.
4. Pulled tubing to 1875', spotted 30 sx cement plug 1875'-1725' in open hole.
5. Pulled tubing to 180', spotted 30 sx cement plug to 80', across shoe. Laid down tubing.
6. Set 10 sx surface plug and erected hole marker.

RECEIVED
DEC 17 1976

U. S. GEOLOGICAL SURVEY
BUREAU OF OIL & GAS

18. I hereby certify that the foregoing is true and correct

SIGNED [Signature] TITLE 11/10/76 DATE 12-9-76

(This space for Federal or State office use)

APPROVED BY _____ TITLE _____ DATE _____

CONDITIONS OF APPROVAL, IF ANY:

Instructions

General: This form is designed for submitting proposals to perform certain well operations, and reports of such operations when completed, as indicated, on Federal and Indian lands pursuant to applicable Federal law and regulations, and, if approved or accepted by any State, on all lands in such State, pursuant to applicable State law and regulations. Any necessary special instructions concerning the use of this form and the number of copies to be submitted, particularly with regard to local, area, or regional procedures and practices, either are shown below or will be issued by, or may be obtained from, the local Federal and/or State office.

Item 4: If there are no applicable State requirements, locations on Federal or Indian land should be described in accordance with Federal requirements. Consult local State or Federal office for specific instructions.

Item 17: Proposals to abandon a well and subsequent reports of abandonment should include such special information as is required by local Federal and/or State offices. In addition, such proposals and reports should include reasons for the abandonment; data on any former or present productive zones, or other zones with present significant fluid contents not sealed off by cement or otherwise; depths (top and bottom) and method of placement of cement plugs; mud or other material placed below, between and above plugs; amount, size, method of parting of any casing, liner or tubing pulled and the depth to top of any left in the hole; method of closing top of well; and date well site conditioned for final inspection looking to approval of the abandonment.