

FARMINGTON DISTRICT
COMPLETION PROCEDURE

Date: _____

WELL NAME: Ealum Gas Com "C" No. 1

FIELD Main Basal Coal

LOCATION: 1645' FNL x 1615' FEL, Sec 33, T32N,
R10W, San Juan County, NM

FORMATION(S) Fruitland

ELEVATIONS: KB: 6008' TD: 2805'

PED: 2525'

CASING: 13 3/8" 61# K-55 @ 274'
7" 23# K-55 @ 2769'

LOGS: _____

DV TOOL SET AT: Pengo Tool @ 2532'

PURPOSE: Plug and abandonment


2DF
SKB
RPM

BSB
ENGR

FILE

WELLBORE SKETCH

PROCEDURE

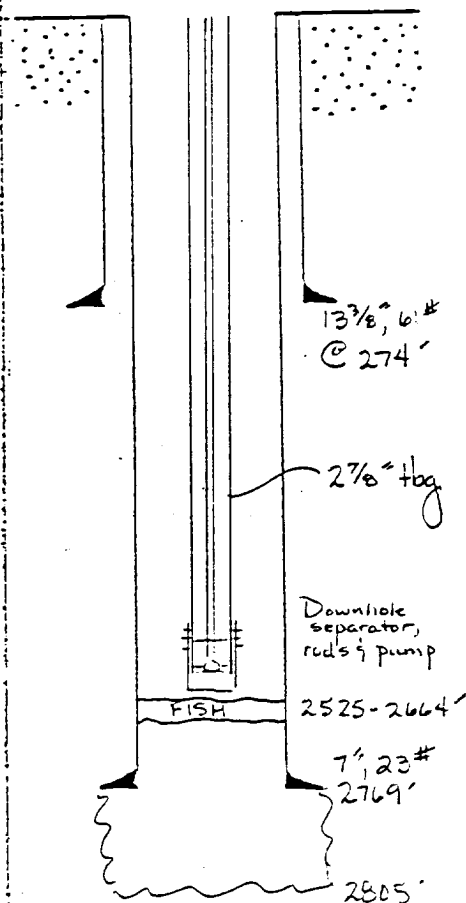

1. MIRUSU
2. TOH with rods x pump
3. TOH with tbg and downhole gas separator.
4. TIT with tbg. TOH while spotting cmt plugs.
5. Spot 26 sx class B x 2% CaCl_2 across top of fish (2425 - 2525').
6. Spot 26 sx class B x 2% CaCl_2 across top of Ojo Alamo (1100 - 1200').
7. Spot 52 sx class B x 2% CaCl_2 from 200 ft to surface.
8. Erect Dry Hole Marker.

Note: Plan to redrill well on same location.

DISTRICT MANAGER _____

DISTRICT ENGINEER _____

DISTRICT DRILLING SUPERVISOR _____

ENGINEER Bruce S. Bell

DATE _____