

UNITED STATES
DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT

FORM APPROVED
Budget Bureau No. 1004-0135
Expires: March 31, 1993

SUNDRY NOTICES AND REPORTS ON WELLS

Do not use this form for proposals to drill or to deepen or reentry to a different reservoir.
Use "APPLICATION FOR PERMIT - " for such proposals

5. Lease Designation and Serial No.
SF-078097

6. If Indian, Allottee or Tribe Name

7. If Unit or CA, Agreement Designation

8. Well Name and No.
Zachary LS #1

9. API Well No.
3004560031

10. Field and Pool, or Exploratory Area
Blanco Mesaverde

11. County or Parish, State
San Juan New Mexico

1. Type of Well
 Oil Well Gas Well Other

2. Name of Operator
Amoco Production Company
Attention: Mike Curry

3. Address and Telephone No.
P.O. Box 800, Denver, Colorado 80201

4. Location of Well (Footage, Sec., T., R., M., or Survey Description)
1604'FSL 1630FWL Sec. 25 T 31N R 11W

CHECK APPROPRIATE BOX(S) TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA

TYPE OF SUBMISSION	TYPE OF ACTION
<input type="checkbox"/> Notices of Intent	<input checked="" type="checkbox"/> Abandonment
<input type="checkbox"/> Subsequent Report	<input type="checkbox"/> Recompletion
<input type="checkbox"/> Final Abandonment Notice	<input type="checkbox"/> Plugging Back
	<input type="checkbox"/> Casing Repair
	<input type="checkbox"/> Altering Casing
	<input type="checkbox"/> Other _____
	<input type="checkbox"/> Change of Plans
	<input type="checkbox"/> New Construction
	<input type="checkbox"/> Non-Routine Fracturing
	<input type="checkbox"/> Water Shut-Off
	<input type="checkbox"/> Conversion to Injection
	<input type="checkbox"/> Dispose Water

(Note: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)

13. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)*

The captioned well will be P&A'd per the attached procedures.

**SEE ATTACHED FOR
CONDITIONS OF APPROVAL**

OFO INFORMATION UNIT
SAT FEB 10 PM 2:57

14. I hereby certify that the foregoing is true and correct

Signed Mike Curry Title Business Analyst Date 02-08-1994

(This space for Federal or State office use)

Approved by _____ Title _____

Conditions of approval, if any:

**APPROVED
FEB 15 1994**


Title 18 U.S.C. Section 1001, makes it a crime for any person knowingly and willfully to make to any department or agency of the United States any false, fictitious, or fraudulent statements or representations as to any matter within its jurisdiction.

DISTRICT MANAGER

Zachary LS #1
PXA Procedures

1. Check location for anchors. Install if necessary. Test anchors.
2. MIRUSU. Blow down well. Kill if necessary with fresh water.
3. POOH with 2 3/8" tbg and lockset pkr. NDWH. NUBOPE. RIH with tbg and cement retainer. Set retainer at 4650'. Test casing integrity to 500#. Isolate casing leak. Squeeze perfs at 4712' to 4840' with 55.82 cuft cement. Pull out of retainer and if casing leak is above 2450' spot cement plug to 2450' with 750 cuft cement.
4. RIH with tbg and cement retainer, set retainer 50' above casing leak and attempt circulate to surface. If unable to circulate displace cement to 1438' and shoot squeeze holes at 1438' and attempt to circulate. If again unable to circulate, displace cement to 200', repeat process at 200' and displace cement to surface.
5. NDBOPE. Cut off casing and wellhead. Install PXA marker according to BLM or State requirements.
6. Turn over to John Schwartz for reclamation.
7. Rehabilitate location according to BLM or State requirements.

ZACHARY LS 001
 Location - 25K-31N-11W
 SINGLE MV
 Orig. Completion - 12/55
 LAST FILE UPDATE - 1/94 BY CSW
 5859' GL

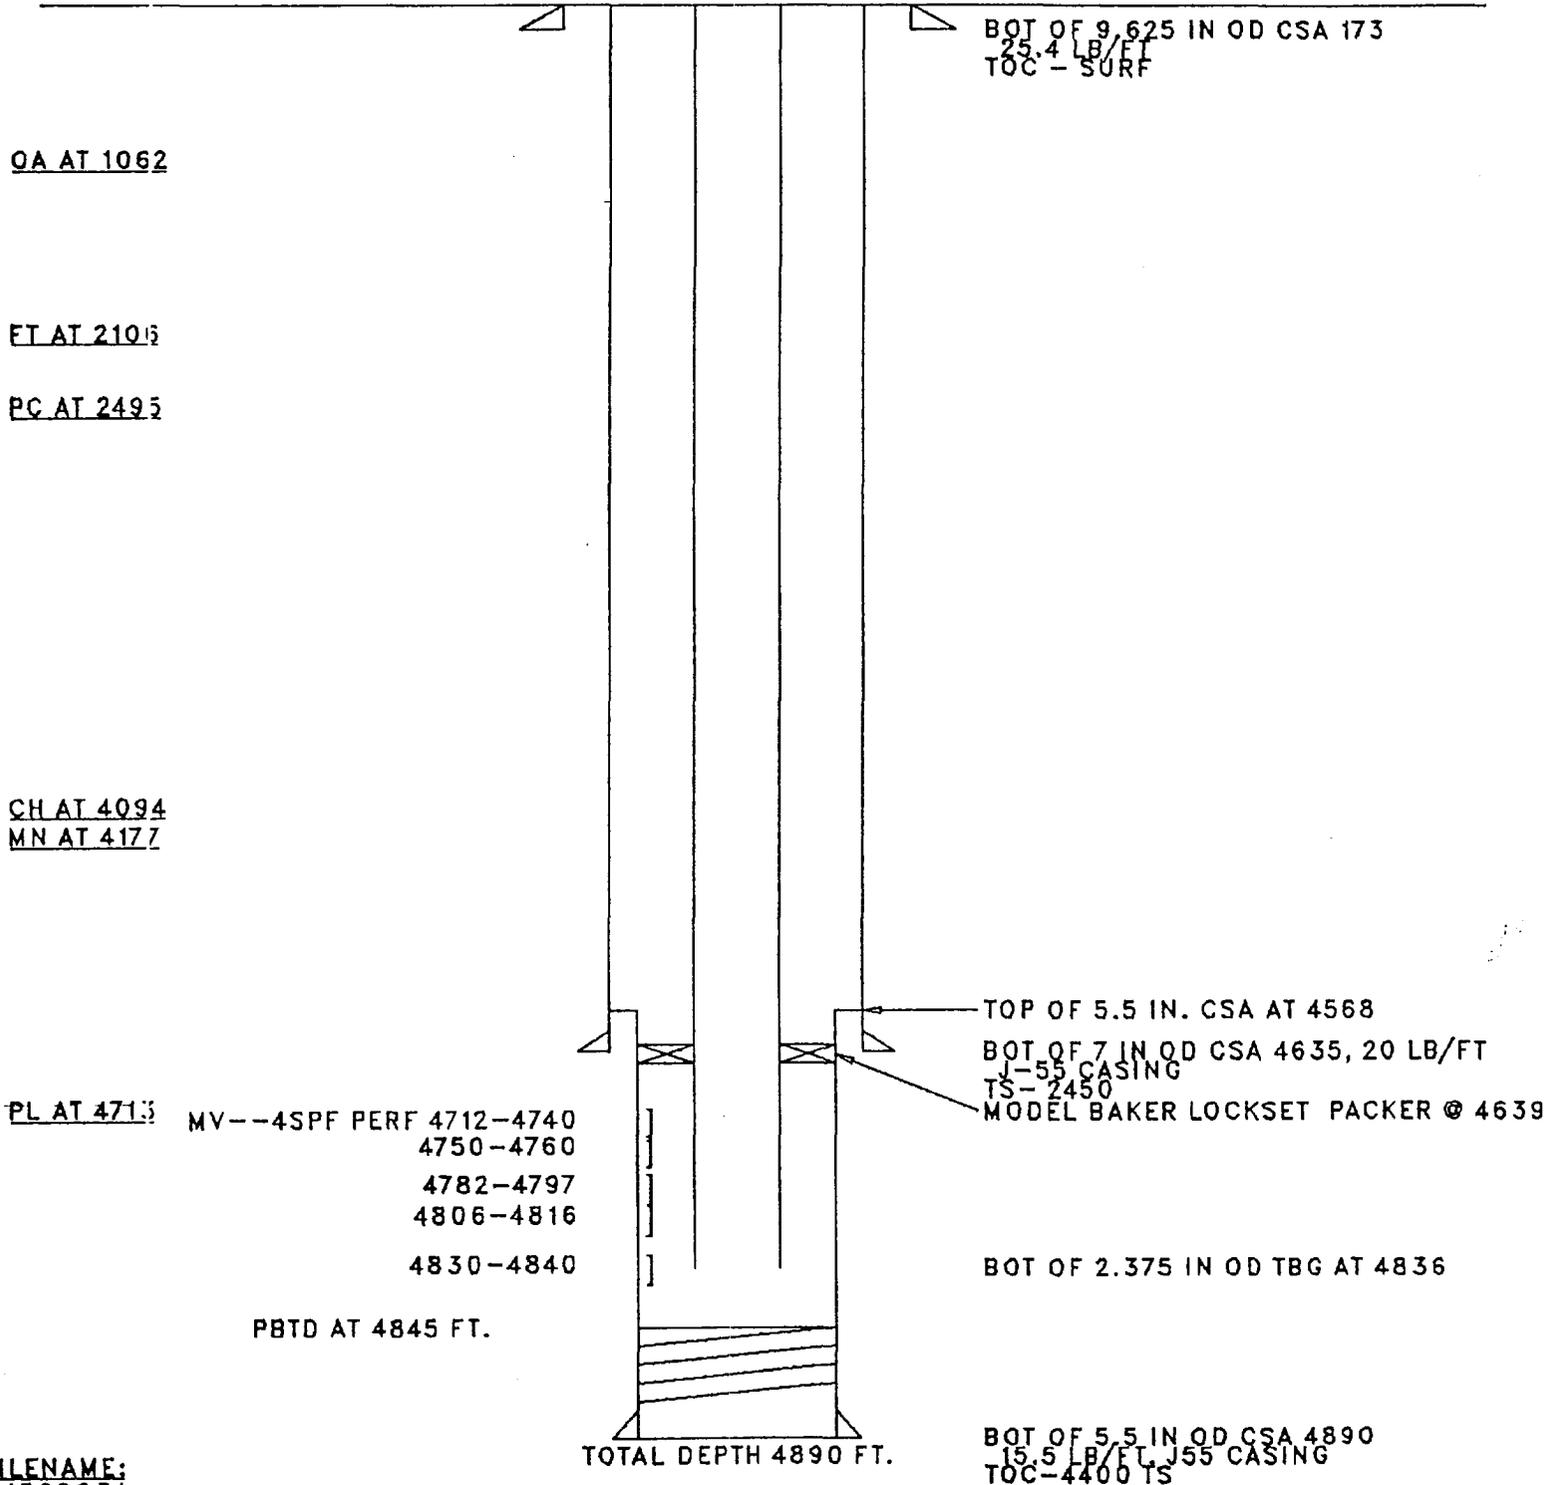

FILENAME:
 04560031

1983 SET PKR ISOLATING CSG LEAK

IN REPLY REFER TO:
(07337)

UNITED STATES DEPARTMENT OF THE INTERIOR

BUREAU OF LAND MANAGEMENT
FARMINGTON DISTRICT OFFICE
1235 La Plata Highway
Farmington, New Mexico 87401

Attachment to Notice of

Re: Permanent Abandonment

Intention to Abandon

Well: 1 Zachary LS

CONDITIONS OF APPROVAL

1. Plugging operations authorized are subject to the attached "General Requirements for Permanent Abandonment of Wells on Federal and Indian Leases."
2. Mike Flaniken with the Farmington Office is to be notified at least 24 hours before the plugging operations commence (505) 599-8907.
3. The following modifications to your plugging program are to be made (when applicable):

At a minimum:

- 1.) Perforate @ 2156', place a cement plug from 2156' to 2056' inside & outside casing* (Fruitland Top @ 2106')
- 2.) Perforate @ 1176', place a cement plug from 1176' to 1012' inside & outside the casing* (Ojo Alamo 1126' to 1062')
- 3.) Perforate @ 223' and circulate cement to the surface.

Office Hours: 7:45 a.m. to 4:30 p.m.

* Excess cement is to be 100% excess in the annulus and 50 linear feet inside the casing.