

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEYSUBMIT IN TRIPPLICATE*
(Other instructions on re-
verse side)Form approved.
Budget Bureau No. 42-R1424.

5. LEASE DESIGNATION AND SERIAL NO.

14-20-604-92

6. IF INDIAN, ALLOTTEE OR TRIBE NAME

Ute Mountain Tribe

7. UNIT AGREEMENT NAME

8. FARM OR LEASE NAME

Ute Mountain Tribal "K"

9. WELL NO.

1

10. FIELD AND POOL, OR WILDCAT

Ute Bone Paradox

11. SEC., T., R., M., OR BLK. AND
SURVEY OR AREASE/4 SE/4 Section 33,
T-32-N, R-14-W

12. COUNTY OR PARISH

San Juan

13. STATE

New Mexico

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir.
Use "APPLICATION FOR PERMIT—" for such proposals.)

1.

OIL WELL ☐ GAS WELL ☒ OTHER

2. NAME OF OPERATOR

AMOCO PRODUCTION COMPANY

3. ADDRESS OF OPERATOR

501 Airport Drive, Farmington, New Mexico 87401

4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements.*
See also space 17 below.)
At surface

790' FSL & 790' FSL

14. PERMIT NO.

15. ELEVATIONS (Show whether DF, RT, GR, etc.)

6700' BDL, 6686' GL

16. Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

TEST WATER SHUT-OFF

☐
☐
☐
☐

PULL OR ALTER CASING

☐
☐
☐
☐

FRACTURE TREAT

MULTIPLE COMPLETE

SHOOT OR ACIDIZE

ABANDON*

REPAIR WELL

CHANGE PLANS

(Other)

SUBSEQUENT REPORT OF:

WATER SHUT-OFF

☐
☐
☐

FRACTURE TREATMENT

SHOOTING OR ACIDIZING

(Other)

REPAIRING WELL

ALTERING CASING

ABANDONMENT*

☐
☐
☒(NOTE: Report results of multiple completion on Well
Completion or Recompletion Report and Log form.)

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)*

On May 5, 1973, the subject well was plugged and abandoned as follows:

1. Spotted 75 sacks Class "A" cement with 2X CaCl₂ at 3260'. Pulled tubing to 2783' and bradenhead squeezed perforated zones 3201-09' and 3236-40' with 25 sacks in formation. Pressured up to 2000 psig and held with the top of the cement at 3082'.
2. Spotted 50 sacks Class "A" cement with 2X CaCl₂ from 1100-930'.
3. Pressured 8-5/8" - 13-3/8" annulus to 1000 psig.
4. Perforated two holes in 8-5/8" casing at 150' and cemented with 110 sacks Class "A" cement with 2X CaCl₂. Circulated down 8-5/8" and out 13-3/8" with cement on each.
5. Cut off casing, erected PXA marker and cleaned up well.

18. I hereby certify that the foregoing is true and correct

SIGNED

Original Signed by
J. ARNOLD SMITH

TITLE

Area Engineer

DATE



July 2, 1973

(This space for Federal or State office use)

APPROVED BY

TITLE

CONDITIONS OF APPROVAL, IF ANY:

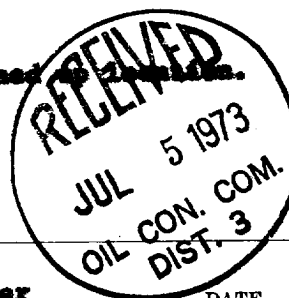

JUL 5 1973

*See Instructions on Reverse Side

Instructions

General: This form is designed for submitting proposals to perform certain well operations, and reports of such operations when completed, as indicated, on Federal and Indian lands pursuant to applicable Federal law and regulations, and, if approved or accepted by any State, on all lands in such State, pursuant to applicable State law and regulations. Any necessary special instructions concerning the use of this form and the number of copies to be submitted, particularly with regard to local, area, or regional procedures and practices, either are shown below or will be issued by, or may be obtained from, the local Federal and/or State office.

Item 4: If there are no applicable State requirements, locations on Federal or Indian land should be described in accordance with Federal requirements. Consult local State or Federal office for specific instructions.

Item 17: Proposals to abandon a well and subsequent reports of abandonment should include such special information as is required by local Federal and/or State offices. In addition, such proposals and reports should include reasons for the abandonment; data on any former or present productive zones, or other zones with present significant fluid contents not sealed off by cement or otherwise; depths (top and bottom) and method of placement of cement plugs; mud or other material placed below, between and above plugs; amount, size, method of parting of any casing, liner or tubing pulled and the depth to top of any left in the hole; method of closing top of well; and date well site conditioned for final inspection looking to approval of the abandonment.

U.S. GOVERNMENT PRINTING OFFICE : 1963—O-685229

847 - 485