

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

SUBMIT IN TRIPLICATE*
(Other instructions on re-
verse side)

Form approved.
Budget Bureau No. 42-R1424.

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir.
Use "APPLICATION FOR PERMIT—" for such proposals.)

5. LEASE DESIGNATION AND SERIAL NO.

SF-078147

6. IF INDIAN, ALLOTTEE OR TRIBE NAME

7. UNIT AGREEMENT NAME

8. FARM OR LEASE NAME

Moore "C"

9. WELL NO.

1

10. FIELD AND POOL, OR WILDCAT

Basin Dakota

11. SEC., T., R., M., OR BLK. AND
SURVEY OR AREA

Sec. 27, T32N - R12W

12. COUNTY OR PARISH

San Juan

13. STATE

New Mexico

1. OIL WELL ☐ GAS WELL ☒ OTHER

2. NAME OF OPERATOR

Tenneco Oil Company

3. ADDRESS OF OPERATOR

P. O. Box 1714, Durango, Colorado

4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements.*
See also space 17 below.)
At surface

820 FSL 1105 FEL

Unit P

14. PERMIT NO.

15. ELEVATIONS (Show whether DF, RT, GR, etc.)

6246 Gr.

16. Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

TEST WATER SHUT-OFF ☐

FRACTURE TREAT ☐

SHOOT OR ACIDIZE ☐

REPAIR WELL ☐

(Other) ☐

PULL OR ALTER CASING ☐

MULTIPLE COMBLETE ☐

ABANDON* ☐

CHANGE PLANS ☐

SUBSEQUENT REPORT OF:

WATER SHUT-OFF ☐

FRACTURE TREATMENT ☒

SHOOTING OR ACIDIZING ☒

(Other) ☐

REPAIRING WELL ☐

ALTERING CASING ☐


ABANDONMENT* ☐

(NOTE: Report results of multiple completion on Well
Completion or Recompletion Report and Log form.)

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)*

Rigged up completion rig 9/7/66. Perforated 7440-43 with 2 HPF, 7443-45 with 3 HPF, 7400-06 w/2HPF. Set packer at 7430. Frac with 25,000# sand and 30,000 gals. water. Set bridge plug at 7376. Perforated 7354-58, 7330-38 w/2HPF. Frac with 45,000# sand and 55,000 gals. water. Set bridge plug at 7320. Perforate 7241-43, 7246, 7249-51, 7255-58, 7264-67, 7271 with 2HPF. Frac with 40,000# sand and 50,000 gals. water. Cleaned out to PBTD 7460. Ran 2 3/8" EUE tubing set at 7438.

Job complete 9/9/66.
Rig released.
Waiting on test.

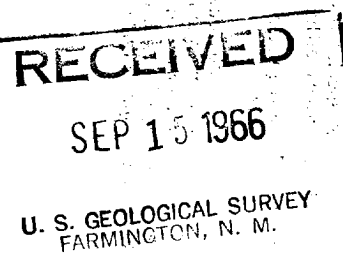

18. I hereby certify that the foregoing is true and correct

SIGNED

Harold C. Nichols

TITLE

Senior Production Clerk

DATE

9/14/66

(This space for Federal or State office use)

APPROVED BY

TITLE

DATE

CONDITIONS OF APPROVAL, IF ANY:

DISTRIBUTION:

5-USGS, 1-Continental, 1-File

*See Instructions on Reverse Side