

Submit 3 Copies To Appropriate District Office
 District I
 1625 N. French Dr., Hobbs, NM 88240
 District II
 811 South First, Artesia, NM 88210
 District III
 1000 Rio Brazos Rd., Aztec, NM 87410
 District IV
 2040 South Pacheco, Santa Fe, NM 87505

State of New Mexico
 Energy, Minerals and Natural Resources

Form C-103
 Revised March 25, 1999

OIL CONSERVATION DIVISION
 2040 South Pacheco
 Santa Fe, NM 87505

WELL API NO. 30025-34698
5. Indicate Type of Lease STATE <input checked="" type="checkbox"/> FEE <input type="checkbox"/>
6. State Oil & Gas Lease No.

SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.) 1. Type of Well: Oil Well <input type="checkbox"/> Gas Well <input type="checkbox"/> Other <input type="checkbox"/> 2. Name of Operator CONCHO RESOURCES INC. 3. Address of Operator 110 W. LOUISIANA STE 410; MIDLAND TX 79701 4. Well Location Unit Letter <u>O</u> : <u>660</u> feet from the <u>SOUTH</u> line and <u>2310</u> feet from the <u>EAST</u> line Section <u>10</u> Township <u>17S</u> Range <u>35E</u> NMPM LEA County	7. Lease Name or Unit Agreement Name: SOUTH SHOE BAR '10' STATE
	8. Well No. 1
	9. Pool name or Wildcat Midway Upper Penn West
	10. Elevation (Show whether DR, RKB, RT, GR, etc.) 3659' GR

11. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data	
NOTICE OF INTENTION TO: PERFORM REMEDIAL WORK <input type="checkbox"/> PLUG AND ABANDON <input checked="" type="checkbox"/> TEMPORARILY ABANDON <input type="checkbox"/> CHANGE PLANS <input type="checkbox"/> PULL OR ALTER CASING <input type="checkbox"/> MULTIPLE COMPLETION <input type="checkbox"/> OTHER: P&A <input checked="" type="checkbox"/>	SUBSEQUENT REPORT OF: REMEDIAL WORK <input type="checkbox"/> ALTERING CASING <input type="checkbox"/> COMMENCE DRILLING OPNS. <input type="checkbox"/> PLUG AND ABANDONMENT <input type="checkbox"/> CASING TEST AND CEMENT JOB <input type="checkbox"/> OTHER: <input type="checkbox"/>

12. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed completion or recompilation.
 Concho Resources Inc. respectfully requests approval to plug and abandon the S. Shoebar '10' State No. 1 well according to the following procedure:

- MIRU WSU. POOH w/ tbg & pkr. TIH w/ tbg to RBP @ 11012'. Release RBP & POOH.
- RU WL. Set CIBP @ 10700' & dump 35' cmt on top.
- Cut 5-1/2" csg @ 8900' & LD. — TAG
- TIH w/ tbg & set 35 sx Class C cmt plug @ 8950'.
- Set 35 sx Class C cmt plug @ 5040'. — TAG
- Set 35 sx Class C cmt plug @ 500'. — TAG
- Set 10 sx Class C cmt surface plug.
- Cut off wellhead & install P&A marker.

SET 100' CEMENT PLUG F/1740'-1640'

I hereby certify that the information above is true and complete to the best of my knowledge and belief.
 SIGNATURE Terri Stathem TITLE Production Analyst DATE 11/8/00
 Type or print name Terri Stathem Telephone No. 915-683-7443
 (This space for State use)



APPROVED BY GARY WINK ORIGINAL SIGNED BY GARY WINK TITLE FIELD REPRESENTATIVE II DATE 11/8/00
 Conditions of approval, if any: FIELD REP. II

S
C

96

S. Shoebar 10 State #1 Proposed Wellbore Diagram

Lease No.: Dist. No. : County: Eddy Field: Midway Upper Penn, west
 Section: 10 Blk: Twsp: 17S Range: 35E Location: Surface: 660' FSL & 2310' FEL
 API No. 30025-34698 Bottom Hole: 1400' FSL & 1949' FWL
 Spud Date: 11/09/99 GRE: 3659
 Comp Date: 06/29/00

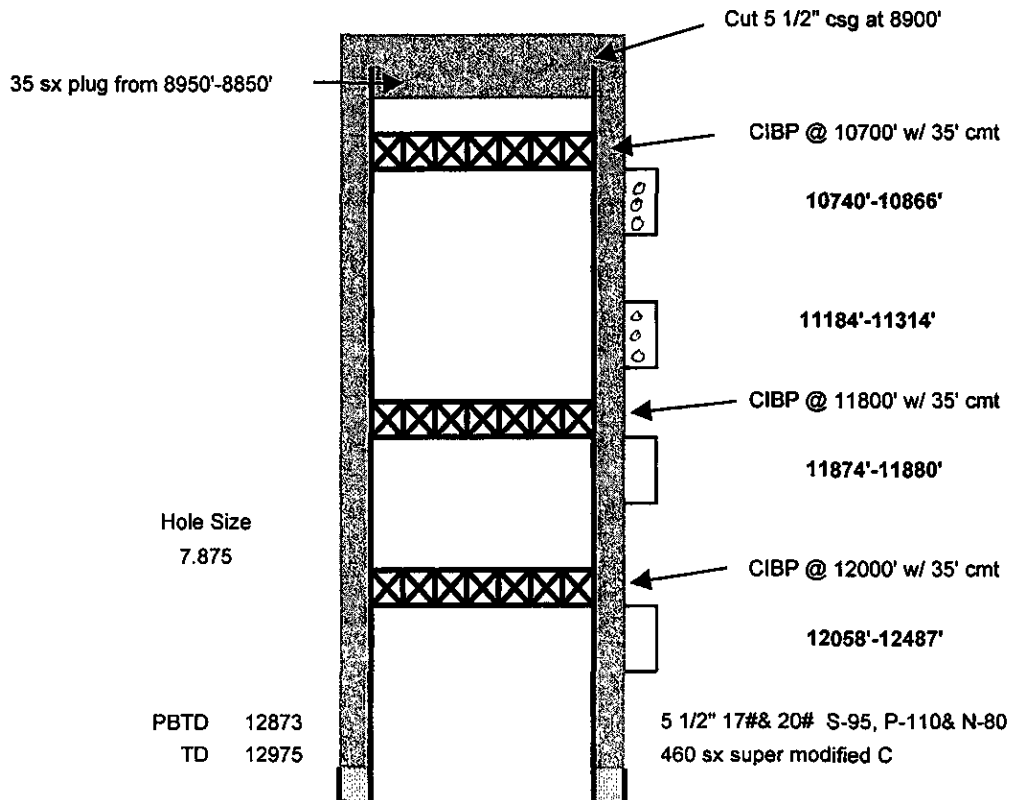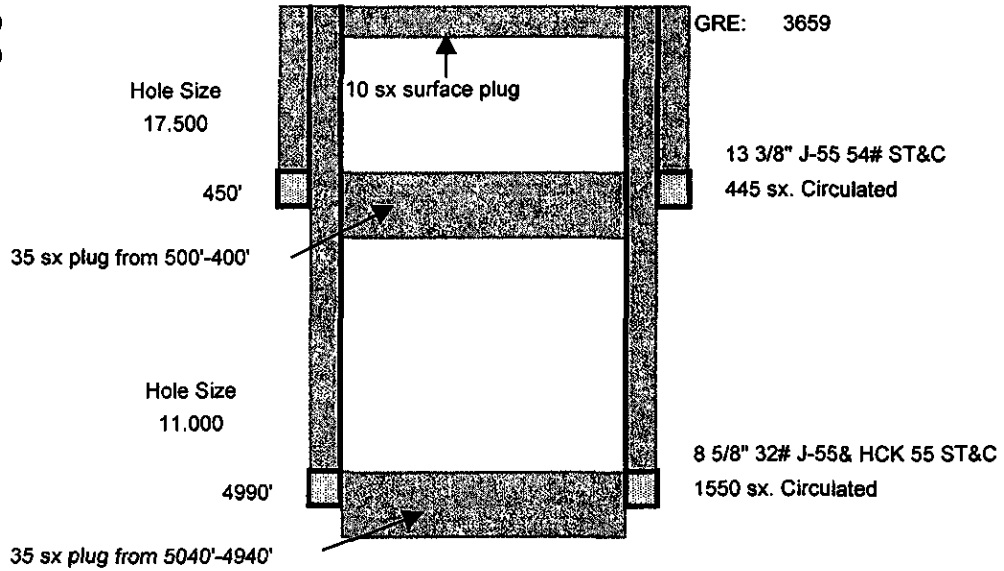

S. Shoebar 10 State #1

Current Wellbore Diagram

Lease No.: Dist. No. : County: Eddy Field: Midway Upper Penn, west
 Section: 10 Blk: Twsp: 17S Range: 35E Location: Surface: 660' FSL & 2310' FEL
 API No. 30025-34698 Bottom Hole: 1400' FSL & 1949' FWL

Spud Date: 11/09/99
 Comp Date: 06/29/00

