

District I - (575) 393-6161
1625 N. French Dr., Hobbs, NM 88240
District II - (575) 748-1283
811 S. First St., Artesia, NM 88210
District III - (505) 334-6178
1000 Rio Brazos Rd., Aztec, NM 87410
District IV - (505) 476-3460
1220 S. St. Francis Dr., Santa Fe, NM 87505

HOBBS OCO
JAN 07 2013

OIL CONSERVATION DIVISION
1220 South St. Francis Dr.
Santa Fe, NM 87505

WELL API NO. 30-025-24365
5. Indicate Type of Lease STATE ☒ FEE ☐
6. State Oil & Gas Lease No. B-1722-1
7. Lease Name or Unit Agreement Name Vacuum Grayburg San Andres Unit
8. Well Number: 47
9. OGRID Number: 4323
10. Pool name or Wildcat Vacuum Grayburg San Andres

SUNDRY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)

1. Type of Well: Oil Well ☒ Gas Well ☐ Other Water Injection ☐

2. Name of Operator
Chevron U.S.A. INC.

3. Address of Operator
15 Smith Road Midland, TX 79705

4. Well Location
Unit Letter H : 1330 feet from the North line and 10 feet from the East line
Section 2 Township 18-S Range 34-E NMPM County Lea

11. Elevation (Show whether DR, RKB, RT, GR, etc.)
4003' GL

12. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO: PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☒ TEMPORARILY ABANDON ☐ CHANGE PLANS ☐ PULL OR ALTER CASING ☐ MULTIPLE COMPL ☐ DOWNHOLE COMMINGLE ☐ OTHER: ☐	SUBSEQUENT REPORT OF: REMEDIAL WORK ☐ ALTERING CASING ☐ COMMENCE DRILLING OPNS. ☐ P AND A ☐ CASING/CEMENT JOB ☐ OTHER: ☐
---	--

13. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion.

TD - 4840' PERFS - 4312' - 4795'
8-5/8" 20# csg @ 355' w/300 sks, 12-1/4" hole, TOC Surf
4-1/2" 9.5# csg @ 4800' w/600 sks, 7-7/8" hole, TOC @ 2460' CBL

- MIRUWSU. NDWH. NUBOP.
- Remove NP Loc-Set Packer @ 4204'
- Set CIBP @ 4212' w/ 25 sks of Class C cement. **CIBP @ 4223'**
- Circulate well with 9.5 PPG plugging mud. Pressure Test casing to 500 psi and record/report findings.
- Set 30 sks of C cement @ 3,100' - 2900' CTOC. WOC & TAG, (Bottom of Salt)
- Perf & Sqz 80 sks of C cement @ 1,600' - 1400', CTOC. WOC & TAG, (Top of Salt)
- Perf & Circulate 160 sks of C cement 405' to Surface.
- Cut off wellhead and anchors 3' below grade. Weld on dry hole marker. Clean location.

The Oil Conservation Division Must be notified
24 hours prior to the beginning of plugging operations.

Spud Date:

Rig Release Date:

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE [Signature] TITLE Representative DATE 01/03/2013

Type or print name Robert Holden E-mail address: rholden@keyenergy.com PHONE: 432-523-5155

For State Use Only

APPROVED BY: [Signature] TITLE Compliance Officer DATE 1/11/2013

Conditions of Approval (if any)


VGSAU #47 Wellbore Diagram

Created: 05/18/04 By: SMG
 Updated: 05/12/08 By: BSPT
 Updated: 12/11/12 By: TPQJ
 Updated: By: Cayce
 Lease: Vacuum Grayburg San Andres Unit
 Field: Vacuum Grayburg San Andres Unit
 Surf. Loc.: 1330' FNL & 10' FEL
 Bot. Loc.:
 County: Lea St.: NM
 Status: Active Injection Well

Well #: 47 St. Lse: 857948
 API: 30-025-24365
 Unit Ltr.: H Section: 2
 TSHP/Rng: S-18 E-34
 Unit Ltr.: Section:
 TSHP/Rng:
 Directions: Buckeye, NM
 Chevno: FH0890

Surface Casing
 Size: 8 5/8"
 Wt., Grd.: 20#, K-55
 Depth: 355'
 Sxs Cmt: 300
 Circulate: Yes
 TOC: Surface
 Hole Size: 12 1/4"

Production Casing
 Size: 4 1/2"
 Wt., Grd.: 9.5#, J-55
 Depth: 4800'
 Sxs Cmt: 600
 Circulate: No
 TOC: 2460', CBL
 Hole Size: 7 7/8"

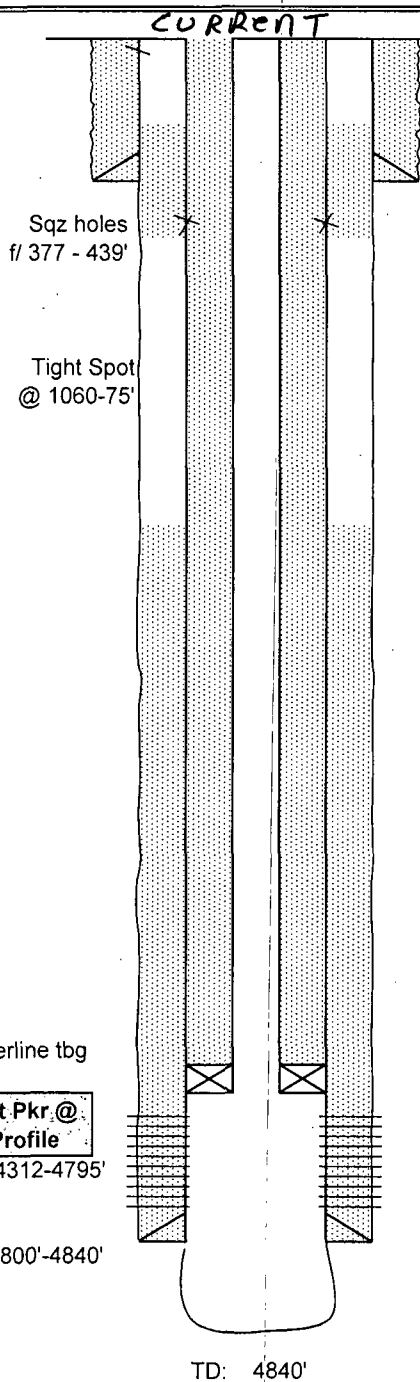

KB: _____
 DF: _____
 GL: 4,003
 Ini. Spud: 03/24/73
 Ini. Comp.: 04/04/73

History

4/73 Ini Comp: Perf 2 jspl 4361, 93, 4407, 16, 28, 51, 65, 75, 85, 4500, 16, 29, 34, 46, 62, 69, 75, 89, 94, 4620, 24, 32, 38, 59, 68, 77, 4708, 19, 29 & 39, acidize w/ 6000 gals 20% NEA.
 7/82 CT CO: Washed perfs with 1000 gals 15% NEFE using CT unit
 6/90 CO, Perf, Acid: Swage tight spot in csg @ 1075'. Rpr WH. CO to 4800'. Perf 2 jspl 4403-12, 20, 34, 46, 55, 96, 4512, 25, 50, 58, 81, 85, 4616, 46 and 4712 (32 holes). AC all perfs w/ 6000 gals 15% NEFE in 3 stages w/ 3K# RS & 46 BS. Test csg ok.
 9/92 CO, Acid: CO to 4789'. Acidize w/ 5000 gals 20% NEFE w/ 3K# RS & 144 BS. Set pkr @ 4250. Test csg ok.
 8/96 CO, Acid: CO fill from 4232' to 4788' (PBSD) w/ 3 7/8" bit. Acidize GSA perfs 4361'-4739' (92 holes) with 5000 gal 20% NEFE in 4 stages w/ 5000 # RS (good block). Pkr @ 4230. Test csg ok.
 8/04 MIT, CO, Perf, Acid: Tagged @ 4246' w/ bit. Attempt to find holes in 4 1/2" csg w/ RBP & pkr? Set RBP @ 4220'. Repair hole in 8 5/8" near WH by digging out cellar. Pump 125 sx cmt down 4 1/2" csg, no circ. DO cmt. TIH w/ 3 7/8" bit and C/O to 4772' (scale, iron sulfate). Perf 4 jspl 4360'-4370' & re-perf 4400'-4440' (200 holes). Set pkr @ 4207. AC 6000 gls 15% NEFE & 4000# RS (good block). Set RBP @ 4207. Find holes f/ 377-439' w/ pkr. Sqs w/ 105 sx. Run CBL. Sqs w/ 100 sx. Test csg to 350# ok.
 7/05: Tagged @ 4764'.
 10/5/2007: Failed MIT pre-test.
 6/08 Deepen to TZ: Attempt to sqz csg leak unsuccessful. Deepen to 4840'. Perf 4 1/2" csg 4294-4795'. Acidize interval 4294-4840' w/ 6000 gals 15% in 4 stages. RIH w/ 4 1/2" pkr & on/off tool on 2 7/8" fiberline tbq. Set pkr at 4204'. Cement in tbq w/ 165 sx Class C. Test tbq to 2500 psi. Return to injection.
 4/09 Tagged @ 4796'. Tbg. press 1725.
 7/12: Failed MIT w/ no remedial options available - plan to P&A

130 jts. 2 7/8" J-55 Fiberline tbq

4 1/2" NP-Loc-Set Pkr @ 4204'-1,50" F" Profile

Perfs: 4312-4795'

3-7/8" Open Hole 4800'-4840'

TD: 4840'

Perf Details

4323-28, 54-66, 93,
 4403, 07, 12, 16, 20, 28, 34, 46, 51, 55, 60-70, 65,
 4475, 82-88, 90-96,
 4500, 12, 16, 25, 29, 34, 46, 50, 56-64, 69, 75, 81,
 4585, 89, 94,
 4616, 20, 24, 32, 38, 39-48, 59, 64-81,
 4708, 12, 19-24, 29, 39, 40-42, 50-56, 60-66, 70-80,
 4785-95,
 OH 4800-4840

VGSAU #47 Wellbore Diagram


Created: 05/18/04 By: SMG
 Updated: 05/12/08 By: BSPT
 Updated: 12/11/12 By: TPQJ
 Updated: By: Cayce
 Lease: Vacuum Grayburg San Andres Unit
 Field: Vacuum Grayburg San Andres Unit
 Surf. Loc.: 1330' FNL & 10' FEL
 Bot. Loc.:
 County: Lea St.: NM
 Status: Active Injection Well

Well #: 47 St. Lse: 857948
 API 30-025-24365
 Unit Ltr.: H Section: 2
 TSHP/Rng: S-18 E-34
 Unit Ltr.: Section:
 TSHP/Rng:
 Directions: Buckeye, NM
 Chevno: FH0890

Surface Casing
 Size: 8 5/8"
 Wt., Grd.: 20#, K-55
 Depth: 355'
 Sxs Cmt: 300
 Circulate: Yes
 TOC: Surface
 Hole Size: 12 1/4"

Production Casing
 Size: 4 1/2"
 Wt., Grd.: 9.5#, J-55
 Depth: 4800'
 Sxs Cmt: 600
 Circulate: No
 TOC: 2460', CBL
 Hole Size: 7 7/8"

KB:
 DF:
 GL: 4,003
 Ini. Spud: 03/24/73
 Ini. Comp.: 04/04/73

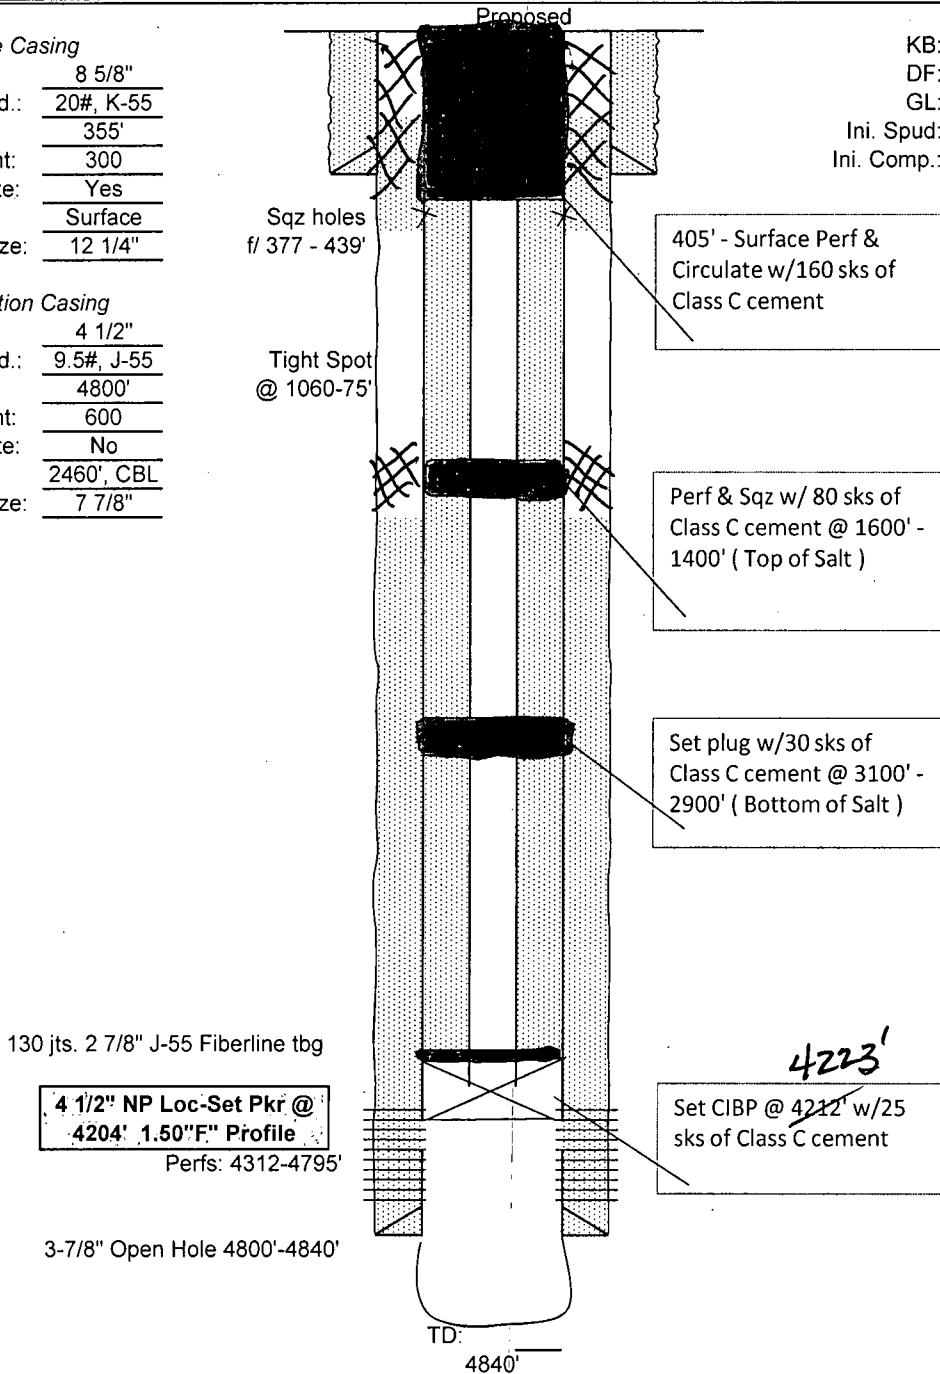

Vacuum Grayburg San Andres Unit # 47

C-144 CLEZ P&A Rig Lay out



Well Head

