

UNITED STATES  
DEPARTMENT OF THE INTERIOR  
BUREAU OF LAND MANAGEMENTNMOCD  
HobbsFORM APPROVED  
OMB NO. 1004-0137  
Expires: January 31, 2018

## SUDDRY NOTICES AND REPORTS ON WELLS

Do not use this form for proposals to drill or to re-enter an abandoned well. Use form 3160-3 (APD) for such proposals.

SUBMIT IN TRIPLICATE - Other instructions on page 2

5. Lease Serial No.  
NMNM83197

6. If Indian, Allottee or Tribe Name

7. If Unit or CA/Agreement, Name and/or No.

8. Well Name and No.  
FARRELL FEDERAL 139. API Well No.  
30-041-10431-00-S110. Field and Pool or Exploratory Area  
CHAVEROO-SAN ANDRES11. County or Parish, State  
ROOSEVELT COUNTY, NM

## 12. CHECK THE APPROPRIATE BOX(ES) TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA

TYPE OF SUBMISSION	TYPE OF ACTION		
<input checked="" type="checkbox"/> Notice of Intent	<input type="checkbox"/> Acidize	<input type="checkbox"/> Deepen	<input type="checkbox"/> Production (Start/Re
<input type="checkbox"/> Subsequent Report	<input type="checkbox"/> Alter Casing	<input type="checkbox"/> Hydraulic Fracturing	<input type="checkbox"/> Reclamation
<input type="checkbox"/> Final Abandonment Notice	<input type="checkbox"/> Casing Repair	<input type="checkbox"/> New Construction	<input type="checkbox"/> Recomplete
	<input type="checkbox"/> Change Plans	<input checked="" type="checkbox"/> Plug and Abandon	<input type="checkbox"/> Temporarily Abando
	<input type="checkbox"/> Convert to Injection	<input type="checkbox"/> Plug Back	<input type="checkbox"/> Water Disposal

INT TO PA Pm x  
P&A NR \_\_\_\_\_  
P&A R \_\_\_\_\_

13. Describe Proposed or Completed Operation: Clearly state all pertinent details, including estimated starting date of any proposed work and approximate duration thereof. If the proposal is to deepen directionally or recomple horizontally, give subsurface locations and measured and true vertical depths of all pertinent markers and zones. Attach the Bond under which the work will be performed or provide the Bond No. on file with BLM/BIA. Required subsequent reports must be filed within 30 days following completion of the involved operations. If the operation results in a multiple completion or recomple in a new interval, a Form 3160-4 must be filed once testing has been completed. Final Abandonment Notices must be filed only after all requirements, including reclamation, have been completed and the operator has determined that the site is ready for final inspection.

Ridgeway Arizona Oil Corp (Ridgeway) requests approval to plug and abandon the Farrell Federal #13 according to the attached proposed plugging procedure and well bore diagram.

Ridgeway or a representative of Ridgeway will contact the BLM 24 hours prior to beginning plugging procedures.

SEE ATTACHED FOR  
CONDITIONS OF APPROVALAPPROVED FOR 3 MONTH PERIOD  
ENDING JUL 21 2017

14. I hereby certify that the foregoing is true and correct.

Electronic Submission #373404 verified by the BLM Well Information System

For RIDGEWAY ARIZONA OIL CORP, sent to the Roswell

Committed to AFMSS for processing by DAVID GLASS on 04/20/2017 (17DRG0157SE)

Name (Printed/Typed) LAURI M STANFIELD

Title OFFICE MANAGER

Signature (Electronic Submission)

Date 04/20/2017

## THIS SPACE FOR FEDERAL OR STATE OFFICE USE

Approved By

(ORIG. SGD) DAVID E GLASS

Title

PETROLEUM ENGINEER

APR 21 2017

Conditions of approval, if any, are attached. Approval of this notice does not warrant or certify that the applicant holds legal or equitable title to those rights in the subject lease which would entitle the applicant to conduct operations thereon.


Office

Title 18 U.S.C. Section 1001 and Title 43 U.S.C. Section 1212, make it a crime for any person knowingly and willfully to make to any department or agency of the United States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction.

(Instructions on page 2)

\*\* BLM REVISED \*\* BLM REVISED \*\* BLM REVISED \*\* BLM REVISED \*\* BLM REVISED \*\*

FOR RECORD ONLY  
mw/ocd 04/27/2017

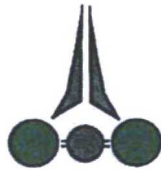

# Ridgeway

Arizona Oil Corporation

Plugging Procedure  
Farrell Federal #13  
API – 30-041-10431  
Sec. 28, T7S, R33E, UL-D  
660' FNL 660' FWL

1. Prepare location and test anchors
2. MIRU plugging rig
3. Notify OCD/BLM 24 hours prior to commencement of P&A procedures
4. NDWH/NU BOP
5. RIH w/ 4 ½" CIBP on 2 3/8" workstring @ 4201' (+/-) within 50' if top perf – 4246'
  - a. Spot 35' of cement on CIBP
  - b. WOC – bump plug @ 4166' (+/-)
6. Load well with a minimum of 9 lb. mud and conduct MIT to 500 psi., test for leak off
  - a. Bleed pressure off after MIT
7. MIRU WL and RIH w/ perf gun to 2566'
  - a. Perforate @ 2 JSPF
  - b. POOH w/WL
  - c. RDWL
8. TIH w/WS – Squeeze 125' cement @ 2566' to 2441' (+/-)
  - a. Wait on cement
  - b. Tag plug @ 2441' or above
9. MIRU WL and RIH w/perf gun to 492'
  - a. Perforate @ 2 JSPF
  - b. POOH w/WL
  - c. RDWL
10. TIH w/WS – Squeeze <sup>150</sup>100 cement @ 492' to <sup>342</sup>392'
  - a. 8 5/8" casing shoe @ 417'
  - b. Wait on cement
  - c. Tag plug @ <sup>342</sup>392' or above
11. MIRU WL and RIH w/perf gun to 60'
  - a. Perforate @ 2 JSPF
  - b. POOH w/WL
  - c. RDWL
12. TIH w/WS – Circulate cement plug from 60' to surface
  - a. Wait on cement
  - b. Cut off well head 4' below ground level
13. RDMO plugging rig
  - a. Install P&A marker
  - b. Cut off dead men
  - c. Remediate location

200 N. Loraine, STE 1440  
Midland, TX 79701

Tel: 432-687-0303  
Fax: 432-687-0321



Co. Rep	0	Well No.	13
Well Name	Farrell Federal		
Field	Chaveroo San Andres		
County	Roosevelt		
State	NM		
Date			
Date Comp			
KB	4425' RDB		

Description	O.D.	Grade	Weight	Depth	Cmt Sx	TO
Surface Csg	8 5/8"		24#	417'	250	Surfa
Inter Csg						
Prod Csg	4 1/2"	J-55	9.5#	4448'	800	
Liner O.D.						

Perf @ 60'  
sqz. To  
Surface

3 5/8" to 417'

Perf @ 492'  
sqz. 100' Cmt.

Perf @ 2566'  
sqz. 125' cmt.

35' cmt. Plug  
CIBP 4201'

TOC  
392'  
342'

TOC  
2441'

TOC 4166'

Lease	Farrell Federal	Well #	13	Field	Chaveroo San Andres
Well Test Data	BOPD	BWPD		MCF	
Unit Name & Size					
Perforations	4246-4388				
TBG Data			Pump Size		
Strokes Per. Min.			Stroke Length	Seat Nipple	
Tension	Rods String	Taper 1	Taper 2		
TAC	Rod Grade	Taper 3	Taper 4		
Predictive Load			Actual Load		

LIST DATES, REASON FOR FAILURES & MEASURES TAKEN TO PREVENT SAID FAILURES & NON FAILURE PULLS.

LIST ANY RECOMMENDATIONS TO PREVENT FUTURE FAILURES OR ANY COMMENTS ON WELL CONDITIONS THAT WILL CONTRIBUTE TO FAILURES.

#### Perforations

4246-47, 49-51, 53-54, 62-66, 73-74, 82-84, 85-86, 90-91, 98-99; 4301-02, 08-10, 14-15, 17-18, 22-25, 72-74, 80-81, 83-84, 86-88 @ 1 shot/interval - 18 holes

PBTD @ 4414'

ETD @ 4402'

TD @ 4448'

**BUREAU OF LAND MANAGEMENT**  
**Roswell Field Office**  
**2909 West Second Street**  
**Roswell, New Mexico 88201**  
**(575) 627-0272**

**Permanent Abandonment of Federal Wells**  
**Conditions of Approval**

Failure to comply with the following Conditions of Approval may result in a Notice of Incidents of Noncompliance (INC) in accordance with 43 CFR 3163.1.

1. Plugging operations shall commence within **ninety (90) days** from the approval date of this Notice of Intent to Abandon. **If you are unable to plug the well by the 90<sup>th</sup> day provide the BLM Roswell Field Office (RFO), prior to the 90<sup>th</sup> day, with the reason for not meeting the deadline and a date when the BLM Roswell Field Office can expect the well to be plugged. Failure to do so will result in enforcement action. Unless the well has been properly plugged, the rig shall not be removed from over the hole without prior approval.**

2. Notification: Contact the BLM Roswell Field Office at least 24 hours prior to the commencing of any plugging operations. For wells in Chaves and Roosevelt County, during office hours or after office hours call (575) 627-0205. Engineer on call during office hours phone (575) 627-0275 or phone (after hours) call (575) 626-5749.

3. Blowout Preventers: A blowout preventer (BOP), as appropriate, shall be installed before commencing any plugging operation. The minimum BOP requirement is a 2M system for a well not deeper than 9090 feet; a 3M system for a well not deeper than 13636 feet; and a 5M system for a well not deeper than 22727 feet.

4. Mud Requirement: Mud shall be placed between all plugs. Minimum consistency of plugging mud shall be obtained by mixing at a rate of 25 sacks (50 pounds each) of gel per 100 barrels of water. Minimum nine (9) pounds per gallon.

5. Cement Requirement: Sufficient cement shall be used to bring any required plug to the specified depth and length. Any given cement volumes on the proposed plugging procedure are merely estimates and not final. Unless specific approval is received, no plug except the surface plug shall be less than 25 sacks of cement. In lieu of a cement plug in cased hole, a bridge plug set within 50 feet to 100 feet above the perforations shall be capped with 50 feet of cement. If a bailer is used to cap this plug, 35 feet of cement shall be sufficient.

Unless otherwise specified in the approved procedure, the cement plug shall consist of either class "C" for up to 7500 feet of depth, mixed at 14.8 lbs./gal with 6.3 gallons of fresh water per sack or class "H" for deeper than 7500 feet plugs, mixed at 16.4 lbs./gal with 4.3 gallons of fresh water per sack.

6. Monument: Upon abandonment of the well, all casing shall be cut-off at the base of the cellar or 3-feet below final restored ground level (whichever is deeper). The well bore shall then be covered with a metal plate at least ¼ inch thick and welded in place. The following information shall be permanently inscribed on the dry hole marker: Well name and number, the name of the operator, the lease serial number, the surveyed location (the quarter-quarter section, township and range or other authorized survey designation acceptable to the authorized officer; such as metes and bounds).

7. Timing Limitation Lease Stipulation / Condition of Approval For Lesser Prairie-Chicken: Oil and gas activities including 3-D geophysical exploration, and drilling will not be allowed in lesser prairie-chicken habitat during the period from March 1 through June 15 annually. During that period, other activities that produce noise or involve human activity, such as the maintenance of oil and gas facilities, geophysical exploration other than 3-D seismic operations, and pipeline, road, and well pad construction, will be allowed except between 3:00 am and 9:00 am. The 3:00 am to 9:00 am restriction will not apply to normal, around-the-clock operations, such as venting, flaring, or pumping, which do not require a human presence during this period. Additionally, no new drilling will be allowed within up to 200 meters of leks known at the time of permitting. Normal vehicle use on existing roads will not be restricted. Exhaust noise from pump jack engines must be muffled or otherwise controlled so as not to exceed 75 db measured at 30 feet from the source of the noise.

8. Subsequent Plugging Reporting: Within 30 days after plugging work is completed, file one original and five copies of the Subsequent Report of Abandonment, Form 3160-5 to the BLM Roswell Field Office. The report should give in detail the manner in which the plugging work was carried out, the extent (by depths) of cement plugs placed, and the size and location (by depths) of casing left in the well. **Show date well was plugged.**

Following the submittal and approval of the Subsequent Report of Abandonment, a Notice of Intent for Final Abandonment with the proposed surface restoration procedure must be submitted for approval.