
Submit 1 Copy To Appropriate District	State of New Mexico	Form C-103
Office District I	Energy, Minerals and Natural Resources	October 13, 2009
1625 N. French Dr., Hobbs, NM 88240		WELL API NO. / 30-025-24302
District II 1301 W. Grand Ave. Artesia NM 88210	CIOIL CONSERVATION DIVISION	5. Indicate Type of Lease
I hetrict III	2 - 1011 ZZU SOUIII St. Flaucis Dir i 1 / r-	r) STATE X FEE
1000 Rio Brazos Rd., Aztec, NM 87410	25 2010 (ta Fe, NM 87505) [V [G. State Oil & Gas Lease No.
1220 S. St. Francis Dr., Santa Fe, NM	Diversity of the second	NM-4160
87505	DESCRIPTION WELLS 22 AM 11	13 Lease Name or Unit Agreement Name
(DO NOT USE THIS FORM FOR PROPOS	CES AND REPORTS ON WELLS". CE THE ALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A	North Vacuum Abo North Unit 4-A
DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH		
PROPOSALS) 1. Type of Well: Oil Well Gas Well Other INJECTION		8. Well Number 1
2. Name of Operator		9. OGRID Number
Sheridan Production Company		252496/
3. Address of Operator		10. Pool name or Wildcat
200 N. Loraine Ste. 530 Midland,	ΓX 79701	North Vacuum)Abo) ~
4. Well Location		, '
Unit Letter L : 1980 feet from the South line and 860 feet from the West line		
Section 1	Township 17S Range 34E	NMPM Lea County
William Park of the Light Control	11. Elevation (Show whether DR, RKB, RT, GR, etc.	.)
	4041.9 GR	The state of the s
40 01 1 4	the Day of The Alleton of Nietze	Depart on Other Date
12. Check A	ppropriate Box to Indicate Nature of Notice	, Report of Other Data
NOTICE OF IN	TENTION TO: SUE	SSEQUENT REPORT OF:
PERFORM REMEDIAL WORK X	PLUG AND ABANDON REMEDIAL WOR	_
TEMPORARILY ABANDON		
PULL OR ALTER CASING $ ightarrow$ \square	MULTIPLE COMPL CASING/CEMEN	IT JOB
DOWNHOLE COMMINGLE		•
OTHER:	OTHER:	· · ·
13 Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date		
of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiple Completions: Attach wellbore diagram of		
proposed completion or recompletion.		
1. 01/05/2010 ND Wellhead NLI ROI	P and released nacker Rigged up scanners. Pull the	out of hole and lay down. Moved bad tbg off
01/05/2010 ND Wellhead, NU BOP and released packer. Rigged up scanners. Pull tbg out of hole and lay down. Moved bad tbg off location.		
01/06/2010 Pick up bailer, pick up tbg., trip tbg		
01/07/2010 picked up packer, rig up and down tester and hydro tested in hole. Set arrowset treating packer and tested casing.		
01/08/2010 swabbed		
01/09/2010 Release packer, lay do		
01/10/2010 Hydro test injection string in hole 01/12/2010 Circulate packer fluid. ND BOP and set arrowset packer @ 8593.60'. NU wellhead, tested casing and packer to 500# for 30		
minutes.		
Spud Date:	Rig Release Date:	
I hereby certify that the information	above is true and complete to the best of my knowled	lge and belief.
CILL OI IN THE DATE OF THE OFFICE OFFICE OF THE OFFICE OF THE OFFICE OFFICE OF THE OFFICE OF THE OFFICE OFFICE OFF		
SIGNATURE		
Type or print nameSylvia Shoemaker_ E-mail address: _sshoemaker@sheridanproduction.com PHONE: 432 683-5271		
For State Use Only		
DISTRICT 1 SUPERVISOR WAN 2 6 2010		
APPROVED BY: DATE DISTRIBUTION DATE DATE		

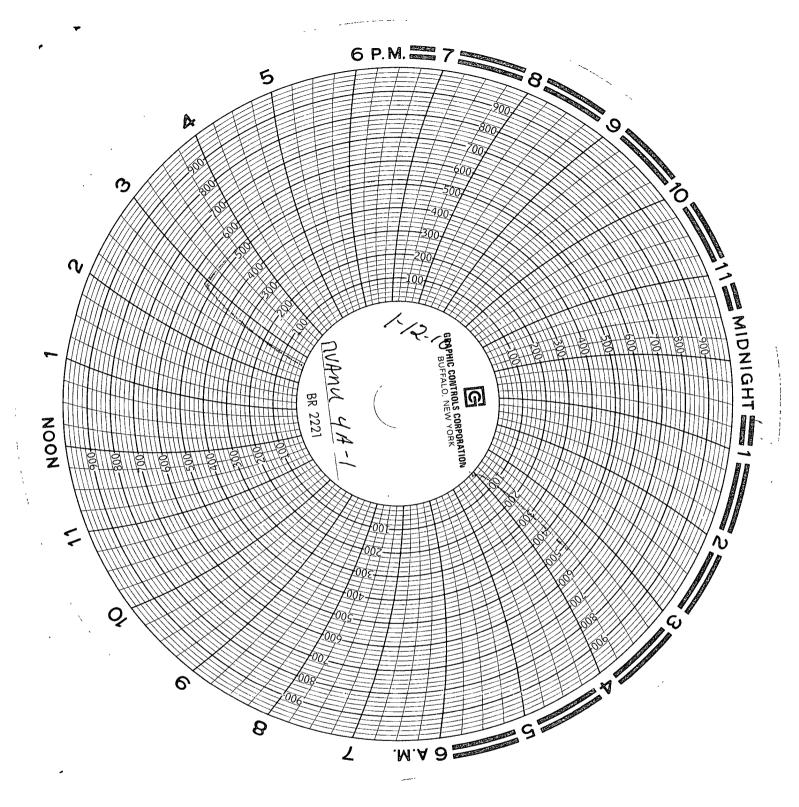

Banely Cons