

Submit 3 Copies To Appropriate District
Office
District I
1625 N. French Dr., Hobbs, NM 88201
District II
1301 W. Grand Ave., Artesia, NM 88210
District III
1000 Rio Brazos Rd., Aztec, NM 87410
District IV
1220 S. St Francis Dr., Santa Fe, NM 87505

State of New Mexico
Energy, Minerals and Natural Resources

Form C-103
May 27, 2004

RECEIVED

AUG 19 2010

HOBO SOCD

OIL CONSERVATION DIVISION
1220 South St. Francis Dr.
Santa Fe, NM 87505

WELL API NO. 30-025-05602
5. Indicate Type of Lease STATE <input checked="" type="checkbox"/> FEE <input type="checkbox"/>
6. State Oil & Gas Lease No. B2330
7. Lease Name or Unit Agreement Name: East Eumont Unit
8. Well Number 39
9. OGRID Number 192463
10. Pool name or Wildcat Eumont Yates 7Rvr On

SUNDRY NOTICES AND REPORTS ON WELLS

(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)

1. Type of Well: Oil Well <input type="checkbox"/> Gas Well <input type="checkbox"/> Other Injection <input checked="" type="checkbox"/>
2. Name of Operator OXY USA WTP Limited Partnership
3. Address of Operator P.O. Box 50250 Midland, TX 79710-0250
4. Well Location Unit Letter C : 660 feet from the north line and 1980 feet from the west line Section 15 Township 19S Range 37E NMPM County Lea
11. Elevation (Show whether DR, RKB, RT, GR, etc.) 3667'
Pit or Below-grade Tank Application <input type="checkbox"/> or Closure <input type="checkbox"/> Pit type _____ Depth to Groundwater _____ Distance from nearest fresh water well _____ Distance from nearest surface water _____ Pit Liner Thickness: _____ mil Below-Grade Tank: Volume _____ bbls; Construction Material _____

12. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☒
TEMPORARILY ABANDON ☐ CHANGE PLANS ☐
PULL OR ALTER CASING ☐ MULTIPLE COMPLETION ☐
OTHER: ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐ ALTERING CASING ☐
COMMENCE DRILLING OPNS. ☐ PLUG AND ABANDONMENT ☐
CASING TEST AND CEMENT JOB ☐
OTHER: ☐

13. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion.

TD-4011' PBTD-4005' Perfs-3845-3978' Pkr-3772'
8-5/8" 22.7# csg @ 375' w/300sx, 12-1/4" hole, TOC-Surf-Circ
5-1/2" 14# csg @ 4009' w/800sx, 7-7/8" hole, TOC-1940'-TS
1. RIH & Set CIBP @ 3795' M&P 25sx cmt to 3625'
2. M&P 25sx cmt @ 2850-2675'
3. Perf @ 1600' sqz 60sx cmt to 1450' WOC-Tag
4. Perf @ 425' sqz 150sx cmt to Surface - Verify
10# MLF between plugs

The Oil Conservation Division **Must be notified 24 hours prior** to the beginning of plugging operations

I hereby certify that the information above is true and complete to the best of my knowledge and that no below-grade tank has been/will be constructed or closed according to NMOCD guidelines ☐ , a general permit ☐ or an (attached) alternative OCD-approved plan ☐

SIGNATURE David Stewart TITLE Sr. Regulatory Analyst DATE 8/20/10
E-mail address: david_stewart@oxy.com
Type or print name David Stewart Telephone No. 432-685-5717


For State Use Only

APPROVED BY Carly W. Hill TITLE DISTRICT 1 SUPERVISOR DATE AUG 20 2010
Conditions of Approval, if any:

OXY USA WTP LP - Proposed
East Eumont Unit #39
API No. 30-025-05602


150sx @ 425' - Surface

12-1/4" hole @ 375'
8-5/8" csg @ 375'
w/ 300sx-TOC-Surf-Circ

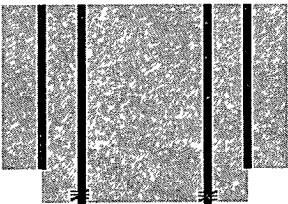


Perf @ 425'

60sx @ 1600-1450' WOC-Tag




Perf @ 1600'

25sx @ 2850-2675'

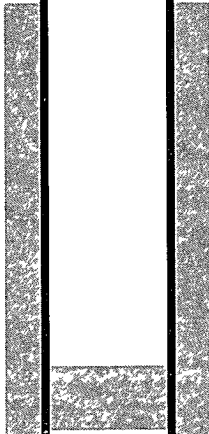

CIBP @ 3795' w/ 25sx


7-7/8" hole @ 4011'
5-1/2" csg @ 4009'
w/ 800sx-TOC-1940'-TS

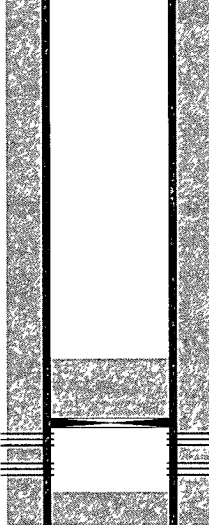

Perfs @ 3845-3978'

TD-4011'

OXY USA WTP LP - Current
East Eumont Unit #39
API No. 30-025-05602

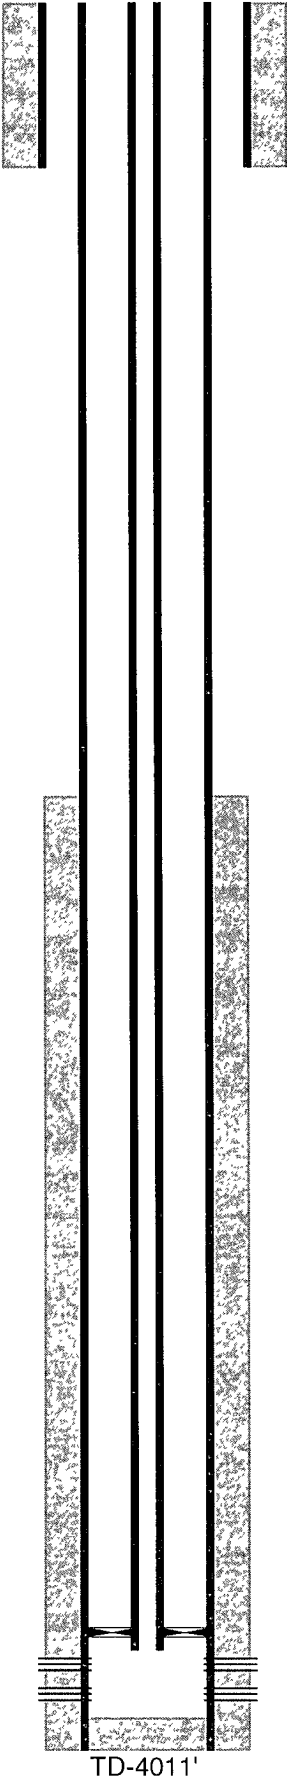

12-1/4" hole @ 375'
8-5/8" csg @ 375'
w/ 300sx-TOC-Surf-Circ

2-3/8" tbg w/ pkr @ 3772'

7-7/8" hole @ 4011'
5-1/2" csg @ 4009'
w/ 800sx-TOC-1940'-TS

Perfs @ 3845-3978'

TD-4011'