

Santa Fe, NM 87505

1. Operator Name and Address COG OPERATING LLC 550 W TEXAS MIDLAND , TX 79701		2. OGRID Number 229137
		3. API Number 30-015-36481
4. Property Code 37287	5. Property Name KOOL AID STATE	6. Well No. 004

UL - Lot G	Section 24	Township 17S	Range 28E	Lot Idn G	Feet From 1650	N/S Line N	Feet From 1650	E/W Line E	County EDDY
---------------	---------------	-----------------	--------------	--------------	-------------------	---------------	-------------------	---------------	----------------

EMPIRE; GLORIETA-YESO	96210
-----------------------	-------

9. Work Type New Well	10. Well Type OIL	11. Cable/Rotary	12. Lease Type State	13. Ground Level Elevation 3702
14. Multiple N	15. Proposed Depth	16. Formation Yeso Formation	17. Contractor	18. Spud Date 8/15/2008
Depth to Ground water 110		Distance from nearest fresh water well		Distance to nearest surface water
Pit: Liner: Synthetic ☐ mls thick Clay ☐ Pit Volume: bbls Drilling Method:				
Closed Loop System ☒ Fresh Water ☐ Brine ☐ Diesel/Oil-based ☐ Gas/Air ☐				

Type	Hole Size	Casing Type	Casing Weight/ft	Setting Depth	Sacks of Cement	Estimated TOC
Surf	11	8.625	32	250	300	0
Prod	7.875	5.5	17	5400	1200	0

COG proposes to drill an 11" hole to 250' w/fresh water mud system, vis 8.5, vis 28. Set 8-5/8" casing & cement to surface. Drill 7-7/8" hole to 5400' w/brine mud system, wt 8.7, vis 29-32. Test Yeso formation. Run 5-1/2" casing & cement to surface. Note: On production string, a caliper will be run. COG will attempt to circulate cement.

Type	Working Pressure	Test Pressure	Manufacturer
DoubleRam	2000	2000	

Date: 7/29/2008	Phone: 432-683-7443
-----------------	---------------------

District I
 1625 N. French Dr., Hobbs, NM 88240
 Phone:(505) 393-6161 Fax:(505) 393-0720

District II
 1301 W. Grand Ave., Artesia, NM 88210
 Phone:(505) 748-1283 Fax:(505) 748-9720

District III
 1000 Rio Brazos Rd., Aztec, NM 87410
 Phone:(505) 334-6178 Fax:(505) 334-6170

District IV
 1220 S. St Francis Dr., Santa Fe, NM 87505
 Phone:(505) 476-3470 Fax:(505) 476-3462

State of New Mexico
Energy, Minerals and Natural Resources
Oil Conservation Division
1220 S. St Francis Dr.
Santa Fe, NM 87505

Form C-102
 Permit 77734

WELL LOCATION AND ACREAGE DEDICATION PLAT

1. API Number 30-015-36481	2. Pool Code 96210	3. Pool Name EMPIRE; GLORIETA-YESO
4. Property Code 37287	5. Property Name KOOL AID STATE	6. Well No. 004
7. OGRID No. 229137	8. Operator Name COG OPERATING LLC	9. Elevation 3702


10. Surface Location

UL - Lot	Section	Township	Range	Lot Idn	Feet From	N/S Line	Feet From	E/W Line	County
G	24	17S	28E		1650	N	1650	E	EDDY

11. Bottom Hole Location If Different From Surface

UL - Lot	Section	Township	Range	Lot Idn	Feet From	N/S Line	Feet From	E/W Line	County
12. Dedicated Acres 40.00		13. Joint or Infill		14. Consolidation Code		15. Order No.			

NO ALLOWABLE WILL BE ASSIGNED TO THIS COMPLETION UNTIL ALL INTERESTS HAVE BEEN CONSOLIDATED OR A NON-STANDARD UNIT HAS BEEN APPROVED BY THE DIVISION

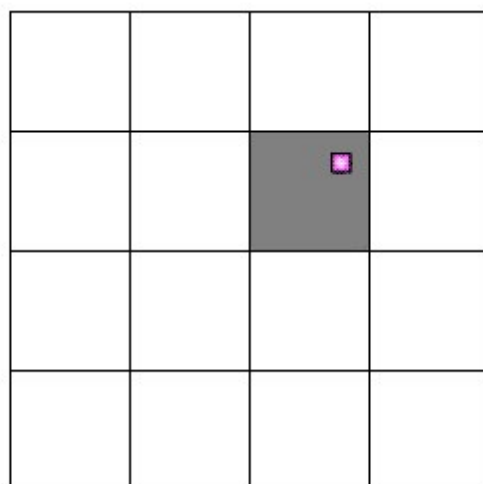

OPERATOR CERTIFICATION

I hereby certify that the information contained herein is true and complete to the best of my knowledge and belief, and that this organization either owns a working interest or unleased mineral interest in the land including the proposed bottom hole location(s) or has a right to drill this well at this location pursuant to a contract with an owner of such a mineral or working interest, or to a voluntary pooling agreement or a compulsory pooling order heretofore entered by the division.

E-Signed By: Diane Kuykendall
 Title: Regulatory Analyst
 Date: 7/29/2008

SURVEYOR CERTIFICATION

I hereby certify that the well location shown on this plat was plotted from field notes of actual surveys made by me or under my supervision, and that the same is true and correct to the best of my belief.

Surveyed By: Ronald Eidson
 Date of Survey: 7/14/2008
 Certificate Number: 3239

Permit Comments

Operator: COG OPERATING LLC , 229137

Well: KOOL AID STATE #004

API: 30-015-36481

Created By	Comment	Comment Date
PEDWARDS	H2S concentrations of wells in this area from surface to TD are low enough that a contingency plan is not required.	6/26/2008