

Submit 1 Copy To Appropriate District Office  
 District I – (575) 393-6161  
 1625 N. French Dr., Hobbs, NM 88240  
 District II – (575) 748-1283  
 811 S. First St., Artesia, NM 88210  
 District III – (505) 334-6178  
 1000 Rio Brazos Rd., Aztec, NM 87410  
 District IV – (505) 476-3460  
 1220 S. St. Francis Dr., Santa Fe, NM 87505

State of New Mexico  
 Energy, Minerals and Natural Resources

OIL CONSERVATION DIVISION  
 1220 South St. Francis Dr.  
 Santa Fe, NM 87505

Form C-103  
 Revised August 1, 2011

SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.) 1. Type of Well: Oil Well <input type="checkbox"/> Gas Well <input checked="" type="checkbox"/> Other		WELL API NO. 30-045-29158 5. Indicate Type of Lease STATE <input checked="" type="checkbox"/> FEE <input type="checkbox"/> 6. State Oil & Gas Lease No. VA-1121
2. Name of Operator Dugan Production Corp.		7. Lease Name or Unit Agreement Name Marley
3. Address of Operator P O Box 420, Farmington, NM 87499-0420 505-325-1821		8. Well Number 1
4. Well Location Unit Letter <u>N</u> : <u>1190</u> feet from the <u>South</u> line and <u>1450</u> feet from the <u>West</u> line Section <u>36</u> Township <u>23N</u> Range <u>9W</u> NMPM San Juan County		9. OGRID Number 006515
11. Elevation (Show whether DR, RKB, RT, GR, etc.) 6640' GL		10. Pool name or Wildcat Basin Fruitland Coal

12. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☒  
 TEMPORARILY ABANDON ☐ CHANGE PLANS ☐  
 PULL OR ALTER CASING ☐ MULTIPLE COMPL ☐  
 DOWNHOLE COMMINGLE ☐

OTHER: ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐ ALTERING CASING ☐  
 COMMENCE DRILLING OPNS. ☐ P AND A ☐  
 CASING/CEMENT JOB ☐

OTHER: ☐

13. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion.

Dugan Production Corp. request permission to plug & abandon the well per the following procedure:

1. RIH w/1 1/4" tubing. Tag 2-7/8" BP @ 750'. Fruitland Coal perforations @ 800'-812'. Well TA'd per procedure on sundry dated 7/31/2015.
2. Spot and circulate cement to surface from 750' w/22 sks (25.3 cu ft) Class G cement (1.15 cu ft/sk, 15.8#/gal). WOC 4 hrs. Plug I, Fruitland-Kirtland-Ojo Alamo-surface, 0-750', Inside.
3. Cut wellhead off. Tag TOC @ surface inside 2-7/8" casing and in 7" 2-7/8" annulus. Top off cement if needed and install dry hole marker.
4. Clean location and move.

Spud Date:

Rig Release Date:

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE [Signature] TITLE Engineering Supervisor DATE June 16, 2021

Type or print name Aliph Reena, PE E-mail address: aliph.reena@duganproduction.com PHONE: 505-325-1821  
**For State Use Only**

APPROVED BY: \_\_\_\_\_ TITLE \_\_\_\_\_ DATE \_\_\_\_\_  
 Conditions of Approval (if any): \_\_\_\_\_

Dugan Production Corp. request permission to Plug and Abandon the well per the following procedure.

- RIH w/ 1-1/4" tubing. Tag 2-7/8" BP @ 750'. Fruitland coal perforations @ 800'-812'. Well TA' ed per procedure on sundry dated 07/31/2015.
- Spot and circulate cement to surface from 750' w/ 22 sks (25.3 Cu.ft) Class G cement (1.15 Cu.ft/sk, 15.8 #/gal). WOC 4 hrs. Plug I, Fruitland-Kirtland-Ojo Alamo-Surface, 0-750, Inside.
- Cut wellhead off. Tag TOC @ surface inside 2-7/8" casing and in 7"-2-7/8" annulus. Top off cement if needed and install dry hole marker.
- Clean location and move.

**Current Wellbore Schematic**


Marley # 1

API: 30-045-29158

1190' FSL & 1450' FWL

Unit N, Sec 36, T23N R9W

San Juan County, NM

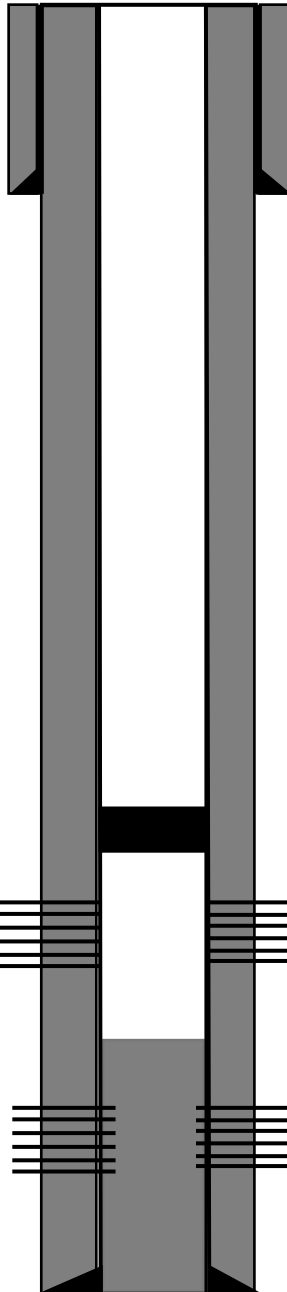

7", 26# Casing Set @ 122'.  
Cemented w/50 sks Class B.  
Circulate 2 bbl cement to surface. Hole size 9-1/8"

2-7/8" BP set @ 750'  
2-7/8" 6.5# J-55 Casing Set @ 1413' GR.  
Cemented w/70 sks 2% Lodense & 130 sks Class B neat.  
Total 296 cu ft. Circulated 1 bbl cement to surface. Hole size: 6"  
Fruitland Coal perforated from 800'-812'

Chacra plugged back to 1000'. Current PBTD @ 1000'.  
Chacra perfs @ 1178'-1270'

TD @ 1332', PBTD @ 1308'

**Planned P & A Schematic**


Marley # 1

API: 30-045-29158

1190' FSL &amp; 1450' FWL

Unit N, Sec 36, T23N R9W

San Juan County, NM

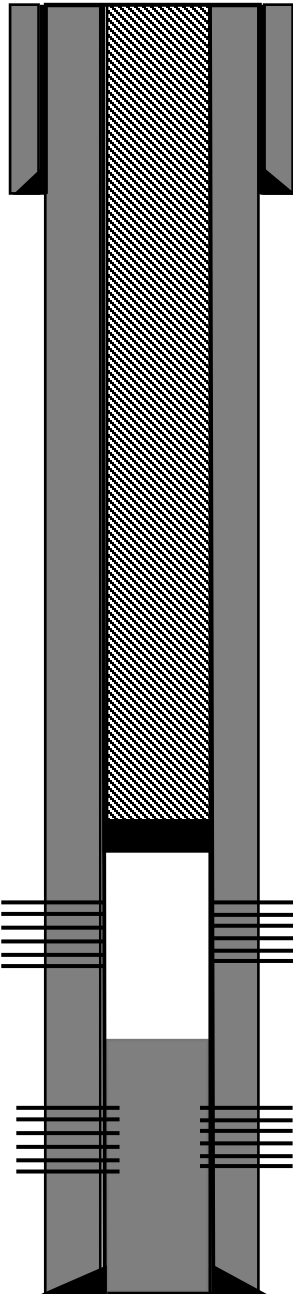

7", 26# Casing Set @ 122'.  
Cemented w/50 sks Class B.  
Circulate 2 bbl cement to surface. Hole size 9-1/8"

Spot Plug I from above BP @ 750' to surface w/22 sks Class G neat cement  
(25.3 cu ft). Fruitland-Kirtland-Ojo Alamo-Surface

2-7/8" BP set @ 750'

2-7/8" 6.5# J-55 Casing Set @ 1413' GR.  
Cemented w/70 sks 2% Lodense & 130 sks Class B neat.  
Total 296 cu ft. Circulated 1 bbl cement to surface. Hole size: 6"  
Fruitland Coal perforated from 800'-812'

Chacra plugged back to 1000'. Current PBTD @ 1000'.  
Chacra perfs @ 1178'-1270'

TD @ 1332', PBTD @ 1308'

**District I**

1625 N. French Dr., Hobbs, NM 88240  
Phone:(575) 393-6161 Fax:(575) 393-0720

**District II**

811 S. First St., Artesia, NM 88210  
Phone:(575) 748-1283 Fax:(575) 748-9720

**District III**

1000 Rio Brazos Rd., Aztec, NM 87410  
Phone:(505) 334-6178 Fax:(505) 334-6170

**District IV**

1220 S. St Francis Dr., Santa Fe, NM 87505  
Phone:(505) 476-3470 Fax:(505) 476-3462

**State of New Mexico**  
**Energy, Minerals and Natural Resources**  
**Oil Conservation Division**  
**1220 S. St Francis Dr.**  
**Santa Fe, NM 87505**

COMMENTS

Action 32279

## COMMENTS

Operator: DUGAN PRODUCTION CORP 709 E Murray Drive Farmington, NM 87499	OGRID: 6515
	Action Number: 32279
	Action Type: [C-103] NOI Plug & Abandon (C-103F)

## COMMENTS

Created By	Comment	Comment Date
kpickford	KP GEO Review 6/22/2021	6/22/2021

**District I**  
1625 N. French Dr., Hobbs, NM 88240  
Phone:(575) 393-6161 Fax:(575) 393-0720  
**District II**  
811 S. First St., Artesia, NM 88210  
Phone:(575) 748-1283 Fax:(575) 748-9720  
**District III**  
1000 Rio Brazos Rd., Aztec, NM 87410  
Phone:(505) 334-6178 Fax:(505) 334-6170  
**District IV**  
1220 S. St Francis Dr., Santa Fe, NM 87505  
Phone:(505) 476-3470 Fax:(505) 476-3462

**State of New Mexico**  
**Energy, Minerals and Natural Resources**  
**Oil Conservation Division**  
**1220 S. St Francis Dr.**  
**Santa Fe, NM 87505**

CONDITIONS  
  
Action 32279

CONDITIONS

Operator: DUGAN PRODUCTION CORP 709 E Murray Drive Farmington, NM 87499	OGRID: 6515
	Action Number: 32279
	Action Type: [C-103] NOI Plug & Abandon (C-103F)

CONDITIONS

Created By	Condition	Condition Date
kpickford	Notify NMOCD 24 Hours Prior to beginning operations	6/22/2021