
Received by OCD: 9/28/2021 9:48:1 Submit 1 Copy To Appropriate District	4 AM	lew Mes	rico		Form C-103	of.
Office District I = (575) 393-6161	State of New Mexico Energy, Minerals and Natural Resources				Revised July 18, 2013	_
1625 N. French Dr., Hobbs, NM 88240 District II – (575) 748-1283	25 N. French Dr., Hobbs, NM 88240			WELL API NO.		
811 S. First St., Artesia, NM 88210	OIL CONSERVATION DIVISION			30-015-41322 5. Indicate Type	of Lease	1
<u>District III</u> - (505) 334-6178 1000 Rio Brazos Rd., Aztec, NM 87410	1220 South S				FEE	
<u>District IV</u> – (505) 476-3460 1220 S. St. Francis Dr., Santa Fe, NM	Santa Fe,	NM 87	505	6. State Oil & Ga	is Lease No.]
87505						
SUNDRY NOT (DO NOT USE THIS FORM FOR PROPO DIFFERENT RESERVOIR. USE "APPLI PROPOSALS.)	ICES AND REPORTS ON ISALS TO DRILL OR TO DEEPE CATION FOR PERMIT" (FORM	N OR PLU	IG BACK TO A R SUCII	7. Lease Name o	r Unit Agreement Name	
	Gas Well Other			8. Well Number		1
2. Name of Operator	1.0			9. OGRID Numl	ber	1
Devon Energy Production Compar 3. Address of Operator	iy, LP			246289 10. Pool name o	r Wildcat	4
333 W. Sheridan Avenue, Oklahon	na City, OK 73102			WILDCAT; BO		
4. Well Location						\dashv
Unit Letter D :250 feet	from the _North line	and	700 feet from	n theWest	_line	
Section 16	Township 2		Range 30E	NMPM	Eddy County, NM	
	11. Elevation (Show whe 3088' KB	ther DR,	RKB, RT, GR, etc.,)		
12 Check Apr	propriate Box to Indica	te Matu	re of Notice De	nort or Other D	into	لـ
		ic ivatu		port of Other D	ala	
NOTICE OF IN		_		SEQUENT RE		_
PERFORM REMEDIAL WORK TEMPORARILY ABANDON	PLUG AND ABANDON CHANGE PLANS		REMEDIAL WOR		ALTERING CASING	_
PULL OR ALTER CASING	MULTIPLE COMPL		COMMENCE DRI CASING/CEMEN	7	P AND A	ı
DOWNHOLE COMMINGLE	MOZIN EZ OOMI Z		OASING/CEMEN	1300		
CLOSED-LOOP SYSTEM						
OTHER:			OTHER: Devon	Company Rep No	tified 9/13/21	
13. Describe proposed or comp	leted operations. (Clearly	state all p	pertinent details, an	d give pertinent da	ates, including estimated of	late
of starting any proposed we	ork). SEE RULE 19.15.7.1	4 NMAC	C. For Multiple Co	mpletions: Attach	wellbore diagram of	
proposed completion or rec 9-15-21. Move in P&A Equipment & Rig						
9-16-21. Rig up Rig. Open well with 0 ps		ad & N/U	Bop's, R/U the equin	ment Stand by on a	atwalk & pipe sacks Poleass	
packer & TOH laying down tbg. (20 jts).		,-	sop s if o tog equip	ment. Stand by on c	atwark & pipe racks, Release	;
9-17-21. Open well with 0 psi on tbg & c	asing. TOH laying down 251 j	ts & BHA.	R/U W-L. Set 5 1/2" CI	вр @ 7450'. ТОН &	R/D W-L. Load work string o	n
pipe racks & tally. TIH picking up tbg. (4)	O jts).				_	
9-20-21. Open well with 0 psi on tbg & c	asing. TIH picking up tbg. (24)	0 jts). Tag	ged top of CIBP @ 74	456'. R/U Cementing	g Unit. Circulate well around	with
SG. (160 bbl.'s). Test CIBP & Casing @ 50	10 psi. Held for 30 mins. Relea	ase psi. Pu	mp plug @ 7456'-72	200'. (25 sxs). TOH 1	0 stands. Reverse circulate.	
9-21-21. Open well with 0 psi on tbg & c standing back 10 stands. Reverse circula	te & WOC. TIH & tagged top of ce	of cemen	100 . TOH laying dov	wn 57 jts. Pump plug	រូ @ 5650'-5400'. (25 sxs). TO	H.
TOH standing back 10 stands. Reverse ci	rculate.		C 2320 . TOTTIAYIII	g down 66 jts. Pullip	J plug @ 3560 -3310 . (25 SX	۶).
9-22-21. Open well with 0 psi on tbg & o	asing. TIH & tagged top of ce	ement @ :	3300'. TOH laying do	wn 95 its. R/U W-L.	Perf @ 1150'. Pump plug @	
1150'-800'. (115 sxs). WOC & TAG. TIH 8	tagged top of cement @ 75	0'. TOH la	ying down tbg. R/U	W-L. Perf @ 140'. Pi	ump plug @ 140'-0'. (80 sxs)	. R/I
Rig & wash out rig tank.						
9-23-21. Open well with 0 psi on casing.						
9-24-21. Dig out wellhead. Cut off wellho	aad, welded on cap & above	ground m	narker.	Approved for plus	gging of well bore only. Liability under	
					pending Location cleanup & receipt of	
Spud Date:			\neg		ent Report of Well Plugging) which OCD Web Page, OCD Permitting @	
				www.emnrd.state		
Landard College College						
hereby certify that the information	above is true and complete	to the b	est of my knowled	lge and belief.		
IGNATURE 5	TITLE	Mai	nager	r	NATE 0/27/21	
				L	DATE <u>9/27/21</u>	
ype or print name Trey Smith	_ E-mail address: tr	smith@s	spnws.com PH	IONE: <u>940-372-</u> 2	836	
or State Use Only		7, ,,	741		7	
PPROVED BY: Approval (if any):	TITLE_S	the fre	Whanager	DATE10	/5/2021	
onditions of Approval (if any):						

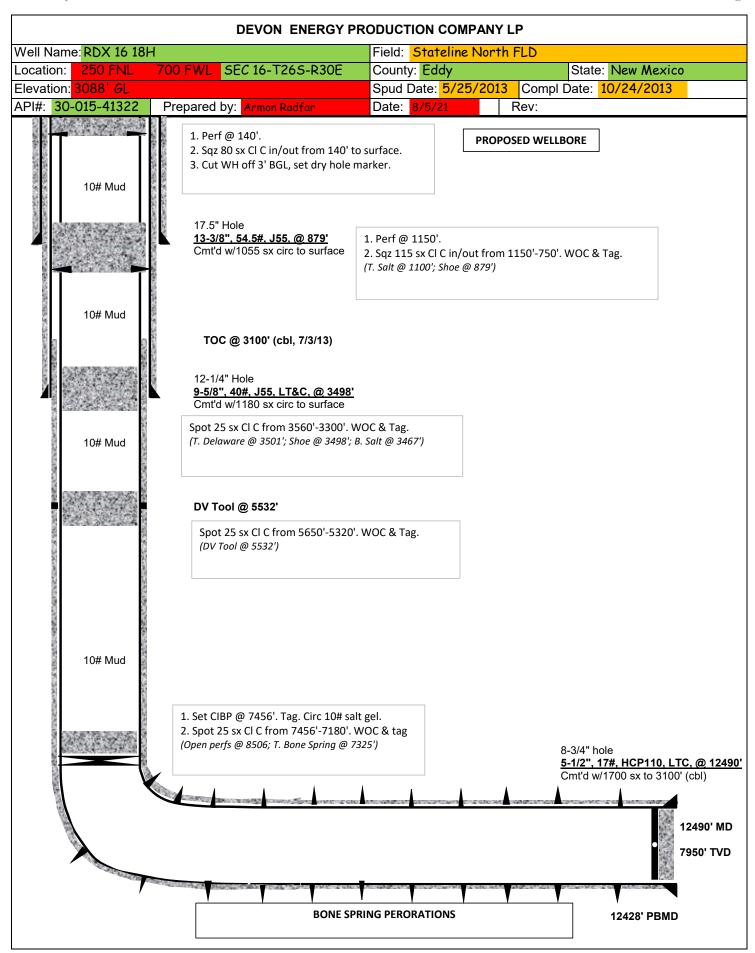

District I
1625 N. French Dr., Hobbs, NM 88240
Phone: (575) 393-6161 Fax: (575) 393-0720 District II

811 S. First St., Artesia, NM 88210 Phone: (575) 748-1283 Fax: (575) 748-9720 District III

1000 Rio Brazos Rd., Aztec, NM 87410 Phone:(505) 334-6178 Fax:(505) 334-6170

1220 S. St Francis Dr., Santa Fe, NM 87505 Phone:(505) 476-3470 Fax:(505) 476-3462

State of New Mexico Energy, Minerals and Natural Resources Oil Conservation Division 1220 S. St Francis Dr. **Santa Fe, NM 87505**

CONDITIONS

Action 52384

CONDITIONS

Operator:	OGRID:
WPX Energy Permian, LLC	246289
Devon Energy - Regulatory	Action Number:
Oklahoma City, OK 73102	52384
	Action Type:
	[C-103] Sub. Plugging (C-103P)

CONDITIONS

Created By	Condition	Condition Date
gcordero	None	10/5/2021