

Office
 District I - (575) 393-6161
 1625 N. French Dr., Hobbs, NM 88240
 District II - (575) 748-1283
 811 S. First St., Artesia, NM 88210
 District III - (505) 334-6178
 1000 Rio Brazos Rd., Aztec, NM 87410
 District IV - (505) 476-3460
 1220 S. St. Francis Dr., Santa Fe, NM
 87505

State of New Mexico
 Energy, Minerals and Natural Resources

Form C-103
 Revised July 18, 2013

OIL CONSERVATION DIVISION
 1220 South St. Francis Dr.
 Santa Fe, NM 87505

WELL API NO. 300-025-29983
5. Indicate Type of Lease STATE ☐ FEE ☒
6. State Oil & Gas Lease No. 313857
7. Lease Name or Unit Agreement Name WEST DOLLARHIDE QUEEN SAND UNIT
8. Well Number 74
9. OGRID Number 309777
10. Pool name or Wildcat DOLLARHIDE QUEEN

SUNDRY NOTICES AND REPORTS ON WELLS
 (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)

1. Type of Well: Oil Well ☒ Gas Well ☐ Other ☐

2. Name of Operator
RAM ENERGY LLC

3. Address of Operator
5100 E. SKELLY DRIVE SUITE #600, TULSA, OK 74135

4. Well Location
 Unit Letter B : 2500 feet from the E line and 1250 feet from the N line
 Section 31 Township 24S Range 38E NMPM County LEA

11. Elevation (Show whether DR, RKB, RT, GR, etc.)
3119KB

12. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:		OF:	
PERFORM REMEDIAL WORK ☐	PLUG AND ABANDON ☐	REMEDIAL WORK ☐	ALTERING CASING ☐
TEMPORARILY ABANDON ☐	CHANGE PLANS ☐	COMMENCE DRILLING OPNS. ☐	P AND A ☒
PULL OR ALTER CASING ☐	MULTIPLE COMPL ☐	CASING/CEMENT JOB ☐	PNR ☐
DOWNHOLE COMMINGLE ☐			
CLOSED-LOOP SYSTEM ☐			
OTHER: ☐		OTHER: ☐	

13. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion.

10-20-21

MOVE & SPOT BASEBEAM HOLD SFTY MTG & JSA MIRU UNIT OPEN WELL UP PU ON TBJ RELEASE PKR NU WELL CONTROL BREAK CIRC CIRC CLEAN MIX & CIRC
 WELL W/ 9.5 PPG MLF POOH W/ 50 JNTS TBJ & PKR LD PKR CWI SDON

10-21-21

HOLD SFTY MTG & JSA OPEN WELL UP CNT TO POOH W/ TBJ TOTAL OF 112 JNTS LD BHA RIH W/ WL SET CIBP TO 3472' POOH W/ WL RIH W/ WL DUMP BAIL 35' CMT
 POOH W/ WL TEST CSG TO 500# RU WL RIH W/ CIBP SET CIBP @ 2760' POOH W/ WL RU BAILER RIH W/ BAILER & CMT DUMP 35' CMT POOH W/ WL SBWOC RU CIBP

RIH W/ WL VERFIY CMT POOH & SET CIBP @ 1320' POOH W/ WL RU BAILER & CMT RIH W/ BAILER & CMT DUMP 35' CMT POOH W/ WL CWI SDON

10-22-21

HOLD SFTY MTG & JSA RIH W/ WL VERIFY CMT POOH & PERF @ 520' POOH W/ WL RU PUMP EIR (ESTABLISH INJECTION RATE) NO INJECTION RATE @ 500# RIH W/ TBJ
 TO 520' RU PUMP MIX & SPOT 60 SXS CLASS "H" CMT @ 520' TO SURF WASH UP CMT EQUIP POOH W/ TBJ RIG DOWN ALL EQUIPMENT READY TO MOVE

Spud Date:

Rig Release Date:

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE Kevin Briceland TITLE Consultant DATE 12/1/21

Type or print name Kevin Briceland E-mail address: kbriceland@ramenergy.net PHONE: 918-947-6413

For State Use Only

APPROVED BY: Kerry Fortner TITLE Compliance Officer A DATE 4/4/22

Conditions of Approval (if any)

Submit a Copy To Appropriate District
Office
District I – (575) 393-6161
1625 N. French Dr., Hobbs, NM 88240
District II – (575) 748-1283
811 S. First St., Artesia, NM 88210
District III – (505) 334-6178
1000 Rio Brazos Rd., Aztec, NM 87410
District IV – (505) 476-3460
1220 S. St. Francis Dr., Santa Fe, NM
87505

State of New Mexico
Energy, Minerals and Natural Resources

Form C-103
Revised July 18, 2013

OIL CONSERVATION DIVISION
1220 South St. Francis Dr.
Santa Fe, NM 87505

WELL API NO. 300-025-29983
5. Indicate Type of Lease STATE ☐ FEE ☒
6. State Oil & Gas Lease No. 313857
7. Lease Name or Unit Agreement Name WEST DOLLARHIDE QUEEN SAND UNIT
8. Well Number 74
9. OGRID Number 309777
10. Pool name or Wildcat DOLLARHIDE QUEEN

SUNDRY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)

1. Type of Well: Oil Well ☒ Gas Well ☐ Other ☐

2. Name of Operator
RAM ENERGY LLC

3. Address of Operator
5100 E. SKELLY DRIVE SUITE #600, TULSA, OK 74135

4. Well Location
Unit Letter B : 2500 feet from the E line and 1250 feet from the N line
Section 31 Township 24S Range 38E NMPM County LEA

11. Elevation (Show whether DR, RKB, RT, GR, etc.)
3119KB

12. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:	SUBSEQUENT REPORT OF:
PERFORM REMEDIAL WORK ☐	REMEDIAL WORK ☐
TEMPORARILY ABANDON ☐	ALTERING CASING ☒
PULL OR ALTER CASING ☐	COMMENCE DRILLING OPNS. ☐
DOWNHOLE COMMINGLE ☐	P AND A ☒
CLOSED-LOOP SYSTEM ☐	CASING/CEMENT JOB ☐
OTHER: ☐	OTHER: ☐

13. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion.

10-20-21
MOVE & SPOT BASEBEAM HOLD SFTY MTG & JSA MIRU UNIT OPEN WELL UP PU ON TBJ RELEASE PKR NU WELL CONTROL BREAK CIRC CIRC CLEAN MIX & CIRC
WELL W/ 9.5 PPG MLF POOH W/ 50 JNTS TBJ & PKR LD PKR CWI SDON

10-21-21
HOLD SFTY MTG & JSA OPEN WELL UP CNT TO POOH W/ TBJ TOTAL OF 112 JNTS LD BHA RIH W/ WL SET CIBP TO 3472' POOH W/ WL RIH W/ WL DUMP BAIL 35' CMT
POOH W/ WL TEST CSG TO 500# RU WL RIH W/ CIBP SET CIBP @ 2760' POOH W/ WL RU BAILER RIH W/ BAILER & CMT DUMP 35' CMT POOH W/ WL SBWOC RU CIBP
RIH W/ WL VERFIY CMT POOH & SET CIBP @ 1320' POOH W/ WL RU BAILER & CMT RIH W/ BAILER & CMT DUMP 35' CMT POOH W/ WL CWI SDON

10-22-21
HOLD SFTY MTG & JSA RIH W/ WL VERIFY CMT POOH & PERF @ 520' POOH W/ WL RU PUMP EIR (ESTABLISH INJECTION RATE) NO INJECTION RATE @ 500# RIH W/ TBJ
TO 520' RU PUMP MIX & SPOT 60 SXS CLASS "H" CMT @ 520' TO SURF WASH UP CMT EQUIP POOH W/ TBJ RIG DOWN ALL EQUIPMENT READY TO MOVE

Spud Date:

Rig Release Date:

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE _____ TITLE Consultant DATE 12/1/21

Type or print name Kevin Briceland E-mail address: kbriceland@ramenergy.net PHONE: 918-947-6413

For State Use Only

APPROVED BY: _____ TITLE _____ DATE _____

Conditions of Approval (if any):

WELLBORE DIAGRAM
WEST DOLLARHIDE QUEEN SAND UNIT #74
CURRENT
API: 30-025-29983

Surface Casing


Size: 8 5/8"
Wt.: 24#
Depth: 398'
Sxs Cmt: 250
Circulate: yes
TOC: surface
Hole Size: 12-1/4"

Formation Tops

T. Salt 1230'
B. Salt 2522'

Production Casing

Size: 5-1/2"
Wt.: 17#
Depth: 3866'
Sxs Cmt: 1000
Circulate: yes
TOC: surface
Hole Size: 7-7/8"

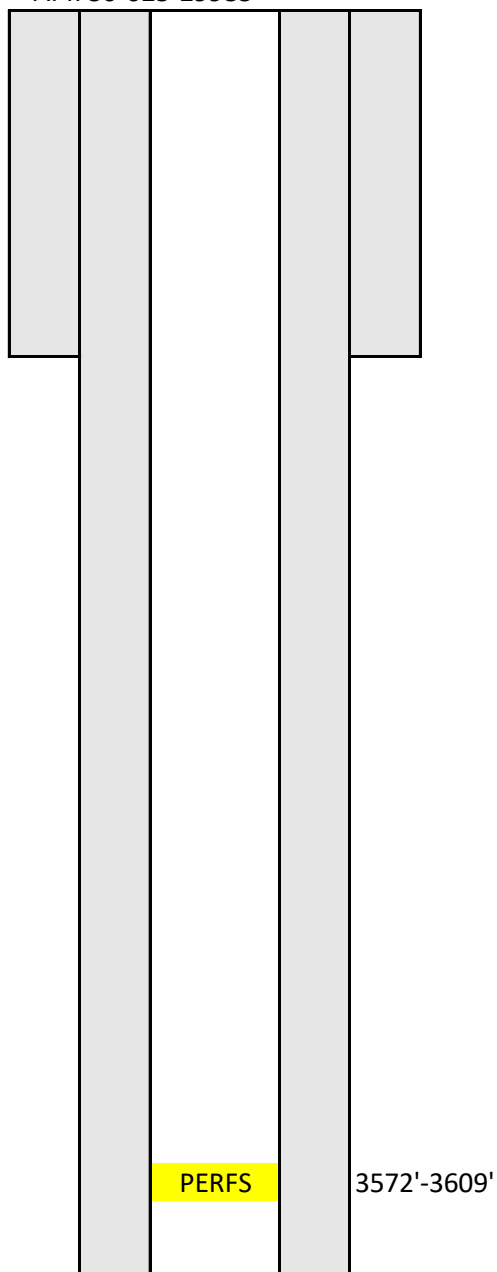

Cotton Oilfield Services
Calhoun La

DAILY ACTIVITY REPORT

RAM ENERGY LLC
WDQSU # 128
LEA COUNTY, NM
API # 30-025-30290

8-18-21

ROAD RIG & EQUIPMENT TO LOCATION SPOT RIG, BASEBEAM & CMT PUMP MIXER COMBO PACKAGE ONTO LOCATION RU PUMP & PUMP LINES HOLD SFTY MTG & JSA HAUL IN CMT UNLOAD CMT RU UNIT OPEN WELL UP ND WELL PU ON TBJ RELEASE PKR POOH W/ PKR PKR DRAGGING ALL THE WAY OUT NU WELL CONTROL POOH W/ TBJ & PKR LD PKR RIH W/ TBJ & MECHANICAL SET CIBP TO 3654' RU PUMP SET CIBP RELEASE OFF CIBP CWI SDON

8-19-21

HOLD SFTY MTG & JSA OPEN WELL UP RU PUMP SET CIBP RELEASE OFF CIBP BREAK CIRC CIRC CLEAN MIX & SPOT 25 SXS CLASS "H" CMT @ 3450'-3650' DISPLACE PLUG WASH UP CMT EQUIP POOH TO 3300' TEST CSG TO 500# MIX & CIRC WELL W/ 9.5 PPG MLF DISPLACE PLUG WASH UP CMT EQUIP POOH TO 3300' MIX & CIRC WELL W/ 9.5 PPG MLF POOH W/ TBJ MIRU WL RIH W/ CIBP SET CIBP @ 2785' POOH W/ WL RU BAILER RIH W/ BAILER & CMT DUMP 35' CMT POOH W/ WL SBWOC RU CIBP RIH W/ WL VERFIY CMT POOH & SET CIBP @ 1340' POOH W/ WL RU BAILER & CMT RIH W/ BAILER & CMT DUMP 35' CMT POOH W/ WL SBWOC RIH W/ WL VERIFY CMT POOH W/ WL CWI SDON

8-20-21

HOLD SFTY MTG & JSA RIH W/ WL PERF #@ 460' POOH W/ WL RU PUMP EIR (ESTABLISH INJECTION RATE) NO INJECTION RATE @ 700# RIH W/ TBJ TO 464' RU PUMP MIX & SPOT 55 SXS CLASS "H" CMT @ 464' TO SURF WASH UP CMT EQUIP POOH W/ TBJ RIG DOWN ALL EQUIPMENT READY TO MOVE

RAM ENERGY LLC
WDQSU # 135
LEA COUNTY, NM
API # 30-025-30295

8-20-21

MOVE & SPOT BASEBEAM HOLD SFTY MTG & JSA MIRU UNIT OPEN WELL UP ND TREE PU ON TBJ RELEASE PKR POOH W/ TBJ MIRU WL RIH W/ GAUGE RING TO 3533' POOH W/ WL RIH & SET CIBP @ 3,533' RIH W/ DUMP BAILER SPOT 35' CMT RIH W/ TBJ CIRC CLEAN TEST CSG TO 500# MIX & CIRC WELL W/ MLF POOH W/ TBJ CWI SDON

8-21-21

HOLD SFTY MTG & JSA OPEN WELL UP MIRU WL RIH W/ CIBP SET CIBP @ 2760' POOH W/ WL RU BAILER RIH W/ BAILER & CMT DUMP 35' CMT POOH W/ WL SBWOC RU CIBP RIH W/ WL VERFIY CMT POOH & SET CIBP @ 1320' POOH W/ WL RU BAILER & CMT RIH W/ BAILER & CMT DUMP 35' CMT POOH W/ WL SBWOC RIH W/ WL VERIFY CMT POOH W/ WL RIH W/ WL PERF #@ 520' POOH W/ WL RU PUMP EIR (ESTABLISH INJECTION RATE)

NO INJECTION RATE @ 550# RIH W/ TBJ TO 520' RU PUMP MIX & SPOT 60 SXS CLASS "H"
CMT @ 520' TO SURF WASH UP CMT EQUIP POOH W/ TBJ RIG DOWN ALL EQUIPMENT
READY TO MOVE

RAM ENERGY LLC
WDQSU # 106
LEA COUNTY, NM
API # 30-025-30157

8-22-21

MOVE & SPOT BASEBEAM HOLD SFTY MTG & JSA MIRU UNIT OPEN WELL UP POOH W/ TBJ
33 JNTS RIH W/TBJ & CIBP TO 3650' RU PUMP SET CIBP RELEASE OFF CIBP BREAK CIRC
CIRC CLEAN MIX & SPOT 25 SXS CLASS "H" CMT @ 3450'-3650' DISPLACE PLUG WASH UP
CMT EQUIP POOH TO 3300' TEST CSG TO 500# MIX & CIRC WELL W/ 9.5 PPG MLF
DISPLACE PLUG WASH UP CMT EQUIP POOH TO 3300' MIX & CIRC WELL W/ 9.5 PPG MLF
POOH W/ TBJ CWI SDON

8-23-21

HOLD SFTY MTG & JSA OPEN WELL UP MIRU WL RIH W/ CIBP SET CIBP @ 2785' POOH W/
WL RU BAILER RIH W/BAILER & CMT DUMP 35' CMT POOH W/ WL SBWOC RU CIBP RIH
W/ WL VERFIY CMT POOH & SET CIBP @ 1340' POOH W/ WL RU BAILER & CMT RIH W/
BAILER & CMT DUMP 35' CMT POOH W/ WL SBWOC RIH W/ WL VERIFY CMT POOH W/
WL RIH W/ WL PERF #@ 460' POOH W/ WL RU PUMP EIR (ESTABLISH INJECTION RATE)
NO INJECTION RATE @ 500# CWI SDON

8-24-21

HOLD SFTY MTG & JSA OPEN WELL UP RIH W/ TBJ TO 460' RU PUMP MIX & SPOT 55 SXS
CLASS "H" CMT @ 460' TO SURF WASH UP CMT EQUIP POOH W/ TBJ RIG DOWN ALL
EQUIPMENT READY TO MOVE

RAM ENERGY LLC
WDQSU # 129
LEA COUNTY, NM
API # 30-025-30291

8-24-21

MOVE & SPOT BASEBEAM HOLD SFTY MTG & JSA MIRU UNIT OPEN WELL UP PU ON TBJ
RELEASE PKR NU WELL CONTROL POOH W/ 132 JNTS TBJ & PKR LD PKR RIH W/TBJ & CIBP
TO 3650' RU PUMP SET CIBP RELEASE OFF CIBP CWI SDON

8-25-21

HOLD SFTY MTG & JSA OPEN WELL UP BREAK CIRC CIRC CLEAN MIX & SPOT 25 SXS CLASS
"H" CMT @ 3450'-3650' DISPLACE PLUG WASH UP CMT EQUIP POOH TO 3300' TEST CSG TO
500# MIX & CIRC WELL W/ 9.5 PPG MLF DISPLACE PLUG WASH UP CMT EQUIP POOH TO
3300' MIX & CIRC WELL W/ 9.5 PPG MLF POOH W/ TBJ MIRU WL RIH W/ CIBP SET CIBP @

2785' POOH W/ WL RU BAILER RIH W/ BAILER & CMT DUMP 35' CMT POOH W/ WL SBWOC RU CIBP RIH W/ WL VERFIY CMT POOH & SET CIBP @ 1340' POOH W/ WL RU BAILER & CMT RIH W/ BAILER & CMT DUMP 35' CMT POOH W/ WL SBWOC RIH W/ WL VERIFY CMT POOH W/ WL RIH W/ WL PERF #@ 460' POOH W/ WL RU PUMP EIR (ESTABLISH INJECTION RATE) NO INJECTION RATE @ 600# CWI SDON

8-26-21

HOLD SFTY MTG & JSA OPEN WELL UP RIH W/ TBJ TO 460' RU PUMP MIX & SPOT 55 SXS CLASS "H" CMT @ 460' TO SURF WASH UP CMT EQUIP POOH W/ TBJ RIG DOWN ALL EQUIPMENT READY TO MOVE

RAM ENERGY LLC
WDQSU # 131
LEA COUNTY, NM
API # 30-025-30293

8-26-21

MOVE & SPOT BASEBEAM HOLD SFTY MTG & JSA MIRU UNIT OPEN WELL UP PU ON TBJ RELEASE PKR NU WELL CONTROL POOH W/ 132 JNTS TBJ & PKR LD PKR RIH W/ 50 JNTS TBJ CWI SDON

8-27-21

HOLD SFTY MTG & JSA OPEN WELL UP RIH W/ WL SET CIBP TO 3580' POOH W/ WL RIH W/ WL DUMP BAIL 35' CMT POOH W/ WL RIH W/ TBJ BREAK CIRC CIRC CLEAN TEST CSG TO 500# MIX & CIRC WELL W/ 9.5 PPG MLF POOH W/ TBJ RU WL RIH W/ CIBP SET CIBP @ 2760' POOH W/ WL RU BAILER RIH W/ BAILER & CMT DUMP 35' CMT POOH W/ WL SBWOC RU CIBP RIH W/ WL VERFIY CMT POOH & SET CIBP @ 1320' POOH W/ WL RU BAILER & CMT RIH W/ BAILER & CMT DUMP 35' CMT POOH W/ WL CWI SDON

8-30-21

HOLD SFTY MTG & JSA OPEN WELL UP RIH W/ WL VERIFY CMT POOH W/ WL & PERF @ 520' POOH W/ WL RU PUMP EIR (ESTABLISH INJECTION RATE) NO INJECTION RATE @ 600# RIH W/ TBJ TO 520' RU PUMP MIX & SPOT 60 SXS CLASS "H" CMT @ 520' TO SURF WASH UP CMT EQUIP POOH W/ TBJ RIG DOWN ALL EQUIPMENT READY TO MOVE

RAM ENERGY LLC
WDQSU # 06
LEA COUNTY, NM
API # 30-025-12263

8-30-21

MOVE & SPOT BASEBEAM HOLD SFTY MTG & JSA MIRU UNIT OPEN WELL UP PU ON TBJ
RELEASE PKR NU WELL CONTROL BREAK CIRC CIRC CLEAN MIX & CIRC WELL W/ 9.5 PPG
MLF POOH W/ 132 JNTS TBJ & PKR LD PKR CWI SDON

8-31-21

HOLD SFTY MTG & JSA OPEN WELL UP RIH W/ WL SET CIBP TO 3580' POOH W/ WL RIH W/
WL DUMP BAIL 35' CMT POOH W/ WL TEST CSG TO 500# RU WL RIH W/ CIBP SET CIBP
@ 2760' POOH W/ WL RU BAILER RIH W/ BAILER & CMT DUMP 35' CMT POOH W/ WL
SBWOC RU CIBP RIH W/ WL VERFIY CMT POOH & SET CIBP @ 1320' POOH W/ WL RU
BAILER & CMT RIH W/ BAILER & CMT DUMP 35' CMT POOH W/ WL CWI SDON

9-1-21

HOLD SFTY MTG & JSA OPEN WELL UP RIH W/ WL VERIFY CMT POOH W/ WL & PERF @ 520'
POOH W/ WL RU PUMP EIR (ESTABLISH INJECTION RATE) NO INJECTION RATE @ 600# RIH
W/ TBJ TO 520' RU PUMP MIX & SPOT 50 SXS CLASS "H" CMT @ 520' TO SURF WASH UP CMT
EQUIP POOH W/ TBJ RIG DOWN ALL EQUIPMENT READY TO MOVE

RAM ENERGY LLC
WDQSU # 155
LEA COUNTY, NM
API # 30-025-30780

9-1-21

MOVE & SPOT BASEBEAM HOLD SFTY MTG & JSA MIRU UNIT OPEN WELL UP PU ON TBJ
RELEASE PKR NU WELL CONTROL BREAK CIRC CIRC CLEAN MIX & CIRC WELL W/ 9.5 PPG
MLF POOH W/ 119 JNTS TBJ & PKR LD PKR CWI SDON

9-2-21

HOLD SFTY MTG & JSA OPEN WELL UP RIH W/ WL SET CIBP TO 3600' POOH W/ WL RIH W/
WL DUMP BAIL 35' CMT POOH W/ WL TEST CSG TO 500# RU WL RIH W/ CIBP SET CIBP
@ 2760' POOH W/ WL RU BAILER RIH W/ BAILER & CMT DUMP 35' CMT POOH W/ WL
SBWOC RU CIBP RIH W/ WL VERFIY CMT POOH & SET CIBP @ 1320' POOH W/ WL RU
BAILER & CMT RIH W/ BAILER & CMT DUMP 35' CMT POOH W/ WL CWI SDON

9-3-21

HOLD SFTY MTG & JSA OPEN WELL UP RIH W/ WL VERIFY CMT POOH W/ WL & PERF @ 520'
POOH W/ WL RU PUMP EIR (ESTABLISH INJECTION RATE) NO INJECTION RATE @ 550# RIH
W/ TBJ TO 520' RU PUMP MIX & SPOT 60 SXS CLASS "H" CMT @ 520' TO SURF WASH UP CMT
EQUIP POOH W/ TBJ RIG DOWN ALL EQUIPMENT READY TO MOVE

RAM ENERGY LLC
WDQSU # 132
LEA COUNTY, NM

API # 30-025-30294

9-3-21

MOVE & SPOT BASEBEAM HOLD SFTY MTG & JSA MIRU UNIT OPEN WELL UP PU ON TBJ
RELEASE PKR NU WELL CONTROL BREAK CIRC CIRC CLEAN MIX & CIRC WELL W/ 9.5 PPG
MLF POOH W/ 122 JNTS TBJ & PKR LD PKR CWI SDON

9-7-21

HOLD SFTY MTG & JSA OPEN WELL UP RIH W/WL SET CIBP TO 3600' POOH W/ WL RIH W/
WL DUMP BAIL 35' CMT POOH W/WL TEST CSG TO 500# RU WL RIH W/ CIBP SET CIBP
@ 2760' POOH W/ WL RU BAILER RIH W/BAILER & CMT DUMP 35' CMT POOH W/ WL
SBWOC RU CIBP RIH W/ WL VERFIY CMT POOH & SET CIBP @ 1320' POOH W/ WL RU
BAILER & CMT RIH W/ BAILER & CMT DUMP 35' CMT POOH W/ WL CWI SDON

9-8-21

HOLD SFTY MTG & JSA OPEN WELL UP RIH W/WL VERIFY CMT POOH W/ WL & PERF @ 520'
POOH W/ WL RU PUMP EIR (ESTABLISH INJECTION RATE) NO INJECTION RATE @ 600# RIH
W/ TBJ TO 520' RU PUMP MIX & SPOT 60 SXS CLASS "H" CMT @ 520' TO SURF WASH UP CMT
EQUIP POOH W/ TBJ RIG DOWN ALL EQUIPMENT READY TO MOVE

**RAM ENERGY LLC
WDQSU # 103
LEA COUNTY, NM
API # 30-025-30154**

9-10-21

MOVE & SPOT BASEBEAM HOLD SFTY MTG & JSA MIRU UNIT OPEN WELL UP PU ON TBJ
RELEASE PKR NU WELL CONTROL BREAK CIRC CIRC CLEAN MIX & CIRC WELL W/ 9.5 PPG
MLF POOH W/ 122 JNTS TBJ & PKR LD PKR CWI SDON

9-11-21

HOLD SFTY MTG & JSA OPEN WELL UP RIH W/WL SET CIBP TO 3600' POOH W/ WL RIH W/
WL DUMP BAIL 35' CMT POOH W/WL TEST CSG TO 500# RU WL RIH W/ CIBP SET CIBP
@ 2760' POOH W/ WL RU BAILER RIH W/BAILER & CMT DUMP 35' CMT POOH W/ WL
SBWOC RU CIBP RIH W/ WL VERFIY CMT POOH & SET CIBP @ 1320' POOH W/ WL RU
BAILER & CMT RIH W/ BAILER & CMT DUMP 35' CMT POOH W/ WL CWI SDON

9-13-21

HOLD SFTY MTG & JSA OPEN WELL UP RIH W/WL VERIFY CMT POOH W/ WL & PERF @ 520'
POOH W/ WL RU PUMP EIR (ESTABLISH INJECTION RATE) NO INJECTION RATE @ 500# RIH
W/ TBJ TO 520' RU PUMP MIX & SPOT 60 SXS CLASS "H" CMT @ 520' TO SURF WASH UP CMT
EQUIP POOH W/ TBJ RIG DOWN ALL EQUIPMENT READY TO MOVE

RAM ENERGY LLC
WDQSU # 102
LEA COUNTY, NM
API # 30-025-30172

9-13-21

MOVE & SPOT BASEBEAM HOLD SFTY MTG & JSA MIRU UNIT OPEN WELL UP RU ROD EQUIP
PU ON RODS UN-SEAT PUMP POOH W/ 145 RODS CWI SDON

9-14-21

HOLD SFTY MTG & JSA OPEN WELL UP PU ON TBJ NU WELL CONTROL BREAK CIRC CIRC
CLEAN MIX & CIRC WELL W/ 9.5 PPG MLF POOH W/ 120 JNTS TBJ & SN RIH W/WL SET
CIBP TO 3600' POOH W/ WL RIH W/ WL DUMP BAIL 35' CMT POOH W/WL TEST CSG TO
500# RU WL RIH W/ CIBP SET CIBP @ 2760' POOH W/ WL RU BAILER RIH W/BAILER &
CMT DUMP 35' CMT POOH W/ WL SBWOC RU CIBP RIH W/ WL VERFIY CMT POOH &
SET CIBP @ 1320' POOH W/ WL RU BAILER & CMT RIH W/ BAILER & CMT DUMP 35' CMT
POOH W/ WL CWI SDON

9-15-21

HOLD SFTY MTG & JSA OPEN WELL UP RIH W/ WL VERIFY CMT POOH W/ WL & PERF @ 520'
POOH W/ WL RU PUMP EIR (ESTABLISH INJECTION RATE) NO INJECTION RATE @ 600# RIH
W/ TBJ TO 520' RU PUMP MIX & SPOT 60 SXS CLASS "H" CMT @ 520' TO SURF WASH UP CMT
EQUIP POOH W/ TBJ RIG DOWN ALL EQUIPMENT READY TO MOVE

RAM ENERGY LLC
WDQSU # 79
LEA COUNTY, NM
API # 30-025-30002

9-15-21

MOVE & SPOT BASEBEAM HOLD SFTY MTG & JSA MIRU UNIT OPEN WELL UP CWI SDON

9-16-21

HOLD SFTY MTG & JSA OPEN WELL UP PU ON TBJ NU WELL CONTROL BREAK CIRC CIRC
CLEAN MIX & CIRC WELL W/ 9.5 PPG MLF POOH W/ 116 JNTS TBJ & SN RIH W/WL SET
CIBP TO 3550' POOH W/ WL RIH W/ WL DUMP BAIL 35' CMT POOH W/WL TEST CSG TO
500# RU WL RIH W/ CIBP SET CIBP @ 2760' POOH W/ WL RU BAILER RIH W/BAILER &
CMT DUMP 35' CMT POOH W/ WL SBWOC RU CIBP RIH W/ WL VERFIY CMT POOH &
SET CIBP @ 1320' POOH W/ WL RU BAILER & CMT RIH W/ BAILER & CMT DUMP 35' CMT
POOH W/ WL CWI SDON

9-17-21

HOLD SFTY MTG & JSA OPEN WELL UP RIH W/ WL VERIFY CMT POOH W/ WL & PERF @ 520'
POOH W/ WL RU PUMP EIR (ESTABLISH INJECTION RATE) NO INJECTION RATE @ 550# RIH
W/ TBJ TO 520' RU PUMP MIX & SPOT 60 SXS CLASS "H" CMT @ 520' TO SURF WASH UP CMT
EQUIP POOH W/ TBJ RIG DOWN ALL EQUIPMENT READY TO MOVE

RAM ENERGY LLC
WDQSU # 77
LEA COUNTY, NM
API # 30-025-30000

9-20-21

MOVE & SPOT BASEBEAM HOLD SFTY MTG & JSA MIRU UNIT OPEN WELL UP PU ON RODS
RODS STUCK WORK RODS RU BACK-OFF TOOL BACK RODS OFF POOH W/ 90 RODS RD
ROD EQUIP RU FOR TBJ PU ON TBJ POOH W/ 85 JNTS TBJ CWI SDON

9-21-21

HOLD SFTY MTG & JSA OPEN WELL UP BEGIN STRIPPING RODS & TUBING SWITCHING BACK &
FORTH FROM ROD EQUIP TO TBJ EQUIP FINISH STRIPPING RODS & TBJ OUT OF THE HOLE NU
WELL CONTROL RIH W/WL SET CIBP TO 3550' POOH W/ WL RIH W/ WL DUMP BAIL 35'
CMT POOH W/WL RIH W/ TBJ BREAK CIRC TEST TBJ TO 500# CIRC WELL CLEAN CIRC
W/ MLF POOH W/ TBJ TEST CSG TO 500# POOH W/ 30 JNTS CWI SDON

9-22-21

HOLD SFTY MTG & JSA OPEN WELL UP POOH W/ REMAINING TBJ RU WL RIH W/ CIBP SET
CIBP @ 2760' POOH W/ WL RU BAILER RIH W/ BAILER & CMT DUMP 35' CMT POOH W/ WL
SBWOC RU CIBP RIH W/ WL VERFIY CMT POOH & SET CIBP @ 1320' POOH W/ WL RU
BAILER & CMT RIH W/ BAILER & CMT DUMP 35' CMT POOH W/ WL RIH W/ WL VERIFY CMT
POOH W/ WL & PERF @ 520' POOH W/ WL CWI SDON

9-23-21

HOLD SFTY MTG & JSA RU PUMP EIR (ESTABLISH INJECTION RATE) NO INJECTION RATE @
600# RIH W/ TBJ TO 520' RU PUMP MIX & SPOT 60 SXS CLASS "H" CMT @ 520' TO SURF
WASH UP CMT EQUIP POOH W/ TBJ RIG DOWN ALL EQUIPMENT READY TO MOVE

RAM ENERGY LLC
WDQSU # 153
LEA COUNTY, NM
API # 30-025-30357

9-23-21

MOVE & SPOT BASEBEAM HOLD SFTY MTG & JSA MIRU UNIT OPEN WELL UP PU ON TBJ
RELEASE PKR NU WELL CONTROL BREAK CIRC CIRC CLEAN MIX & CIRC WELL W/ 9.5 PPG
MLF POOH W/ 115 JNTS TBJ & PKR LD PKR CWI SDON

9-24-21

HOLD SFTY MTG & JSA OPEN WELL UP PU ON TBJ NU WELL CONTROL BREAK CIRC CIRC
CLEAN MIX & CIRC WELL W/ 9.5 PPG MLF POOH W/ 116 JNTS TBJ & SN RIH W/WL SET
CIBP TO 3550' POOH W/ WL RIH W/ WL DUMP BAIL 35' CMT POOH W/WL TEST CSG TO
500# RU WL RIH W/ CIBP SET CIBP @ 2760' POOH W/ WL RU BAILER RIH W/ BAILER &
CMT DUMP 35' CMT POOH W/ WL SBWOC RU CIBP RIH W/ WL VERFIY CMT POOH &

SET CIBP @ 1320' POOH W/ WL RU BAILER & CMT RIH W/ BAILER & CMT DUMP 35' CMT
POOH W/ WL CWI SDON

9-27-21

HOLD SFTY MTG & JSA OPEN WELL UP RIH W/ WL VERIFY CMT POOH W/ WL & PERF @ 520'
POOH W/ WL RU PUMP EIR (ESTABLISH INJECTION RATE) NO INJECTION RATE @ 500# RIH
W/ TBJ TO 520' RU PUMP MIX & SPOT 60 SXS CLASS "H" CMT @ 520' TO SURF WASH UP CMT
EQUIP POOH W/ TBJ RIG DOWN ALL EQUIPMENT READY TO MOVE

RAM ENERGY LLC
WDQSU # 12
LEA COUNTY, NM
API # 30-025-12271

9-27-21

MOVE & SPOT BASEBEAM HOLD SFTY MTG & JSA MIRU UNIT OPEN WELL UP PU ON TBJ
RELEASE PKR NU WELL CONTROL BREAK CIRC CIRC CLEAN MIX & CIRC WELL W/ 9.5 PPG
MLF POOH W/ 117 JNTS TBJ & PKR LD PKR CWI SDON

9-28-21

HOLD SFTY MTG & JSA OPEN WELL UP RIH W/ WL SET CIBP TO 3550' POOH W/ WL RIH W/
WL DUMP BAIL 35' CMT POOH W/ WL TEST CSG TO 500# RU WL RIH W/ CIBP SET CIBP
@ 2760' POOH W/ WL RU BAILER RIH W/ BAILER & CMT DUMP 35' CMT POOH W/ WL
SBWOC RU CIBP RIH W/ WL VERFIY CMT POOH & SET CIBP @ 1320' POOH W/ WL RU
BAILER & CMT RIH W/ BAILER & CMT DUMP 35' CMT POOH W/ WL & PERF @ 520' POOH W/
WL WASH UP CMT EQUIP CWI SDON

9-29-21

HOLD SFTY MTG & JSA RU PUMP EIR (ESTABLISH INJECTION RATE) NO INJECTION RATE @
500# RIH W/ TBJ TO 520' RU PUMP MIX & SPOT 60 SXS CLASS "H" CMT @ 520' TO SURF
WASH UP CMT EQUIP POOH W/ TBJ RIG DOWN ALL EQUIPMENT READY TO MOVE

WDQSU # 101
LEA COUNTY, NM
API # 30-025-12271

9-29-21

MOVE & SPOT BASEBEAM HOLD SFTY MTG & JSA MIRU UNIT OPEN WELL UP PU ON TBJ
RELEASE PKR NU WELL CONTROL BREAK CIRC CIRC CLEAN MIX & CIRC WELL W/ 9.5 PPG
MLF POOH W/ 115 JNTS TBJ & PKR LD PKR CWI SDON

9-30-21

HOLD SFTY MTG & JSA OPEN WELL UP RIH W/ WL SET CIBP TO 3550' POOH W/ WL RIH W/
WL DUMP BAIL 35' CMT POOH W/ WL TEST CSG TO 500# RU WL RIH W/ CIBP SET CIBP
@ 2760' POOH W/ WL RU BAILER RIH W/ BAILER & CMT DUMP 35' CMT POOH W/ WL
SBWOC RU CIBP RIH W/ WL VERFIY CMT POOH & SET CIBP @ 1320' POOH W/ WL RU
BAILER & CMT RIH W/ BAILER & CMT DUMP 35' CMT POOH W/ WL & PERF @ 520' POOH W/
WL CWI SDON

10-1-21

HOLD SFTY MTG & JSA RU PUMP EIR (ESTABLISH INJECTION RATE) NO INJECTION RATE @ 500# RIH W/ TBJ TO 520' RU PUMP MIX & SPOT 60 SXS CLASS "H" CMT @ 520' TO SURF WASH UP CMT EQUIP POOH W/ TBJ RIG DOWN ALL EQUIPMENT READY TO MOVE

WDQSU # 21
LEA COUNTY, NM
API # 30-025-12270

10-01-21

MOVE & SPOT BASEBEAM HOLD SFTY MTG & JSA MIRU UNIT OPEN WELL UP PU ON TBJ RELEASE PKR NU WELL CONTROL BREAK CIRC CIRC CLEAN MIX & CIRC WELL W/ 9.5 PPG MLF POOH W/ 122 JNTS TBJ & PKR LD PKR CWI SDON

10-02-21

HOLD SFTY MTG & JSA OPEN WELL UP RIH W/WL SET CIBP TO 3600' POOH W/ WL RIH W/ WL DUMP BAIL 35' CMT POOH W/WL TEST CSG TO 500# RU WL RIH W/ CIBP SET CIBP @ 2760' POOH W/ WL RU BAILER RIH W/BAILER & CMT DUMP 35' CMT POOH W/ WL SBWOC RU CIBP RIH W/ WL VERFIY CMT POOH & SET CIBP @ 1320' POOH W/ WL RU BAILER & CMT RIH W/ BAILER & CMT DUMP 35' CMT POOH W/ WL & PERF @ 520' POOH W/ WL RU PUMP WASH UP CMT EQUIP CWI SDON

10-04-21

HOLD SFTY MTG & JSA RU PUMP EIR (ESTABLISH INJECTION RATE) NO INJECTION RATE @ 500# RIH W/ TBJ TO 520' RU PUMP MIX & SPOT 60 SXS CLASS "H" CMT @ 520' TO SURF WASH UP CMT EQUIP POOH W/ TBJ RIG DOWN ALL EQUIPMENT READY TO MOVE

WDQSU # 08
LEA COUNTY, NM
API # 30-025-12261

10-04-21

MOVE & SPOT BASEBEAM HOLD SFTY MTG & JSA MIRU UNIT OPEN WELL UP PU ON TBJ RELEASE PKR NU WELL CONTROL BREAK CIRC CIRC CLEAN MIX & CIRC WELL W/ 9.5 PPG MLF CWI SDON

10-05-21

HOLD SFTY MTG & JSA OPEN WELL UP POOH W/ 122 JNTS TBJ RIH W/WL SET CIBP TO 3580' POOH W/ WL RIH W/ WL DUMP BAIL 35' CMT POOH W/WL TEST CSG TO 500# RU WL RIH W/ CIBP SET CIBP @ 2760' POOH W/ WL RU BAILER RIH W/BAILER & CMT DUMP 35' CMT POOH W/ WL SBWOC RU CIBP RIH W/ WL VERFIY CMT POOH & SET CIBP @ 1320' POOH W/ WL RU BAILER & CMT RIH W/ BAILER & CMT DUMP 35' CMT POOH W/ WL & PERF @ 520' POOH W/ WL CWI SDON

10-06-21

HOLD SFTY MTG & JSA RU PUMP EIR (ESTABLISH INJECTION RATE) NO INJECTION RATE @ 500# RIH W/ TBJ TO 520' RU PUMP MIX & SPOT 90 SXS CLASS "H" CMT @ 520' TO SURF WASH UP CMT EQUIP POOH W/ TBJ RIG DOWN ALL EQUIPMENT READY TO MOVE

WDQSU # 81
LEA COUNTY, NM
API # 30-025-30011

10-06-21

MOVE & SPOT BASEBEAM HOLD SFTY MTG & JSA MIRU UNIT OPEN WELL UP PU ON RODS UN-SEAT PUMP POOH LAYING DOWN 136 RODS CWI SDON

10-07-21

HOLD SFTY MTG & JSA RU FOR TBJ OPEN WELL UP RU FLOOR & TONGS WORK TO UN-SET TAC CNT TO WORK STUCK TAC WORK TAC FREE RU PUMP BREAK CIRC CIRC CLEAN CIRC WELL W/ MLF POOH W/ 112 JNTS TBJ RIH W/ WL SET CIBP TO 3600' POOH W/ WL RIH W/ WL DUMP BAIL 35' CMT POOH W/ WL TEST CSG TO 500# CWI SDON

10-08-21

HOLD SFTY MTG & JSA RU WL RIH W/ CIBP SET CIBP @ 2760' POOH W/ WL RU BAILER RIH W/ BAILER & CMT DUMP 35' CMT POOH W/ WL SBWOC RU CIBP RIH W/ WL VERFIY CMT POOH & SET CIBP @ 1320' POOH W/ WL RU BAILER & CMT RIH W/ BAILER & CMT DUMP 35' CMT POOH W/ WL & PERF @ 520' POOH W/ WL CWI SDON

10-11-21

HOLD SFTY MTG & JSA RU PUMP EIR (ESTABLISH INJECTION RATE) NO INJECTION RATE @ 500# RIH W/ TBJ TO 520' RU PUMP MIX & SPOT 60 SXS CLASS "H" CMT @ 520' TO SURF WASH UP CMT EQUIP POOH W/ TBJ RIG DOWN ALL EQUIPMENT READY TO MOVE

WDQSU # 75
LEA COUNTY, NM
API # 30-025-29984

10-11-21

MOVE & SPOT BASEBEAM HOLD SFTY MTG & JSA MIRU UNIT OPEN WELL UP PU ON RODS UN-SEAT PUMP POOH LAYING DOWN 141 RODS CWI SDON

10-12-21

HOLD SFTY MTG & JSA RU FOR TBJ OPEN WELL UP RU FLOOR & TONGS WORK TO UN-SET TAC WORK TAC FREE RU PUMP BREAK CIRC CIRC CLEAN CIRC WELL W/ MLF POOH W/ 125 JNTS TBJ RIH W/ WL SET CIBP TO 3600' POOH W/ WL RIH W/ WL DUMP BAIL 35' CMT POOH W/ WL TEST CSG TO 500# CWI SDON

10-13-21

HOLD SFTY MTG & JSA RU WL RIH W/ CIBP SET CIBP @ 2760' POOH W/ WL RU BAILER RIH W/ BAILER & CMT DUMP 35' CMT POOH W/ WL SBWOC RU CIBP RIH W/ WL VERFIY CMT POOH & SET CIBP @ 1320' POOH W/ WL RU BAILER & CMT RIH W/ BAILER & CMT DUMP 35' CMT RIH W/ WL VERIFY CMT POOH W/ WL & PERF @ 520' POOH W/ WL RU PUMP EIR (ESTABLISH INJECTION RATE) NO INJECTION RATE @ 500# RIH W/ TBJ TO 520' RU PUMP MIX & SPOT 60 SXS CLASS "H" CMT @ 520' TO SURF WASH UP CMT EQUIP POOH W/ TBJ RIG DOWN ALL EQUIPMENT READY TO MOVE

WDQSU # 152
LEA COUNTY, NM
API # 30-025-30358

10-14-21

MOVE & SPOT BASEBEAM HOLD SFTY MTG & JSA MIRU UNIT OPEN WELL UP PU ON TBJ RELEASE PKR NU WELL CONTROL BREAK CIRC CIRC CLEAN MIX & CIRC WELL W/ 9.5 PPG MLF POOH W/ 135 JNTS TBJ & PKR LD PKR CWI SDON

10-15-21

HOLD SFTY MTG & JSA OPEN WELL UP RIH W/ WL SET CIBP TO 3600' POOH W/ WL RIH W/ WL DUMP BAIL 35' CMT POOH W/ WL TEST CSG TO 500# RU WL RIH W/ CIBP SET CIBP @ 2760' POOH W/ WL RU BAILER RIH W/ BAILER & CMT DUMP 35' CMT POOH W/ WL SBWOC RU CIBP RIH W/ WL VERFIY CMT POOH & SET CIBP @ 1320' POOH W/ WL RU BAILER & CMT RIH W/ BAILER & CMT DUMP 35' CMT RIH W/ WL VERIFY CMT POOH W/ WL & PERF @ 520' POOH W/ WL CWI SDON

10-18-21

HOLD SFTY MTG & JSA RU PUMP EIR (ESTABLISH INJECTION RATE) NO INJECTION RATE @ 500# RIH W/ TBJ TO 520' RU PUMP MIX & SPOT 60 SXS CLASS "H" CMT @ 520' TO SURF WASH UP CMT EQUIP POOH W/ TBJ RIG DOWN ALL EQUIPMENT READY TO MOVE

WDQSU # 18
LEA COUNTY, NM
API # 30-025-12257

10-18-21

MOVE & SPOT BASEBEAM HOLD SFTY MTG & JSA MIRU UNIT OPEN WELL UP PU ON TBJ RELEASE PKR NU WELL CONTROL BREAK CIRC CIRC CLEAN MIX & CIRC WELL W/ 9.5 PPG MLF POOH W/ 118 JNTS TBJ & PKR LD PKR CWI SDON

10-19-21

HOLD SFTY MTG & JSA OPEN WELL UP RIH W/ WL SET CIBP TO 3520' POOH W/ WL RIH W/ WL DUMP BAIL 35' CMT POOH W/ WL TEST CSG TO 500# RU WL RIH W/ CIBP SET CIBP

@ 2760' POOH W/ WL RU BAILER RIH W/ BAILER & CMT DUMP 35' CMT POOH W/ WL SBWOC RU CIBP RIH W/ WL VERFIY CMT POOH & SET CIBP @ 1320' POOH W/ WL RU BAILER & CMT RIH W/ BAILER & CMT DUMP 35' CMT RIH W/ WL VERIFY CMT POOH W/ WL & PERF @ 520' POOH W/ WL CWI SDON

10-20-21

HOLD SFTY MTG & JSA RU PUMP EIR (ESTABLISH INJECTION RATE) NO INJECTION RATE @ 500# RIH W/ TBJ TO 520' RU PUMP MIX & SPOT 43 SXS CLASS "H" CMT @ 520' TO SURF WASH UP CMT EQUIP POOH W/ TBJ RIG DOWN ALL EQUIPMENT READY TO MOVE

WDQSU # 74
LEA COUNTY, NM
API # 30-025-29983

10-20-21

MOVE & SPOT BASEBEAM HOLD SFTY MTG & JSA MIRU UNIT OPEN WELL UP PU ON TBJ RELEASE PKR NU WELL CONTROL BREAK CIRC CIRC CLEAN MIX & CIRC WELL W/ 9.5 PPG MLF POOH W/ 50 JNTS TBJ & PKR LD PKR CWI SDON

10-21-21

HOLD SFTY MTG & JSA OPEN WELL UP CNT TO POOH W/ TBJ TOTAL OF 112 JNTS LD BHA RIH W/ WL SET CIBP TO 3472' POOH W/ WL RIH W/ WL DUMP BAIL 35' CMT POOH W/ WL TEST CSG TO 500# RU WL RIH W/ CIBP SET CIBP @ 2760' POOH W/ WL RU BAILER RIH W/ BAILER & CMT DUMP 35' CMT POOH W/ WL SBWOC RU CIBP RIH W/ WL VERFIY CMT POOH & SET CIBP @ 1320' POOH W/ WL RU BAILER & CMT RIH W/ BAILER & CMT DUMP 35' CMT POOH W/ WL CWI SDON

10-22-21

HOLD SFTY MTG & JSA RIH W/ WL VERIFY CMT POOH & PERF @ 520' POOH W/ WL RU PUMP EIR (ESTABLISH INJECTION RATE) NO INJECTION RATE @ 500# RIH W/ TBJ TO 520' RU PUMP MIX & SPOT 60 SXS CLASS "H" CMT @ 520' TO SURF WASH UP CMT EQUIP POOH W/ TBJ RIG DOWN ALL EQUIPMENT READY TO MOVE

WDQSU # 113
LEA COUNTY, NM
API # 30-025-30231

10-27-2021

MOVE & SPOT BASEBEAM HOLD SFTY MTG & JSA MIRU UNIT OPEN WELL UP PU ON TBJ RELEASE PKR NU WELL CONTROL BREAK CIRC CIRC CLEAN MIX & CIRC WELL W/ 9.5 PPG MLF POOH W/ 115 JNTS TBJ & PKR LD PKR CWI SDON

11-1-2021

HOLD SFTY MTG & JSA OPEN WELL UP CNT TO POOH W/ TBJ TOTAL OF 112 JNTS LD BHA RIH W/WL SET CIBP TO 3472' POOH W/ WL RIH W/ WL DUMP BAIL 35' CMT POOH W/WL TEST CSG TO 500# RU WL RIH W/ CIBP SET CIBP @ 2760' POOH W/ WL RU BAILER RIH W/ BAILER & CMT DUMP 35' CMT POOH W/ WL SBWOC RU CIBP RIH W/ WL VERFIY CMT POOH & SET CIBP @ 1320' POOH W/ WL RU BAILER & CMT RIH W/ BAILER & CMT DUMP 35' CMT POOH W/ WL CWI SDON

WDQSU # 24
LEA COUNTY, NM
API # 30-025-12276

11-4-21

HOLD SFTY MTG & JSA RIH W/ WL VERIFY CMT POOH & PERF @ 520' POOH W/ WL RU PUMP EIR (ESTABLISH INJECTION RATE) NO INJECTION RATE @ 500# RIH W/ TBJ TO 520' RU PUMP MIX & SPOT 60 SXS CLASS "H" CMT @ 520' TO SURF WASH UP CMT EQUIP POOH W/ TBJ RIG DOWN ALL EQUIPMENT READY TO MOVE

MOVE & SPOT BASEBEAM HOLD SFTY MTG & JSA MIRU UNIT OPEN WELL UP PU ON TBJ RELEASE PKR NU WELL CONTROL BREAK CIRC CIRC CLEAN MIX & CIRC WELL W/ 9.5 PPG MLF POOH W/ 122 JNTS TBJ & PKR LD PKR CWI SDON

11-6-21

HOLD SFTY MTG & JSA OPEN WELL UP RIH W/ WL SET CIBP TO 3600' POOH W/ WL RIH W/ WL DUMP BAIL 35' CMT POOH W/ WL TEST CSG TO 500# RU WL RIH W/ CIBP SET CIBP @ 2760' POOH W/ WL RU BAILER RIH W/ BAILER & CMT DUMP 35' CMT POOH W/ WL SBWOC RU CIBP RIH W/ WL VERFIY CMT POOH & SET CIBP @ 1320' POOH W/ WL RU BAILER & CMT RIH W/ BAILER & CMT DUMP 35' CMT POOH W/ WL & PERF @ 520' POOH W/ WL RU PUMP WASH UP CMT EQUIP CWI SDON

11-8-21

HOLD SFTY MTG & JSA RU PUMP EIR (ESTABLISH INJECTION RATE) NO INJECTION RATE @ 500# RIH W/ TBJ TO 520' RU PUMP MIX & SPOT 60 SXS CLASS "H" CMT @ 520' TO SURF WASH UP CMT EQUIP POOH W/ TBJ RIG DOWN ALL EQUIPMENT READY TO MOVE

RAM ENERGY LLC
WDQSU # 001
LEA COUNTY, NM
API # 30-025-12212

5-11-21

HAUL IN & SPOT BASE BEAM HOLD SFTY MTG & JSA MI RIG SPOT RIG OVER BEAM MOVE IN CMT EQUIPMENT RU RIG RU CMT EQUIP. SDON

5-12-21

HOLD SFTY MTG & JSA SERVICE UNIT & PUMP OPEN WELL UP ND HEAD PU ON TBJ RELEASE
PKR POOH W/ TBJ & PKR LD BHA PU MU MECHANICL SET CIBP RIH W/ TBJ & CIBP SET
CIBP @ 3650' RELEASE OFF CIBP BREAK CIRC CIRC WELL CLEAN MIX & SPOT 25 SXS
CLASS "C" CMT @ 3450'-3650' DISPLACE PLUG WASH UP CMT EQUIP POOH TO 3300' MIX &
CIRC WELL W/ MLF POOH W/ 30 JNTS CWI SDON

5-13-21

HOLD SFTY MTG & JSA SERVICE UNIT & PUMP OPEN WELL UP LAY DOWN REMAINING TBJ
MIRU WL RIH W/ WL SET CIBP @ 2785' POOH W/ WL RU BAILER RIH W/ BAILER DUMP 35'
CMT POOH W/ WL SBWOC RIH W/ WL VERIFY PLUG POOH W/ WL SETTING CIBP @ 1340'
POOH W/ WL RU BAILER RIH W/ BAILER DUMP 35' CMT POOH W/ WL SBWOC RIH W/
WL VERIFY PLUG POOH W/ WL PERF @ 460' POOH W// WL RIH W/ TBJ TO 460' RU
PUMP ESTABLISH INJTION RATE (EIR) NO INJ RATE @ 600# CWI SDON

5-14-21

HOLD SFTY MTG & JSA SERVICE UNIT & PUMP OPEN WELL UP RU CMT EQUIP BREAK CIRC
MIX & SPOT 55 SXS CLASS "C" CMT @ 460'- SURFACE DISPLACE PLUG WASH UP CMT EQUIP
POOH W/ TBJ RD UNIT & CMT EQUIP MOVE OFF LOCATION

Cotton Oilfield Services
Calhoun La

DAILY ACTIVITY REPORT

*RAM ENERGY LLC
WDQSU # 128
LEA COUNTY, NM
API # 30-025-30290*

8-18-21

ROAD RIG & EQUIPMENT TO LOCATION SPOT RIG, BASEBEAM & CMT PUMP MIXER COMBO PACKAGE ONTO LOCATION RU PUMP & PUMP LINES HOLD SFTY MTG & JSA HAUL IN CMT UNLOAD CMT RU UNIT OPEN WELL UP ND WELL PU ON TBJ RELEASE PKR POOH W/ PKR PKR DRAGGING ALL THE WAY OUT NU WELL CONTROL POOH W/ TBJ & PKR LD PKR RIH W/ TBJ & MECHANICAL SET CIBP TO 3654' RU PUMP SET CIBP RELEASE OFF CIBP CWI SDON

8-19-21

HOLD SFTY MTG & JSA OPEN WELL UP RU PUMP SET CIBP RELEASE OFF CIBP BREAK CIRC CIRC CLEAN MIX & SPOT 25 SXS CLASS "H" CMT @ 3450'-3650' DISPLACE PLUG WASH UP CMT EQUIP POOH TO 3300' TEST CSG TO 500# MIX & CIRC WELL W/ 9.5 PPG MLF DISPLACE PLUG WASH UP CMT EQUIP POOH TO 3300' MIX & CIRC WELL W/ 9.5 PPG MLF POOH W/ TBJ MIRU WL RIH W/ CIBP SET CIBP @ 2785' POOH W/ WL RU BAILER RIH W/ BAILER & CMT DUMP 35' CMT POOH W/ WL SBWOC RU CIBP RIH W/ WL VERFIY CMT POOH & SET CIBP @ 1340' POOH W/ WL RU BAILER & CMT RIH W/ BAILER & CMT DUMP 35' CMT POOH W/ WL SBWOC RIH W/ WL VERIFY CMT POOH W/ WL CWI SDON

8-20-21

HOLD SFTY MTG & JSA RIH W/ WL PERF #@ 460' POOH W/ WL RU PUMP EIR (ESTABLISH INJECTION RATE) NO INJECTION RATE @ 700# RIH W/ TBJ TO 464' RU PUMP MIX & SPOT 55 SXS CLASS "H" CMT @ 464' TO SURF WASH UP CMT EQUIP POOH W/ TBJ RIG DOWN ALL EQUIPMENT READY TO MOVE

*RAM ENERGY LLC
WDQSU # 135
LEA COUNTY, NM
API # 30-025-30295*

8-20-21

MOVE & SPOT BASEBEAM HOLD SFTY MTG & JSA MIRU UNIT OPEN WELL UP ND TREE PU ON TBJ RELEASE PKR POOH W/ TBJ MIRU WL RIH W/ GAUGE RING TO 3533' POOH W/ WL RIH & SET CIBP @ 3,533' RIH W/ DUMP BAILER SPOT 35' CMT RIH W/ TBJ CIRC CLEAN TEST CSG TO 500# MIX & CIRC WELL W/ MLF POOH W/ TBJ CWI SDON

8-21-21

HOLD SFTY MTG & JSA OPEN WELL UP MIRU WL RIH W/ CIBP SET CIBP @ 2760' POOH W/ WL RU BAILER RIH W/ BAILER & CMT DUMP 35' CMT POOH W/ WL SBWOC RU CIBP RIH W/ WL VERFIY CMT POOH & SET CIBP @ 1320' POOH W/ WL RU BAILER & CMT RIH W/ BAILER & CMT DUMP 35' CMT POOH W/ WL SBWOC RIH W/ WL VERIFY CMT POOH W/ WL RIH W/ WL PERF #@ 520' POOH W/ WL RU PUMP EIR (ESTABLISH INJECTION RATE)

NO INJECTION RATE @ 550# RIH W/ TBJ TO 520' RU PUMP MIX & SPOT 60 SXS CLASS "H"
CMT @ 520' TO SURF WASH UP CMT EQUIP POOH W/ TBJ RIG DOWN ALL EQUIPMENT
READY TO MOVE

RAM ENERGY LLC
WDQSU # 106
LEA COUNTY, NM
API # 30-025-30157

8-22-21

MOVE & SPOT BASEBEAM HOLD SFTY MTG & JSA MIRU UNIT OPEN WELL UP POOH W/ TBJ
33 JNTS RIH W/TBJ & CIBP TO 3650' RU PUMP SET CIBP RELEASE OFF CIBP BREAK CIRC
CIRC CLEAN MIX & SPOT 25 SXS CLASS "H" CMT @ 3450'-3650' DISPLACE PLUG WASH UP
CMT EQUIP POOH TO 3300' TEST CSG TO 500# MIX & CIRC WELL W/ 9.5 PPG MLF
DISPLACE PLUG WASH UP CMT EQUIP POOH TO 3300' MIX & CIRC WELL W/ 9.5 PPG MLF
POOH W/ TBJ CWI SDON

8-23-21

HOLD SFTY MTG & JSA OPEN WELL UP MIRU WL RIH W/ CIBP SET CIBP @ 2785' POOH W/
WL RU BAILER RIH W/BAILER & CMT DUMP 35' CMT POOH W/ WL SBWOC RU CIBP RIH
W/ WL VERFIY CMT POOH & SET CIBP @ 1340' POOH W/ WL RU BAILER & CMT RIH W/
BAILER & CMT DUMP 35' CMT POOH W/ WL SBWOC RIH W/ WL VERIFY CMT POOH W/
WL RIH W/ WL PERF #@ 460' POOH W/ WL RU PUMP EIR (ESTABLISH INJECTION RATE)
NO INJECTION RATE @ 500# CWI SDON

8-24-21

HOLD SFTY MTG & JSA OPEN WELL UP RIH W/ TBJ TO 460' RU PUMP MIX & SPOT 55 SXS
CLASS "H" CMT @ 460' TO SURF WASH UP CMT EQUIP POOH W/ TBJ RIG DOWN ALL
EQUIPMENT READY TO MOVE

RAM ENERGY LLC
WDQSU # 129
LEA COUNTY, NM
API # 30-025-30291

8-24-21

MOVE & SPOT BASEBEAM HOLD SFTY MTG & JSA MIRU UNIT OPEN WELL UP PU ON TBJ
RELEASE PKR NU WELL CONTROL POOH W/ 132 JNTS TBJ & PKR LD PKR RIH W/TBJ & CIBP
TO 3650' RU PUMP SET CIBP RELEASE OFF CIBP CWI SDON

8-25-21

HOLD SFTY MTG & JSA OPEN WELL UP BREAK CIRC CIRC CLEAN MIX & SPOT 25 SXS CLASS
"H" CMT @ 3450'-3650' DISPLACE PLUG WASH UP CMT EQUIP POOH TO 3300' TEST CSG TO
500# MIX & CIRC WELL W/ 9.5 PPG MLF DISPLACE PLUG WASH UP CMT EQUIP POOH TO
3300' MIX & CIRC WELL W/ 9.5 PPG MLF POOH W/ TBJ MIRU WL RIH W/ CIBP SET CIBP @

2785' POOH W/ WL RU BAILER RIH W/ BAILER & CMT DUMP 35' CMT POOH W/ WL SBWOC RU CIBP RIH W/ WL VERFIY CMT POOH & SET CIBP @ 1340' POOH W/ WL RU BAILER & CMT RIH W/ BAILER & CMT DUMP 35' CMT POOH W/ WL SBWOC RIH W/ WL VERIFY CMT POOH W/ WL RIH W/ WL PERF #@ 460' POOH W/ WL RU PUMP EIR (ESTABLISH INJECTION RATE) NO INJECTION RATE @ 600# CWI SDON

8-26-21

HOLD SFTY MTG & JSA OPEN WELL UP RIH W/ TBJ TO 460' RU PUMP MIX & SPOT 55 SXS CLASS "H" CMT @ 460' TO SURF WASH UP CMT EQUIP POOH W/ TBJ RIG DOWN ALL EQUIPMENT READY TO MOVE

RAM ENERGY LLC
WDQSU # 131
LEA COUNTY, NM
API # 30-025-30293

8-26-21

MOVE & SPOT BASEBEAM HOLD SFTY MTG & JSA MIRU UNIT OPEN WELL UP PU ON TBJ RELEASE PKR NU WELL CONTROL POOH W/ 132 JNTS TBJ & PKR LD PKR RIH W/ 50 JNTS TBJ CWI SDON

8-27-21

HOLD SFTY MTG & JSA OPEN WELL UP RIH W/ WL SET CIBP TO 3580' POOH W/ WL RIH W/ WL DUMP BAIL 35' CMT POOH W/ WL RIH W/ TBJ BREAK CIRC CIRC CLEAN TEST CSG TO 500# MIX & CIRC WELL W/ 9.5 PPG MLF POOH W/ TBJ RU WL RIH W/ CIBP SET CIBP @ 2760' POOH W/ WL RU BAILER RIH W/ BAILER & CMT DUMP 35' CMT POOH W/ WL SBWOC RU CIBP RIH W/ WL VERFIY CMT POOH & SET CIBP @ 1320' POOH W/ WL RU BAILER & CMT RIH W/ BAILER & CMT DUMP 35' CMT POOH W/ WL CWI SDON

8-30-21

HOLD SFTY MTG & JSA OPEN WELL UP RIH W/ WL VERIFY CMT POOH W/ WL & PERF @ 520' POOH W/ WL RU PUMP EIR (ESTABLISH INJECTION RATE) NO INJECTION RATE @ 600# RIH W/ TBJ TO 520' RU PUMP MIX & SPOT 60 SXS CLASS "H" CMT @ 520' TO SURF WASH UP CMT EQUIP POOH W/ TBJ RIG DOWN ALL EQUIPMENT READY TO MOVE

RAM ENERGY LLC
WDQSU # 06
LEA COUNTY, NM
API # 30-025-12263

8-30-21

MOVE & SPOT BASEBEAM HOLD SFTY MTG & JSA MIRU UNIT OPEN WELL UP PU ON TBJ
RELEASE PKR NU WELL CONTROL BREAK CIRC CIRC CLEAN MIX & CIRC WELL W/ 9.5 PPG
MLF POOH W/ 132 JNTS TBJ & PKR LD PKR CWI SDON

8-31-21

HOLD SFTY MTG & JSA OPEN WELL UP RIH W/ WL SET CIBP TO 3580' POOH W/ WL RIH W/
WL DUMP BAIL 35' CMT POOH W/ WL TEST CSG TO 500# RU WL RIH W/ CIBP SET CIBP
@ 2760' POOH W/ WL RU BAILER RIH W/ BAILER & CMT DUMP 35' CMT POOH W/ WL
SBWOC RU CIBP RIH W/ WL VERFIY CMT POOH & SET CIBP @ 1320' POOH W/ WL RU
BAILER & CMT RIH W/ BAILER & CMT DUMP 35' CMT POOH W/ WL CWI SDON

9-1-21

HOLD SFTY MTG & JSA OPEN WELL UP RIH W/ WL VERIFY CMT POOH W/ WL & PERF @ 520'
POOH W/ WL RU PUMP EIR (ESTABLISH INJECTION RATE) NO INJECTION RATE @ 600# RIH
W/ TBJ TO 520' RU PUMP MIX & SPOT 50 SXS CLASS "H" CMT @ 520' TO SURF WASH UP CMT
EQUIP POOH W/ TBJ RIG DOWN ALL EQUIPMENT READY TO MOVE

RAM ENERGY LLC
WDQSU # 155
LEA COUNTY, NM
API # 30-025-30780

9-1-21

MOVE & SPOT BASEBEAM HOLD SFTY MTG & JSA MIRU UNIT OPEN WELL UP PU ON TBJ
RELEASE PKR NU WELL CONTROL BREAK CIRC CIRC CLEAN MIX & CIRC WELL W/ 9.5 PPG
MLF POOH W/ 119 JNTS TBJ & PKR LD PKR CWI SDON

9-2-21

HOLD SFTY MTG & JSA OPEN WELL UP RIH W/ WL SET CIBP TO 3600' POOH W/ WL RIH W/
WL DUMP BAIL 35' CMT POOH W/ WL TEST CSG TO 500# RU WL RIH W/ CIBP SET CIBP
@ 2760' POOH W/ WL RU BAILER RIH W/ BAILER & CMT DUMP 35' CMT POOH W/ WL
SBWOC RU CIBP RIH W/ WL VERFIY CMT POOH & SET CIBP @ 1320' POOH W/ WL RU
BAILER & CMT RIH W/ BAILER & CMT DUMP 35' CMT POOH W/ WL CWI SDON

9-3-21

HOLD SFTY MTG & JSA OPEN WELL UP RIH W/ WL VERIFY CMT POOH W/ WL & PERF @ 520'
POOH W/ WL RU PUMP EIR (ESTABLISH INJECTION RATE) NO INJECTION RATE @ 550# RIH
W/ TBJ TO 520' RU PUMP MIX & SPOT 60 SXS CLASS "H" CMT @ 520' TO SURF WASH UP CMT
EQUIP POOH W/ TBJ RIG DOWN ALL EQUIPMENT READY TO MOVE

RAM ENERGY LLC
WDQSU # 132
LEA COUNTY, NM

API # 30-025-30294

9-3-21

MOVE & SPOT BASEBEAM HOLD SFTY MTG & JSA MIRU UNIT OPEN WELL UP PU ON TBJ
RELEASE PKR NU WELL CONTROL BREAK CIRC CIRC CLEAN MIX & CIRC WELL W/ 9.5 PPG
MLF POOH W/ 122 JNTS TBJ & PKR LD PKR CWI SDON

9-7-21

HOLD SFTY MTG & JSA OPEN WELL UP RIH W/WL SET CIBP TO 3600' POOH W/WL RIH W/
WL DUMP BAIL 35' CMT POOH W/WL TEST CSG TO 500# RU WL RIH W/ CIBP SET CIBP
@ 2760' POOH W/WL RU BAILER RIH W/BAILER & CMT DUMP 35' CMT POOH W/WL
SBWOC RU CIBP RIH W/WL VERFIY CMT POOH & SET CIBP @ 1320' POOH W/WL RU
BAILER & CMT RIH W/ BAILER & CMT DUMP 35' CMT POOH W/WL CWI SDON

9-8-21

HOLD SFTY MTG & JSA OPEN WELL UP RIH W/WL VERIFY CMT POOH W/WL & PERF @ 520'
POOH W/WL RU PUMP EIR (ESTABLISH INJECTION RATE) NO INJECTION RATE @ 600# RIH
W/ TBJ TO 520' RU PUMP MIX & SPOT 60 SXS CLASS "H" CMT @ 520' TO SURF WASH UP CMT
EQUIP POOH W/ TBJ RIG DOWN ALL EQUIPMENT READY TO MOVE

**RAM ENERGY LLC
WDQSU # 103
LEA COUNTY, NM
API # 30-025-30154**

9-10-21

MOVE & SPOT BASEBEAM HOLD SFTY MTG & JSA MIRU UNIT OPEN WELL UP PU ON TBJ
RELEASE PKR NU WELL CONTROL BREAK CIRC CIRC CLEAN MIX & CIRC WELL W/ 9.5 PPG
MLF POOH W/ 122 JNTS TBJ & PKR LD PKR CWI SDON

9-11-21

HOLD SFTY MTG & JSA OPEN WELL UP RIH W/WL SET CIBP TO 3600' POOH W/WL RIH W/
WL DUMP BAIL 35' CMT POOH W/WL TEST CSG TO 500# RU WL RIH W/ CIBP SET CIBP
@ 2760' POOH W/WL RU BAILER RIH W/BAILER & CMT DUMP 35' CMT POOH W/WL
SBWOC RU CIBP RIH W/WL VERFIY CMT POOH & SET CIBP @ 1320' POOH W/WL RU
BAILER & CMT RIH W/ BAILER & CMT DUMP 35' CMT POOH W/WL CWI SDON

9-13-21

HOLD SFTY MTG & JSA OPEN WELL UP RIH W/WL VERIFY CMT POOH W/WL & PERF @ 520'
POOH W/WL RU PUMP EIR (ESTABLISH INJECTION RATE) NO INJECTION RATE @ 500# RIH
W/ TBJ TO 520' RU PUMP MIX & SPOT 60 SXS CLASS "H" CMT @ 520' TO SURF WASH UP CMT
EQUIP POOH W/ TBJ RIG DOWN ALL EQUIPMENT READY TO MOVE

RAM ENERGY LLC
WDQSU # 102
LEA COUNTY, NM
API # 30-025-30172

9-13-21

MOVE & SPOT BASEBEAM HOLD SFTY MTG & JSA MIRU UNIT OPEN WELL UP RU ROD EQUIP
PU ON RODS UN-SEAT PUMP POOH W/ 145 RODS CWI SDON

9-14-21

HOLD SFTY MTG & JSA OPEN WELL UP PU ON TBJ NU WELL CONTROL BREAK CIRC CIRC
CLEAN MIX & CIRC WELL W/ 9.5 PPG MLF POOH W/ 120 JNTS TBJ & SN RIH W/WL SET
CIBP TO 3600' POOH W/ WL RIH W/ WL DUMP BAIL 35' CMT POOH W/WL TEST CSG TO
500# RU WL RIH W/ CIBP SET CIBP @ 2760' POOH W/ WL RU BAILER RIH W/BAILER &
CMT DUMP 35' CMT POOH W/ WL SBWOC RU CIBP RIH W/ WL VERFIY CMT POOH &
SET CIBP @ 1320' POOH W/ WL RU BAILER & CMT RIH W/ BAILER & CMT DUMP 35' CMT
POOH W/ WL CWI SDON

9-15-21

HOLD SFTY MTG & JSA OPEN WELL UP RIH W/ WL VERIFY CMT POOH W/ WL & PERF @ 520'
POOH W/ WL RU PUMP EIR (ESTABLISH INJECTION RATE) NO INJECTION RATE @ 600# RIH
W/ TBJ TO 520' RU PUMP MIX & SPOT 60 SXS CLASS "H" CMT @ 520' TO SURF WASH UP CMT
EQUIP POOH W/ TBJ RIG DOWN ALL EQUIPMENT READY TO MOVE

RAM ENERGY LLC
WDQSU # 79
LEA COUNTY, NM
API # 30-025-30002

9-15-21

MOVE & SPOT BASEBEAM HOLD SFTY MTG & JSA MIRU UNIT OPEN WELL UP CWI SDON

9-16-21

HOLD SFTY MTG & JSA OPEN WELL UP PU ON TBJ NU WELL CONTROL BREAK CIRC CIRC
CLEAN MIX & CIRC WELL W/ 9.5 PPG MLF POOH W/ 116 JNTS TBJ & SN RIH W/WL SET
CIBP TO 3550' POOH W/ WL RIH W/ WL DUMP BAIL 35' CMT POOH W/WL TEST CSG TO
500# RU WL RIH W/ CIBP SET CIBP @ 2760' POOH W/ WL RU BAILER RIH W/BAILER &
CMT DUMP 35' CMT POOH W/ WL SBWOC RU CIBP RIH W/ WL VERFIY CMT POOH &
SET CIBP @ 1320' POOH W/ WL RU BAILER & CMT RIH W/ BAILER & CMT DUMP 35' CMT
POOH W/ WL CWI SDON

9-17-21

HOLD SFTY MTG & JSA OPEN WELL UP RIH W/ WL VERIFY CMT POOH W/ WL & PERF @ 520'
POOH W/ WL RU PUMP EIR (ESTABLISH INJECTION RATE) NO INJECTION RATE @ 550# RIH
W/ TBJ TO 520' RU PUMP MIX & SPOT 60 SXS CLASS "H" CMT @ 520' TO SURF WASH UP CMT
EQUIP POOH W/ TBJ RIG DOWN ALL EQUIPMENT READY TO MOVE

RAM ENERGY LLC
WDQSU # 77
LEA COUNTY, NM
API # 30-025-30000

9-20-21

MOVE & SPOT BASEBEAM HOLD SFTY MTG & JSA MIRU UNIT OPEN WELL UP PU ON RODS
RODS STUCK WORK RODS RU BACK-OFF TOOL BACK RODS OFF POOH W/ 90 RODS RD
ROD EQUIP RU FOR TBJ PU ON TBJ POOH W/ 85 JNTS TBJ CWI SDON

9-21-21

HOLD SFTY MTG & JSA OPEN WELL UP BEGIN STRIPPING RODS & TUBING SWITCHING BACK &
FORTH FROM ROD EQUIP TO TBJ EQUIP FINISH STRIPPING RODS & TBJ OUT OF THE HOLE NU
WELL CONTROL RIH W/WL SET CIBP TO 3550' POOH W/ WL RIH W/ WL DUMP BAIL 35'
CMT POOH W/WL RIH W/ TBJ BREAK CIRC TEST TBJ TO 500# CIRC WELL CLEAN CIRC
W/ MLF POOH W/ TBJ TEST CSG TO 500# POOH W/ 30 JNTS CWI SDON

9-22-21

HOLD SFTY MTG & JSA OPEN WELL UP POOH W/ REMAINING TBJ RU WL RIH W/ CIBP SET
CIBP @ 2760' POOH W/ WL RU BAILER RIH W/ BAILER & CMT DUMP 35' CMT POOH W/ WL
SBWOC RU CIBP RIH W/ WL VERFIY CMT POOH & SET CIBP @ 1320' POOH W/ WL RU
BAILER & CMT RIH W/ BAILER & CMT DUMP 35' CMT POOH W/ WL RIH W/ WL VERIFY CMT
POOH W/ WL & PERF @ 520' POOH W/ WL CWI SDON

9-23-21

HOLD SFTY MTG & JSA RU PUMP EIR (ESTABLISH INJECTION RATE) NO INJECTION RATE @
600# RIH W/ TBJ TO 520' RU PUMP MIX & SPOT 60 SXS CLASS "H" CMT @ 520' TO SURF
WASH UP CMT EQUIP POOH W/ TBJ RIG DOWN ALL EQUIPMENT READY TO MOVE

RAM ENERGY LLC
WDQSU # 153
LEA COUNTY, NM
API # 30-025-30357

9-23-21

MOVE & SPOT BASEBEAM HOLD SFTY MTG & JSA MIRU UNIT OPEN WELL UP PU ON TBJ
RELEASE PKR NU WELL CONTROL BREAK CIRC CIRC CLEAN MIX & CIRC WELL W/ 9.5 PPG
MLF POOH W/ 115 JNTS TBJ & PKR LD PKR CWI SDON

9-24-21

HOLD SFTY MTG & JSA OPEN WELL UP PU ON TBJ NU WELL CONTROL BREAK CIRC CIRC
CLEAN MIX & CIRC WELL W/ 9.5 PPG MLF POOH W/ 116 JNTS TBJ & SN RIH W/WL SET
CIBP TO 3550' POOH W/ WL RIH W/ WL DUMP BAIL 35' CMT POOH W/WL TEST CSG TO
500# RU WL RIH W/ CIBP SET CIBP @ 2760' POOH W/ WL RU BAILER RIH W/ BAILER &
CMT DUMP 35' CMT POOH W/ WL SBWOC RU CIBP RIH W/ WL VERFIY CMT POOH &

SET CIBP @ 1320' POOH W/ WL RU BAILER & CMT RIH W/ BAILER & CMT DUMP 35' CMT
POOH W/ WL CWI SDON

9-27-21

HOLD SFTY MTG & JSA OPEN WELL UP RIH W/ WL VERIFY CMT POOH W/ WL & PERF @ 520'
POOH W/ WL RU PUMP EIR (ESTABLISH INJECTION RATE) NO INJECTION RATE @ 500# RIH
W/ TBJ TO 520' RU PUMP MIX & SPOT 60 SXS CLASS "H" CMT @ 520' TO SURF WASH UP CMT
EQUIP POOH W/ TBJ RIG DOWN ALL EQUIPMENT READY TO MOVE

RAM ENERGY LLC
WDQSU # 12
LEA COUNTY, NM
API # 30-025-12271

9-27-21

MOVE & SPOT BASEBEAM HOLD SFTY MTG & JSA MIRU UNIT OPEN WELL UP PU ON TBJ
RELEASE PKR NU WELL CONTROL BREAK CIRC CIRC CLEAN MIX & CIRC WELL W/ 9.5 PPG
MLF POOH W/ 117 JNTS TBJ & PKR LD PKR CWI SDON

9-28-21

HOLD SFTY MTG & JSA OPEN WELL UP RIH W/ WL SET CIBP TO 3550' POOH W/ WL RIH W/
WL DUMP BAIL 35' CMT POOH W/ WL TEST CSG TO 500# RU WL RIH W/ CIBP SET CIBP
@ 2760' POOH W/ WL RU BAILER RIH W/ BAILER & CMT DUMP 35' CMT POOH W/ WL
SBWOC RU CIBP RIH W/ WL VERFIY CMT POOH & SET CIBP @ 1320' POOH W/ WL RU
BAILER & CMT RIH W/ BAILER & CMT DUMP 35' CMT POOH W/ WL & PERF @ 520' POOH W/
WL WASH UP CMT EQUIP CWI SDON

9-29-21

HOLD SFTY MTG & JSA RU PUMP EIR (ESTABLISH INJECTION RATE) NO INJECTION RATE @
500# RIH W/ TBJ TO 520' RU PUMP MIX & SPOT 60 SXS CLASS "H" CMT @ 520' TO SURF
WASH UP CMT EQUIP POOH W/ TBJ RIG DOWN ALL EQUIPMENT READY TO MOVE

WDQSU # 101
LEA COUNTY, NM
API # 30-025-12271

9-29-21

MOVE & SPOT BASEBEAM HOLD SFTY MTG & JSA MIRU UNIT OPEN WELL UP PU ON TBJ
RELEASE PKR NU WELL CONTROL BREAK CIRC CIRC CLEAN MIX & CIRC WELL W/ 9.5 PPG
MLF POOH W/ 115 JNTS TBJ & PKR LD PKR CWI SDON

9-30-21

HOLD SFTY MTG & JSA OPEN WELL UP RIH W/ WL SET CIBP TO 3550' POOH W/ WL RIH W/
WL DUMP BAIL 35' CMT POOH W/ WL TEST CSG TO 500# RU WL RIH W/ CIBP SET CIBP
@ 2760' POOH W/ WL RU BAILER RIH W/ BAILER & CMT DUMP 35' CMT POOH W/ WL
SBWOC RU CIBP RIH W/ WL VERFIY CMT POOH & SET CIBP @ 1320' POOH W/ WL RU
BAILER & CMT RIH W/ BAILER & CMT DUMP 35' CMT POOH W/ WL & PERF @ 520' POOH W/
WL CWI SDON

10-1-21

HOLD SFTY MTG & JSA RU PUMP EIR (ESTABLISH INJECTION RATE) NO INJECTION RATE @ 500# RIH W/ TBJ TO 520' RU PUMP MIX & SPOT 60 SXS CLASS "H" CMT @ 520' TO SURF WASH UP CMT EQUIP POOH W/ TBJ RIG DOWN ALL EQUIPMENT READY TO MOVE

WDQSU # 21
LEA COUNTY, NM
API # 30-025-12270

10-01-21

MOVE & SPOT BASEBEAM HOLD SFTY MTG & JSA MIRU UNIT OPEN WELL UP PU ON TBJ RELEASE PKR NU WELL CONTROL BREAK CIRC CIRC CLEAN MIX & CIRC WELL W/ 9.5 PPG MLF POOH W/ 122 JNTS TBJ & PKR LD PKR CWI SDON

10-02-21

HOLD SFTY MTG & JSA OPEN WELL UP RIH W/WL SET CIBP TO 3600' POOH W/ WL RIH W/ WL DUMP BAIL 35' CMT POOH W/WL TEST CSG TO 500# RU WL RIH W/ CIBP SET CIBP @ 2760' POOH W/ WL RU BAILER RIH W/BAILER & CMT DUMP 35' CMT POOH W/ WL SBWOC RU CIBP RIH W/ WL VERFIY CMT POOH & SET CIBP @ 1320' POOH W/ WL RU BAILER & CMT RIH W/ BAILER & CMT DUMP 35' CMT POOH W/ WL & PERF @ 520' POOH W/ WL RU PUMP WASH UP CMT EQUIP CWI SDON

10-04-21

HOLD SFTY MTG & JSA RU PUMP EIR (ESTABLISH INJECTION RATE) NO INJECTION RATE @ 500# RIH W/ TBJ TO 520' RU PUMP MIX & SPOT 60 SXS CLASS "H" CMT @ 520' TO SURF WASH UP CMT EQUIP POOH W/ TBJ RIG DOWN ALL EQUIPMENT READY TO MOVE

WDQSU # 08
LEA COUNTY, NM
API # 30-025-12261

10-04-21

MOVE & SPOT BASEBEAM HOLD SFTY MTG & JSA MIRU UNIT OPEN WELL UP PU ON TBJ RELEASE PKR NU WELL CONTROL BREAK CIRC CIRC CLEAN MIX & CIRC WELL W/ 9.5 PPG MLF CWI SDON

10-05-21

HOLD SFTY MTG & JSA OPEN WELL UP POOH W/ 122 JNTS TBJ RIH W/WL SET CIBP TO 3580' POOH W/ WL RIH W/ WL DUMP BAIL 35' CMT POOH W/WL TEST CSG TO 500# RU WL RIH W/ CIBP SET CIBP @ 2760' POOH W/ WL RU BAILER RIH W/BAILER & CMT DUMP 35' CMT POOH W/ WL SBWOC RU CIBP RIH W/ WL VERFIY CMT POOH & SET CIBP @ 1320' POOH W/ WL RU BAILER & CMT RIH W/ BAILER & CMT DUMP 35' CMT POOH W/ WL & PERF @ 520' POOH W/ WL CWI SDON

10-06-21

HOLD SFTY MTG & JSA RU PUMP EIR (ESTABLISH INJECTION RATE) NO INJECTION RATE @ 500# RIH W/ TBJ TO 520' RU PUMP MIX & SPOT 90 SXS CLASS "H" CMT @ 520' TO SURF WASH UP CMT EQUIP POOH W/ TBJ RIG DOWN ALL EQUIPMENT READY TO MOVE

WDQSU # 81
LEA COUNTY, NM
API # 30-025-30011

10-06-21

MOVE & SPOT BASEBEAM HOLD SFTY MTG & JSA MIRU UNIT OPEN WELL UP PU ON RODS UN-SEAT PUMP POOH LAYING DOWN 136 RODS CWI SDON

10-07-21

HOLD SFTY MTG & JSA RU FOR TBJ OPEN WELL UP RU FLOOR & TONGS WORK TO UN-SET TAC CNT TO WORK STUCK TAC WORK TAC FREE RU PUMP BREAK CIRC CIRC CLEAN CIRC WELL W/ MLF POOH W/ 112 JNTS TBJ RIH W/ WL SET CIBP TO 3600' POOH W/ WL RIH W/ WL DUMP BAIL 35' CMT POOH W/ WL TEST CSG TO 500# CWI SDON

10-08-21

HOLD SFTY MTG & JSA RU WL RIH W/ CIBP SET CIBP @ 2760' POOH W/ WL RU BAILER RIH W/ BAILER & CMT DUMP 35' CMT POOH W/ WL SBWOC RU CIBP RIH W/ WL VERFIY CMT POOH & SET CIBP @ 1320' POOH W/ WL RU BAILER & CMT RIH W/ BAILER & CMT DUMP 35' CMT POOH W/ WL & PERF @ 520' POOH W/ WL CWI SDON

10-11-21

HOLD SFTY MTG & JSA RU PUMP EIR (ESTABLISH INJECTION RATE) NO INJECTION RATE @ 500# RIH W/ TBJ TO 520' RU PUMP MIX & SPOT 60 SXS CLASS "H" CMT @ 520' TO SURF WASH UP CMT EQUIP POOH W/ TBJ RIG DOWN ALL EQUIPMENT READY TO MOVE

WDQSU # 75
LEA COUNTY, NM
API # 30-025-29984

10-11-21

MOVE & SPOT BASEBEAM HOLD SFTY MTG & JSA MIRU UNIT OPEN WELL UP PU ON RODS UN-SEAT PUMP POOH LAYING DOWN 141 RODS CWI SDON

10-12-21

HOLD SFTY MTG & JSA RU FOR TBJ OPEN WELL UP RU FLOOR & TONGS WORK TO UN-SET TAC WORK TAC FREE RU PUMP BREAK CIRC CIRC CLEAN CIRC WELL W/ MLF POOH W/ 125 JNTS TBJ RIH W/ WL SET CIBP TO 3600' POOH W/ WL RIH W/ WL DUMP BAIL 35' CMT POOH W/ WL TEST CSG TO 500# CWI SDON

10-13-21

HOLD SFTY MTG & JSA RU WL RIH W/ CIBP SET CIBP @ 2760' POOH W/ WL RU BAILER RIH W/ BAILER & CMT DUMP 35' CMT POOH W/ WL SBWOC RU CIBP RIH W/ WL VERFIY CMT POOH & SET CIBP @ 1320' POOH W/ WL RU BAILER & CMT RIH W/ BAILER & CMT DUMP 35' CMT RIH W/ WL VERIFY CMT POOH W/ WL & PERF @ 520' POOH W/ WL RU PUMP EIR (ESTABLISH INJECTION RATE) NO INJECTION RATE @ 500# RIH W/ TBJ TO 520' RU PUMP MIX & SPOT 60 SXS CLASS "H" CMT @ 520' TO SURF WASH UP CMT EQUIP POOH W/ TBJ RIG DOWN ALL EQUIPMENT READY TO MOVE

WDQSU # 152
LEA COUNTY, NM
API # 30-025-30358

10-14-21

MOVE & SPOT BASEBEAM HOLD SFTY MTG & JSA MIRU UNIT OPEN WELL UP PU ON TBJ RELEASE PKR NU WELL CONTROL BREAK CIRC CIRC CLEAN MIX & CIRC WELL W/ 9.5 PPG MLF POOH W/ 135 JNTS TBJ & PKR LD PKR CWI SDON

10-15-21

HOLD SFTY MTG & JSA OPEN WELL UP RIH W/ WL SET CIBP TO 3600' POOH W/ WL RIH W/ WL DUMP BAIL 35' CMT POOH W/ WL TEST CSG TO 500# RU WL RIH W/ CIBP SET CIBP @ 2760' POOH W/ WL RU BAILER RIH W/ BAILER & CMT DUMP 35' CMT POOH W/ WL SBWOC RU CIBP RIH W/ WL VERFIY CMT POOH & SET CIBP @ 1320' POOH W/ WL RU BAILER & CMT RIH W/ BAILER & CMT DUMP 35' CMT RIH W/ WL VERIFY CMT POOH W/ WL & PERF @ 520' POOH W/ WL CWI SDON

10-18-21

HOLD SFTY MTG & JSA RU PUMP EIR (ESTABLISH INJECTION RATE) NO INJECTION RATE @ 500# RIH W/ TBJ TO 520' RU PUMP MIX & SPOT 60 SXS CLASS "H" CMT @ 520' TO SURF WASH UP CMT EQUIP POOH W/ TBJ RIG DOWN ALL EQUIPMENT READY TO MOVE

WDQSU # 18
LEA COUNTY, NM
API # 30-025-12257

10-18-21

MOVE & SPOT BASEBEAM HOLD SFTY MTG & JSA MIRU UNIT OPEN WELL UP PU ON TBJ RELEASE PKR NU WELL CONTROL BREAK CIRC CIRC CLEAN MIX & CIRC WELL W/ 9.5 PPG MLF POOH W/ 118 JNTS TBJ & PKR LD PKR CWI SDON

10-19-21

HOLD SFTY MTG & JSA OPEN WELL UP RIH W/ WL SET CIBP TO 3520' POOH W/ WL RIH W/ WL DUMP BAIL 35' CMT POOH W/ WL TEST CSG TO 500# RU WL RIH W/ CIBP SET CIBP

@ 2760' POOH W/ WL RU BAILER RIH W/ BAILER & CMT DUMP 35' CMT POOH W/ WL SBWOC RU CIBP RIH W/ WL VERFIY CMT POOH & SET CIBP @ 1320' POOH W/ WL RU BAILER & CMT RIH W/ BAILER & CMT DUMP 35' CMT RIH W/ WL VERIFY CMT POOH W/ WL & PERF @ 520' POOH W/ WL CWI SDON

10-20-21

HOLD SFTY MTG & JSA RU PUMP EIR (ESTABLISH INJECTION RATE) NO INJECTION RATE @ 500# RIH W/ TBJ TO 520' RU PUMP MIX & SPOT 43 SXS CLASS "H" CMT @ 520' TO SURF WASH UP CMT EQUIP POOH W/ TBJ RIG DOWN ALL EQUIPMENT READY TO MOVE

WDQSU # 74
LEA COUNTY, NM
API # 30-025-29983

10-20-21

MOVE & SPOT BASEBEAM HOLD SFTY MTG & JSA MIRU UNIT OPEN WELL UP PU ON TBJ RELEASE PKR NU WELL CONTROL BREAK CIRC CIRC CLEAN MIX & CIRC WELL W/ 9.5 PPG MLF POOH W/ 50 JNTS TBJ & PKR LD PKR CWI SDON

10-21-21

HOLD SFTY MTG & JSA OPEN WELL UP CNT TO POOH W/ TBJ TOTAL OF 112 JNTS LD BHA RIH W/ WL SET CIBP TO 3472' POOH W/ WL RIH W/ WL DUMP BAIL 35' CMT POOH W/ WL TEST CSG TO 500# RU WL RIH W/ CIBP SET CIBP @ 2760' POOH W/ WL RU BAILER RIH W/ BAILER & CMT DUMP 35' CMT POOH W/ WL SBWOC RU CIBP RIH W/ WL VERFIY CMT POOH & SET CIBP @ 1320' POOH W/ WL RU BAILER & CMT RIH W/ BAILER & CMT DUMP 35' CMT POOH W/ WL CWI SDON

10-22-21

HOLD SFTY MTG & JSA RIH W/ WL VERIFY CMT POOH & PERF @ 520' POOH W/ WL RU PUMP EIR (ESTABLISH INJECTION RATE) NO INJECTION RATE @ 500# RIH W/ TBJ TO 520' RU PUMP MIX & SPOT 60 SXS CLASS "H" CMT @ 520' TO SURF WASH UP CMT EQUIP POOH W/ TBJ RIG DOWN ALL EQUIPMENT READY TO MOVE

WDQSU # 113
LEA COUNTY, NM
API # 30-025-30231

10-27-2021

MOVE & SPOT BASEBEAM HOLD SFTY MTG & JSA MIRU UNIT OPEN WELL UP PU ON TBJ RELEASE PKR NU WELL CONTROL BREAK CIRC CIRC CLEAN MIX & CIRC WELL W/ 9.5 PPG MLF POOH W/ 115 JNTS TBJ & PKR LD PKR CWI SDON

11-1-2021

HOLD SFTY MTG & JSA OPEN WELL UP CNT TO POOH W/ TBJ TOTAL OF 112 JNTS LD BHA RIH W/WL SET CIBP TO 3472' POOH W/ WL RIH W/ WL DUMP BAIL 35' CMT POOH W/WL TEST CSG TO 500# RU WL RIH W/ CIBP SET CIBP @ 2760' POOH W/ WL RU BAILER RIH W/ BAILER & CMT DUMP 35' CMT POOH W/ WL SBWOC RU CIBP RIH W/ WL VERFIY CMT POOH & SET CIBP @ 1320' POOH W/ WL RU BAILER & CMT RIH W/ BAILER & CMT DUMP 35' CMT POOH W/ WL CWI SDON

WDQSU # 24
LEA COUNTY, NM
API # 30-025-12276

11-4-21

HOLD SFTY MTG & JSA RIH W/ WL VERIFY CMT POOH & PERF @ 520' POOH W/ WL RU PUMP EIR (ESTABLISH INJECTION RATE) NO INJECTION RATE @ 500# RIH W/ TBJ TO 520' RU PUMP MIX & SPOT 60 SXS CLASS "H" CMT @ 520' TO SURF WASH UP CMT EQUIP POOH W/ TBJ RIG DOWN ALL EQUIPMENT READY TO MOVE

MOVE & SPOT BASEBEAM HOLD SFTY MTG & JSA MIRU UNIT OPEN WELL UP PU ON TBJ RELEASE PKR NU WELL CONTROL BREAK CIRC CIRC CLEAN MIX & CIRC WELL W/ 9.5 PPG MLF POOH W/ 122 JNTS TBJ & PKR LD PKR CWI SDON

11-6-21

HOLD SFTY MTG & JSA OPEN WELL UP RIH W/ WL SET CIBP TO 3600' POOH W/ WL RIH W/ WL DUMP BAIL 35' CMT POOH W/ WL TEST CSG TO 500# RU WL RIH W/ CIBP SET CIBP @ 2760' POOH W/ WL RU BAILER RIH W/ BAILER & CMT DUMP 35' CMT POOH W/ WL SBWOC RU CIBP RIH W/ WL VERFIY CMT POOH & SET CIBP @ 1320' POOH W/ WL RU BAILER & CMT RIH W/ BAILER & CMT DUMP 35' CMT POOH W/ WL & PERF @ 520' POOH W/ WL RU PUMP WASH UP CMT EQUIP CWI SDON

11-8-21

HOLD SFTY MTG & JSA RU PUMP EIR (ESTABLISH INJECTION RATE) NO INJECTION RATE @ 500# RIH W/ TBJ TO 520' RU PUMP MIX & SPOT 60 SXS CLASS "H" CMT @ 520' TO SURF WASH UP CMT EQUIP POOH W/ TBJ RIG DOWN ALL EQUIPMENT READY TO MOVE

RAM ENERGY LLC
WDQSU # 001
LEA COUNTY, NM
API # 30-025-12212

5-11-21

HAUL IN & SPOT BASE BEAM HOLD SFTY MTG & JSA MI RIG SPOT RIG OVER BEAM MOVE IN CMT EQUIPMENT RU RIG RU CMT EQUIP. SDON

5-12-21

HOLD SFTY MTG & JSA SERVICE UNIT & PUMP OPEN WELL UP ND HEAD PU ON TBJ RELEASE
PKR POOH W/ TBJ & PKR LD BHA PU MU MECHANICL SET CIBP RIH W/ TBJ & CIBP SET
CIBP @ 3650' RELEASE OFF CIBP BREAK CIRC CIRC WELL CLEAN MIX & SPOT 25 SXS
CLASS "C" CMT @ 3450'-3650' DISPLACE PLUG WASH UP CMT EQUIP POOH TO 3300' MIX &
CIRC WELL W/ MLF POOH W/ 30 JNTS CWI SDON

5-13-21

HOLD SFTY MTG & JSA SERVICE UNIT & PUMP OPEN WELL UP LAY DOWN REMAINING TBJ
MIRU WL RIH W/ WL SET CIBP @ 2785' POOH W/ WL RU BAILER RIH W/ BAILER DUMP 35'
CMT POOH W/ WL SBWOC RIH W/ WL VERIFY PLUG POOH W/ WL SETTING CIBP @ 1340'
POOH W/ WL RU BAILER RIH W/ BAILER DUMP 35' CMT POOH W/ WL SBWOC RIH W/
WL VERIFY PLUG POOH W/ WL PERF @ 460' POOH W// WL RIH W/ TBJ TO 460' RU
PUMP ESTABLISH INJTION RATE (EIR) NO INJ RATE @ 600# CWI SDON

5-14-21

HOLD SFTY MTG & JSA SERVICE UNIT & PUMP OPEN WELL UP RU CMT EQUIP BREAK CIRC
MIX & SPOT 55 SXS CLASS "C" CMT @ 460'- SURFACE DISPLACE PLUG WASH UP CMT EQUIP
POOH W/ TBJ RD UNIT & CMT EQUIP MOVE OFF LOCATION

WELLBORE DIAGRAM
WEST DOLLARHIDE QUEEN SAND UNIT #74
CURRENT
API: 30-025-29983

Surface Casing


Size: 8 5/8"
Wt.: 24#
Depth: 398'
Sxs Cmt: 250
Circulate: yes
TOC: surface
Hole Size: 12-1/4"

Formation Tops

T. Salt 1230'
B. Salt 2522'

Production Casing

Size: 5-1/2"
Wt.: 17#
Depth: 3866'
Sxs Cmt: 1000
Circulate: yes
TOC: surface
Hole Size: 7-7/8"

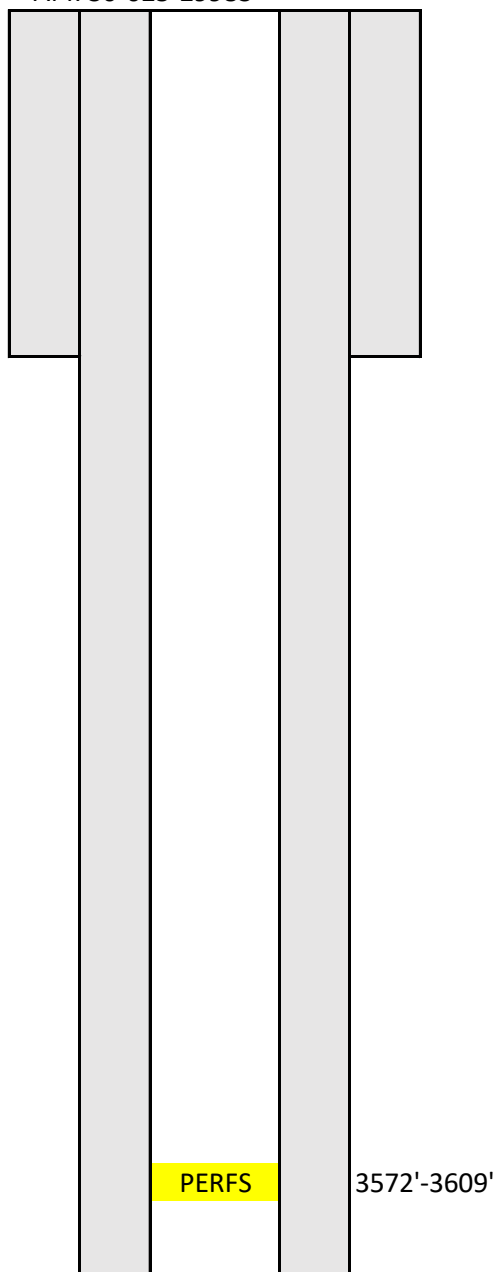

District I
1625 N. French Dr., Hobbs, NM 88240
Phone:(575) 393-6161 Fax:(575) 393-0720
District II
811 S. First St., Artesia, NM 88210
Phone:(575) 748-1283 Fax:(575) 748-9720
District III
1000 Rio Brazos Rd., Aztec, NM 87410
Phone:(505) 334-6178 Fax:(505) 334-6170
District IV
1220 S. St Francis Dr., Santa Fe, NM 87505
Phone:(505) 476-3470 Fax:(505) 476-3462

State of New Mexico
Energy, Minerals and Natural Resources
Oil Conservation Division
1220 S. St Francis Dr.
Santa Fe, NM 87505

CONDITIONS

Action 67426

CONDITIONS

Operator: RAM ENERGY LLC 5100 East Skelly Drive Tulsa, OK 74135	OGRID: 309777
	Action Number: 67426
	Action Type: [C-103] Sub. Plugging (C-103P)

CONDITIONS

Created By	Condition	Condition Date
kfortner	None	4/4/2022