

U.S. Department of the Interior BUREAU OF LAND MANAGEMENT

Sundry Print Report of 15

Well Name: NV KEVIN 23 Well Location: T29N / R14W / SEC 23 / County or Parish/State: SAN

SENW / JUAN / NM

Well Number: 2 Type of Well: CONVENTIONAL GAS Allottee or Tribe Name:

WELL SHIPROCK

Lease Number: 14206032198A Unit or CA Name: Unit or CA Number:

US Well Number: 300453118600S1 Well Status: Producing Gas Well Operator: HILCORP ENERGY

COMPANY

Notice of Intent

Sundry ID: 2735709

Type of Submission: Notice of Intent

Type of Action: Plug and Abandonment

Date Sundry Submitted: 06/14/2023 Time Sundry Submitted: 08:28

Date proposed operation will begin: 07/01/2023

Procedure Description: Hilcorp Energy requests permission to plug and abandon the subject well per the attached procedures, current and proposed wellbore schematics. The Pre-Disturbance Site Visit was held on 06/06/2023 with Roger Herrera/BLM, Bertha Spencer/BIA, Belinda Chee, Johnnie Begay and Valjean Uentillie, with Navjao Nation. The Re-Vegetation Plan is attached. A closed loop system will be used.

Surface Disturbance

Is any additional surface disturbance proposed?: No

NOI Attachments

Procedure Description

PA_Reclamation___NV_Kevin_23_2_06.09.2023_20230614082609.pdf

NV Kevin 23 2 PA NOI 20230614082551.pdf

eived by OCD: 6/23/2023 12:33:04 PM Well Name: NV KEVIN 23

Well Location: T29N / R14W / SEC 23 / County or Parish/State: SAN Page

SENW /

JUAN / NM

Well Number: 2

Type of Well: CONVENTIONAL GAS

WELL

Allottee or Tribe Name:

SHIPROCK

Lease Number: 14206032198A

Unit or CA Name:

Unit or CA Number:

US Well Number: 300453118600S1

Well Status: Producing Gas Well

Operator: HILCORP ENERGY

COMPANY

Conditions of Approval

Additional

PxA_29N14W23FKpc_NV_Kevin_23_002 20230622113104.pdf

Authorized

General_Requirement PxA 20230622124629.pdf

2735709_NOIA_2_3004531186_KR_06222023_20230622124549.pdf

Operator

I certify that the foregoing is true and correct. Title 18 U.S.C. Section 1001 and Title 43 U.S.C. Section 1212, make it a crime for any person knowingly and willfully to make to any department or agency of the United States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction. Electronic submission of Sundry Notices through this system satisfies regulations requiring a

Operator Electronic Signature: CHERYLENE WESTON Signed on: JUN 14, 2023 04:13 PM

Name: HILCORP ENERGY COMPANY Title: Operations/Regulatory Tech - Sr

Street Address: 1111 TRAVIS STREET

City: HOUSTON State: TX

Phone: (713) 289-2615

Email address: cweston@hilcorp.com

Field

Representative Name:

Street Address:

City:

State:

Zip:

Phone:

Email address:

BLM Point of Contact

BLM POC Name: KENNETH G RENNICK

Released to Imaging: 6/28/2023 4:17:46 PM BLM POC Phone: 5055647742

BLM POC Title: Petroleum Engineer

BLM POC Email Address: krennick@blm.gov




HILCORP ENERGY COMPANY NV KEVIN 23 2 NOTICE OF INTENT TO PERMANENTLY ABANDON

API #: 3004531186

	JOB PROCEDURES					
_	Contact OCD and BLM/Navajo 24 hrs prior to MIRU. Comply with all NMOCD, BLM & Navajo, and HEC safety and					
☑ BLM/Navajo	environmental regulations.					
1. MIRU service rig	and associated equipment, LOTO pumping unit and remove HH and bridle. Record all casing pressures on well.					
2. Release On/Off to	2. Release On/Off tool on rods, POOH w/ rods, lay down.					
3. Load well, ND tre	ee, NU BOPs and test.					
4. POOH w/ tubing	4. POOH w/ tubing barrel pump on 2-3/8" production tbg, lay down.					
5. MU 5-1/2" 15.5# !	5. MU 5-1/2" 15.5# bit/scraper, clear csg to 880', POOH. RIH w/ 5-1/2" 15.5# CICR on pipe and set @ 732' (FRD Top Perf 782').					
6. Pressure test 5-1	6. Pressure test 5-1/2" & CICR to 560psi for 30min.					
7. Plug #1 716' - 8	866' (PC Top Perf @ 916' PC Top @ 908') Pump 15sx (3.7 bbl) Class III Select cmt & spot 150' cmt plug on top of the CICR.					
8. Plug #2 Surface Fruitland Top & s	re - 363' (FRD Top @ 313' Surface Shoe: 130') Circulate in 35sx (8.5 bbl) Class III Select cmt from 363' to surface to cover the surface shoe.					
9. LD tubing. ND BC	OP and cut off wellhead below surface casing flange as per NMOCD. Top off cement at surface as needed. Weld new P&A maker.					
Note Class III "Se	elect" cement: Neat, 1.37yld, 14.6ppg, 6.64gpsx mix wtr.					
	l l					




HILCORP ENERGY COMPANY NV KEVIN 23 2 NOTICE OF INTENT TO PERMANENTLY ABANDON

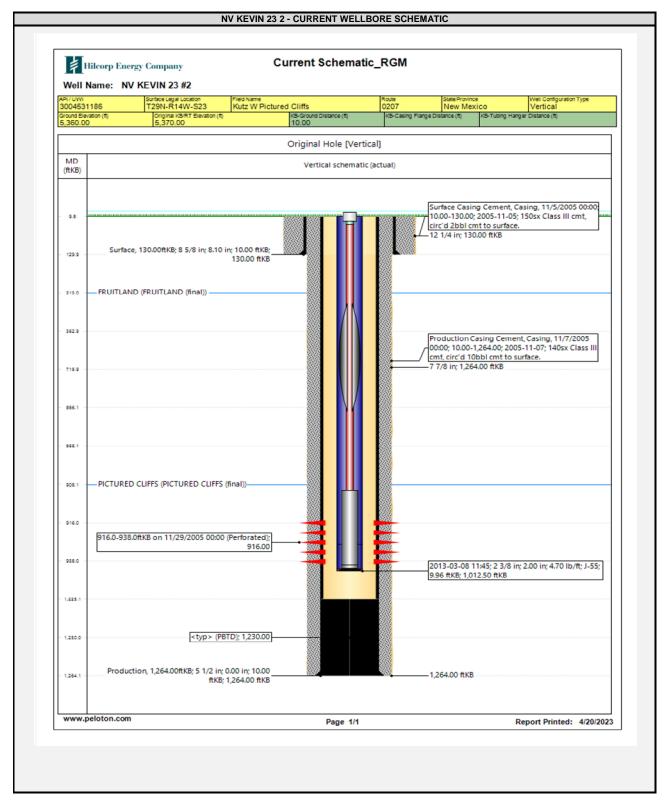



HILCORP ENERGY COMPANY NV KEVIN 23 2 NOTICE OF INTENT TO PERMANENTLY ABANDON

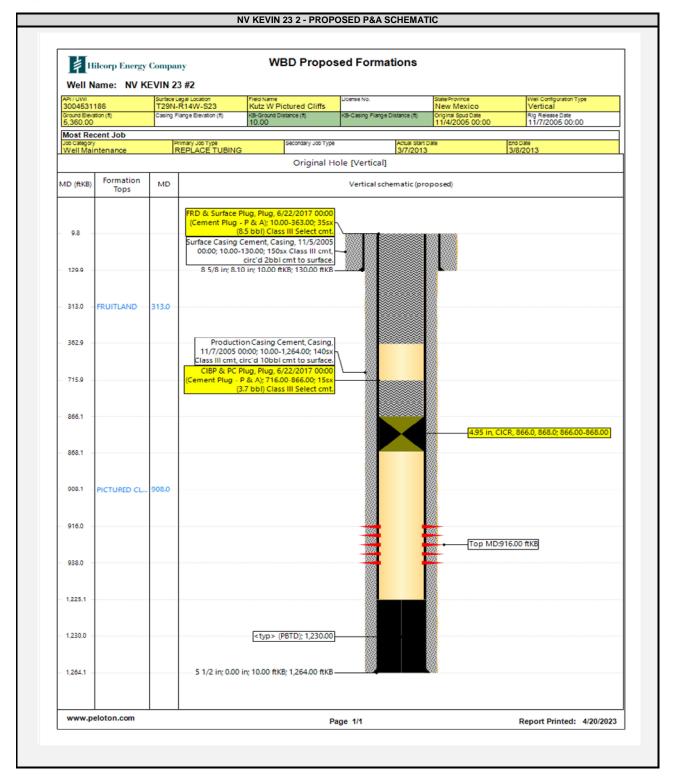

Hilcorp Energy P&A Final Reclamation Plan

NV Kevin 23 #2 API: 30-045-31186

Sec.23-T029N-R014W-Unit F

Lat: 36.714773, Long: -108.279617 Footage: 1714' FNL & 2230' FWL San Juan County, NM

1. PRE-RECLAMATION SITE INSPECTION

- 1.1) A pre-reclamation site inspection was completed by Hilcorp Energy and representatives from multiple government agencies on Tuesday June 6, 2023:
 - Roger Herrera with the BLM
 - Bertha Spencer with the BIA
 - Belinda Chee with the Navajo Nation
 - Johnnie Begay with the Navajo Nation
 - Valjean Uentillie with the Navajo Nation
 - Chad Perkins with Hilcorp Energy

2. LOCATION RECLAMATION PROCEDURE

- 2.1) Final reclamation work will be completed after the well is Plugged.
- 2.2) Remove all production equipment, anchors, and flowlines.
- 2.3) The water and gas pipelines approximately 150' will be stripped from the well facility to the dogleg or mainline. The mainline will be blind flanged or capped off.
- 2.4) All nonnative aggregate will be scraped up and buried in toe of the cut prior to recontouring.
- 2.5) On the northeastern side of location, the soil will be rolled off into the cut reducing the northern eastern slope. The cut will be same elevation as the two-track road that runs above the cut.
- 2.6) Stockpile topsoil from fill on the southwestern side of location.
- 2.7) Push fill into cut slope and re-contour with shallow swales and or silt traps for major drainage to create a rolling terrain that matches natural topography drainage features to limit erosion.
- 2.8) Lay out stockpiled soil on reclamation.
- 2.9) Rip compacted soil and walk down disturbed portion of well pad.
- 2.10) All trash and debris will be removed within 50' buffer outside of the location disturbance during reclamation.

3. ACCESS ROAD RECLAMATION PROCEDURE:


- 3.1) The main lease access road is approximately ~100′ long.
- 3.2) All culverts along lease access road will be removed prior to re-contouring.
- 3.3) Rip and re-contour ~100' of lease access road up to main road with shallow swells, berms, and or silt traps as needed to match natural topography drainage features.
- 3.4) H-Posts and gates at entrance of location will be removed and hauled off.
- 3.5) All trash and debris will be removed within 50' buffer outside of the road disturbance during reclamation.


4. SEEDING PROCDURE


- 4.1) A Badlands seed mix will be used for all reclaimed and disturbed areas of the location and lease road.
- 4.2) Drill seeding will be done where applicable and all other disturbed areas will be broadcast seeded and harrowed, broadcast seeding will be applied at a double the rate of seed.
- 4.3) Timing of the seeding will take place when the ground is not frozen or saturated.

5. WEED MANAGEMENT

5.1) No action is required at this time for weed management, no noxious weeds were identified during the onsite.

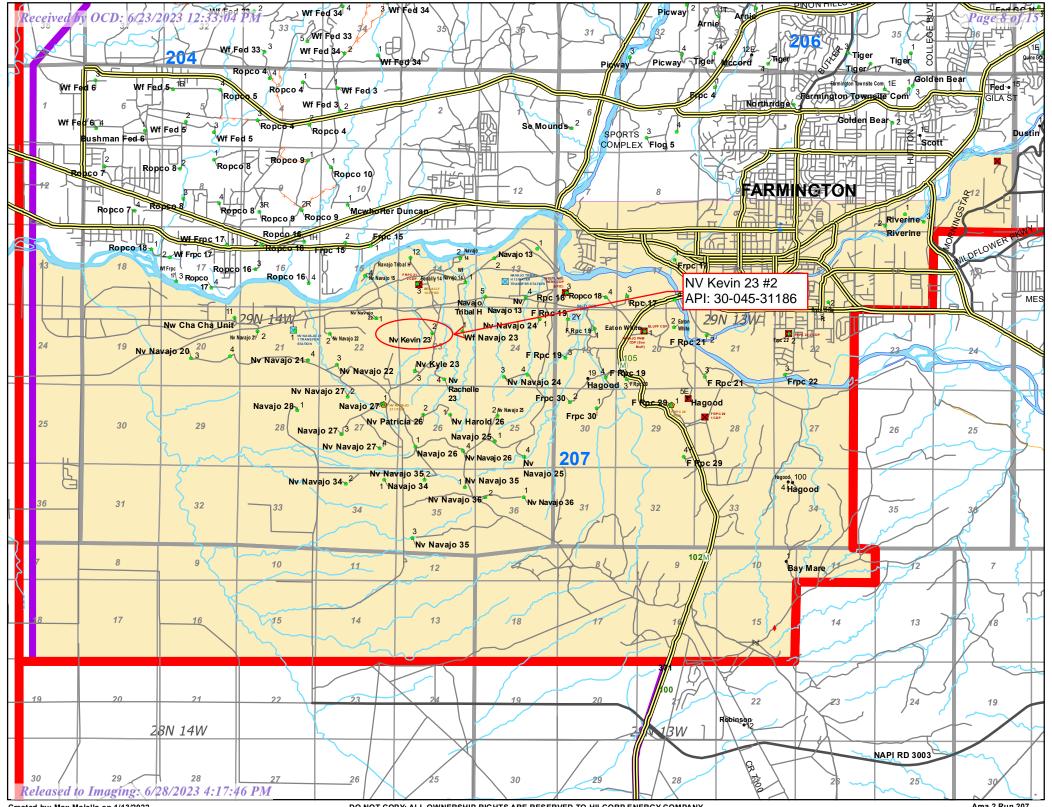

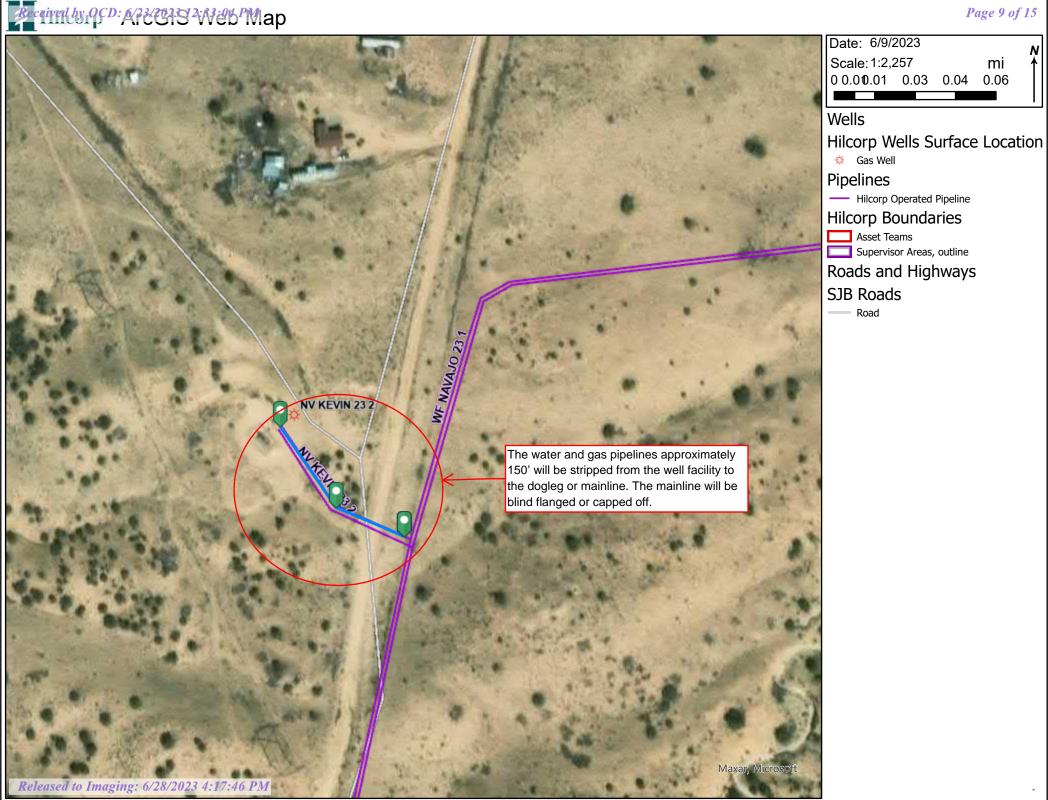

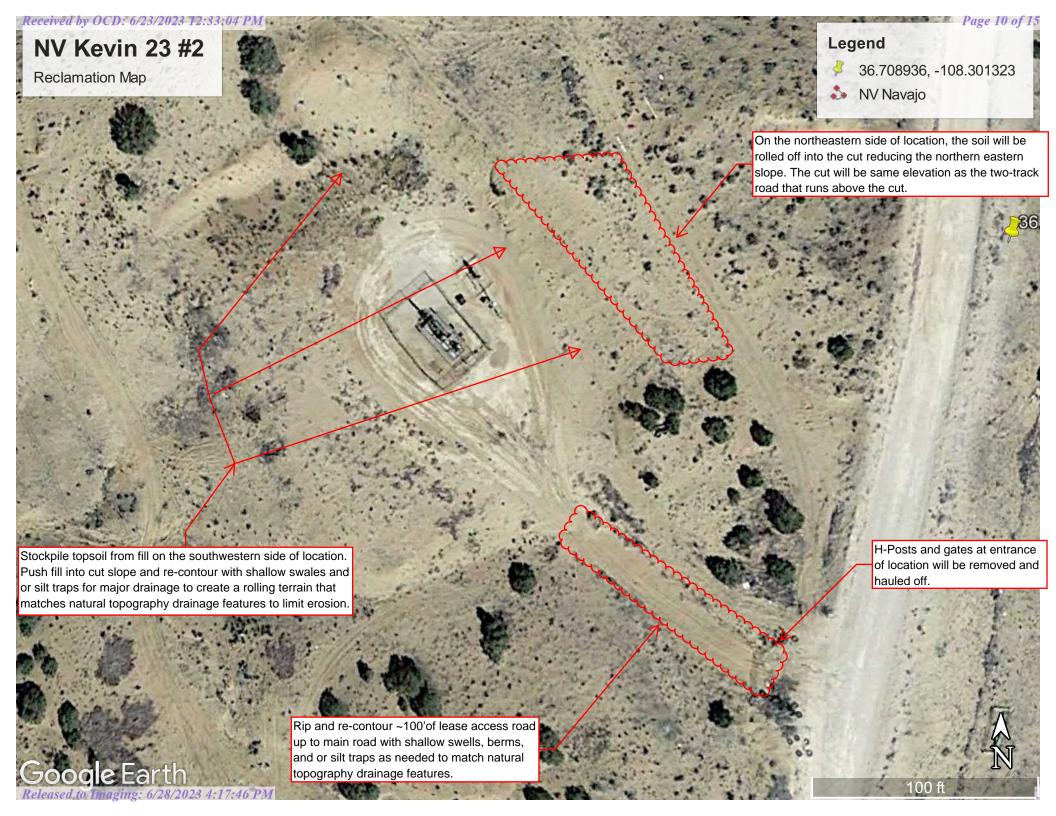

UNITED STATES DEPARTMENT OF THE INTERIOR BUREAU OF LAND MANAGEMENT FARMINGTON DISTRICT OFFICE

6251 COLLEGE BLVD. FARMINGTON, NEW MEXICO 87402

AFMSS 2 Sundry ID 2735709

Attachment to notice of Intention to Abandon

Well: NV Kevin 23 2

CONDITIONS OF APPROVAL

- 1. Plugging operations authorized are subject to the attached "General Requirements for Permanent Abandonment of Wells on Federal and Indian Lease."
- 2. The following modifications to your plugging program are to be made:
 - a. Adjust Plug #2 (Fruitland/ Surface), or add a plug, to cover BLM Fruitland top @ 458'.
- 3. Farmington Office is to be notified at least 24 hours before the plugging operations commence at (505) 564-7750.

You are also required to place cement excesses per 4.2 and 4.4 of the attached General Requirements.

Office Hours: 7:45 a.m. to 4:30 p.m.

K. Rennick 06/22/2023

BLM FFO Fluid Minerals P&A Geologic Report

AFMSS ID: 2735709 **Date Completed:** 6/22/2023

Well No.	NV Kevin 23 #002	SHL	1714	FNL	2230	FWL
API No.	3004531186			Sec. 23	T29N	R14W
Lease No.	14206032198A	BHL	Same			
Operator	Hilcorp Energy Company					
Elev. (KB)	5370	County	San Juan		State	NM
Total Depth	1269 PBTD 1230	Formation	Pictured Cliffs			

Formation Top	TVD (ft KB)	Remarks
San Jose Fm.		
Nacimiento Fm.		
Ojo Alamo Ss		
Kirtland Fm.	Surface	Probable gas/water
Fruitland Fm.	458	Coal/gas/water
Pictured Cliffs Ss	908	Probable gas/water
Lewis Shale		
Chacra (upper)		
Cliff House Ss		
Menefee Fm.		
Point Lookout Fm.		
Mancos Shale		
Gallup		
Greenhorn Ls		
Graneros Shale		
Dakota Ss		
Morrison Fm.		

Remarks:

- Pictured Cliffs perfs 916' - 938'.

- Adjust Plug #2 (Fruitland/Surface), or add a plug, to cover BLM Fruitland top @ 458'.

Same

- Adjust Plug #2 (Fruitland/Surface), or add a plug, to cover BLM Fruitland top @ 458'.

Prepared by: Chris Wenman

GENERAL REQUIREMENTS FOR PERMANENT ABANDONMENT OF WELLS ON FEDERAL AND INDIAN LEASES FARMINGTON FIELD OFFICE

- 1.0 The approved plugging plans may contain variances from the following <u>minimum general</u> requirements.
 - 1.1 Modification of the approved plugging procedure is allowed only with the prior approval of the Authorized Officer, Farmington Field Office.
 - 1.2 Requirements may be added to address specific well conditions.
- 2.0 Materials used must be accurately measured. (densometer/scales)
- 3.0 A tank or lined pit must be used for containment of any fluids from the wellbore during plugging operations and all pits are to be fenced with woven wire. These pits will be fenced on three sides and once the rig leaves location, the fourth side will be fenced.
 - 3.1 Pits are not to be used for disposal of any hydrocarbons. If hydrocarbons are present in the pit, the fluids must be removed prior to filling in.
- 4.0 All cement plugs are to be placed through a work string. Cement may be bull-headed down the casing with prior approval. Cement caps on top of bridge plugs or cement retainers may be placed by dump bailer.
 - 4.1 The cement shall be as specified in the approved plugging plan.
 - 4.2 All cement plugs placed inside casing shall have sufficient volume to fill a minimum of 100' of the casing, or annular void(s) between casings, plus an excess volume sufficient to provide for 50 linear feet of fill above the plug.
 - 4.3 Surface plugs may be no less than 50' in length.
 - 4.4 All cement plugs placed to fill annular void(s) between casing and the formation shall be of sufficient volume to fill a minimum of 100' of the annular space plus 100% excess, calculated using the bit size, or 100' of annular capacity, determined from a caliper log, plus an excess volume sufficient to provide for 50 linear feet of fill above the plug.
 - 4.5 All cement plugs placed to fill an open hole shall be of sufficient volume to fill a minimum of 100' of hole, as calculated from a caliper log, plus an excess volume sufficient to provide for 50 linear feet of fill above the plug. In the absence of a caliper log, an excess of 100% shall be required.
 - 4.6 A cement bond log or other accepted cement evaluation tool is required to be run if one had not been previously ran or cement did not circulate to surface during the original casing cementing job or subsequent cementing jobs.

2

- 5.0 All cement plugs spotted across, or above, any exposed zone(s), when; the wellbore is not full of fluid or the fluid level will not remain static, and in the case of lost circulation or partial returns during cement placement, shall be tested by tagging with the work string.
 - 5.1 The top of any cement plug verified by tagging must be at or above the depth specified in the approved plan, without regard to any excess.
 - 5.2 Testing will not be required for any cement plug that is mechanically contained by use of a bridge plug and/or cement retainer, if casing integrity has been established.
 - 5.3 Any cement plug which is the only isolating medium, for a fresh water interval or a zone containing a prospectively valuable deposit of minerals, shall be tested by tagging.
 - 5.4 If perforations are required below the surface casing shoe, a 30 minute minimum wait time will be required to determine if gas and/or water flows are present. If flow is present, the well will be shut-in for a minimum of one hour and the pressure recorded. Short or long term venting may be necessary to evacuate trapped gas. If only a water flow occurs with no associated gas, shut well in and record the pressures. Contact the Engineer as it may be necessary to change the cement weight and additives.
- 6.0 Before setting any cement plugs the hole needs to be rolled. All wells are to be controlled by means of a fluid that is to be of a weight and consistency necessary to stabilize the wellbore. This fluid shall be left in place as filler between all plugs.
 - 6.1 Drilling mud may be used as the wellbore fluid in open hole plugging operations.
 - 6.2 The wellbore fluid used in cased holes shall be of sufficient weight to balance known pore pressures in all exposed formations.
- 7.0 A blowout preventer and related equipment (BOPE) shall be installed and tested prior to working in a wellbore with any exposed zone(s); (1) that are over pressured, (2) where the pressures are unknown, or (3) known to contain H_2S .
- 8.0 Within 30 days after plugging work is completed, file a Sundry Notice, Subsequent Report of Abandonment (Form 3160-5), through the Automated Fluid Minerals Support System (AFMSS) with the Field Manager, Bureau of Land Management, 6251 College Blvd., Suite A, Farmington, NM 87402. The report should show the manner in which the plugging work was carried out, the extent, by depth(s), of cement plugs placed, and the size and location, by depth(s), of casing left in the well. Show <u>date</u> well was plugged.
- 9.0 All permanently abandoned wells are to be marked with a permanent monument as specified in 43 CFR 3162.6(d). Unless otherwise approved.
- 10.0 If this well is located in a Specially Designated Area (SDA), compliance with the appropriate seasonal closure requirements will be necessary.

All of the above are minimum requirements. Failure to comply with the above conditions of approval may result in an assessment for noncompliance and/or a Shut-in Order being issued pursuant to 43 CFR 3163.1. You are further advised that any instructions, orders or decisions issued by the Bureau of Land Management are subject to administrative review pursuant to 43 CFR 3165.3 and appeal pursuant to 43 CFR 3165.4 and 43 CFR 4.700.

District I
1625 N. French Dr., Hobbs, NM 88240
Phone: (575) 393-6161 Fax: (575) 393-0720 District II

811 S. First St., Artesia, NM 88210 Phone:(575) 748-1283 Fax:(575) 748-9720 District III

1000 Rio Brazos Rd., Aztec, NM 87410 Phone:(505) 334-6178 Fax:(505) 334-6170

1220 S. St Francis Dr., Santa Fe, NM 87505 Phone:(505) 476-3470 Fax:(505) 476-3462

State of New Mexico Energy, Minerals and Natural Resources Oil Conservation Division 1220 S. St Francis Dr. **Santa Fe, NM 87505**

CONDITIONS

Action 232227

CONDITIONS

Operator:	OGRID:
HILCORP ENERGY COMPANY	372171
1111 Travis Street	Action Number:
Houston, TX 77002	232227
	Action Type:
	[C-103] NOI Plug & Abandon (C-103F)

CONDITIONS

Created By	Condition	Condition Date
john.harrisor	Accepted for record - NMOCD JRH 6/28/23. BLM approved P&A 6/22/23	6/28/2023