Received by OCD: 9/19/2023 10:06: Submit 1 copy 10 Appropriate District Office District 1 – (575) 393-6161	State of New Mexico Energy, Minerals and Natural Resources	Form C-103 Revised August 1, 2011
1625 N. French Dr., Hobbs, NM 88240 <u>District II</u> – (575) 748-1283 811 S. First St., Artesia, NM 88210 <u>District III</u> – (505) 334-6178 1000 Rio Brazos Rd., Aztec, NM 87410 <u>District IV</u> – (505) 476-3460 1220 S. St. Francis Dr., Santa Fe, NM 87505	OIL CONSERVATION DIVISION 1220 South St. Francis Dr. Santa Fe, NM 87505	WELL API NO. 30-025-01268 5. Indicate Type of Lease STATE X FEE 6. State Oil & Gas Lease No.
(DO NOT USE THIS FORM FOR PROPOS DIFFERENT RESERVOIR. USE "APPLIC PROPOSALS.)	CES AND REPORTS ON WELLS ALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A ATION FOR PERMIT" (FORM C-101) FOR SUCH	7. Lease Name or Unit Agreement Name New Mex A 8. Well Number 001
1. Type of Well: Oil Well Ga 2. Name of Operator	s Well Other SWD	9. OGRID Number
TLT SV	VD, Inc	287481
	1906, Hobbs, NM 88 241	10. Pool name or Wildcat Kemnitz; Lower Wolfcamp
4. Well Location		
Unit Letter K :		
Section 25	Township 16S Range 33E 11. Elevation (Show whether DR, RKB, RT, GR, et	NMPM Lea County
NOTICE OF IN PERFORM REMEDIAL WORK TEMPORARILY ABANDON DULL OR ALTER CASING DOWNHOLE COMMINGLE OTHER: 13. Describe proposed or complete.	PLUG AND ABANDON XX CHANGE PLANS MULTIPLE COMPL CASING/CEME OTHER: eted operations. (Clearly state all pertinent details, a	BSEQUENT REPORT OF: RK
	SEE ATTACHED	
I hereby certify that the information a	bove is true and complete to the best of my knowled	lge and belief.
SIGNATURE CARRE	TITLE Grant	DATE 9/17/2023
Type or print name M. J. M. For State Use Only	rchant E-mail address: mymorehe	pcnrxx0i/-ca-pHONE 575)492-1236
APPROVED BY: Xuy 3. Conditions of Approval (if any):	TITLE Compliance Offic	er A DATE <u>9/21/23</u>

Plugging Report TLT SWD LLC New Mex A #1 API 30-025-01268

3/3/2023 Move in rig. Set large matting board and rigged up. Replace connections on surface and intermediate heads. Installed BOP and start OOH with tubing. Stood back 65 stands and SION.

3/6/2023 Finish pulling tubing. 142 stands. Made gauge ring run and set down on fish at 9110'. Set 5 ½" CIBP at 9100'. Shut down.

3/7/2023 Loaded hole with brine and ran #BL. TOC at 4670'. RIH with tubing and spot 25 sx Class H cement on top of CIBP. POOH and SION.

3/8/2023 Spot 25 sx Class H cement at 7985'. POOH and spot 35 sx Class H cement with CaCl at 7196'. WOC and tagged at 6893'. POOH to 5980' and spot 25 sx Class C cement. POOH and SION.

Tagged cement at 5767'. POOH to 5014' and spot 35 sx cement. Pulled tubing and perforated casing at 4600'. Set packer and pressured up to 500#. Held. Bled off to the truck. Repeated to 750# and held. No drop in pressure. Called OCD. Pulled packer and perforated casing at 4400'. Set packer and got good communication to the intermediate head. Called OCD. RIH with tubing to 4663' and spot 25 sx cement across the perforations. POOH and SION. Called Kerry Fortner with the OCD and obtained verbal permission to attempt to pull casing from 4400'.

3/10/2023 Tagged cement at 4458'. POOH with tubing and removed the top spool and exposed the 5 ½" casing stub. Welded on 5 ½" pull stub. Did not attempt to remove seal assembly. Shut down.


3/13/2023 Pulled 130 pts on casing and jet cut casing at 4400'. Lost 2 point but did not come out of the wellhead slips. Shot wellhead with detonator cord. Casing came off of the slips. Laid down casing. Reassembled wellhead and shut down.

3/14/2023 RIH with tubing to 4471', circulated wellbore and spot 50 sx cement with CaCl. WOC and tagged at 4279'. POOH to 2810 and spot 40 sx cement. POOH to 1516' and spot 40 sx cement. POOH and SION.

3/15/2023 Perforated 9 5/8" casing at 424'. Pressured up to 500# and held. RIH with tubing and circulated cement to surface from 479' to surface with 155 sx. Rigged down. Dug out around the concrete cellar. Used track hoe with hammer to break up cement around the wellhead and to the east of the cellar. Will break up the remaining concrete tomorrow and cut off tomorrow.

3/16/2023 Used track hoe with hammer to attempt to break up concrete on the west side of the wellhead. Making slow progress. Will need a bigger machine. Removed the wellhead. Good cement in the 9 5/8" and 13 3/8" casing. Installed standard marker, removed the anchors and move out equipment.

New Mexico A' No.1 1983' FSL. 2313' FWL Unit Letter K: Sec 25, TILS, R-33E Lea County, New Mexico APE # 30-025-01268'

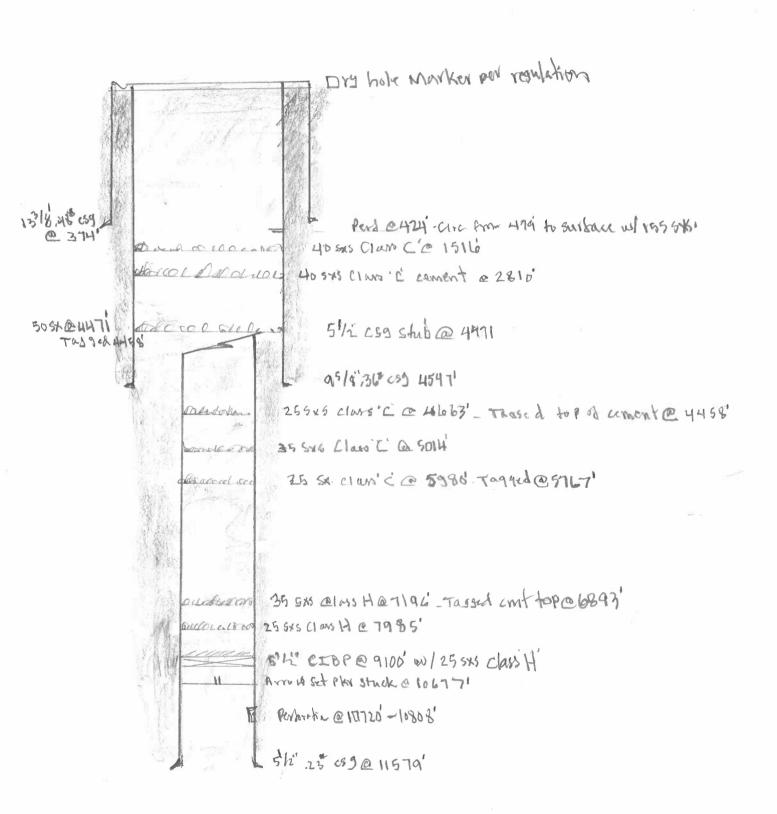

District I
1625 N. French Dr., Hobbs, NM 88240
Phone: (575) 393-6161 Fax: (575) 393-0720 District II

811 S. First St., Artesia, NM 88210 Phone:(575) 748-1283 Fax:(575) 748-9720 District III

1000 Rio Brazos Rd., Aztec, NM 87410 Phone:(505) 334-6178 Fax:(505) 334-6170

1220 S. St Francis Dr., Santa Fe, NM 87505 Phone:(505) 476-3470 Fax:(505) 476-3462

State of New Mexico Energy, Minerals and Natural Resources Oil Conservation Division 1220 S. St Francis Dr. **Santa Fe, NM 87505**

COMMENTS

Action 260938

COMMENTS

Operator:	OGRID:
TLT SWD, LLC	287481
P.O. Box 1906	Action Number:
Hobbs, NM 88241	260938
	Action Type:
	[C-103] Sub. Plugging (C-103P)

COMMENTS

Created By	Comment	Comment Date
plmartine	z DATA ENTRY PM.	9/21/2023

District I
1625 N. French Dr., Hobbs, NM 88240
Phone: (575) 393-6161 Fax: (575) 393-0720

District II 811 S. First St., Artesia, NM 88210 Phone:(575) 748-1283 Fax:(575) 748-9720

District III 1000 Rio Brazos Rd., Aztec, NM 87410 Phone:(505) 334-6178 Fax:(505) 334-6170

1220 S. St Francis Dr., Santa Fe, NM 87505 Phone:(505) 476-3470 Fax:(505) 476-3462

State of New Mexico Energy, Minerals and Natural Resources Oil Conservation Division 1220 S. St Francis Dr. **Santa Fe, NM 87505**

CONDITIONS

Action 260938

CONDITIONS

Operator:	OGRID:
TLT SWD, LLC	287481
P.O. Box 1906	Action Number:
Hobbs, NM 88241	260938
	Action Type:
	[C-103] Sub. Plugging (C-103P)

CONDITIONS

Created By		Condition Date
kfortner	Need C103Q and marker photo to release	9/21/2023