
Office	16 F Z MV 4					
December Minimals and Matricel December 2	Foff##C ¹ 1953 Revised July 18, 2013					
District I – (575) 393-6161 Energy, Wilnerals and Natural Resources WELL API NO.	, ,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,					
District II (575) 749 1092						
811 S. First St., Artesia, NM 88210 OIL CONSERVATION DIVISION 5. Indicate Type of Lease						
District III – (505) 334-6178 1220 South St. Francis Dr. STATE x FEE						
1000 Rio Brazos Rd., Aztec, NM 87410 District IV – (505) 476-3460 Santa Fe, NM 87505 6. State Oil & Gas Lease No.						
1220 S. St. Francis Dr., Santa Fe, NM						
87505 SUNDRY NOTICES AND REPORTS ON WELLS 7. Lease Name or Unit Agreemen	f					
SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A 7. Lease Name or Unit Agreemen Jalmat Field Yates Sand Unit	•					
PARTIE TO THE PROPERTY OF THE PARTIE AND THE PARTIE						
PROPOSALS.)						
1. Type of Well: Oil Well x Gas Well Other 208						
2. Name of Operator 9. OGRID Number						
Breitburn Operating, LP 370080						
3. Address of Operator 10. Pool name or Wildcat						
1111 Bagby Street, Ste. 1600 Houston, TX 77002 Jalmat (Tansil, Yates, Seven River	·s)					
4. Well Location						
Unit M_: 1310 feet from the South line and _330 feet from the _West_line						
Section 14 Township 22S Range 35E NMPM County: Lea, NM						
11. Elevation (Show whether DR, RKB, RT, GR, etc.)						
3590' GL						
12. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data						
NOTICE OF INTENTION TO:						
NOTICE OF INTENTION TO: SUBSEQUENT REPORT OF:						
PERFORM REMEDIAL WORK PLUG AND ABANDON REMEDIAL WORK ALTERING CAS						
TEMPORARILY ABANDON CHANGE PLANS COMMENCE DRILLING OPNS. P AND A	\boxtimes					
PULL OR ALTER CASING						
DOWNHOLE COMMINGLE						
CLOSED-LOOP SYSTEM						
13. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estim						
	ated date					
of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiple Completions: Attach wellbore diagram or proposed completion or recompletion.						
proposed completion or recompletion.						
proposed completion or recompletion. 05/10/23: Set CIBP @ 3775'. Tag @ 3775'. Spot 25 sx class C cmt plug @ 3775' to CTOC 3525'. WOC						
proposed completion or recompletion. 05/10/23: Set CIBP @ 3775'. Tag @ 3775'. Spot 25 sx class C cmt plug @ 3775' to CTOC 3525'. WOC 05/11/23: Tag TOC @ 3498'. Spot 25 sx class C cmt @ 1945' to CTOC @ 1700'. WOC. Tag TOC @ 1718'. Perf @ 480'. No circulation.						
proposed completion or recompletion. 05/10/23: Set CIBP @ 3775'. Tag @ 3775'. Spot 25 sx class C cmt plug @ 3775' to CTOC 3525'. WOC						
proposed completion or recompletion. 05/10/23: Set CIBP @ 3775'. Tag @ 3775'. Spot 25 sx class C cmt plug @ 3775' to CTOC 3525'. WOC 05/11/23: Tag TOC @ 3498'. Spot 25 sx class C cmt @ 1945' to CTOC @ 1700'. WOC. Tag TOC @ 1718'. Perf @ 480'. No circulation.						
proposed completion or recompletion. 05/10/23: Set CIBP @ 3775'. Tag @ 3775'. Spot 25 sx class C cmt plug @ 3775' to CTOC 3525'. WOC 05/11/23: Tag TOC @ 3498'. Spot 25 sx class C cmt @ 1945' to CTOC @ 1700'. WOC. Tag TOC @ 1718'. Perf @ 480'. No circulation. Held 500 psi. Perf @ 150'. No circulation. Held @ 500 psi. Spot 60 sx Class C cmt @ 530'-0' Surface.						
proposed completion or recompletion. 05/10/23: Set CIBP @ 3775'. Tag @ 3775'. Spot 25 sx class C cmt plug @ 3775' to CTOC 3525'. WOC 05/11/23: Tag TOC @ 3498'. Spot 25 sx class C cmt @ 1945' to CTOC @ 1700'. WOC. Tag TOC @ 1718'. Perf @ 480'. No circulation. Held 500 psi. Perf @ 150'. No circulation. Held @ 500 psi. Spot 60 sx Class C cmt @ 530'-0' Surface.						
proposed completion or recompletion. 05/10/23: Set CIBP @ 3775'. Tag @ 3775'. Spot 25 sx class C cmt plug @ 3775' to CTOC 3525'. WOC 05/11/23: Tag TOC @ 3498'. Spot 25 sx class C cmt @ 1945' to CTOC @ 1700'. WOC. Tag TOC @ 1718'. Perf @ 480'. No circulation. Held 500 psi. Perf @ 150'. No circulation. Held @ 500 psi. Spot 60 sx Class C cmt @ 530'-0' Surface. 05/11/2023: Cut casing and capped						
proposed completion or recompletion. 05/10/23: Set CIBP @ 3775'. Tag @ 3775'. Spot 25 sx class C cmt plug @ 3775' to CTOC 3525'. WOC 05/11/23: Tag TOC @ 3498'. Spot 25 sx class C cmt @ 1945' to CTOC @ 1700'. WOC. Tag TOC @ 1718'. Perf @ 480'. No circulation. Held 500 psi. Perf @ 150'. No circulation. Held @ 500 psi. Spot 60 sx Class C cmt @ 530'-0' Surface. 05/11/2023: Cut casing and capped						
proposed completion or recompletion. 05/10/23: Set CIBP @ 3775'. Tag @ 3775'. Spot 25 sx class C cmt plug @ 3775' to CTOC 3525'. WOC 05/11/23: Tag TOC @ 3498'. Spot 25 sx class C cmt @ 1945' to CTOC @ 1700'. WOC. Tag TOC @ 1718'. Perf @ 480'. No circulation. Held 500 psi. Perf @ 150'. No circulation. Held @ 500 psi. Spot 60 sx Class C cmt @ 530'-0' Surface. 05/11/2023: Cut casing and capped NOTE: Spud Date:						
proposed completion or recompletion. 05/10/23: Set CIBP @ 3775'. Tag @ 3775'. Spot 25 sx class C cmt plug @ 3775' to CTOC 3525'. WOC 05/11/23: Tag TOC @ 3498'. Spot 25 sx class C cmt @ 1945' to CTOC @ 1700'. WOC. Tag TOC @ 1718'. Perf @ 480'. No circulation. Held 500 psi. Perf @ 150'. No circulation. Held @ 500 psi. Spot 60 sx Class C cmt @ 530'-0' Surface. 05/11/2023: Cut casing and capped						
proposed completion or recompletion. 05/10/23: Set CIBP @ 3775'. Tag @ 3775'. Spot 25 sx class C cmt plug @ 3775' to CTOC 3525'. WOC 05/11/23: Tag TOC @ 3498'. Spot 25 sx class C cmt @ 1945' to CTOC @ 1700'. WOC. Tag TOC @ 1718'. Perf @ 480'. No circulation. Held 500 psi. Perf @ 150'. No circulation. Held @ 500 psi. Spot 60 sx Class C cmt @ 530'-0' Surface. 05/11/2023: Cut casing and capped NOTE: Spud Date: I hereby certify that the information above is true and complete to the best of my knowledge and belief.						
proposed completion or recompletion. 05/10/23: Set CIBP @ 3775'. Tag @ 3775'. Spot 25 sx class C cmt plug @ 3775' to CTOC 3525'. WOC 05/11/23: Tag TOC @ 3498'. Spot 25 sx class C cmt @ 1945' to CTOC @ 1700'. WOC. Tag TOC @ 1718'. Perf @ 480'. No circulation. Held 500 psi. Perf @ 150'. No circulation. Held @ 500 psi. Spot 60 sx Class C cmt @ 530'-0' Surface. 05/11/2023: Cut casing and capped NOTE: Spud Date:						
proposed completion or recompletion. 05/10/23: Set CIBP @ 3775'. Tag @ 3775'. Spot 25 sx class C cmt plug @ 3775' to CTOC 3525'. WOC 05/11/23: Tag TOC @ 3498'. Spot 25 sx class C cmt @ 1945' to CTOC @ 1700'. WOC. Tag TOC @ 1718'. Perf @ 480'. No circulation. Held 500 psi. Perf @ 150'. No circulation. Held @ 500 psi. Spot 60 sx Class C cmt @ 530'-0' Surface. 05/11/2023: Cut casing and capped NOTE: Spud Date: I hereby certify that the information above is true and complete to the best of my knowledge and belief. SIGNATURE SIGNATURE Operations Manager DATE 03/15/2024	of					
proposed completion or recompletion. 05/10/23: Set CIBP @ 3775'. Tag @ 3775'. Spot 25 sx class C cmt plug @ 3775' to CTOC 3525'. WOC 05/11/23: Tag TOC @ 3498'. Spot 25 sx class C cmt @ 1945' to CTOC @ 1700'. WOC. Tag TOC @ 1718'. Perf @ 480'. No circulation. Held 500 psi. Perf @ 150'. No circulation. Held @ 500 psi. Spot 60 sx Class C cmt @ 530'-0' Surface. 05/11/2023: Cut casing and capped NOTE: Spud Date: I hereby certify that the information above is true and complete to the best of my knowledge and belief. SIGNATURE SIGNATURE Jason McCullough E-mail address:Jason.McCullough@axisofs.com PHONE:832-995-771.	of					
proposed completion or recompletion. 05/10/23: Set CIBP @ 3775'. Tag @ 3775'. Spot 25 sx class C cmt plug @ 3775' to CTOC 3525'. WOC 05/11/23: Tag TOC @ 3498'. Spot 25 sx class C cmt @ 1945' to CTOC @ 1700'. WOC. Tag TOC @ 1718'. Perf @ 480'. No circulation. Held 500 psi. Perf @ 150'. No circulation. Held @ 500 psi. Spot 60 sx Class C cmt @ 530'-0' Surface. 05/11/2023: Cut casing and capped NOTE: Spud Date: I hereby certify that the information above is true and complete to the best of my knowledge and belief. SIGNATURE SIGNATURE Operations Manager DATE 03/15/2024	of					

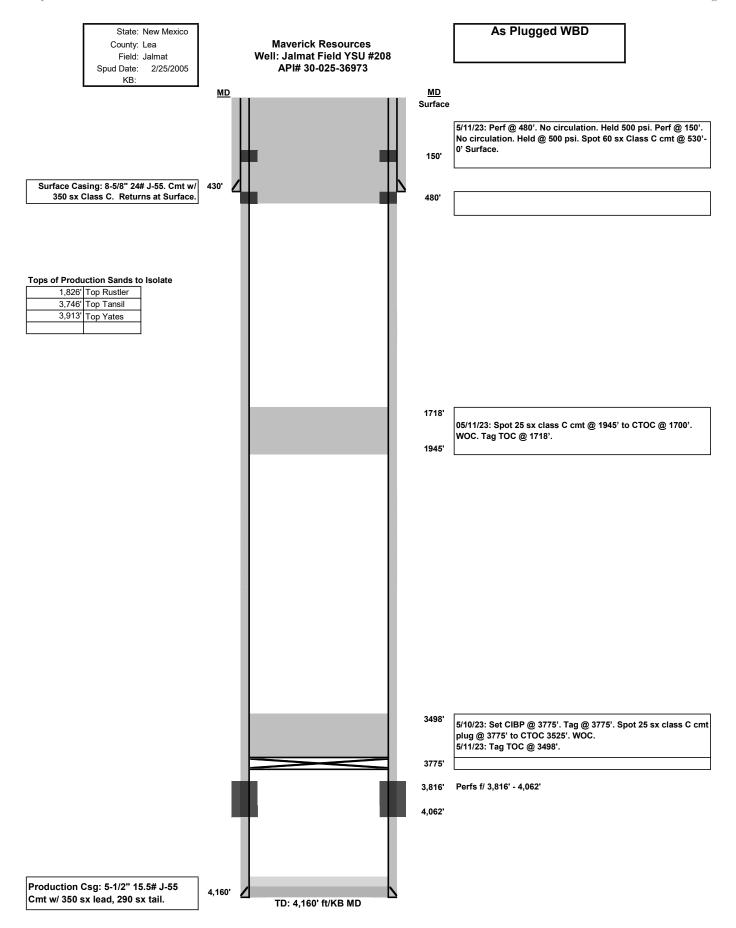

District I
1625 N. French Dr., Hobbs, NM 88240
Phone: (575) 393-6161 Fax: (575) 393-0720

District II 811 S. First St., Artesia, NM 88210 Phone:(575) 748-1283 Fax:(575) 748-9720 District III

1000 Rio Brazos Rd., Aztec, NM 87410 Phone:(505) 334-6178 Fax:(505) 334-6170

1220 S. St Francis Dr., Santa Fe, NM 87505 Phone:(505) 476-3470 Fax:(505) 476-3462

State of New Mexico Energy, Minerals and Natural Resources Oil Conservation Division 1220 S. St Francis Dr. **Santa Fe, NM 87505**

COMMENTS

Action 341885

COMMENTS

Operator:	OGRID:
BREITBURN OPERATING LP	370080
1000 Main Street, Suite 2900	Action Number:
Houston, TX 77002	341885
Γ.	Action Type:
	[C-103] Sub. Plugging (C-103P)

COMMENTS

Created By		Comment Date
plmartinez	DATA ENTRY PM	5/31/2024

District I
1625 N. French Dr., Hobbs, NM 88240
Phone: (575) 393-6161 Fax: (575) 393-0720 District II

811 S. First St., Artesia, NM 88210 Phone:(575) 748-1283 Fax:(575) 748-9720

District III 1000 Rio Brazos Rd., Aztec, NM 87410 Phone:(505) 334-6178 Fax:(505) 334-6170

1220 S. St Francis Dr., Santa Fe, NM 87505 Phone:(505) 476-3470 Fax:(505) 476-3462

State of New Mexico Energy, Minerals and Natural Resources Oil Conservation Division 1220 S. St Francis Dr. **Santa Fe, NM 87505**

CONDITIONS

Action 341885

CONDITIONS

Operator:	OGRID:
BREITBURN OPERATING LP	370080
1000 Main Street, Suite 2900	Action Number:
Houston, TX 77002	341885
	Action Type:
	[C-103] Sub. Plugging (C-103P)

CONDITIONS

Created By		Condition Date
gcordero	well head cut off 5/11/23. CBL in Well File	5/31/2024