Form 3160-3 (June 2015)		FORM APPROOMB No. 1004 Expires: January	4-0137	
UNITED STATE: DEPARTMENT OF THE I BUREAU OF LAND MAN.	NTERIOR	5. Lease Serial No.		
APPLICATION FOR PERMIT TO D		6. If Indian, Allotee or Tril	oe Name	
	EENTER	7. If Unit or CA Agreemen	it, Name and No.	
1b. Type of Well: Oil Well Gas Well O 1c. Type of Completion: Hydraulic Fracturing S	8. Lease Name and Well N	8. Lease Name and Well No.		
2. Name of Operator		9. API Well No. 30-015	3-55245	
3a. Address	3b. Phone No. (include area code)	10. Field and Pool, or Exp	loratory	
Location of Well (Report location clearly and in accordance of At surface At proposed prod. zone	with any State requirements.*)	11. Sec., T. R. M. or Blk. a	and Survey or Area	
14. Distance in miles and direction from nearest town or post off	ice*	12. County or Parish	13. State	
15. Distance from proposed* location to nearest property or lease line, ft. (Also to nearest drig. unit line, if any)	16. No of acres in lease 17. Sp	acing Unit dedicated to this we	II	
18. Distance from proposed location* to nearest well, drilling, completed, applied for, on this lease, ft.	19. Proposed Depth 20./BI	.M/BIA Bond No. in file		
21. Elevations (Show whether DF, KDB, RT, GL, etc.)	22. Approximate date work will start*	23. Estimated duration		
	24. Attachments			
The following, completed in accordance with the requirements o (as applicable)	f Onshore Oil and Gas Order No. 1, and the	ne Hydraulic Fracturing rule per	: 43 CFR 3162.3-3	
 Well plat certified by a registered surveyor. A Drilling Plan. A Surface Use Plan (if the location is on National Forest Syste SUPO must be filed with the appropriate Forest Service Office 	Item 20 above). m Lands, the 5. Operator certification.	tions unless covered by an existing and/or plans as may be		
25. Signature	Name (Printed/Typed)	Date		
Title				
Approved by (Signature)	Name (Printed/Typed)	Date		
Title	Office	-		
Application approval does not warrant or certify that the applicant applicant to conduct operations thereon. Conditions of approval, if any, are attached.	nt holds legal or equitable title to those rig	hts in the subject lease which w	ould entitle the	
Title 18 U.S.C. Section 1001 and Title 43 U.S.C. Section 1212, r of the United States any false, fictitious or fraudulent statements			partment or agency	
		1		

APPROVED WITH CONDITIONS

*(Instructions on page 2)

<u>District 1</u>
1625 N. French Dr., Hobbs, NM 88240
Phone: (575) 393-6161 Fax: (575) 393-0720
<u>District II</u>
811 S. First St., Artesia, NM 88210

Phone: (575) 748-1283 Fax: (575) 748-9720 <u>District IIII</u> 1000 Rio Brazos Road, Aztec, NM 87410 Phone: (505) 334-6178 Fax: (505) 334-6170

1220 S. St. Francis Dr., Santa Fe, NM 87505 Phone: (505) 476-3460 Fax: (505) 476-3462

District IV

State of New Mexico

Energy, Minerals & Natural Resources Department OIL CONSERVATION DIVISION 1220 South St. Francis Dr.

Santa Fe, NM 87505

Form C-102 Revised August 1, 2011 Submit one copy to appropriate District Office

☐ AMENDED REPORT

WELL LOCATION AND ACREAGE DEDICATION PLAT


¹ API Number		² Pool Code			
30-015-55245		53805	SAND DUNE; BONE SPRIN	G,	
⁴ Property Code		⁵ Pr	⁶ Well Number		
325761		BORA BOR	302H		
⁷ OGRID No.		8 O _I	8 Operator Name		
6137		DEVON ENERGY PRO	3500.1		

¹⁰ Surface Location

	UL or lot no.	Section	Township	Range	Lot Idn	Feet from the	North/South line	Feet from the	East/West line	County
	0	12	23 S	31 E		490	SOUTH	2520	EAST	EDDY
" Bottom Hole Location If Different From Surface										
	III ou lot no	Continu	Township	Dange	L of Idn	East fuom the	Nouth/Couth line	East from the	Foot/Woot line	Country

UL or lot no.	Section	Township	Range	Lot Idn	Feet from the	North/South line	Feet from the	East/West line	County
N	24	23 S	31 E		20	SOUTH	2200	WEST	EDDY
12 Dedicated Ac	es 13 Joint	or Infill 14	Consolidatio	n Code			15 Order No.		
320									

No allowable will be assigned to this completion until all interests have been consolidated or a non-standard unit has been approved by the division.

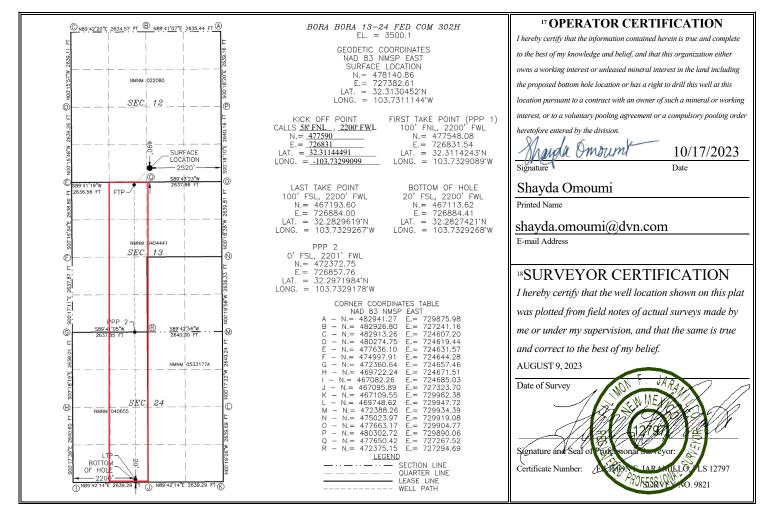

Intent	X	As Dril	led											
API#														
DEV	Operator Name: DEVON ENERGY PRODUCTION COMPANY, L.P.				1	Property Name: BORA BORA 13-24 FED COM						Well Number 302H		
Kick C	Off Point	(KOP)												
UL C	Section 13	Township 23S	Range 31E	Lot	Feet 58		From NOF		Feet 2200			n E/W VEST	County EDDY	
Latitu		233	312		Longitu	ıde	1101	· · · · ·	2200		•	VLST	NAD	
32.311	44491				-103.73	29909	99						83	
First T	ake Poin	it (FTP)												
UL C	Section 13	Township 23S	Range 31E	Lot	Feet 100		From NOR	•	Feet 2200		From	n E/W ST	County EDDY	
Latitu	_		• • •	<u> </u>	Longitu 103.7		1		1				NAD 83	
Last T	ake Poin	t (LTP)												
UL N	Section 24	Township 23S	Range 31E	Lot	Feet 100		om N/S OUTH	Feet 220		From WES		Count EDD	•	
Latitu 32.2	de 282961	9				ongitude NAD 03.7329267 83								
Is this	well the	defining v	vell for th	e Horiz	zontal Տր	oacin	ıg Unit?	, [N					
Is this	well an	infill well?		Υ]									
	l is yes p ng Unit.	lease prov	ide API if a	availab	ile, Opei	rator	Name	and v	vell nu	mber	for [Definir	ng well fo	r Horizontal
API #)15-4710	3												
Opei	rator Nar	me:	1			Pro	perty N	lame						Well Number
DEV	ON ENEF	RGY PRODU	JCTION C	OMPAI	NY,	ВС)ra bo	RA 13	8-24 FE	D CO	M			213H

KZ 06/29/2018

State of New Mexico Energy, Minerals and Natural Resources Department

Submit Electronically Via E-permitting

Oil Conservation Division 1220 South St. Francis Dr. Santa Fe, NM 87505

NATURAL GAS MANAGEMENT PLAN

This Natural Gas Management Plan must be submitted with each Application for Permit to Drill (APD) for a new or recompleted well.

Section 1 – Plan Description <u>Effective May 25, 2021</u>

I. Operator: Devon End	ergy Production	n Company, L.P.	OGRID:	6137		Date:10	<u>/10 / 2023</u>
II. Type: ☒ Original ☐] Amendment	due to □ 19.15.27.9	9.D(6)(a) NMA	C □ 19.15.27.9.D(6)(b) N	MAC □ Othe	er.
If Other, please describe	:						
III. Well(s): Provide the be recompleted from a s					wells pro	oposed to be	drilled or proposed to
Well Name	API	ULSTR	Footages	Anticipated Oil BBL/D		cipated MCF/D	Anticipated Produced Water BBL/D
See Attached							
V. Anticipated Schedul proposed to be recomple Well Name	e: Provide the		ion for each nev			<u> </u>	•
See Attached							
VI. Separation Equipm VII. Operational Pract Subsection A through F VIII. Best Management during active and planner	tices: X Attacl of 19.15.27.8 I	h a complete descr NMAC.	iption of the ac	tions Operator will	l take to	o comply with	n the requirements of

Section 2 – Enhanced Plan EFFECTIVE APRIL 1, 2022

Beginning April 1, 2022, an operator that is not in compliance with its statewide natural gas capture requirement for the applicable reporting area must complete this section.

🗵 Operator certifies that it is not required to complete this section because Operator is in compliance with its statewide natural gas capture requirement for the applicable reporting area.

IX. Anticipated Natural Gas Production:

Well	API	Anticipated Average Natural Gas Rate MCF/D	Anticipated Volume of Natural Gas for the First Year MCF

X. Natural Gas Gathering System (NGGS):

Operator	System	ULSTR of Tie-in	Anticipated Gathering Start Date	Available Maximum Daily Capacity of System Segment Tie-in

XI. Map. \square Attach an accurate and legible map depicting the location of the well(s), the anticipated pipeline route(s) connecting the
production operations to the existing or planned interconnect of the natural gas gathering system(s), and the maximum daily capacity of
the segment or portion of the natural gas gathering system(s) to which the well(s) will be connected.

XII. Line C	Capacity. The natural	gas gathering system	\square will \square will	not have capacity to	o gather 100%	of the anticipated	natural gas
production v	volume from the well	prior to the date of fir	st production.				

XIII. Line Pressure. Operator \square does \square does not anticipate that its existing well(s) connected to the same segment, or portion, of the same segment is a connected to the same segment.	he
natural gas gathering system(s) described above will continue to meet anticipated increases in line pressure caused by the new well(s)).

] Attach (Onerator's nlar	to manage	nroduction	in resnonse	to the increase	sed line pressure

XIV. Confidentiality: Operator asserts confidentiality pursuant to Section 71-2-8 NMSA 1978 for the information provides the information provide	ded in
Section 2 as provided in Paragraph (2) of Subsection D of 19.15.27.9 NMAC, and attaches a full description of the specific inform	nation
for which confidentiality is asserted and the basis for such assertion.	

(h)

(i)

Section 3 - Certifications <u>Effective May 25, 2021</u>

Operator certifies that, after reasonable inquiry and based on the available information at the time of submittal: 🗵 Operator will be able to connect the well(s) to a natural gas gathering system in the general area with sufficient capacity to transport one hundred percent of the anticipated volume of natural gas produced from the well(s) commencing on the date of first production, taking into account the current and anticipated volumes of produced natural gas from other wells connected to the pipeline gathering system; or ☐ Operator will not be able to connect to a natural gas gathering system in the general area with sufficient capacity to transport one hundred percent of the anticipated volume of natural gas produced from the well(s) commencing on the date of first production, taking into account the current and anticipated volumes of produced natural gas from other wells connected to the pipeline gathering system. If Operator checks this box, Operator will select one of the following: Well Shut-In. ☐ Operator will shut-in and not produce the well until it submits the certification required by Paragraph (4) of Subsection D of 19.15.27.9 NMAC; or Venting and Flaring Plan.

Operator has attached a venting and flaring plan that evaluates and selects one or more of the potential alternative beneficial uses for the natural gas until a natural gas gathering system is available, including: power generation on lease; (a) power generation for grid; **(b)** (c) compression on lease; (d) liquids removal on lease; (e) reinjection for underground storage; **(f)** reinjection for temporary storage; reinjection for enhanced oil recovery; (g)

Section 4 - Notices

1. If, at any time after Operator submits this Natural Gas Management Plan and before the well is spud:

other alternative beneficial uses approved by the division.

fuel cell production; and

- (a) Operator becomes aware that the natural gas gathering system it planned to connect the well(s) to has become unavailable or will not have capacity to transport one hundred percent of the production from the well(s), no later than 20 days after becoming aware of such information, Operator shall submit for OCD's approval a new or revised venting and flaring plan containing the information specified in Paragraph (5) of Subsection D of 19.15.27.9 NMAC; or
- (b) Operator becomes aware that it has, cumulatively for the year, become out of compliance with its baseline natural gas capture rate or natural gas capture requirement, no later than 20 days after becoming aware of such information, Operator shall submit for OCD's approval a new or revised Natural Gas Management Plan for each well it plans to spud during the next 90 days containing the information specified in Paragraph (2) of Subsection D of 19.15.27.9 NMAC, and shall file an update for each Natural Gas Management Plan until Operator is back in compliance with its baseline natural gas capture rate or natural gas capture requirement.
- 2. OCD may deny or conditionally approve an APD if Operator does not make a certification, fails to submit an adequate venting and flaring plan which includes alternative beneficial uses for the anticipated volume of natural gas produced, or if OCD determines that Operator will not have adequate natural gas takeaway capacity at the time a well will be spud.

I certify that, after reasonable inquiry, the statements in and attached to this Natural Gas Management Plan are true and correct to the best of my knowledge and acknowledge that a false statement may be subject to civil and criminal penalties under the Oil and Gas Act.

Signature:
Printed Name: Jeff Walla
Title: Surface Land and Regulatory Manager
E-mail Address:
Date:
Phone:
OIL CONSERVATION DIVISION
(Only applicable when submitted as a standalone form)
Approved By:
Title:
Approval Date:
Conditions of Approval:

NATURAL GAS MANAGEMENT PLAN

Section 1 - Plan Description

III. Well(s): Provide the following information for each new or recompleted well or set of wells proposed to be drilled or proposed to be recompleted from a single well pad or connected to a central delivery point.

									Anticipated	Anticipated
								Anticipated	Gas	Produced Water
Well Name	API	UL	STR		FOOTA	GES		Oil BBL/D	MCF/D	BBL/D
Bora Bora 13-24 Fed Com 302H			12-23S-31E	2520	FEL	490	FSL	(+/-) 1130bop	od/(+/-)2839mcf	fd/(+/-)6074bwpd
Bora Bora 13-24 Fed Com 303H			12-23S-31E	2490 FEL 490 FSL (+/-) 1130bopd/(+/-)2839mcfd/(+/-)6074bwp				fd/(+/-)6074bwpd		
Bora Bora 13-24 Fed Com 813H			12-23S-31E	2460 FEL 490 FSL (+/-) 913bopd/(+/-)4641mcfd/(+/-)3197bwp				d/(+/-)3197bwpd		

V. Anticipated Schedule: Provide the following information for each new or recompleted well or set of wells proposed to be drilled or proposed to be recompleted from a single well pad or connected to a central delivery point.

				Completion		First
			TD Reached	Commence	Initial Flow	Production
Well Name	API	Spud Date	Date	ment Date	back Date	Date
Bora Bora 13-24 Fed Com 302H		6/1/2024	7/1/2024	10/29/2024	10/29/2024	10/29/2024
Bora Bora 13-24 Fed Com 303H		6/1/2024	7/1/2024	10/29/2024	10/29/2024	10/29/2024
Bora Bora 13-24 Fed Com 813H		6/1/2024	7/1/2024	10/29/2024	10/29/2024	10/29/2024

^{*}dates above are subject to change



VI. Separation Equipment

Devon Energy Production Company, L.P. utilizes a "stage separation" process in which oil and gas separation is carried out through a series of separators operating at successively reduced pressures. Hydrocarbon liquids are produced into a high-pressure inlet separator, then carried through one or more lower pressure separation vessels before entering the storage tanks. The purpose of this separation process is to attain maximum recovery of liquid hydrocarbons from the fluids and allow maximum capture of produced gas into the sales pipeline. Devon utilizes a series of Low-Pressure Compression units to capture gas off the staged separation and send it to the sales pipeline. This process minimizes the amount of flash gas that enters the end-stage storage tanks that is subsequently vented or flared.



VII. Operational Practices

Devon Energy Production Company, L. P. will employ best management practices and control technologies to maximize the recovery and minimize waste of natural gas through venting and flaring.

- During drilling operations, Devon will utilize flares and/or combustors to capture and control
 natural gas, where technically feasible. If flaring is deemed technically in-feasible, Devon will
 employ best management practices to minimize or reduce venting to the extent possible.
- During completions operations, Devon will utilize Green Completion methods to capture gas
 produced during well completions that is otherwise vented or flared. If capture is technically
 in-feasible, flares and/or combustors will be used to capture and control flow back fluids
 entering into frac tanks during initial flowback. Upon indication of first measurable hydrocarbon
 volumes, Devon will turn operations to onsite separation vessels and flow to the gathering
 pipeline.
- During production operations, Devon will take every practical effort to minimize waste of natural gas through venting and flaring by:
 - Designing and constructing facilities in a manner consistent to achieve maximum capture and control of hydrocarbon liquids & produced gas
 - Utilizing a closed-loop capture system to collect and route produced gas to sales line via low pressure compression, or to a flare/combustor
 - Flaring in lieu of venting, where technically feasible
 - Utilizing auto-ignitors or continuous pilots, with thermocouples connected to Scada, to quickly detect and resolve issues related to malfunctioning flares/combustors
 - Employ the use of automatic tank gauging to minimize storage tank venting during loading events
 - Installing air-driven or electric-driven pneumatics & combustion engines, where technically feasible to minimize venting to the atmosphere
 - Confirm equipment is properly maintained and repaired through a preventative maintenance and repair program to ensure equipment meets all manufacturer specifications
 - Conduct and document AVO inspections on the frequency set forth in Part 27 to detect and repair any onsite leaks as quickly and efficiently as is feasible



VIII. Best Management Practices during Maintenance

Devon Energy Production Company, L.P. will utilize best management practices to minimize venting during active and planned maintenance activities. Devon is operating under guidance that production facilities permitted under NOI permits have no provisions to allow high pressure flaring and high pressure flaring is only allowed in disruption scenarios so long as the duration is less than eight hours. When technically feasible, flaring during maintenance activities will be utilized in lieu of venting to the atmosphere. Devon will work with third-party operators during scheduled maintenance of downstream pipeline or processing plants to address those events ahead of time to minimize venting. Actions considered include identifying alternative capture approaches or planning to temporarily reduce production or shut in the well to address these circumstances.

BORA BORA 13-24 FED COM 302H

1. Geologic Formations

TVD of target	11250	Pilot hole depth	14050
MD at TD:	21589	Deepest expected fresh water	

Basin

1 1	TTT (73.51)	
Depth		
(TVD)	Bearing/Target	Hazards*
from KB	Zone?	
1025		
1330		
4280		
4525		
5460		
6710		
8430		
9515		
10090		
10600		
	_	
	1025 1330 4280 4525 5460 6710 8430 9515 10090	(TVD) Bearing/Target from KB Zone? 1025 1330 4280 4525 5460 6710 8430 9515 10090 10090

^{*}H2S, water flows, loss of circulation, abnormal pressures, etc.

2. Casing Program

		Wt			Casing Interval		Casing Interval		
Hole Size	Csg. Size	(PPF)	Grade	Conn	From (MD)	To (MD)	From (TVD)	To (TVD)	
14 3/4	10 3/4	45 1/2	J-55	ВТС	0	1050	0	1050	
9 7/8	8 5/8	32	P110	Sprint FJ	0	10685	0	10685	
7 7/8	5 1/2	20	P110	DWC / C-IS+	0	21589	0	11250	

[•]All casing strings will be tested in accordance with 43 CFR 3172. Must have table for contingency casing.

3. Cementing Program

Assuming no returns are established while drilling, Devon requests to pump a two stage cement job on the intermediate casing string with the first stage being pumped conventionally with the calculated top of cement at the Brushy Canyon and the second stage performed as a bradenhead squeeze with planned cement from the Brushy Canyon to surface. The final cement top will be verified by Echo-meter. Devon will include the Echo-meter verified fluid top and the volume of displacement fluid above the cement slurry in the annulus in all post-drill sundries on wells utilizing this cement program. Devon will report to the BLM the volume of fluid (limited to 1 bbls) used to flush intermediate casing valves following backside cementing procedures.

Casing	# Sks	TOC	Wt.	Yld (ft3/sack)	Slurry Description
Surface	633	Surf	13.2 1.44		Lead: Class C Cement + additives
Int 1	478	Surf	13.0	2.3	2nd State: Bradenhead Squeeze - Lead: Class C Cement + additives
IIIt I	450	6818	13.2	1.44	Tail: Class H / C + additives
Production	35	10185	9	3.27	Lead: Class H /C + additives
Froduction	1430	10786	13.2	1.44	Tail: Class H / C + additives

Casing String	% Excess
Surface	50%
Intermediate 1	30%
Prod	10%

4. Pressure Control Equipment (Three String Design)

BOP installed and tested before drilling which hole?	Size?	Min. Required WP	Туре		✓	Tested to:	
			Anı	nular	X	50% of rated working pressure	
Int 1	13-5/8"	5M	Bline	l Ram	X		
IIIt I	13-3/6		3111		Pipe	Ram	
			Doub	le Ram	X	JIVI	
			Other*				
			Annular (5M)		X	50% of rated working pressure	
Dun dunation	13-5/8"	514	Blind Ram		X		
Production	13-3/8	5M	Pipe	Ram		514	
			Doub	le Ram	X	5M	
			Other*	Other*			
			Annular (5M)				
			Blind Ram				
			Pipe Ram				
			Double Ram]	
			Other*				
N A variance is requested for	the use of a	diverter or	the surface	casing. See	attached for s	chematic.	
Y A variance is requested to a	run a 5 M a	nnular on a	10M system				

5. Mud Program (Three String Design)

Section	Туре	Weight (ppg)
Surface	FW Gel	8.5-9
Intermediate	DBE / Cut Brine	10-10.5
Production	OBM	8.5-9

Sufficient mud materials to maintain mud properties and meet minimum lost circulation and weight increase requirements will be kept on location at all times.

What will be used to monitor the loss or gain of fluid?	PVT/Pason/Visual Monitoring

6. Logging and Testing Procedures

Logging, C	Logging, Coring and Testing								
	Will run GR/CNL from TD to surface (horizontal well - vertical portion of hole). Stated logs run will be in the								
X	Completion Report and sbumitted to the BLM.								
	No logs are planned based on well control or offset log information.								
	Drill stem test? If yes, explain.								
	Coring? If yes, explain.								

Additional	logs planned	Interval
	Resistivity	Int. shoe to KOP
	Density	Int. shoe to KOP
X	CBL	Production casing
X	Mud log	Intermediate shoe to TD
	PEX	

7. Drilling Conditions

Condition	Specfiy what type and where?
BH pressure at deepest TVD	5265
Abnormal temperature	No

Mitigation measure for abnormal conditions. Describe. Lost circulation material/sweeps/mud scavengers.

Hydrogren Sulfide (H2S) monitors will be installed prior to drilling out the surface shoe. If H2S is detected in concentrations greater than 100 ppm, the operator will comply with the provisions of 43 CFR 3176. If Hydrogen Sulfide is encountered measured values and formations will be provided to the BLM.

measured values and formations will be provided to the BLW.					
N	H2S is present				
Y	H2S plan attached.				

BORA BORA 13-24 FED COM 302H

8. Other facets of operation

Is this a walking operation? Potentially

- 1 If operator elects, drilling rig will batch drill the surface holes and run/cement surface casing; walking the rig to next wells on the pad.
- 2 The drilling rig will then batch drill the intermediate sections and run/cement intermediate casing; the wellbore will be isolated with a blind flange and pressure gauge installed for monitoring the well before walking to the next well.
- 3 The drilling rig will then batch drill the production hole sections on the wells with OBM, run/cement production casing, and install TA caps or tubing heads for completions.

NOTE: During batch operations the drilling rig will be moved from well to well however, it will not be removed from the pad until all wells have production casing run/cemented.

Will be pre-setting casing? Potentially

- 1 Spudder rig will move in and batch drill surface hole.
 - a. Rig will utilize fresh water based mud to drill surface hole to TD. Solids control will be handled entirely on a closed loop basis.,
- 2 After drilling the surface hole section, the spudder rig will run casing and cement following all of the applicable rules and regulations (43 CFR 3172, all COAs and NMOCD regulations).
- 3 The wellhead will be installed and tested once the surface casing is cut off and the WOC time has been reached.
- 4 A blind flange with the same pressure rating as the wellhead will be installed to seal the wellbore. Pressure will be monitored with a pressure gauge installed on the wellhead.
- 5 Spudder rig operations is expected to take 4-5 days per well on a multi-well pa.
- 6 The NMOCD will be contacted and notified 24 hours prior to commencing spudder rig operations.
- 7 Drilling operations will be performed with drilling rig. A that time an approved BOP stack will be nippled up and tested on the wellhead before drilling operations commences on each well.
 - a. The NMOCD will be contacted / notified 24 hours before the drilling rig moves back on to the pad with the pre-set surface casing.

Attachment	ts
X	Directional Plan
	Other, describe

Devon Energy APD VARIANCE DATA

OPERATOR NAME: Devon Energy

1. SUMMARY OF Variance:

Devon Energy respectfully requests approval for the following additions to the drilling plan:

1. Potential utilization of a spudder rig to pre-set surface casing.

2. Description of Operations

- 1. A spudder rig contractor may move in their rig to drill the surface hole section and pre-set surface casing on this well.
 - **a.** After drilling the surface hole section, the rig will run casing and cement following all of the applicable rules and regulations (OnShore Order 2, all COAs and NMOCD regulations).
 - **b.** Rig will utilize fresh water based mud to drill surface hole to TD.
- 2. The wellhead will be installed and tested once the surface casing is cut off and the WOC time has been reached.
- **3.** A blind flange with the same pressure rating as the wellhead will be installed to seal the wellbore. Pressure will be monitored with needle valves installed on two wingvalves.
 - **a.** A means for intervention will be maintained while the drilling rig is not over the well.
- **4.** The BLM will be contacted and notified 24 hours prior to commencing spudder rig operations.
- **5.** Drilling operation will be performed with the big rig. At that time an approved BOP stack will be nippled up and tested on the wellhead before drilling operations commences on each well.
 - **a.** The BLM will be contacted / notified 24 hours before the big rig moves back on to the pad with the pre-set surface casing.
- **6.** Devon Energy will have supervision on the rig to ensure compliance with all BLM and NMOCD regulations and to oversee operations.
- 7. Once the rig is removed, Devon Energy will secure the wellhead area by placing a guard rail around the cellar area.



U.S. Department of the Interior BUREAU OF LAND MANAGEMENT

Drilling Plan Data Report

APD ID: 10400095932 **Submission Date:** 11/26/2023

Operator Name: DEVON ENERGY PRODUCTION COMPANY LP

Well Name: BORA BORA 13-24 FED COM Well Number: 302H

Well Type: OIL WELL Well Work Type: Drill

Highlighted data reflects the most recent changes

Show Final Text

Section 1 - Geologic Formations

Formation			True Vertical			Mineral Resources	Producing
ID	Formation Name	Elevation		Depth	Lithologies		Formatio
13602817	UNKNOWN	3500	0	0	ALLUVIUM	NONE	N
13602823	RUSTLER	2475	1025	1025	SANDSTONE	NONE	N
13602818	TOP SALT	2170	1330	1330	SALT	NONE	N
13602819	BASE OF SALT	-780	4280	4280	SALT	NONE	N
13602836	BELL CANYON	-1025	4525	4525	SANDSTONE	NATURAL GAS, OIL	N
13602837	CHERRY CANYON	-1960	5460	5460	SANDSTONE	NATURAL GAS, OIL	N
13602838	BRUSHY CANYON	-3210	6710	6710	SANDSTONE	NATURAL GAS, OIL	N
13602839	BONE SPRING 1ST	-4930	8430	8430	LIMESTONE	NATURAL GAS, OIL	N
13602840	BONE SPRING 1ST	-6015	9515	9515	SANDSTONE	NATURAL GAS, OIL	N
13602841	BONE SPRING 2ND	-6590	10090	10090	SANDSTONE	NATURAL GAS, OIL	N
13602846	BONE SPRING 3RD	-7100	10600	10600	LIMESTONE	NATURAL GAS, OIL	N
13602843	BONE SPRING 3RD	-7820	11320	11320	SANDSTONE	NATURAL GAS, OIL	N
13602844	WOLFCAMP	-8250	11750	11750	SHALE	NATURAL GAS, OIL	Y
13602845	STRAWN	-9925	13425	13425	LIMESTONE	NATURAL GAS, OIL	N

Section 2 - Blowout Prevention



Commitment Runs Deep



Design Plan
Operation and Maintenance Plan
Closure Plan

SENM - Closed Loop Systems June 2010

I. Design Plan

Devon uses MI SWACO closed loop system (CLS). The MI SWACO CLS is designed to maintain drill solids at or below 5%. The equipment is arranged to progressively remove solids from the largest to the smallest size. Drilling fluids can thus be reused and savings is realized on mud and disposal costs. Dewatering may be required with the centrifuges to insure removal of ultra fine solids.

The drilling location is constructed to allow storm water to flow to a central sump normally the cellar. This insures no contamination leaves the drilling pad in the event of a spill. Storm water is reused in the mud system or stored in a reserve fluid tank farm until it can be reused. All lubricants, oils, or chemicals are removed immediately from the ground to prevent the contamination of storm water. An oil trap is normally installed on the sump if an oil spill occurs during a storm.

A tank farm is utilized to store drilling fluids including fresh water and brine fluids. The tank farm is constructed on a 20 ml plastic lined, bermed pad to prevent the contamination of the drilling site during a spill. Fluids from other sites may be stored in these tanks for processing by the solids control equipment and reused in the mud system. At the end of the well the fluids are transported from the tank farm to an adjoining well or to the next well for the rig.


Prior to installing a closed-loop system on site, the topsoil, if present, will be stripped and stockpiled for use as the final cover or fill at the time of closure.

Signs will be posted on the fence surrounding the closed-loop system unless the closed-loop system is located on a site where there is an existing well, that is operated by Devon.

II. Operations and Maintenance Plan

Primary Shakers: The primary shakers make the first removal of drill solids from the drilling mud as it leaves the well bore. The shakers are sized to handle maximum drilling rate at optimal screen size. The shakers normally remove solids down to 74 microns.

Mud Cleaner: The Mud Cleaner cleans the fluid after it leaves the shakers. A set of hydrocyclones are sized to handle 1.25 to 1.5 times the maximum circulating rate. This ensures all the fluid is being processed to an average cut point of 25 microns. The wet discharged is dewatered on a shaker equipped with ultra fine mesh screens and generally cut at 40 microns.

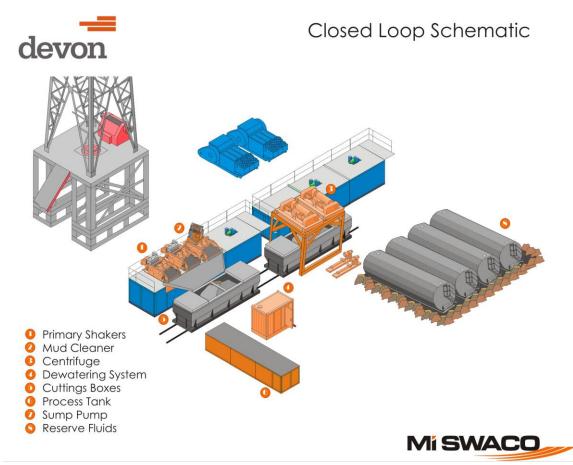

Centrifuges: The centrifuges can be one or two in number depending on the well geometry or depth of well. The centrifuges are sized to maintain low gravity solids at 5% or below. They may or may not need a dewatering system to enhance the removal rates. The centrifuges can make a cut point of 8-10 microns depending on bowl speed, feed rate, solids loading and other factors.

The centrifuge system is designed to work on the active system and be flexible to process incoming fluids from other locations. This set-up is also dependant on well factors.

Dewatering System: The dewatering system is a chemical mixing and dosing system designed to enhance the solids removal of the centrifuge. Not commonly used in shallow wells. It may contain pH adjustment, coagulant mixing and dosing, and polymer mixing and dosing. Chemical flocculation binds ultra fine solids into a mass that is within the centrifuge operating design. The

dewatering system improves the centrifuge cut point to infinity or allows for the return of clear water or brine fluid. This ability allows for the ultimate control of low gravity solids.

Cuttings Boxes: Cuttings boxes are utilized to capture drill solids that are discarded from the solids control equipment. These boxes are set upon a rail system that allows for the removal and replacement of a full box of cuttings with an empty one. They are equipped with a cover that insures no product is spilled into the environment during the transportation phase.

Process Tank: (Optional) The process tank allows for the holding and process of fluids that are being transferred into the mud system. Additionally, during times of lost circulation the process tank may hold active fluids that are removed for additional treatment. It can further be used as a mixing tank during well control conditions.

Sump and Sump Pump: The sump is used to collect storm water and the pump is used to transfer this fluid to the active system or to the tank for to hold in reserve. It can also be used to collect fluids that may escape during spills. The location contains drainage ditches that allow the location fluids to drain to the sump.

Reserve Fluids (Tank Farm): A series of frac tanks are used to replace the reserve pit. These are steel tanks that are equipped with a manifold system and a transfer pump. These tanks can contain any number of fluids used during the drilling process. These can include fresh water, cut brine, and saturated salt fluid. The fluid can be from the active well or reclaimed fluid from other locations. A 20 ml liner and berm system is employed to ensure the fluids do not migrate to the environment during a spill.

If a leak develops, the appropriate division district office will be notified within 48 hours of the discovery and the leak will be addressed. Spill prevention is accomplished by maintaining pump packing, hoses, and pipe fittings to insure no leaks are occurring. During an upset condition the source of the spill is isolated and repaired as soon as it is discovered. Free liquid is removed by a diaphragm pump and returned to the mud system. Loose topsoil may be used to stabilize the spill and the contaminated soil is excavated and placed in the cuttings boxes. After the well is finished and the rig has moved, the entire location is scrapped and testing will be performed to determine if a release has occurred.

All trash is kept in a wire mesh enclosure and removed to an approved landfill when full. All spent motor oils are kept in separate containers and they are removed and sent to an approved recycling center. Any spilled lubricants, pipe


dope, or regulated chemicals are removed from soil and sent to landfills approved for these products.

These operations are monitored by Mi Swaco service technicians. Daily logs are maintained to ensure optimal equipment operation and maintenance. Screen and chemical use is logged to maintain inventory control. Fluid properties are monitored and recorded and drilling mud volumes are accounted for in the mud storage farm. This data is kept for end of well review to insure performance goals are met. Lessons learned are logged and used to help with continuous improvement.

A MI SWACO field supervisor manages from 3-5 wells. They are responsible for training personnel, supervising installations, and inspecting sites for compliance of MI SWACO safety and operational policy.

III. Closure Plan

A maximum 340' X 340' caliche pad is built per well. All of the trucks and steel tanks fit on this pad. All fluid cuttings go to the steel tanks to be hauled by various trucking companies to an agency approved disposal.

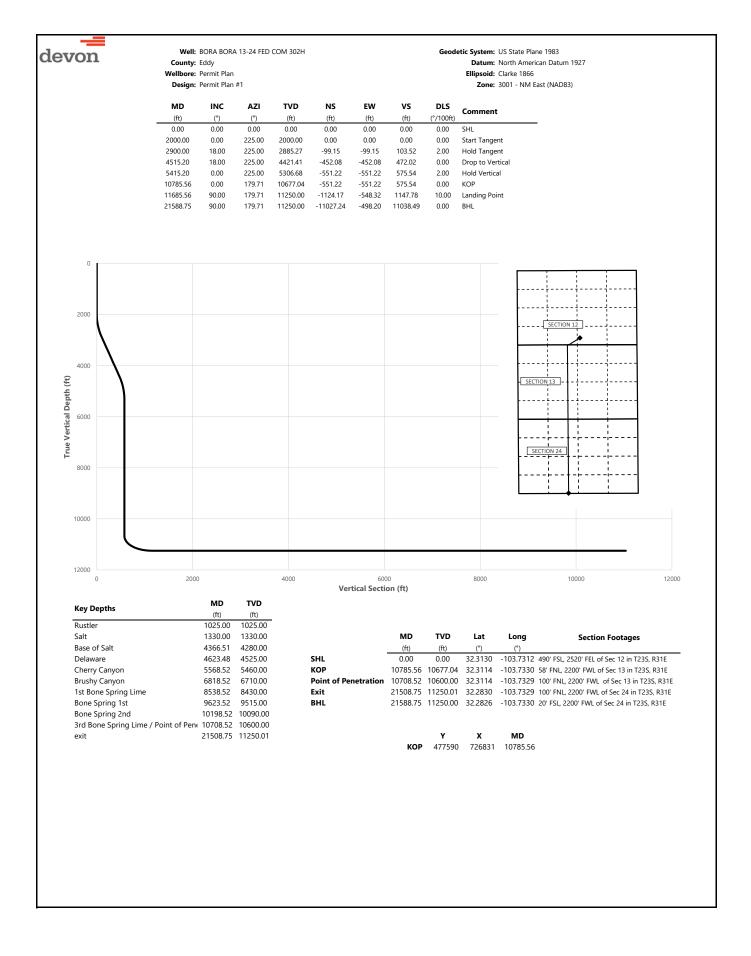



Well: BORA BORA 13-24 FED COM 302H

Geodetic System: US State Plane 1983

County: Eddy

Datum: North American Datu

Wellbore: Permit Plan

Design: Permit Plan #1

Datum: North American Datum 1927 Ellipsoid: Clarke 1866 Zone: 3001 - NM East (NAD83)

								Zone: 3001 - NM East (NAD83)			
N	ИD	INC	AZI	TVD	NS	EW	vs	DLS	6		
	(ft)	(°)	(°)	(ft)	(ft)	(ft)	(ft)	(°/100ft)	Comment		
	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	SHL		
	00.00	0.00	225.00	100.00	0.00	0.00	0.00	0.00			
	00.00	0.00	225.00	200.00	0.00	0.00	0.00	0.00			
	0.00	0.00	225.00 225.00	300.00 400.00	0.00	0.00	0.00	0.00			
	0.00	0.00	225.00	500.00	0.00	0.00	0.00	0.00			
	0.00	0.00	225.00	600.00	0.00	0.00	0.00	0.00			
	00.00	0.00	225.00	700.00	0.00	0.00	0.00	0.00			
	00.00	0.00	225.00	800.00	0.00	0.00	0.00	0.00			
90	00.00	0.00	225.00	900.00	0.00	0.00	0.00	0.00			
	00.00	0.00	225.00	1000.00	0.00	0.00	0.00	0.00			
	25.00	0.00	225.00	1025.00	0.00	0.00	0.00	0.00	Rustler		
	00.00	0.00	225.00	1100.00	0.00	0.00	0.00	0.00			
	00.00	0.00	225.00	1200.00	0.00	0.00	0.00	0.00			
	00.00 30.00	0.00	225.00 225.00	1300.00 1330.00	0.00	0.00	0.00	0.00	Salt		
	00.00	0.00	225.00	1400.00	0.00	0.00	0.00	0.00	Salt		
	00.00	0.00	225.00	1500.00	0.00	0.00	0.00	0.00			
	00.00	0.00	225.00	1600.00	0.00	0.00	0.00	0.00			
	00.00	0.00	225.00	1700.00	0.00	0.00	0.00	0.00			
180	00.00	0.00	225.00	1800.00	0.00	0.00	0.00	0.00			
190	00.00	0.00	225.00	1900.00	0.00	0.00	0.00	0.00			
	00.00	0.00	225.00	2000.00	0.00	0.00	0.00	0.00	Start Tangent		
	00.00	2.00	225.00	2099.98	-1.23	-1.23	1.29	2.00			
	00.00	4.00	225.00	2199.84	-4.93	-4.93	5.15	2.00			
	00.00	6.00 8.00	225.00 225.00	2299.45 2398.70	-11.10 -19.71	-11.10 -19.71	11.59 20.58	2.00 2.00			
	00.00	10.00	225.00	2497.47	-30.78	-30.77	32.13	2.00			
	00.00	12.00	225.00	2595.62	-44.27	-44.27	46.22	2.00			
	00.00	14.00	225.00	2693.06	-60.17	-60.17	62.83	2.00			
280	00.00	16.00	225.00	2789.64	-78.47	-78.47	81.93	2.00			
290	00.00	18.00	225.00	2885.27	-99.15	-99.15	103.52	2.00	Hold Tangent		
	00.00	18.00	225.00	2980.37	-121.00	-121.00	126.33	0.00			
	00.00	18.00	225.00	3075.48	-142.85	-142.85	149.15	0.00			
	00.00	18.00	225.00	3170.59	-164.70	-164.70	171.96	0.00			
	00.00	18.00	225.00	3265.69	-186.55	-186.55	194.78	0.00			
	00.00	18.00 18.00	225.00 225.00	3360.80 3455.90	-208.40 -230.25	-208.40 -230.25	217.59 240.41	0.00			
	00.00	18.00	225.00	3551.01	-252.10	-252.10	263.22	0.00			
	00.00	18.00	225.00	3646.11	-273.95	-273.95	286.04	0.00			
	00.00	18.00	225.00	3741.22	-295.80	-295.80	308.85	0.00			
390	00.00	18.00	225.00	3836.33	-317.65	-317.65	331.67	0.00			
400	00.00	18.00	225.00	3931.43	-339.50	-339.50	354.48	0.00			
	00.00	18.00	225.00	4026.54	-361.36	-361.35	377.30	0.00			
	00.00	18.00	225.00	4121.64	-383.21	-383.20	400.11	0.00			
	00.00	18.00	225.00	4216.75	-405.06	-405.06	422.93	0.00	Dans of Calk		
	66.51 00.00	18.00 18.00	225.00 225.00	4280.00 4311.85	-419.59 -426.91	-419.59 -426.91	438.10 445.74	0.00	Base of Salt		
	00.00	18.00	225.00	4406.96	-426.91 -448.76	-426.91 -448.76	468.56	0.00			
	15.20	18.00	225.00	4421.41	-452.08	-452.08	472.02	0.00	Drop to Vertical		
	00.00	16.30	225.00	4502.44	-469.76	-469.76	490.49	2.00			
	23.48	15.83	225.00	4525.00	-474.36	-474.36	495.28	2.00	Delaware		
470	00.00	14.30	225.00	4598.89	-488.42	-488.42	509.97	2.00			
	00.00	12.30	225.00	4696.20	-504.70	-504.70	526.96	2.00			
	00.00	10.30	225.00	4794.26	-518.56	-518.55	541.43	2.00			
	00.00	8.30	225.00	4892.94	-529.99	-529.99	553.37	2.00			
	00.00	6.30	225.00	4992.12	-538.98	-538.98	562.75	2.00			
	00.00 00.00	4.30 2.30	225.00 225.00	5091.69 5191.51	-545.51 -549.59	-545.51 -549.59	569.58 573.83	2.00 2.00			
	00.00	0.30	225.00	5291.48	-551.20	-551.20	575.51	2.00			
	15.20	0.00	225.00	5306.68	-551.22	-551.22	575.54	2.00	Hold Vertical		
	00.00	0.00	179.71	5391.48	-551.22	-551.22	575.54	0.00			
	68.52	0.00	179.71	5460.00	-551.22	-551.22	575.54	0.00	Cherry Canyon		
	00.00	0.00	179.71	5491.48	-551.22	-551.22	575.54	0.00			
	00.00	0.00	179.71	5591.48	-551.22	-551.22	575.54	0.00			
	00.00	0.00	179.71	5691.48	-551.22	-551.22	575.54	0.00			
	00.00	0.00	179.71	5791.48	-551.22	-551.22	575.54	0.00			
	00.00	0.00	179.71	5891.48	-551.22	-551.22	575.54	0.00			
	00.00 00.00	0.00	179.71 179.71	5991.48 6091.48	-551.22 -551.22	-551.22 -551.22	575.54 575.54	0.00			
021	00.00	0.00	113.11	0051.40	JJ 1.44	JJ 1.44	J1J.J4	0.00			



Well: BORA BORA 13-24 FED COM 302H

County: Eddy
Wellbore: Permit Plan
Design: Permit Plan #1

Geodetic System: US State Plane 1983

Datum: North American Datum 1927 **Ellipsoid:** Clarke 1866

Zone: 3001 - NM East (NAD83)

	Design: Permit Plan #1						Zone: 3001 - NM East (NAD83)		
MD (ft)	INC (°)	AZI (°)	TVD (ft)	NS (ft)	EW (ft)	VS (ft)	DLS (°/100ft)	Comment	
6300.00	0.00	179.71	6191.48	-551.22	-551.22	575.54	0.00		
6400.00	0.00	179.71	6291.48	-551.22	-551.22	575.54	0.00		
6500.00	0.00	179.71	6391.48	-551.22	-551.22	575.54	0.00		
6600.00	0.00	179.71	6491.48	-551.22	-551.22	575.54	0.00		
6700.00	0.00	179.71	6591.48	-551.22	-551.22	575.54	0.00		
6800.00 6818.52	0.00	179.71 179.71	6691.48 6710.00	-551.22 -551.22	-551.22 -551.22	575.54 575.54	0.00	Brushy Canyon	
6900.00	0.00	179.71	6791.48	-551.22	-551.22	575.54	0.00	blushy Carlyon	
7000.00	0.00	179.71	6891.48	-551.22	-551.22	575.54	0.00		
7100.00	0.00	179.71	6991.48	-551.22	-551.22	575.54	0.00		
7200.00	0.00	179.71	7091.48	-551.22	-551.22	575.54	0.00		
7300.00	0.00	179.71	7191.48	-551.22	-551.22	575.54	0.00		
7400.00	0.00	179.71	7291.48	-551.22	-551.22	575.54	0.00		
7500.00	0.00	179.71	7391.48	-551.22	-551.22	575.54	0.00		
7600.00	0.00	179.71	7491.48	-551.22	-551.22	575.54	0.00		
7700.00	0.00	179.71	7591.48	-551.22	-551.22	575.54	0.00		
7800.00 7900.00	0.00	179.71 179.71	7691.48 7791.48	-551.22 -551.22	-551.22 -551.22	575.54 575.54	0.00		
8000.00	0.00	179.71	7891.48	-551.22	-551.22	575.54	0.00		
8100.00	0.00	179.71	7991.48	-551.22	-551.22	575.54	0.00		
8200.00	0.00	179.71	8091.48	-551.22	-551.22	575.54	0.00		
8300.00	0.00	179.71	8191.48	-551.22	-551.22	575.54	0.00		
8400.00	0.00	179.71	8291.48	-551.22	-551.22	575.54	0.00		
8500.00	0.00	179.71	8391.48	-551.22	-551.22	575.54	0.00		
8538.52	0.00	179.71	8430.00	-551.22	-551.22	575.54	0.00	1st Bone Spring Lime	
8600.00	0.00	179.71	8491.48	-551.22	-551.22	575.54	0.00		
8700.00	0.00	179.71	8591.48	-551.22	-551.22	575.54	0.00		
8800.00 8900.00	0.00	179.71 179.71	8691.48 8791.48	-551.22 -551.22	-551.22 -551.22	575.54 575.54	0.00		
9000.00	0.00	179.71	8891.48	-551.22	-551.22	575.54	0.00		
9100.00	0.00	179.71	8991.48	-551.22	-551.22	575.54	0.00		
9200.00	0.00	179.71	9091.48	-551.22	-551.22	575.54	0.00		
9300.00	0.00	179.71	9191.48	-551.22	-551.22	575.54	0.00		
9400.00	0.00	179.71	9291.48	-551.22	-551.22	575.54	0.00		
9500.00	0.00	179.71	9391.48	-551.22	-551.22	575.54	0.00		
9600.00	0.00	179.71	9491.48	-551.22	-551.22	575.54	0.00		
9623.52	0.00	179.71	9515.00	-551.22	-551.22	575.54	0.00	Bone Spring 1st	
9700.00 9800.00	0.00	179.71 179.71	9591.48 9691.48	-551.22 -551.22	-551.22 -551.22	575.54 575.54	0.00		
9900.00	0.00	179.71	9791.48	-551.22	-551.22	575.54	0.00		
10000.00	0.00	179.71	9891.48	-551.22	-551.22	575.54	0.00		
10100.00	0.00	179.71	9991.48	-551.22	-551.22	575.54	0.00		
10198.52	0.00	179.71	10090.00	-551.22	-551.22	575.54	0.00	Bone Spring 2nd	
10200.00	0.00	179.71	10091.48	-551.22	-551.22	575.54	0.00		
10300.00	0.00	179.71	10191.48	-551.22	-551.22	575.54	0.00		
10400.00	0.00	179.71	10291.48	-551.22	-551.22	575.54	0.00		
10500.00	0.00	179.71	10391.48	-551.22	-551.22	575.54	0.00		
10600.00 10700.00	0.00	179.71 179.71	10491.48 10591.48	-551.22 -551.22	-551.22 -551.22	575.54 575.54	0.00		
10708.52	0.00	179.71	10600.00	-551.22	-551.22	575.54	0.00	3rd Bone Spring Lime / Point of Penetration	
10785.56	0.00	179.71	10677.04	-551.22	-551.22	575.54	0.00	KOP	
10800.00	1.44	179.71	10691.48	-551.41	-551.22	575.72	10.00		
10900.00	11.44	179.71	10790.72	-562.62	-551.17	586.92	10.00		
11000.00	21.44	179.71	10886.51	-590.89	-551.02	615.15	10.00		
11100.00	31.44	179.71	10975.94	-635.36	-550.80	659.57	10.00		
11200.00	41.44	179.71	11056.28	-694.69	-550.50	718.83	10.00		
11300.00	51.44	179.71	11125.10	-767.07	-550.13	791.12	10.00		
11400.00 11500.00	61.44 71.44	179.71 179.71	11180.30 11220.21	-850.30 -941.84	-549.71 -549.25	874.24 965.67	10.00 10.00		
11600.00	71.44 81.44	179.71	11243.62	-941.84	-549.25 -548.75	965.67 1062.64	10.00		
11685.56	90.00	179.71	11250.00	-1036.93	-548.32	1147.78	10.00	Landing Point	
11700.00	90.00	179.71	11250.00	-1138.62	-548.25	1162.20	0.00	· · · · · · · · · · · · · · · · · · ·	
11800.00	90.00	179.71	11250.00	-1238.61	-547.74	1262.07	0.00		
11900.00	90.00	179.71	11250.00	-1338.61	-547.24	1361.95	0.00		
12000.00	90.00	179.71	11250.00	-1438.61	-546.73	1461.82	0.00		
12100.00	90.00	179.71	11250.00	-1538.61	-546.23	1561.70	0.00		
12200.00	90.00	179.71		-1638.61	-545.72	1661.57	0.00		
12300.00	90.00	179.71	11250.00	-1738.61	-545.21	1761.44	0.00		
12400.00 12500.00	90.00 90.00	179.71 179.71	11250.00 11250.00	-1838.61 -1938.61	-544.71 -544.20	1861.32 1961.19	0.00		
12300.00	50.00	113.11	11230.00	1550.01	544.20	1501.15	0.00		



Well: BORA BORA 13-24 FED COM 302H

County: Eddy
Wellbore: Permit Plan
Design: Permit Plan #1

Geodetic System: US State Plane 1983

Datum: North American Datum 1927 **Ellipsoid:** Clarke 1866

Zone: 3001 - NM East (NAD83)

Design: Permit Plan #1							Zone: 3001 - NM East (NAD83)			
MD	INC	AZI	TVD	NS	EW	vs	DLS	C		
(ft)	(°)	(°)	(ft)	(ft)	(ft)	(ft)	(°/100ft)	Comment		
12600.00	90.00	179.71	11250.00	-2038.60	-543.69	2061.07	0.00			
12700.00	90.00	179.71	11250.00	-2138.60	-543.19	2160.94	0.00			
12800.00	90.00	179.71	11250.00	-2238.60	-542.68	2260.81	0.00			
12900.00	90.00	179.71	11250.00	-2338.60	-542.17	2360.69	0.00			
13000.00 13100.00	90.00 90.00	179.71 179.71	11250.00 11250.00	-2438.60 -2538.60	-541.67 -541.16	2460.56 2560.44	0.00			
13200.00	90.00	179.71	11250.00	-2638.60	-541.16	2660.31	0.00			
13300.00	90.00	179.71	11250.00	-2738.60	-540.15	2760.18	0.00			
13400.00	90.00	179.71	11250.00	-2838.59	-539.64	2860.06	0.00			
13500.00	90.00	179.71	11250.00	-2938.59	-539.14	2959.93	0.00			
13600.00	90.00	179.71	11250.00	-3038.59	-538.63	3059.81	0.00			
13700.00	90.00	179.71	11250.00	-3138.59	-538.12	3159.68	0.00			
13800.00	90.00	179.71	11250.00	-3238.59	-537.62	3259.55	0.00			
13900.00	90.00	179.71	11250.00	-3338.59	-537.11	3359.43	0.00			
14000.00	90.00	179.71	11250.00	-3438.59	-536.60	3459.30	0.00			
14100.00 14200.00	90.00 90.00	179.71 179.71	11250.00 11250.00	-3538.59 -3638.58	-536.10 -535.59	3559.18 3659.05	0.00			
14300.00	90.00	179.71	11250.00	-3738.58	-535.08	3758.92	0.00			
14400.00	90.00	179.71	11250.00	-3838.58	-534.58	3858.80	0.00			
14500.00	90.00	179.71	11250.00	-3938.58	-534.07	3958.67	0.00			
14600.00	90.00	179.71	11250.00	-4038.58	-533.57	4058.55	0.00			
14700.00	90.00	179.71	11250.00	-4138.58	-533.06	4158.42	0.00			
14800.00	90.00	179.71	11250.00	-4238.58	-532.55	4258.29	0.00			
14900.00	90.00	179.71	11250.00	-4338.57	-532.05	4358.17	0.00			
15000.00	90.00	179.71	11250.01	-4438.57	-531.54	4458.04	0.00			
15100.00 15200.00	90.00 90.00	179.71 179.71	11250.01 11250.01	-4538.57 -4638.57	-531.03 -530.53	4557.91 4657.79	0.00			
15300.00	90.00	179.71	11250.01	-4738.57	-530.55	4757.66	0.00			
15400.00	90.00	179.71	11250.01	-4838.57	-529.51	4857.54	0.00			
15500.00	90.00	179.71	11250.01	-4938.57	-529.01	4957.41	0.00			
15600.00	90.00	179.71	11250.01	-5038.57	-528.50	5057.28	0.00			
15700.00	90.00	179.71	11250.01	-5138.56	-527.99	5157.16	0.00			
15800.00	90.00	179.71	11250.01	-5238.56	-527.49	5257.03	0.00			
15900.00	90.00	179.71	11250.01	-5338.56	-526.98	5356.91	0.00			
16000.00	90.00	179.71	11250.01	-5438.56	-526.48	5456.78	0.00			
16100.00 16200.00	90.00 90.00	179.71 179.71	11250.01 11250.01	-5538.56 -5638.56	-525.97 -525.46	5556.65 5656.53	0.00			
16300.00	90.00	179.71	11250.01	-5738.56	-524.96	5756.40	0.00			
16400.00	90.00	179.71	11250.01	-5838.56	-524.45	5856.28	0.00			
16500.00	90.00	179.71	11250.01	-5938.55	-523.94	5956.15	0.00			
16600.00	90.00	179.71	11250.01	-6038.55	-523.44	6056.02	0.00			
16700.00	90.00	179.71	11250.01	-6138.55	-522.93	6155.90	0.00			
16800.00	90.00	179.71	11250.01	-6238.55	-522.42	6255.77	0.00			
16900.00	90.00	179.71	11250.01	-6338.55	-521.92	6355.65	0.00			
17000.00	90.00	179.71	11250.01	-6438.55	-521.41	6455.52	0.00			
17100.00 17200.00	90.00 90.00	179.71 179.71	11250.01 11250.01	-6538.55 -6638.55	-520.91 -520.40	6555.39 6655.27	0.00			
17200.00	90.00	179.71	11250.01	-6738.54	-520.40	6755.14	0.00			
17400.00	90.00	179.71	11250.01	-6838.54	-519.39	6855.02	0.00			
17500.00	90.00	179.71	11250.01	-6938.54	-518.88	6954.89	0.00			
17600.00	90.00	179.71	11250.01	-7038.54	-518.37	7054.76	0.00			
17700.00	90.00	179.71	11250.01	-7138.54	-517.87	7154.64	0.00			
17800.00	90.00	179.71	11250.01	-7238.54	-517.36	7254.51	0.00			
17900.00	90.00	179.71	11250.01	-7338.54	-516.85	7354.39	0.00			
18000.00 18100.00	90.00 90.00	179.71 179.71	11250.01 11250.01	-7438.54 -7538.53	-516.35	7454.26 7554.13	0.00			
18100.00	90.00	179.71	11250.01	-7538.53 -7638.53	-515.84 -515.33	7554.13 7654.01	0.00			
18300.00	90.00	179.71	11250.01	-7030.53	-515.55	7753.88	0.00			
18400.00	90.00	179.71	11250.01	-7838.53	-514.32	7853.76	0.00			
18500.00	90.00	179.71	11250.01	-7938.53	-513.82	7953.63	0.00			
18600.00	90.00	179.71	11250.01	-8038.53	-513.31	8053.50	0.00			
18700.00	90.00	179.71	11250.01	-8138.53	-512.80	8153.38	0.00			
18800.00	90.00	179.71	11250.01	-8238.52	-512.30	8253.25	0.00			
18900.00	90.00	179.71	11250.01	-8338.52	-511.79	8353.13	0.00			
19000.00	90.00	179.71	11250.01	-8438.52	-511.28	8453.00	0.00			
19100.00	90.00	179.71	11250.01	-8538.52	-510.78	8552.87 8652.75	0.00			
19200.00 19300.00	90.00 90.00	179.71 179.71	11250.01 11250.01	-8638.52 -8738.52	-510.27 -509.76	8652.75 8752.62	0.00			
19400.00	90.00	179.71	11250.01	-8838.52	-509.76	8852.50	0.00			
19500.00	90.00	179.71	11250.01	-8938.52	-508.75	8952.37	0.00			



Well: BORA BORA 13-24 FED COM 302H

County: Eddy
Wellbore: Permit Plan
Design: Permit Plan #1

Geodetic System: US State Plane 1983

Datum: North American Datum 1927

Ellipsoid: Clarke 1866

Zone: 3001 - NM East (NAD83)

MD	INC	AZI	TVD	NS	EW	VS	DLS	Comment
(ft)	(°)	(°)	(ft)	(ft)	(ft)	(ft)	(°/100ft)	Comment
19600.00	90.00	179.71	11250.01	-9038.51	-508.24	9052.24	0.00	
19700.00	90.00	179.71	11250.01	-9138.51	-507.74	9152.12	0.00	
19800.00	90.00	179.71	11250.01	-9238.51	-507.23	9251.99	0.00	
19900.00	90.00	179.71	11250.01	-9338.51	-506.73	9351.86	0.00	
20000.00	90.00	179.71	11250.01	-9438.51	-506.22	9451.74	0.00	
20100.00	90.00	179.71	11250.01	-9538.51	-505.71	9551.61	0.00	
20200.00	90.00	179.71	11250.01	-9638.51	-505.21	9651.49	0.00	
20300.00	90.00	179.71	11250.01	-9738.51	-504.70	9751.36	0.00	
20400.00	90.00	179.71	11250.01	-9838.50	-504.19	9851.23	0.00	
20500.00	90.00	179.71	11250.01	-9938.50	-503.69	9951.11	0.00	
20600.00	90.00	179.71	11250.01	-10038.50	-503.18	10050.98	0.00	
20700.00	90.00	179.71	11250.01	-10138.50	-502.67	10150.86	0.00	
20800.00	90.00	179.71	11250.01	-10238.50	-502.17	10250.73	0.00	
20900.00	90.00	179.71	11250.01	-10338.50	-501.66	10350.60	0.00	
21000.00	90.00	179.71	11250.01	-10438.50	-501.16	10450.48	0.00	
21100.00	90.00	179.71	11250.01	-10538.50	-500.65	10550.35	0.00	
21200.00	90.00	179.71	11250.01	-10638.49	-500.14	10650.23	0.00	
21300.00	90.00	179.71	11250.01	-10738.49	-499.64	10750.10	0.00	
21400.00	90.00	179.71	11250.01	-10838.49	-499.13	10849.97	0.00	
21500.00	90.00	179.71	11250.01	-10938.49	-498.62	10949.85	0.00	
21508.75	90.00	179.71	11250.01	-10947.24	-498.58	10958.59	0.00	exit
21588.75	90.00	179.71	11250.00	-11027.24	-498.20	11038.49	0.00	BHL

Well: BORA BORA 13-24 FED COM 302H Geodetic System: US State Plane 1983 County: Eddy Datum: North American Datum 1927 Wellbore: Permit Plan Ellipsoid: Clarke 1866 Design: Permit Plan #1 **Zone:** 3001 - NM East (NAD83) INC TVD MD AZI NS EW ٧S DLS Comment (ft) (°) (°) (ft) (ft) (ft) (ft) (°/100ft)

A multibowl wellhead may be used. The BOP will be tested per Onshore Order #2 after installation on the surface casing which will cover testing requirements for a maximum of 30 days. If any seal subject to test pressure is broken the system must be tested.

Devon proposes using a multi-bowl wellhead assembly. This assembly will only be tested when installed on the surface casing. Minimum working pressure of the blowout preventer (BOP) and related equipment (BOPE) required for drilling below the surface casing shoe shall be 5000 (5M) psi.


- Wellhead will be installed by wellhead representatives.
- If the welding is performed by a third party, the wellhead representative will monitor the temperature to verify that it does not exceed the maximum temperature of the seal.
- Wellhead representative will install the test plug for the initial BOP test.
- Wellhead company will install a solid steel body pack-off to completely isolate the lower head after cementing intermediate casing. After installation of the pack-off, the pack-off and the lower flange will be tested to 5M, as shown on the attached schematic.
 Everything above the pack-off will not have been altered whatsoever from the initial nipple up. Therefore the BOP components will not be retested at that time.
- If the cement does not circulate and one inch operations would have been possible with a standard wellhead, the well head will be cut and top out operations will be conducted.
- Devon will pressure test all seals above and below the mandrel (but still above the casing) to full working pressure rating.
- Devon will test the casing to 0.22 psi/ft or 1500 psi, whichever is greater, as per Onshore Order #2.


After running the surface casing, a 13-5/8" BOP/BOPE system with a minimum rating of 5M will be installed on the wellhead system and will undergo a 250 psi low pressure test followed by a 5,000 psi high pressure test. The 5,000 psi high and 250 psi low test will cover testing requirements a maximum of 30 days, as per Onshore Order #2. If the well is not complete within 30 days of this BOP test, another full BOP test will be conducted, as per Onshore Order #2.


After running the intermediate casing with a mandrel hanger, the 13-5/8" BOP/BOPE system with a minimum rating of 5M will already be installed on the wellhead.

The pipe rams will be operated and checked each 24 hour period and each time the drill pipe is out of the hole. These tests will be logged in the daily driller's log. A 2" kill line and 3" choke line will be incorporated into the drilling spool below the ram BOP. In addition to the rams and annular preventer, additional BOP accessories include a kelly cock, floor safety valve, choke lines, and choke manifold rated at 5,000 psi WP.

Devon's proposed wellhead manufactures will be FMC Technologies, Cactus Wellhead, or Cameron.

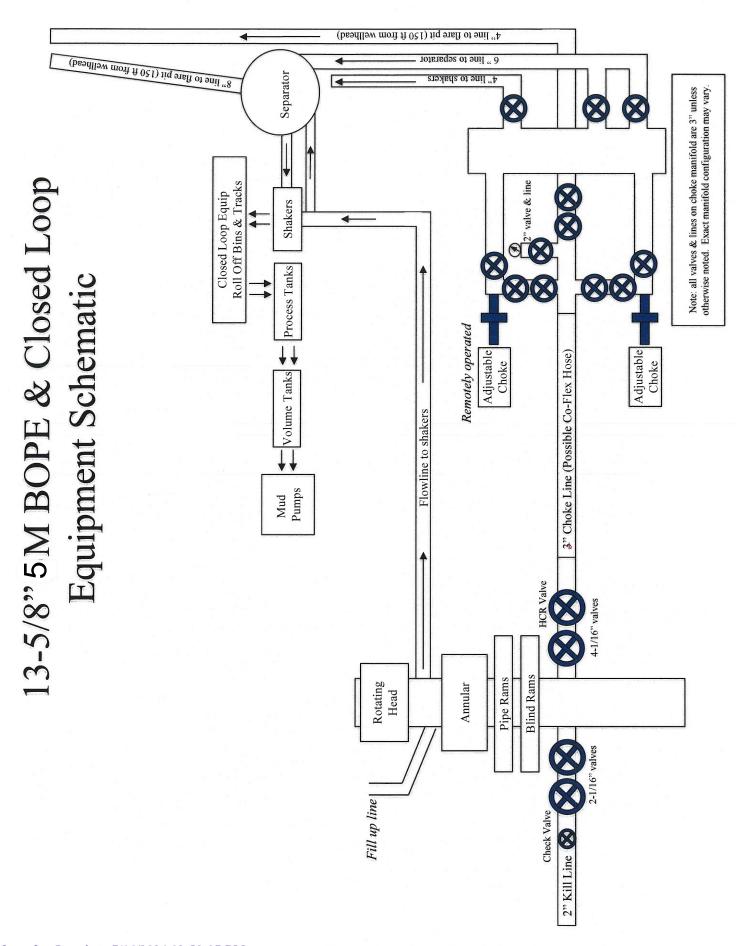

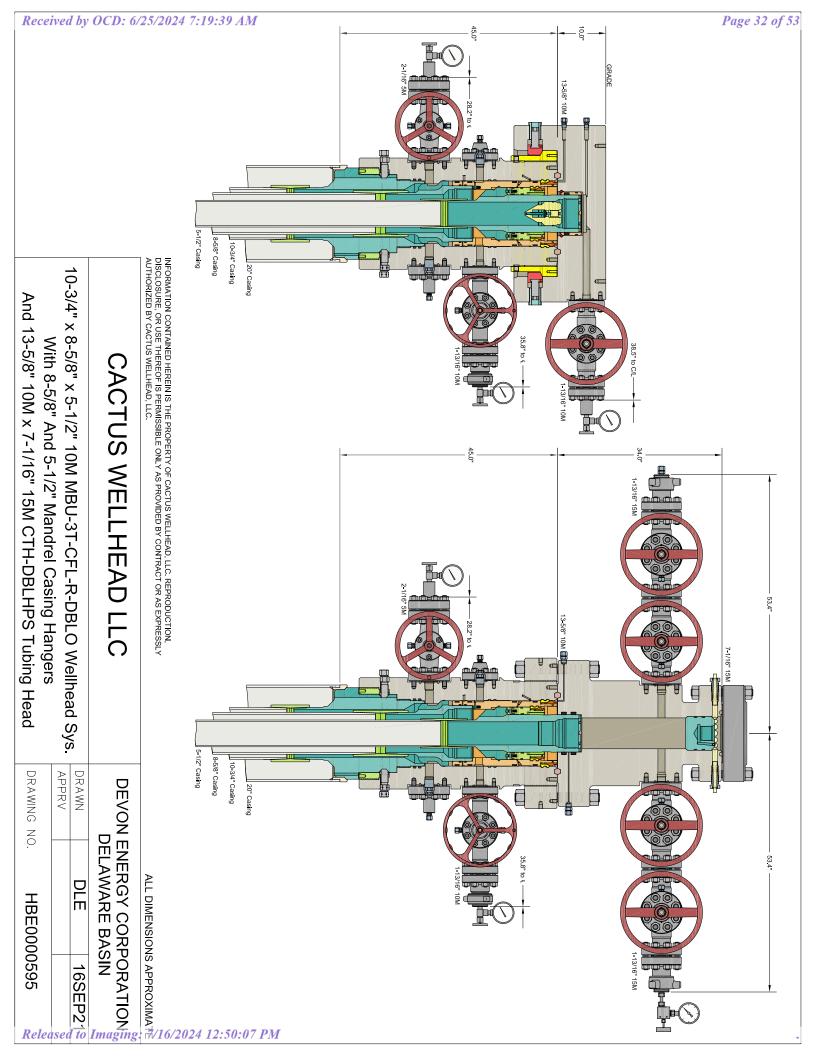

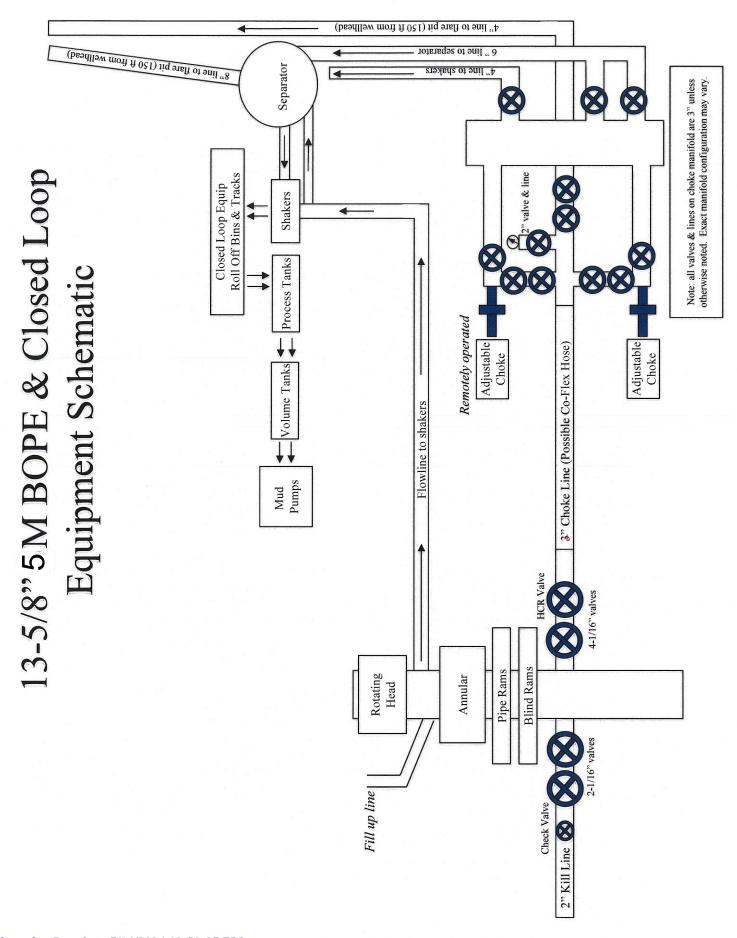

PECOS DISTRICT DRILLING CONDITIONS OF APPROVAL

OPERATOR'S NAME: Devon Energy Production Company LP

LEASE NO.: | NMNM0404441

LOCATION: Section 12, T.23 S., R.31 E., NMPM

COUNTY: Eddy County, New Mexico

WELL NAME & NO.: | Bora Bora 13-24 Fed Com 302H

BOTTOM HOLE FOOTAGE | 20'/S & 2200'/W

ATS/API ID: ATS-24-404 APD ID: 10400095932

Sundry ID: N/a

Date APD Submitted: N/a

WELL NAME & NO.: Bora Bora 13-24 Fed Com 303H

BOTTOM HOLE FOOTAGE | 20'/S & 1760'/E

ATS/API ID: ATS-24-403 APD ID: 10400095933

Sundry ID: N/a

Date APD Submitted: N/a

WELL NAME & NO.: | Bora Bora 13-24 Fed Com 304H

BOTTOM HOLE FOOTAGE | 20'/S & 440'/E | ATS/API ID: | ATS-24-402

APD ID: 10400095938

Sundry ID: N/a
Date APD Submitted: N/a

Page 1 of 11

COA

H2S	Yes ▼		
Potash	Secretary 🔻		
Cave/Karst	Low		
Potential	<u> </u>		
Cave/Karst	☐ Critical		
Potential			
Variance	None	Flex Hose	C Other
Wellhead	Conventional and Multibow	/	
Other	□4 String	Capitan Reef	□WIPP
		None ▼	
Other	Pilot Hole	Open Annulus	
	None 🔻		
Cementing	Contingency Squeeze	Echo-Meter	Primary Cement
	None ▼	Int 1	Squeeze
			None -
Special	□ Water	☑ COM	Unit
Requirements	Disposal/Injection		
Special	☐ Batch Sundry	Waste Prevention	
Requirements		None	
Special	▼ Break Testing	☐ Offline	□ Casing
Requirements		Cementing	Clearance
Variance			

A. HYDROGEN SULFIDE

A Hydrogen Sulfide (H2S) Drilling Plan shall be activated 500 feet prior to drilling into the **Delaware** formation. As a result, the Hydrogen Sulfide area must meet **43 CFR part 3170 Subpart 3176** requirements, which includes equipment and personnel/public protection items. If Hydrogen Sulfide is encountered, please provide measured values and formations to the BLM.

B. CASING

- 1. The 10-3/4 inch surface casing shall be set at approximately 1050 feet (a minimum of 70 feet (Eddy County) into the Rustler Anhydrite and above the salt when present, and below usable fresh water) and cemented to the surface. The surface hole shall be 14 3/4 inch in diameter.
 - a. If cement does not circulate to the surface, the appropriate BLM office shall be notified and a temperature survey utilizing an electronic type temperature survey with surface log readout will be used or a cement bond log shall be run to verify the top of the cement. Temperature survey will be run a minimum of six hours after pumping cement and ideally between 8-10 hours after completing the cement job.
 - b. Wait on cement (WOC) time for a primary cement job will be a minimum of **8** hours or 500 pounds compressive strength, whichever is greater. (This is to include the lead cement)
 - c. Wait on cement (WOC) time for a remedial job will be a minimum of 4 hours after bringing cement to surface or 500 pounds compressive strength, whichever is greater.
 - d. If cement falls back, remedial cementing will be done prior to drilling out that string.

Intermediate casing must be kept fluid filled to meet BLM minimum collapse requirement.

2. The minimum required fill of cement behind the 8-5/8 inch intermediate casing is:

Option 1 (Single Stage):

• Cement to surface. If cement does not circulate see B.1.a, c-d above. Wait on cement (WOC) time for a primary cement job is to include the lead cement slurry due to cave/karst or potash.

Option 2:

Operator has proposed to cement in two stages by conventionally cementing the first stage and performing a bradenhead squeeze on the second stage, contingent upon no returns to surface.

- a. First stage: Operator will cement with intent to reach the top of the Brushy Canyon at 6710' (450 sxs Class H/C+ additives).
- b. Second stage:
 - Operator will perform bradenhead squeeze and top-out. Cement to surface. If cement does not reach surface, the appropriate BLM office shall be notified. (Squeeze 478 sxs Class C)
 Wait on cement (WOC) time for a primary cement job is to include the lead cement slurry due to cave/karst or potash.

Operator has proposed to pump down 10-3/4" X 8-5/8" annulus after primary cementing stage. Operator must run Echo-meter to verify Cement Slurry/Fluid top in the annulus Or operator shall run a CBL from TD of the 8-5/8" casing to surface after the second stage BH to verify TOC.

Submit results to the BLM. No displacement fluid/wash out shall be utilized at the top of the cement slurry between second stage BH and top out. Operator must run one CBL per Well Pad. Operator may conduct a negative and positive pressure test during completion to remediate sustained casing pressure.

If cement does not reach surface, the next casing string must come to surface.

Operator must use a limited flush fluid volume of 1 bbl following backside cementing procedures.

- ❖ In <u>Secretary Potash Areas</u> if cement does not circulate to surface on the first two casing strings, the cement on the 3rd casing string must come to surface.
- 3. The minimum required fill of cement behind the 5-1/2 inch production casing is:
 - Cement should tie-back at least 500 feet into previous casing string.
 Operator shall provide method of verification.
 Wait on cement (WOC) time for a primary cement job is to include the lead cement slurry due to cave/karst or potash.
 Cement excess is less than 25%, more cement is required if washout occurs. Adjust cement volume and excess based on a fluid caliper or similar method that reflects the as-drilled size of the wellbore.

C. PRESSURE CONTROL

- 1. Variance approved to use flex line from BOP to choke manifold. Manufacturer's specification to be readily available. No external damage to flex line. Flex line to be installed as straight as possible (no hard bends).'
- 2.

Option 1:

- a. Minimum working pressure of the blowout preventer (BOP) and related equipment (BOPE) required for drilling below the surface casing shoe shall be 5000 (5M) psi. Annular which shall be tested to 5000 (5M) psi.
- b. Minimum working pressure of the blowout preventer (BOP) and related equipment (BOPE) required for drilling below the 8-5/8 inch intermediate casing shoe shall be 5000 (5M) psi.

Option 2:

Operator has proposed a multi-bowl wellhead assembly. This assembly will only be tested when installed on the 10-3/4 inch surface casing. Minimum working pressure of the blowout preventer (BOP) and related equipment (BOPE) required for drilling below the surface casing shoe shall be 5000 (5M) psi.

- a. Wellhead shall be installed by manufacturer's representatives, submit documentation with subsequent sundry.
- b. If the welding is performed by a third party, the manufacturer's representative shall monitor the temperature to verify that it does not exceed the maximum temperature of the seal.
- c. Manufacturer representative shall install the test plug for the initial BOP test.
- d. If the cement does not circulate and one inch operations would have been possible with a standard wellhead, the well head shall be cut off, cementing operations performed and another wellhead installed.
- e. Whenever any seal subject to test pressure is broken, all the tests in 43 CFR 3172.6(b)(9) must be followed.

D. SPECIAL REQUIREMENT (S)

Communitization Agreement

- The operator will submit a Communitization Agreement to the Santa Fe Office, 301 Dinosaur Trail Santa Fe, New Mexico 87508, at least 90 days before the anticipated date of first production from a well subject to a spacing order issued by the New Mexico Oil Conservation Division. The Communitization Agreement will include the signatures of all working interest owners in all Federal and Indian leases subject to the Communitization Agreement (i.e., operating rights owners and lessees of record), or certification that the operator has obtained the written signatures of all such owners and will make those signatures available to the BLM immediately upon request.
- The operator will submit an as-drilled survey well plat of the well completion, but are not limited to, those specified in 43 CFR part 3170 Subpart 3171

- If the operator does not comply with this condition of approval, the BLM may take enforcement actions that include, but are not limited to, those specified in 43 CFR 3163.1.
- In addition, the well sign shall include the surface and bottom hole lease numbers. When the Communitization Agreement number is known, it shall also be on the sign.

BOPE Break Testing Variance (Approved)

- BOPE Break Testing is ONLY permitted for 5M BOPE or less. (Annular preventer must be tested to a minimum of 70% of BOPE working pressure and shall be higher than the MASP)
- BOPE Break Testing is NOT permitted to drilling the production hole section.
- Variance only pertains to the intermediate hole-sections and no deeper than the Bone Springs formation.
- While in transfer between wells, the BOPE shall be secured by the hydraulic carrier or cradle.
- Any well control event while drilling require notification to the BLM Petroleum Engineer (575-706-2779) prior to the commencement of any BOPE Break Testing operations.
- A full BOPE test is required prior to drilling the first deep intermediate hole section. If any subsequent hole interval is deeper than the first, a full BOPE test will be required. (200' TVD tolerance between intermediate shoes is allowable).
- The BLM is to be contacted (575-361-2822 Eddy County) 4 hours prior to BOPE tests.
- As a minimum, a full BOPE test shall be performed at 21-day intervals.
- In the event any repairs or replacement of the BOPE is required, the BOPE shall test as per 43 CFR part 3170 Subpart 3172.
- If in the event break testing is not utilized, then a full BOPE test would be conducted.

GENERAL REQUIREMENTS

The BLM is to be notified in advance for a representative to witness:

- a. Spudding well (minimum of 24 hours)
- b. Setting and/or Cementing of all casing strings (minimum of 4 hours)
- c. BOPE tests (minimum of 4 hours)

☑ Eddy County

EMAIL or call the Carlsbad Field Office, 620 East Greene St., Carlsbad, NM 88220.

BLM_NM_CFO_DrillingNotifications@BLM.GOV (575) 361-2822

- 1. Unless the production casing has been run and cemented or the well has been properly plugged, the drilling rig shall not be removed from over the hole without prior approval.
 - a. In the event the operator has proposed to drill multiple wells utilizing a skid/walking rig. Operator shall secure the wellbore on the current well, after installing and testing the wellhead, by installing a blind flange of like pressure rating to the wellhead and a pressure gauge that can be monitored while drilling is performed on the other well(s).
 - b. When the operator proposes to set surface casing with Spudder Rig
 - Notify the BLM when moving in and removing the Spudder Rig.
 - Notify the BLM when moving in the 2nd Rig. Rig to be moved in within 90 days of notification that Spudder Rig has left the location.
 - BOP/BOPE test to be conducted per **43** CFR part **3170** Subpart **3172** as soon as 2nd Rig is rigged up on well.
- 2. Floor controls are required for 3M or Greater systems. These controls will be on the rig floor, unobstructed, readily accessible to the driller and will be operational at all times during drilling and/or completion activities. Rig floor is defined as the area immediately around the rotary table; the area immediately above the substructure on which the draw works are located, this does not include the dog house or stairway area.
- 3. For at least one well per pad (deepest well preferred) the record of drilling rate (ROP) along with the Gamma Ray (GR) and Neutron (CNL) well logs run from TVD to surface in the vertical section of the hole shall be submitted to the BLM office as well as all other logs run on the full borehole within 30 days from completion. Only digital copies of the logs in .TIF or .LAS formats are necessary; Logs shall be emailed to blm-cfo-geology@doimspp.onmicrosoft.com. The email should have a subject line with the US Well Number / API Number, well name, and the body should include the starting depth and the TVD of the log.

The top of the Rustler, top and bottom of the salt, and the top of the Capitan Reef (if present are to be recorded on the Completion Report.

A. CASING

- 1. Changes to the approved APD casing program need prior approval if the items substituted are of lesser grade or different casing size or are Non-API. The Operator can exchange the components of the proposal with that of superior strength (i.e. changing from J-55 to N-80, or from 36# to 40#). Changes to the approved cement program need prior approval if the altered cement plan has less volume or strength or if the changes are substantial (i.e. Multistage tool, ECP, etc.). The initial wellhead installed on the well will remain on the well with spools used as needed.
- 2. Wait on cement (WOC) for Potash Areas: After cementing but before commencing any tests, the casing string shall stand cemented under pressure until both of the following conditions have been met: 1) cement reaches a minimum compressive strength of 500 psi for all cement blends of both lead and tail cement, 2) until cement has been in place at least 8 hours. WOC time will be recorded in the driller's log. The casing integrity test can be done (prior to the cement setting up) immediately after bumping the plug.
- 3. Wait on cement (WOC) for Water Basin: After cementing but before commencing any tests, the casing string shall stand cemented under pressure until both of the following conditions have been met: 1) cement reaches a minimum compressive strength of 500 psi at the shoe, 2) until cement has been in place at least 8 hours. WOC time will be recorded in the driller's log. See individual casing strings for details regarding lead cement slurry requirements. The casing integrity test can be done (prior to the cement setting up) immediately after bumping the plug.
- 4. Provide compressive strengths including hours to reach required 500 pounds compressive strength prior to cementing each casing string. Have well specific cement details onsite prior to pumping the cement for each casing string.
- 5. No pea gravel permitted for remedial or fall back remedial without prior authorization from the BLM engineer.
- 6. On that portion of any well approved for a 5M BOPE system or greater, a pressure integrity test of each casing shoe shall be performed. Formation at the shoe shall be tested to a minimum of the mud weight equivalent anticipated to control the formation pressure to the next casing depth or at total depth of the well. This test shall be performed before drilling more than 20 feet of new hole.
- 7. If hardband drill pipe is rotated inside casing, returns will be monitored for metal. If metal is found in samples, drill pipe will be pulled and rubber protectors which have a

- larger diameter than the tool joints of the drill pipe will be installed prior to continuing drilling operations.
- 8. Whenever a casing string is cemented in the R-111-P potash area, the NMOCD requirements shall be followed.

B. PRESSURE CONTROL

- 1. All blowout preventer (BOP) and related equipment (BOPE) shall comply with well control requirements as described in 43 CFR part 3170 Subpart 3172 and API STD 53 Sec. 5.3.
- 2. If a variance is approved for a flexible hose to be installed from the BOP to the choke manifold, the following requirements apply: The flex line must meet the requirements of API 16C. Check condition of flexible line from BOP to choke manifold, replace if exterior is damaged or if line fails test. Line to be as straight as possible with no hard bends and is to be anchored according to Manufacturer's requirements. The flexible hose can be exchanged with a hose of equal size and equal or greater pressure rating. Anchor requirements, specification sheet and hydrostatic pressure test certification matching the hose in service, to be onsite for review. These documents shall be posted in the company man's trailer and on the rig floor.
- 3. 5M or higher system requires an HCR valve, remote kill line and annular to match. The remote kill line is to be installed prior to testing the system and tested to stack pressure.
- 4. If the operator has proposed a multi-bowl wellhead assembly in the APD. The following requirements must be met:
 - a. Wellhead shall be installed by manufacturer's representatives, submit documentation with subsequent sundry.
 - b. If the welding is performed by a third party, the manufacturer's representative shall monitor the temperature to verify that it does not exceed the maximum temperature of the seal.
 - c. Manufacturer representative shall install the test plug for the initial BOP test.
 - d. Whenever any seal subject to test pressure is broken, all the tests in 43 CFR 3172.6(b)(9) must be followed.
 - e. If the cement does not circulate and one inch operations would have been possible with a standard wellhead, the well head shall be cut off, cementing operations performed and another wellhead installed.
- 5. The appropriate BLM office shall be notified a minimum of 4 hours in advance for a representative to witness the tests.

- a. In a water basin, for all casing strings utilizing slips, these are to be set as soon as the crew and rig are ready and any fallback cement remediation has been done. The casing cut-off and BOP installation can be initiated four hours after installing the slips, which will be approximately six hours after bumping the plug. For those casing strings not using slips, the minimum wait time before cut-off is eight hours after bumping the plug. BOP/BOPE testing can begin after cut-off or once cement reaches 500 psi compressive strength (including lead cement), whichever is greater. However, if the float does not hold, cut-off cannot be initiated until cement reaches 500 psi compressive strength (including lead when specified).
- b. In potash areas, for all casing strings utilizing slips, these are to be set as soon as the crew and rig are ready and any fallback cement remediation has been done. For all casing strings, casing cut-off and BOP installation can be initiated at twelve hours after bumping the cement plug. The BOPE test can be initiated after bumping the cement plug with the casing valve open. (only applies to single stage cement jobs, prior to the cement setting up.)
- c. The tests shall be done by an independent service company utilizing a test plug not a cup or J-packer and can be initiated immediately with the casing valve open. The operator also has the option of utilizing an independent tester to test without a plug (i.e. against the casing) pursuant to 43 CFR part 3170 Subpart 3172 with the pressure not to exceed 70% of the burst rating for the casing. Any test against the casing must meet the WOC time for 8 hours or 500 pounds compressive strength, whichever is greater, prior to initiating the test (see casing segment as lead cement may be critical item).
- d. The test shall be run on a 5000 psi chart for a 2-3M BOP/BOP, on a 10000 psi chart for a 5M BOP/BOPE and on a 15000 psi chart for a 10M BOP/BOPE. If a linear chart is used, it shall be a one hour chart. A circular chart shall have a maximum 2 hour clock. If a twelve hour or twenty-four hour chart is used, tester shall make a notation that it is run with a two hour clock.
- e. The results of the test shall be reported to the appropriate BLM office.
- f. All tests are required to be recorded on a calibrated test chart. A copy of the BOP/BOPE test chart and a copy of independent service company test will be submitted to the appropriate BLM office.
- g. The BOP/BOPE test shall include a low pressure test from 250 to 300 psi. The test will be held for a minimum of 10 minutes if test is done with a test plug and 30 minutes without a test plug. This test shall be performed prior to the test at full stack pressure.
- h. BOP/BOPE must be tested by an independent service company within 500 feet of the top of the Wolfcamp formation if the time between the setting of

the intermediate casing and reaching this depth exceeds 20 days. This test does not exclude the test prior to drilling out the casing shoe as per 43 CFR part 3170 Subpart 3172.

C. DRILLING MUD

Mud system monitoring equipment, with derrick floor indicators and visual and audio alarms, shall be operating before drilling into the Wolfcamp formation, and shall be used until production casing is run and cemented.

D. WASTE MATERIAL AND FLUIDS

All waste (i.e. drilling fluids, trash, salts, chemicals, sewage, gray water, etc.) created as a result of drilling operations and completion operations shall be safely contained and disposed of properly at a waste disposal facility. No waste material or fluid shall be disposed of on the well location or surrounding area.

Porto-johns and trash containers will be on-location during fracturing operations or any other crew-intensive operations.

Long Vo (LVO) 6/1/2024



Devon Energy Center 333 West Sheridan Avenue Oklahoma City, Oklahoma 73102-5015

Hydrogen Sulfide (H₂S) Contingency Plan

For


Bora Bora 13-24 Fed Com 302H


Sec-12 T-23S R-31E 490' FSL & 2520' FEL LAT. = 32.3130452° N (NAD83) LONG = 103.7311144° W

Eddy County NM

Bora Bora 13-24 Fed Com 302H

This is an open drilling site. H₂S monitoring equipment and emergency response equipment will be used within 500' of zones known to contain H₂S, including warning signs, wind indicators and H₂S monitor.

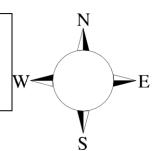

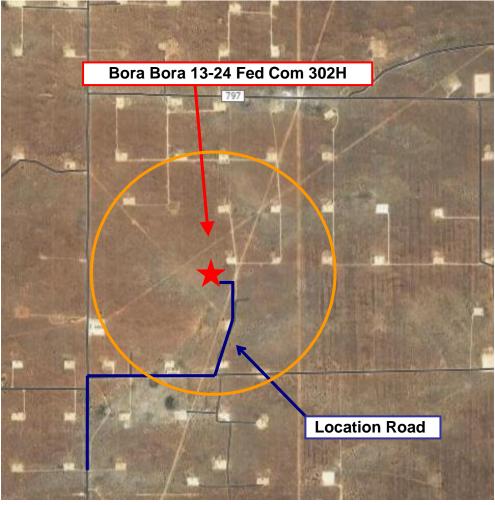

Assumed 100 ppm ROE = 3000' (Radius of Exposure)
100 ppm H2S concentration shall trigger activation of this plan.

Escape

Crews shall escape upwind of escaping gas in the event of an emergency release of gas. Escape can be facilitated from the location entrance road. Crews should then block the entrance to the location from the lease road so as not to allow anyone traversing into a hazardous area. The blockade should be at a safe distance outside of the ROE. There are no homes or buildings in or near the ROE.

Assumed 100 ppm ROE = 3000'

100 ppm H₂S concentration shall trigger activation of this plan.

Emergency Procedures

In the event of a release of gas containing H₂S, the first responder(s) must

- Isolate the area and prevent entry by other persons into the 100 ppm ROE.
- Evacuate any public places encompassed by the 100 ppm ROE.
- Be equipped with H₂S monitors and air packs in order to control the release.
- Use the "buddy system" to ensure no injuries occur during the response
- Take precautions to avoid personal injury during this operation.
- Contact operator and/or local officials to aid in operation. See list of phone numbers attached.
- Have received training in the
 - Detection of H₂S, and
 - Measures for protection against the gas,
 - Equipment used for protection and emergency response.

Ignition of Gas Source

Should control of the well be considered lost and ignition considered, take care to protect against exposure to Sulfur Dioxide (SO₂). Intentional ignition must be coordinated with the NMOCD and local officials. Additionally the NM State Police may become involved. NM State Police shall be the Incident Command on scene of any major release. Take care to protect downwind whenever there is an ignition of the gas

Characteristics of H₂S and SO₂

Common	Chemical	Specific	Threshold	Hazardous Limit	Lethal
Name	Formula	Gravity	Limit	nazaruous Liiilit	Concentration
Hydrogen Sulfide	H ₂ S	1.189 Air = 1	10 ppm	100 ppm/hr	600 ppm
Sulfur	SO ₂	2.21	2 ppm	N/A	1000 ppm
Dioxide		Air = 1		,	

Contacting Authorities

Devon Energy Corp. personnel must liaison with local and state agencies to ensure a proper response to a major release. Additionally, the OCD must be notified of the release as soon as possible but no later than 4 hours. Agencies will ask for information such as type and volume of release, wind direction, location of release, etc. Be prepared with all information available. The following call list of essential and potential responders has been prepared for use during a release. Devon Energy Corp. Company response must be in coordination with the State of New Mexico's 'Hazardous Materials Emergency Response Plan' (HMER)

Hydrogen Sulfide Drilling Operation Plan

I. HYDROGEN SULFIDE (H2S) TRAINING

All personnel, whether regularly assigned, contracted, or employed on an unscheduled basis, will receive training from a qualified instructor in the following areas prior to commencing drilling operations on this well:

- 1. The hazards and characteristics of hydrogen sulfide (H₂S)
- 2. The proper use and maintenance of personal protective equipment and life support systems.
- 3. The proper use of H₂S detectors, alarms, warning systems, briefing areas, evacuation procedures, and prevailing winds.
- 4. The proper techniques for first aid and rescue procedures.

In addition, supervisory personnel will be trained in the following areas:

- 1. The effects of H₂S metal components. If high tensile tubulars are to be used, personnel will be trained in their special maintenance requirements.
- 2. Corrective action and shut-in procedures when drilling or reworking a well and blowout prevention and well control procedures.
- 3. The contents and requirements of the H₂S Drilling Operations Plan.

There will be weekly H₂S and well control drills for all personnel in each crew.

II. HYDROGEN SULFIDE TRAINING

Note: All H₂S safety equipment and systems will be installed, tested, and operational when drilling reaches a depth of 500 feet above, or three days prior to penetrating the first zone containing or reasonably expected to contain H₂S.

1. Well Control Equipment

- A. Flare line
- B. Choke manifold Remotely Operated
- C. Blind rams and pipe rams to accommodate all pipe sizes with properly sized closing unit
- D. Auxiliary equipment may include if applicable: annular preventer and rotating head.
- E. Mud/Gas Separator

2. Protective equipment for essential personnel:

30-minute SCBA units located at briefing areas, as indicated on well site diagram, with escape units available in the top doghouse. As it may be difficult to communicate audibly while wearing these units, hand signals shall be utilized.

3. H₂S detection and monitoring equipment:

Portable H₂S monitors positioned on location for best coverage and response. These units have warning lights which activate when H₂S levels reach 10 ppm and audible sirens which activate at 15 ppm. Sensor locations:

- Bell nipple
- Possum Belly/Shale shaker
- Rig floor
- Choke manifold
- Cellar

Visual warning systems:

- A. Wind direction indicators as shown on well site diagram
- B. Caution/ Danger signs shall be posted on roads providing direct access to locations. Signs will be painted a high visibility yellow with black lettering of sufficient size to be reasonable distance from the immediate location. Bilingual signs will be used when appropriate.

4. Mud program:

The mud program has been designed to minimize the volume of H₂S circulated to surface. Proper mud weight, safe drilling practices and the use of H₂S scavengers will minimize hazards when penetrating H₂S bearing zones.

5. Metallurgy:

- A. All drill strings, casings, tubing, wellhead, blowout preventer, drilling spool, kill lines, choke manifold lines, and valves shall be H₂S trim.
- B. All elastomers used for packing and seals shall be H_2S trim.

6. Communication:

- A. Company personnel have/use cellular telephones in the field.
- B. Land line (telephone) communications at Office

7. Well testing:


- A. Drill stem testing will be performed with a minimum number of personnel in the immediate vicinity, which are necessary to safety and adequately conduct the test. The drill stem testing will be conducted during daylight hours and formation fluids will not be flowed to the surface. All drill-stem-testing operations conducted in an H₂S environment will use the closed chamber method of testing.
- B. There will be no drill stem testing.

Devon Energy Corp. Company Call List					
Employee/Company Contact Representative	Position	Phone Number	After Hours Number		
Jonathan Fisher (North)	Drilling Manager	832-967-7912			
Jason Hildebrand (South)	Drilling Manager	405-552-6514			
Rich Downey	Drilling VP	405-228-2415			
Josh Harvey	EHS Manager	405-228-2440	918-500-5536		
Laura Wright	EHS Supervisor	405-552-5334	832-969-8145		
Robert Glover	EHS Professional	575-703-5712	575-703-5712		
Lane Frank	Lead EHS	580-579-7052	580-579-7052		
Rickey Porter	Lead EHS	903-720-8315	903-720-8315		
Ronnie Handy	Lead EHS	918-839-2046	918-839-2046		
Brock Vise	Lead EHS	918-413-3291	918-413-3291		

Agency	Call List			

County (575) Lea County Communication Authority 397-9265 State Police 385-3138 City Police 396-3611 Ambulance 911 Fire Department 397-9265 LEPC (Local Emergency Planning Committee) 393-2870 NMOCD 393-6161 US Bureau of Land Management (Closed) 393-0002 Eddy County (575) State Police 885-3137 City Police 885-3117 Sheriff's Office 887-7551 Ambulance 911 Fire Department 885-3125 LEPC (Local Emergency Planning Committee) 887-3798 US Bureau of Land Management 234-5972 NM Emergency Response Commission (Santa Fe) (505) 827-9126 National Emergency Response Center (800) 424-8802 National Pollution Control Center: Direct (703) 872-6000 For Oil Spills (800) 280-7118 Emergency Services Wild Well Control (281) 784-4700 Cudd Pressure Control (915) 699-0139 (915) 563-3356 Halliburton (575) 746-3569 (575) 746-3569	<u>Lea</u>	Hobbs	
City Police 397-9265	County	Lea County Communication Authority	397-9265
Sheriff's Office 396-3611	<u>(575)</u>	State Police	885-3138
Ambulance 911		City Police	397-9265
Fire Department		Sheriff's Office	396-3611
LEPC (Local Emergency Planning Committee) 393-2870 NMOCD 393-6161 US Bureau of Land Management (Closed) 393-0002		Ambulance	911
NMOCD		Fire Department	397-9308
NMOCD		LEPC (Local Emergency Planning Committee)	393-2870
Eddy Carlsbad State Police 885-3137 (575) City Police 885-2111 Sheriff's Office 887-7551 Ambulance 911 Fire Department 885-3125 LEPC (Local Emergency Planning Committee) 887-3798 US Bureau of Land Management 234-5972 NM Emergency Response Commission (Santa Fe) (505) 476-9600 24 HR (505) 827-9126 National Emergency Response Center (800) 424-8802 National Pollution Control Center: Direct (703) 872-6000 For Oil Spills (800) 280-7118 Emergency Services Wild Well Control (915) 699-0139 (915) 563-3356 Halliburton (575) 746-2757 B. J. Services (575) 746-3569 Give GPS For Air Ambulance - Eddy County Dispatch (575)-616-7155 For Air Ambulance - Lea County (LCCA) (575)-397-9265 Poison Control (24/7) (800) 222-1222 Oil & Gas Pipeline 24 Hour Service (800) 364-4366 NOAA - Website - www.nhc.noaa.gov National Pollution Control Center 202-795-6958			393-6161
Eddy Carlsbad State Police 885-3137 (575) City Police 885-2111 Sheriff's Office 887-7551 Ambulance 911 Fire Department 885-3125 LEPC (Local Emergency Planning Committee) 887-3798 US Bureau of Land Management 234-5972 NM Emergency Response Commission (Santa Fe) (505) 476-9600 24 HR (505) 827-9126 National Emergency Response Center (800) 424-8802 National Pollution Control Center: Direct (703) 872-6000 For Oil Spills (800) 280-7118 Emergency Services Wild Well Control (915) 699-0139 (915) 563-3356 Halliburton (575) 746-2757 B. J. Services (575) 746-3569 Give GPS For Air Ambulance - Eddy County Dispatch (575)-616-7155 For Air Ambulance - Lea County (LCCA) (575)-397-9265 Poison Control (24/7) (800) 222-1222 Oil & Gas Pipeline 24 Hour Service (800) 364-4366 NOAA - Website - www.nhc.noaa.gov National Pollution Control Center 202-795-6958		US Bureau of Land Management (Closed)	393-0002
County (575) State Police 885-3137 City Police 885-2111 Sheriff's Office 887-7551 Ambulance 911 Fire Department 885-3125 LEPC (Local Emergency Planning Committee) 887-3798 US Bureau of Land Management 234-5972 NM Emergency Response Commission (Santa Fe) (505) 476-9600 24 HR (505) 827-9126 National Emergency Response Center (800) 424-8802 National Pollution Control Center: Direct (703) 872-6000 For Oil Spills (800) 280-7118 Emergency Services Wild Well Control (281) 784-4700 Cudd Pressure Control (915) 699-0139 (915) 563-3356 Halliburton (575) 746-3757 (575) 746-3757 B. J. Services (575) 746-37569 GPS Native Air – Emergency Helicopter – Hobbs (575) 347-9836 For Air Ambulance - Eddy County Dispatch (575)-397-9265 Poison Control (24/7) (800) 222-1222 Oil & Gas Pipeline 24 Hour Service (800) 364-4366 NOAA – Website - www.nhc.noaa.gov		• ,	
City Police 885-2111 Sheriff's Office 887-7551 Ambulance 911 Fire Department 885-3125 LEPC (Local Emergency Planning Committee) 887-3798 US Bureau of Land Management 234-5972 NM Emergency Response Commission (Santa Fe) (505) 476-9600 24 HR (505) 827-9126 National Emergency Response Center (800) 424-8802 National Pollution Control Center: Direct (703) 872-6000 For Oil Spills (800) 280-7118 Emergency Services Wild Well Control (281) 784-4700 Cudd Pressure Control (915) 699-0139 (915) 563-3356 Halliburton (575) 746-2757 (575) 746-2757 B. J. Services (575) 746-3569 GPS For Air Ambulance - Eddy County Dispatch (575)-616-7155 For Air Ambulance - Lea County (LCCA) (575)-397-9265 Poison Control (24/7) (800) 222-1222 Oil & Gas Pipeline 24 Hour Service (800) 364-4366 NOAA - Website - www.nhc.noaa.gov National Pollution Control Center 202-795-6958	Eddy	Carlsbad	
Sheriff's Office	County	State Police	885-3137
Ambulance	<u>(575)</u>	City Police	885-2111
Fire Department		Sheriff's Office	887-7551
LEPC (Local Emergency Planning Committee) 887-3798 US Bureau of Land Management 234-5972 NM Emergency Response Commission (Santa Fe) (505) 476-9600 24 HR (505) 827-9126 National Emergency Response Center (800) 424-8802 National Pollution Control Center: Direct (703) 872-6000 For Oil Spills (800) 280-7118 Emergency Services (800) 424-4700 Cudd Pressure Control (915) 699-0139 (915) 563-3356 Halliburton (575) 746-2757 B. J. Services (575) 746-3569 Give GPS		Ambulance	
US Bureau of Land Management NM Emergency Response Commission (Santa Fe) 234-5972 NM Emergency Response Commission (Santa Fe) 24 HR (505) 827-9126 National Emergency Response Center National Pollution Control Center: Direct For Oil Spills Emergency Services Wild Well Control Cudd Pressure Control (281) 784-4700 Cudd Pressure Control (915) 699-0139 (915) 563-3356 Halliburton (575) 746-2757 B. J. Services (575) 746-3569 Give GPS For Air Ambulance - Eddy County Dispatch For Air Ambulance - Lea County (LCCA) Poison Control (24/7) (800) 222-1222 Oil & Gas Pipeline 24 Hour Service NOAA - Website - www.nhc.noaa.gov National Pollution Control Center		Fire Department	885-3125
NM Emergency Response Commission (Santa Fe) (505) 476-9600 24 HR (505) 827-9126 National Emergency Response Center (800) 424-8802 National Pollution Control Center: Direct (703) 872-6000 For Oil Spills (800) 280-7118 Emergency Services (800) 424-8802 Wild Well Control (800) 280-7118 Emergency Services (800) 280-7118 Emergency Services (800) 280-7118 Emergency Services (800) 280-7118 Emergency Services (915) 699-0139 (915) 563-3356 Halliburton (915) 699-0139 (915) 563-3356 Halliburton (575) 746-2757 B. J. Services (575) 746-3569 Give GPS (575) 347-9836 (575) 347-9836 GPS (575) Air Ambulance - Eddy County Dispatch (575)-616-7155 For Air Ambulance - Lea County (LCCA) (575)-397-9265 Poison Control (24/7) (800) 222-1222 Oil & Gas Pipeline 24 Hour Service (800) 364-4366 NOAA - Website - www.nhc.noaa.gov National Pollution Control Center (202-795-6958)		LEPC (Local Emergency Planning Committee)	887-3798
24 HR			234-5972
National Emergency Response Center (800) 424-8802 National Pollution Control Center: Direct (703) 872-6000 For Oil Spills (800) 280-7118 Emergency Services Wild Well Control (281) 784-4700 Cudd Pressure Control (915) 699-0139 (915) 563-3356 Halliburton (575) 746-2757 B. J. Services (575) 746-3569 Give Native Air – Emergency Helicopter – Hobbs (575) 347-9836 GPS For Air Ambulance - Eddy County Dispatch (575)-616-7155 position: For Air Ambulance - Lea County (LCCA) (575)-397-9265 Poison Control (24/7) (800) 222-1222 Oil & Gas Pipeline 24 Hour Service (800) 364-4366 NOAA – Website - www.nhc.noaa.gov National Pollution Control Center 202-795-6958		NM Emergency Response Commission (Santa Fe)	(505) 476-9600
National Pollution Control Center: Direct (703) 872-6000 For Oil Spills (800) 280-7118 Emergency Services Wild Well Control (281) 784-4700 Cudd Pressure Control (915) 699-0139 (915) 563-3356 Halliburton (575) 746-2757 B. J. Services (575) 746-3569 Give GPS Native Air – Emergency Helicopter – Hobbs (575) 347-9836 For Air Ambulance - Eddy County Dispatch (575)-616-7155 For Air Ambulance - Lea County (LCCA) (575)-397-9265 Poison Control (24/7) (800) 222-1222 Oil & Gas Pipeline 24 Hour Service (800) 364-4366 NOAA – Website - www.nhc.noaa.gov National Pollution Control Center 202-795-6958		24 HR	(505) 827-9126
For Oil Spills (800) 280-7118 Emergency Services Wild Well Control (281) 784-4700 Cudd Pressure Control (915) 699-0139 (915) 563-3356 Halliburton (575) 746-2757 B. J. Services (575) 746-3569 Give Native Air – Emergency Helicopter – Hobbs (575) 347-9836 For Air Ambulance - Eddy County Dispatch (575)-616-7155 position: For Air Ambulance - Lea County (LCCA) (575)-397-9265 Poison Control (24/7) (800) 222-1222 Oil & Gas Pipeline 24 Hour Service (800) 364-4366 NOAA – Website - www.nhc.noaa.gov National Pollution Control Center 202-795-6958		National Emergency Response Center	(800) 424-8802
Emergency Services Wild Well Control (281) 784-4700 Cudd Pressure Control (915) 699-0139 (915) 563-3356 Halliburton (575) 746-2757 B. J. Services (575) 746-3569 Give Native Air – Emergency Helicopter – Hobbs (575) 347-9836 GPS For Air Ambulance - Eddy County Dispatch (575)-616-7155 For Air Ambulance - Lea County (LCCA) (575)-397-9265 Poison Control (24/7) (800) 222-1222 Oil & Gas Pipeline 24 Hour Service (800) 364-4366 NOAA – Website - www.nhc.noaa.gov National Pollution Control Center (202-795-6958)		National Pollution Control Center: Direct	(703) 872-6000
Wild Well Control (281) 784-4700 Cudd Pressure Control (915) 699-0139 (915) 563-3356 Halliburton (575) 746-2757 B. J. Services (575) 746-3569 Give Native Air – Emergency Helicopter – Hobbs (575) 347-9836 For Air Ambulance - Eddy County Dispatch (575)-616-7155 position: For Air Ambulance - Lea County (LCCA) (575)-397-9265 Poison Control (24/7) (800) 222-1222 Oil & Gas Pipeline 24 Hour Service (800) 364-4366 NOAA – Website - www.nhc.noaa.gov National Pollution Control Center 202-795-6958		For Oil Spills	(800) 280-7118
Cudd Pressure Control (915) 699-0139 (915) 563-3356 Halliburton (575) 746-2757 B. J. Services (575) 746-3569 Give Native Air – Emergency Helicopter – Hobbs (575) 347-9836 GPS For Air Ambulance - Eddy County Dispatch (575)-616-7155 position: For Air Ambulance - Lea County (LCCA) (575)-397-9265 Poison Control (24/7) (800) 222-1222 Oil & Gas Pipeline 24 Hour Service (800) 364-4366 NOAA – Website - www.nhc.noaa.gov Vational Pollution Control Center 202-795-6958		Emergency Services	
Halliburton		Wild Well Control	(281) 784-4700
B. J. Services		Cudd Pressure Control (915) 699-0139	(915) 563-3356
Give Native Air – Emergency Helicopter – Hobbs (575) 347-9836 GPS For Air Ambulance - Eddy County Dispatch (575)-616-7155 position: For Air Ambulance - Lea County (LCCA) (575)-397-9265 Poison Control (24/7) (800) 222-1222 Oil & Gas Pipeline 24 Hour Service (800) 364-4366 NOAA – Website - www.nhc.noaa.gov National Pollution Control Center 202-795-6958		Halliburton	(575) 746-2757
GPS position: For Air Ambulance - Eddy County Dispatch (575)-616-7155 For Air Ambulance - Lea County (LCCA) (575)-397-9265 Poison Control (24/7) (800) 222-1222 Oil & Gas Pipeline 24 Hour Service (800) 364-4366 NOAA - Website - www.nhc.noaa.gov Vational Pollution Control Center 202-795-6958		B. J. Services	(575) 746-3569
position: For Air Ambulance - Lea County (LCCA) (575)-397-9265 Poison Control (24/7) (800) 222-1222 Oil & Gas Pipeline 24 Hour Service (800) 364-4366 NOAA – Website - www.nhc.noaa.gov National Pollution Control Center 202-795-6958	Give	Native Air – Emergency Helicopter – Hobbs	(575) 347-9836
Poison Control (24/7) (800) 222-1222 Oil & Gas Pipeline 24 Hour Service (800) 364-4366 NOAA – Website - www.nhc.noaa.gov National Pollution Control Center 202-795-6958	GPS	For Air Ambulance - Eddy County Dispatch	(575)-616-7155
Oil & Gas Pipeline 24 Hour Service (800) 364-4366 NOAA – Website - www.nhc.noaa.gov National Pollution Control Center 202-795-6958	position:	For Air Ambulance - Lea County (LCCA)	(575)-397-9265
NOAA – Website - www.nhc.noaa.gov National Pollution Control Center 202-795-6958		Poison Control (24/7)	(800) 222-1222
National Pollution Control Center 202-795-6958			
		NOAA – Website - www.nhc.noaa.gov	
NPCC – Oil Spills 800-280-7118			202-795-6958
		NPCC – Oil Spills	800-280-7118

Prepared in conjunction with Dave Small

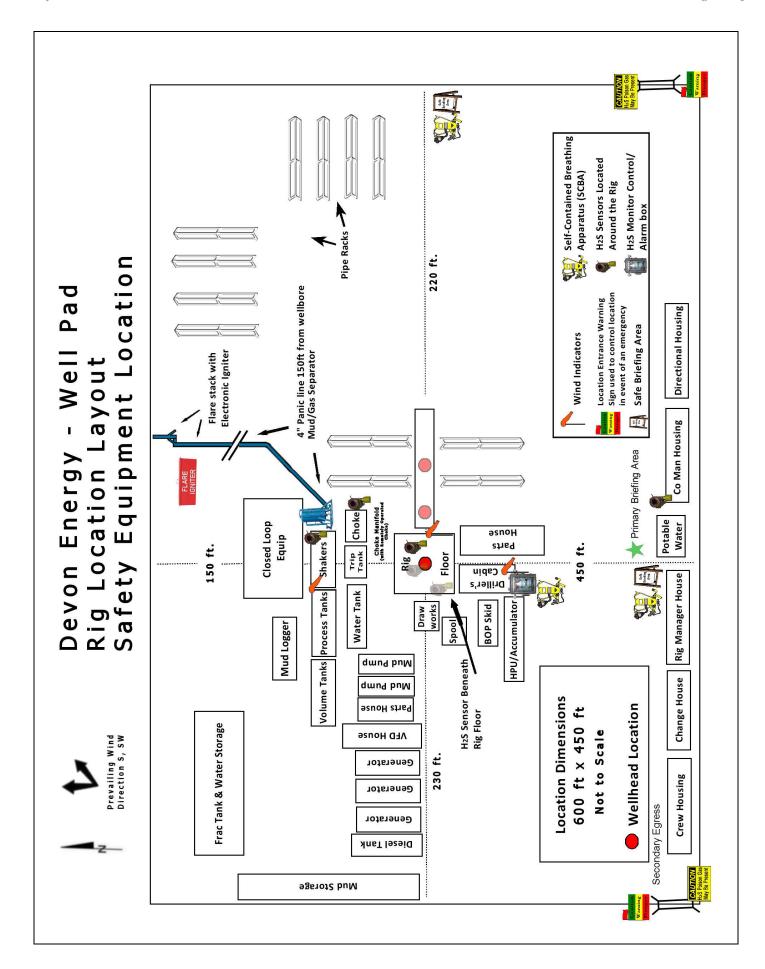

District I
1625 N. French Dr., Hobbs, NM 88240
Phone: (575) 393-6161 Fax: (575) 393-0720 District II

811 S. First St., Artesia, NM 88210 Phone: (575) 748-1283 Fax: (575) 748-9720

District III 1000 Rio Brazos Rd., Aztec, NM 87410 Phone:(505) 334-6178 Fax:(505) 334-6170

1220 S. St Francis Dr., Santa Fe, NM 87505 Phone:(505) 476-3470 Fax:(505) 476-3462

State of New Mexico Energy, Minerals and Natural Resources Oil Conservation Division 1220 S. St Francis Dr. **Santa Fe, NM 87505**

CONDITIONS

Action 356948

CONDITIONS

Operator:	OGRID:
DEVON ENERGY PRODUCTION COMPANY, LP	6137
333 West Sheridan Ave.	Action Number:
Oklahoma City, OK 73102	356948
	Action Type:
	[C-101] BLM - Federal/Indian Land Lease (Form 3160-3)

CONDITIONS

Created By	Condition	Condition Date
ward.rikala	Notify OCD 24 hours prior to casing & cement	7/16/2024
ward.rikala	Will require a File As Drilled C-102 and a Directional Survey with the C-104	7/16/2024
ward.rikala	Once the well is spud, to prevent ground water contamination through whole or partial conduits from the surface, the operator shall drill without interruption through the fresh water zone or zones and shall immediately set in cement the water protection string	7/16/2024
ward.rikala	Cement is required to circulate on both surface and intermediate1 strings of casing	7/16/2024
ward.rikala	If cement does not circulate on any string, a CBL is required for that string of casing	7/16/2024
ward.rikala	Oil base muds are not to be used until fresh water zones are cased and cemented providing isolation from the oil or diesel. This includes synthetic oils. Oil based mud, drilling fluids and solids must be contained in a steel closed loop system	7/16/2024