

Submit 3 Copies To Appropriate District Office
District I
1625 N. French Dr., Hobbs, NM 88240
District II
1301 W. Grand Ave., Artesia, NM 88210
District III
1000 Rio Brazos Rd., Aztec, NM 87410
District IV
1220 S. St. Francis Dr., Santa Fe, NM 87505

State of New Mexico
Energy, Minerals and Natural Resources

Form C-103
May 27, 2004

OIL CONSERVATION DIVISION
1220 South St. Francis Dr.
Santa Fe, NM 87505

WELL API NO. 30-025-26351
5. Indicate Type of Lease STATE <input checked="" type="checkbox"/> FEE <input type="checkbox"/>
6. State Oil & Gas Lease No. VO-7643-0000
7. Lease Name or Unit Agreement Name New Mexico 87 State
8. Well Number 1
9. OGRID Number 151323
10. Pool name or Wildcat Tres Papalotes (Penn)

SUNDRY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)

1. Type of Well: Oil Well ☒ Gas Well ☐ Other ☐

2. Name of Operator
Pride Energy Company

3. Address of Operator
PO Box 701950, Tulsa, OK 74170

4. Well Location
Unit Letter K : 2,086 feet from the South line and 1,874 feet from the West line
Section 33 Township 14S Range 34E NMPM Lea County

11. Elevation (Show whether DR, RKB, RT, GR, etc.)
4,118' GR

Pit or Below-grade Tank Application ☐ or Closure ☐

Pit type _____ Depth to Groundwater _____ Distance from nearest fresh water well _____ Distance from nearest surface water _____

Pit Liner Thickness: _____ mil Below-Grade Tank: Volume _____ bbls; Construction Material _____

12. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:		SUBSEQUENT REPORT OF:	
PERFORM REMEDIAL WORK <input type="checkbox"/>	PLUG AND ABANDON <input type="checkbox"/>	REMEDIAL WORK <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
TEMPORARILY ABANDON <input checked="" type="checkbox"/>	CHANGE PLANS <input type="checkbox"/>	COMMENCE DRILLING OPNS. <input type="checkbox"/>	P AND A <input type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>	MULTIPLE COMPL <input type="checkbox"/>	CASING/CEMENT JOB <input type="checkbox"/>	
OTHER: <input type="checkbox"/>		OTHER: <input type="checkbox"/>	Drilling <input type="checkbox"/>

13. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion.

Plan to mobilize a workover rig to pull the rods and TBG. Will then wireline set a CIBP at 9,600' (50' above top perf) and dump 2 sx cement on top. Then plan to load the hole and test the CIBP and CSG to 500 PSI.

Run TA status MIT/BHT test

I hereby certify that the information above is true and complete to the best of my knowledge and belief. I further certify that any pit or below-grade tank has been/will be constructed or closed according to NMOCD guidelines ☐, a general permit ☐ or an (attached) alternative OCD-approved plan ☐.

SIGNATURE John Pride TITLE Pres. Pride Oil & Gas Co Inc., GP of DATE 7/26/24

Type or print name John Pride E-mail address: JohnP@pride-energy.com Telephone No. 918-524-9200
For State Use Only

APPROVED BY: Kerry Fortner TITLE Compliance Officer A DATE 7/29/24
Conditions of Approval (if any): _____

Well: **New Mexico 87 State #1**

Location: 2086' FSL & 1874' FWL, Unit K, Sec. 33-14S-34E, Lea Co., NM

Field: Tres Papalotes (Penn)

Plan to mobilize a workover rig to pull the rods and TBG. Will then wireline set a CIBP at 9,600' (50' above top perf) and dump 2 sx cement on top. Then plan to load the hole and test the CIBP and CSG to 500 PSI.

9.14.10 Completion

KB: 4132.0'
 DF: 4131.0'
 GL: 4118.0'
 Datum: 14.0' above GL

13³/₈" 48# @ 445'
 13³/₈" TOC @ surface
 w/ 450 sx in 17¹/₂" hole


8⁵/₈" 24# & 32# J-55 @ 4538'
 w/ 500 sx in 11" hole
 8⁵/₈" TOC @ ?

10/7/10:
 Perfs in Upper Wolfcamp
 9,650-654=4'
 9,699-701=2'
 9,742-744=2'
 total of 8', 3 spf 24 holes

Penn Perfs: 10,427'-33', 5 spf, 30 holes,
 10-,450'-60', 70'-85', 3 spf, 75 holes

Orig. Perfs: 1/22/71
 10,427-10,433=6', 2 spf, 12 holes

PBTD = 10,504'
 5¹/₂" 15.5# & 17# @ 10549'
 w/ 460 sx in 7⁷/₈" hole
 5¹/₂" TOC @ ?

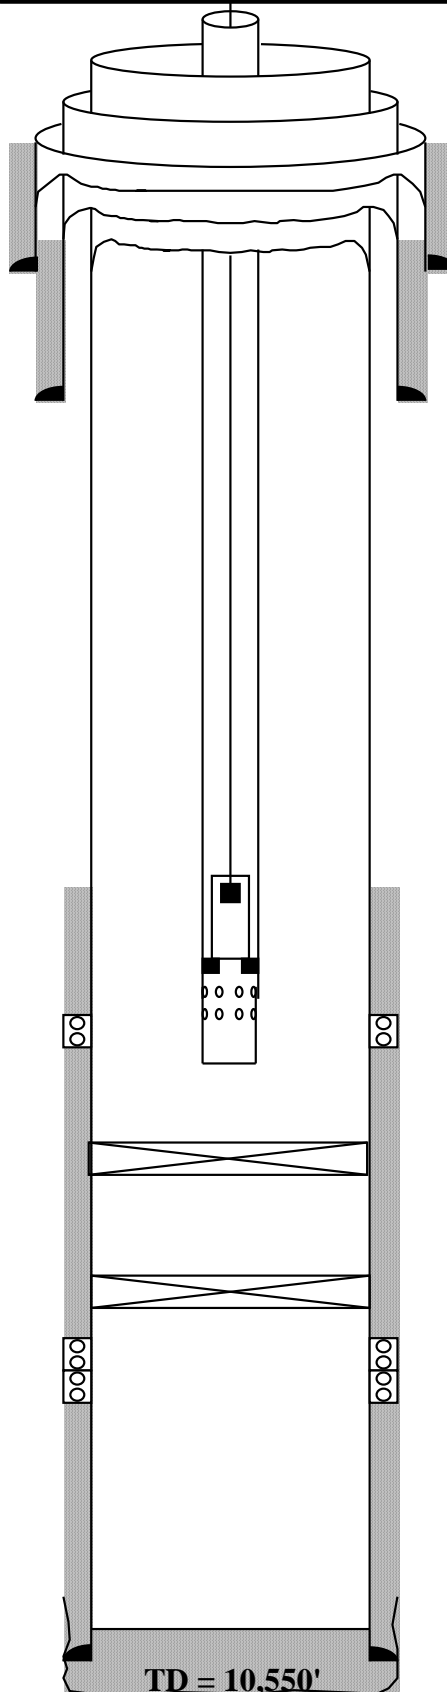New Mexico 87 State #1

John Pride 7/14/16

API # 30-025-23655

2086' FSL & 1874' FWL

Unit K, Sec 33-14S-34E

Lea Co., NM

Field: Tres Papalotes (Penn)


5 1/2 Casing detail

Land below zero	14.78'
39 Jts., N-80, 17#	1,231.75'
35 Jts., K-55, 17#	1,134.62'
119 Jts., K-55, 15.5 #	3,863.92'
47 Jts., K-55, 17#	1,535.69'
85 Jts., N-80, 17#	2,734.09'
Float Collar	1.50'
1 Jt., N-80, 17#	32.15'
Guide Shoe	0.80'

Bottom of Guide Shoe 10,549.30'
 Top of Float Collar 10,514.85'

CIBP set at 10,310' + 2 sx cont.
 on top, 6/18/08

CIBP @ 10,350' set at 6/6/08
 (did not hold)

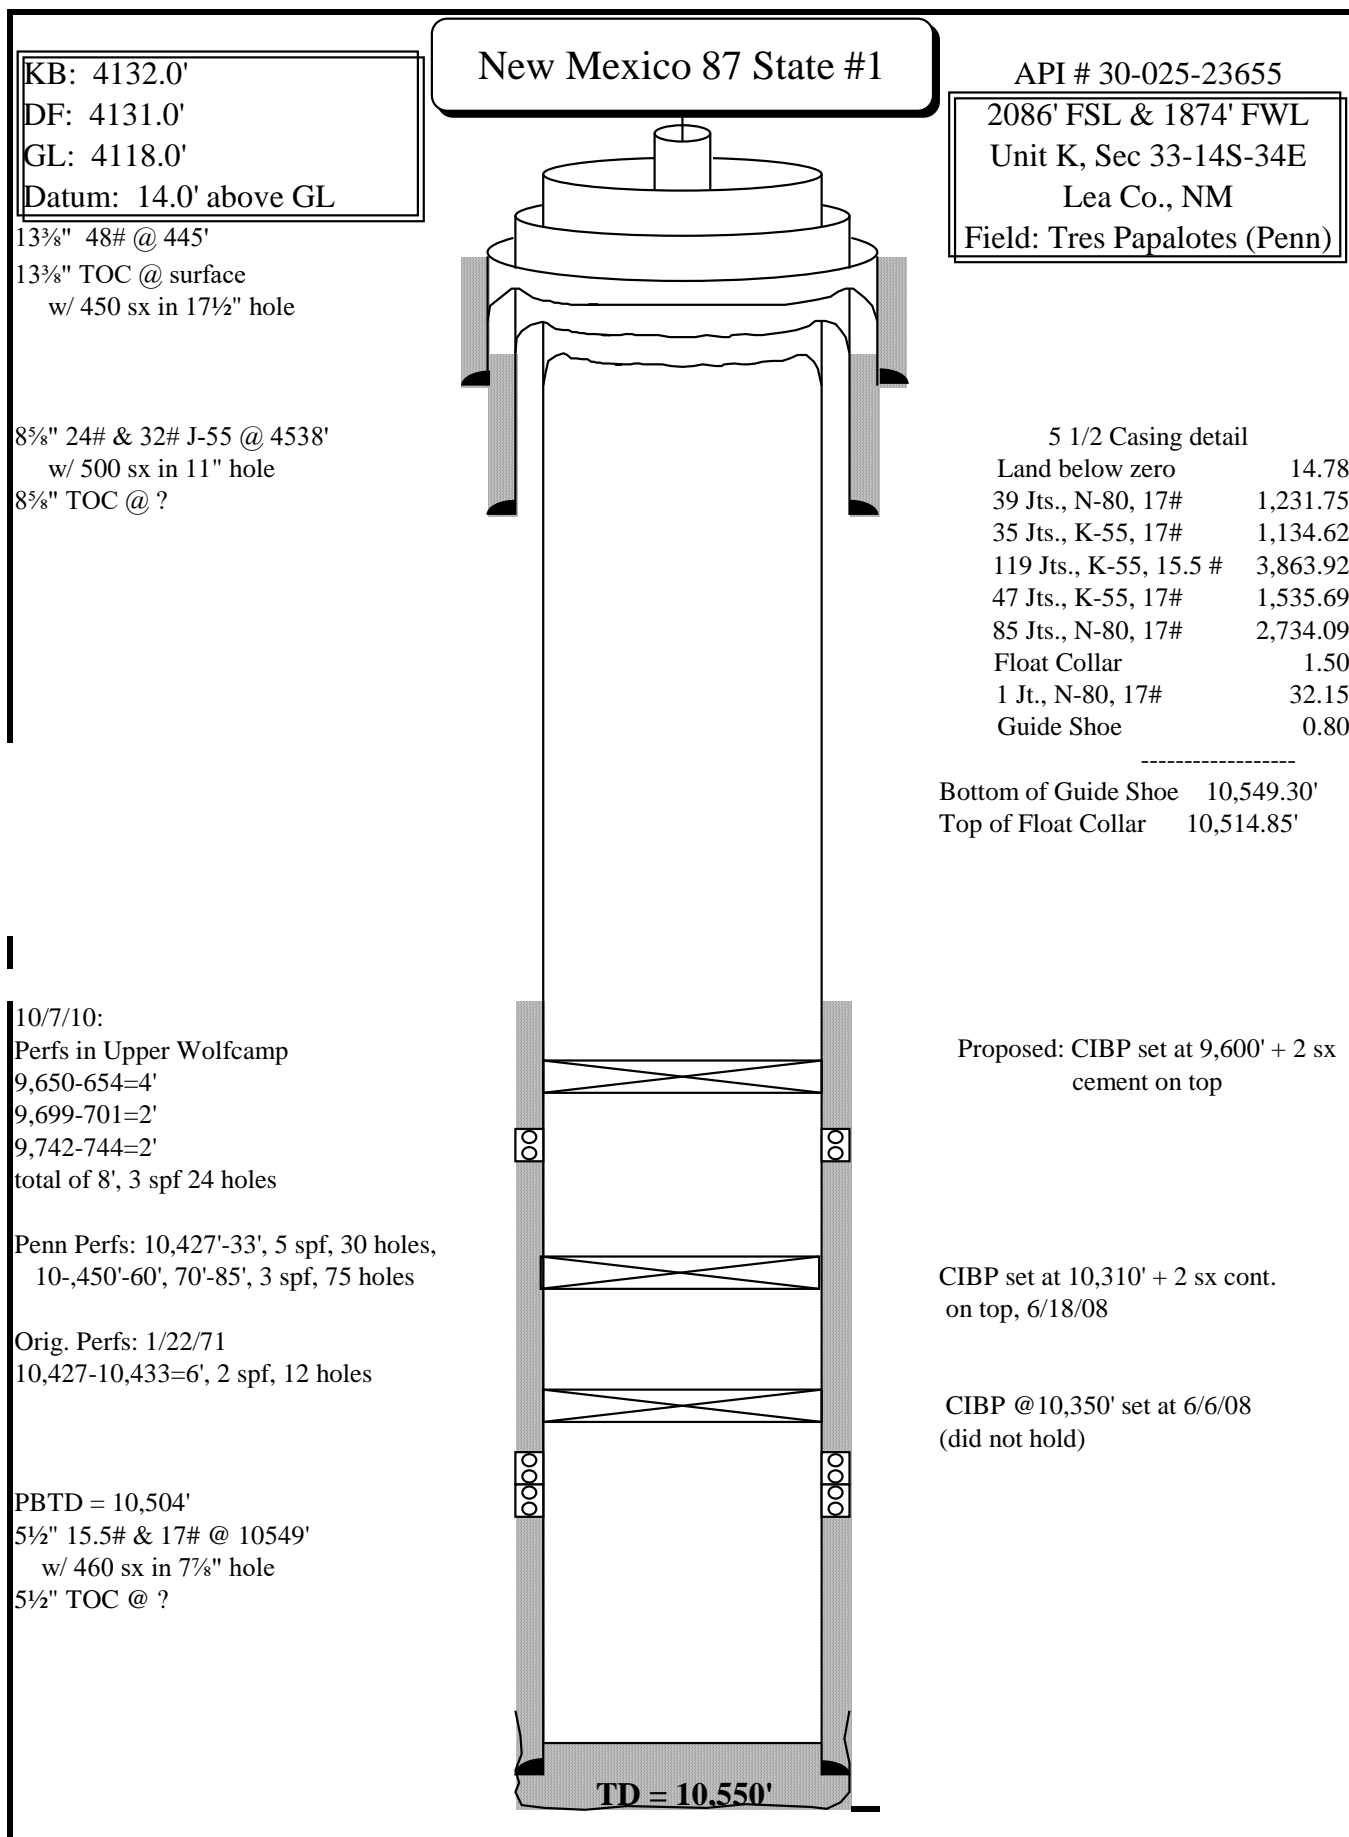

District I
1625 N. French Dr., Hobbs, NM 88240
Phone:(575) 393-6161 Fax:(575) 393-0720
District II
811 S. First St., Artesia, NM 88210
Phone:(575) 748-1283 Fax:(575) 748-9720
District III
1000 Rio Brazos Rd., Aztec, NM 87410
Phone:(505) 334-6178 Fax:(505) 334-6170
District IV
1220 S. St Francis Dr., Santa Fe, NM 87505
Phone:(505) 476-3470 Fax:(505) 476-3462

State of New Mexico
Energy, Minerals and Natural Resources
Oil Conservation Division
1220 S. St Francis Dr.
Santa Fe, NM 87505

CONDITIONS

Action 367405

CONDITIONS

Operator: PRIDE ENERGY COMPANY P.O. Box 701950 Tulsa, OK 741701950	OGRID: 151323
	Action Number: 367405
	Action Type: [C-103] NOI Temporary Abandonment (C-103I)

CONDITIONS

Created By	Condition	Condition Date
kfortner	Run TA status MIT/BHT test	7/29/2024