

Office
 District I – (575) 393-6161
 1625 N. French Dr., Hobbs, NM 88240
 District II – (575) 748-1283
 811 S. First St., Artesia, NM 88210
 District III – (505) 334-6178
 1000 Rio Brazos Rd., Aztec, NM 87410
 District IV – (505) 476-3460
 1220 S. St. Francis Dr., Santa Fe, NM
 87505

State of New Mexico
 Energy, Minerals and Natural Resources

Form C-103
 Revised July 18, 2013

OIL CONSERVATION DIVISION
 1220 South St. Francis Dr.
 Santa Fe, NM 87505

SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)		WELL API NO. 30-021-20604
1. Type of Well: Oil Well <input type="checkbox"/> Gas Well <input checked="" type="checkbox"/> Other CO2		5. Indicate Type of Lease STATE <input type="checkbox"/> FEE <input checked="" type="checkbox"/>
2. Name of Operator Breitburn Operating LP		6. State Oil & Gas Lease No.
3. Address of Operator 1000 Main Street, Suite 2900, Houston, TX 77377		7. Lease Name or Unit Agreement Name Libby Minerals LLC 1931
4. Well Location Unit Letter <u>J</u> : <u>1350</u> feet from the <u>South</u> line and <u>1331</u> feet from the <u>East</u> line Section <u>08</u> Township <u>19N</u> Range <u>31E</u> NMPM County <u>Harding</u>		8. Well Number 83J
11. Elevation (Show whether DR, RKB, RT, GR, etc.)		9. OGRID Number 370080
		10. Pool name or Wildcat Bravo Dome Carbon Dioxide Gas 640

12. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:		SUBSEQUENT REPORT OF:	
PERFORM REMEDIAL WORK <input type="checkbox"/>	PLUG AND ABANDON <input type="checkbox"/>	REMEDIAL WORK <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	CHANGE PLANS <input type="checkbox"/>	COMMENCE DRILLING OPNS. <input type="checkbox"/>	P AND A <input checked="" type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>	MULTIPLE COMPL <input type="checkbox"/>	CASING/CEMENT JOB <input type="checkbox"/>	
DOWNHOLE COMMINGLE <input type="checkbox"/>			
CLOSED-LOOP SYSTEM <input type="checkbox"/>			
OTHER: <input type="checkbox"/>		OTHER: <input type="checkbox"/>	

13. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion.

Breitburn Operating LP recently plugged the Libby Minerals LLC 1931 83J on 3/13/2024. Samantha McFall with the OCD was there during the plugging of the well. Plugging operations are as follows:

3/7/24 Install flange, b section, BOP, PU 7 7/8" tricone bit, bit sub (8) 4 1/4 drill collars, XO, 2 7/8 workstring. Tally and TIH. Tag 2' out jt 8 = 502'. Install spool and stripper head. PU swivel.

3/11/24 PU swivel and break circulation reverse, 3/4 bpm @ 40 psi. Begin drilling CIBP. 9" drilled, CIBP fell. Rack swivel TIH, Tag 12' out jt 15 = 722'. TOH w/ workstring, lay down BHA and drill collars.

3/12/24 RU Quasar, pump 50 bbls brine. Assure well dead. RU Renegade wireline. TIH w/ 8 5/8 CIBP. Set @ 710'. RD wireline. TIH w/ 2 7/8 workstring. Tag CIBP @ 709'. Space out tubing. Load casing 2/40 bbls. Test casing 550 psi. Test good. Pump 9.5 bbls class c cement, displace. TOH w/workstring. Wait 4 hrs for cement. TIH w/workstring. Tagging @ 604', 16' in jt 19. TOH w/workstring.

3/13/24 TIH w/2 7/8 workstring, tag 6' out jt 17 = 559'. TOH, LD 2 7/8 workstring. Leave 3 jts in well = 108'. Pump 30 sx class C cement, returns at surface. Lay down tubing. Nipple down BOP/EPA bowl, install night cap. Rig down equipment, move rig to Hough. Drill out CIBP @ 500'. Wireline set new CIBP @ 710'. 150' cement on top of CIBP. 100' cement plug to surface.

3/13/2024" Set marker

Spud Date:

Rig Release Date:

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE Lauri Stanfield TITLE Sr. Regulatory Analyst DATE 04/09/2024

Type or print name Lauri M. Stanfield E-mail address: Lauri.Stanfield@mavresources.com PHONE: 713.437.8052

For State Use Only


APPROVED BY: _____ TITLE _____ DATE _____

Conditions of Approval (if any):

Breithurn Operating, LP
As-Plugged

FIELD:	Libby Ranch	DATE:	Mar. 13, 2024
LEASE/UNIT:	Libby Minerals LLC 1931	BY:	AH
COUNTY:	Harding	WELL:	8-3-J
		STATE:	New Mexico

CURRENT STATUS: Plug & Abandoned API = 30-021-20604
Location: 1350 FSL 1331 FEL, Sec 8, T19N, R31E KB = 10'

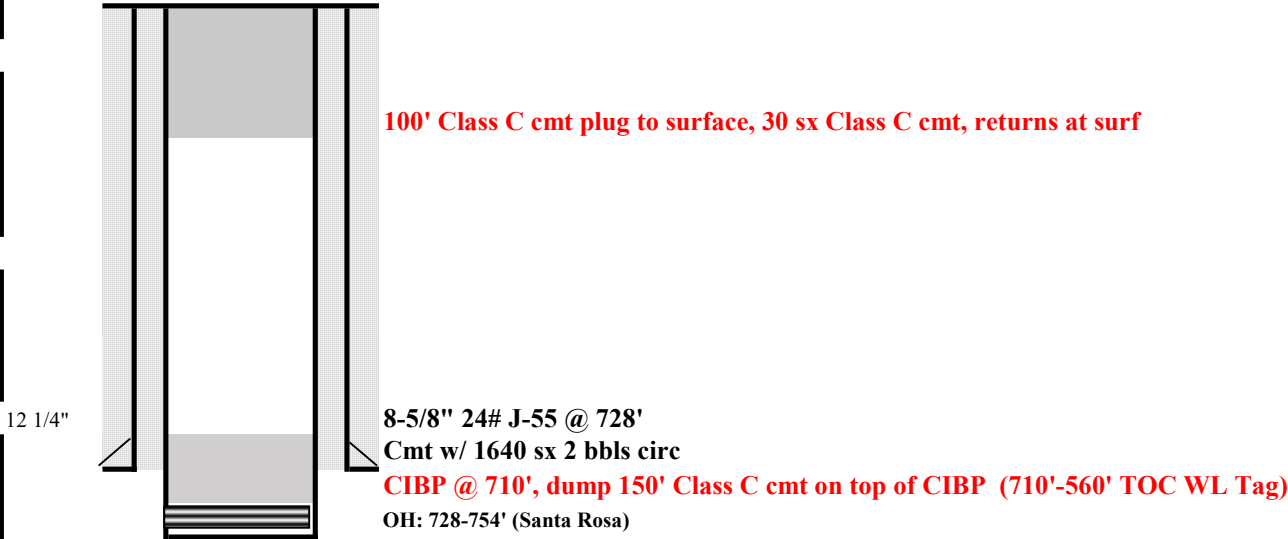

PBTD -
TD - 754'

Sante Fe Main Office
Phone: (505) 476-3441

General Information
Phone: (505) 629-6116

Online Phone Directory
<https://www.emnrd.nm.gov/oed/contact-us>

State of New Mexico
Energy, Minerals and Natural Resources
Oil Conservation Division
1220 S. St Francis Dr.
Santa Fe, NM 87505

CONDITIONS

Action 350545

CONDITIONS

Operator: BREITBURN OPERATING LP 1000 Main Street, Suite 2900 Houston, TX 77002	OGRID: 370080
	Action Number: 350545
	Action Type: [C-103] Sub. Plugging (C-103P)

CONDITIONS

Created By	Condition	Condition Date
mkuehling	Log not required open hole - well plugged 3/13/2024	11/27/2024