Form 3160-3 (June 2015)		OMB No	APPROVED 0. 1004-0137 nuary 31, 2018		
UNITED STATES		-			
DEPARTMENT OF THE IN BUREAU OF LAND MANA		5. Lease Serial No.			
APPLICATION FOR PERMIT TO D	6. If Indian, Allotee or Tribe Name				
		,			
1a. Type of work: DRILL RE	EENTER	7. If Unit or CA Agr	eement, Name and No.		
	ther				
	_	8. Lease Name and	Well No.		
1c. Type of Completion:   Hydraulic Fracturing	ngle Zone Multiple Zone				
2. Name of Operator		9. API Well No. 30	-015-55927		
3a. Address	3b. Phone No. (include area code)	10. Field and Pool, or Exploratory			
4. Location of Well <i>(Report location clearly and in accordance w</i>	vith any State requirements.*)	11. Sec., T. R. M. or	Blk. and Survey or Area		
At surface					
At proposed prod. zone					
14. Distance in miles and direction from nearest town or post offic	ce*	12. County or Parish	13. State		
15. Distance from proposed*	16. No of acres in lease 17. Spac	ing Unit dedicated to th	nis well		
location to nearest	10. No or acres in rease	ling offit dedicated to th	ns wen		
property or lease line, ft. (Also to nearest drig. unit line, if any)					
<ol> <li>Distance from proposed location* to nearest well, drilling, completed, applied for, on this lease, ft.</li> </ol>	19. Proposed Depth 20, BLM	/BIA Bond No. in file			
21. Elevations (Show whether DF, KDB, RT, GL, etc.)	22. Approximate date work will start*	23. Estimated duration	on		
	24. Attachments				
The following, completed in accordance with the requirements of (as applicable)	Onshore Oil and Gas Order No. 1, and the	Hydraulic Fracturing ru	ıle per 43 CFR 3162.3-3		
1. Well plat certified by a registered surveyor.	4. Bond to cover the operatio	ns unless covered by an	existing bond on file (see		
2. A Drilling Plan.	Item 20 above).	-			
3. A Surface Use Plan (if the location is on National Forest Syster SUPO must be filed with the appropriate Forest Service Office		rmation and/or plans as	may be requested by the		
25. Signature	Name (Printed/Typed)		Date		
Title					
Approved by (Signature)	Name (Printed/Typed)		Date		
Title	Office				
Application approval does not warrant or certify that the applican applicant to conduct operations thereon.	t holds legal or equitable title to those rights	in the subject lease wl	nich would entitle the		
Conditions of approval, if any, are attached.					
Title 18 U.S.C. Section 1001 and Title 43 U.S.C. Section 1212, m of the United States any false, fictitious or fraudulent statements of			ny department or agency		
		1			



.

(Continued on page 2)


# State of New Mexico Energy, Minerals & Natural Resources Department OIL CONSERVATION DIVISION 1220 South St. Francis Dr. Santa Fe, NM 87505

AMENDED REPORT

Page 2 of 55

#### WELL LOCATION AND ACREAGE DEDICATION PLAT <sup>1</sup> API Number <sup>2</sup> Pool Code <sup>3</sup> Pool Name 30-015-55927 PURPLE SAGE; WOLFCAMP (GAS) 98220 <sup>4</sup> Property Code <sup>5</sup> Property Name <sup>6</sup> Well Number 332695 **STEEL GUITAR 26-35 FED COM** 424H <sup>7</sup>OGRID No. 8 Operator Name <sup>9</sup> Elevation 246289 WPX ENERGY PERMIAN, LLC 2938.4 Surface Location UL or lot no. Lot Idn Feet from the North/South line East/West line County Section Township Range Feet from the 29 E 455 NORTH 1090 А 26 26 S EAST EDDY "Bottom Hole Location If Different From Surface UL or lot no. Section Township Range Lot Idn Feet from the North/South line Feet from the East/West line County 11 35 26 S 29 E 1784 NORTH 2190 EAST EDDY 12 Dedicated Acres 13 Joint or Infill 14 Consolidation Code 15 Order No. 430.41

No allowable will be assigned to this completion until all interests have been consolidated or a non-standard unit has been approved by the division.

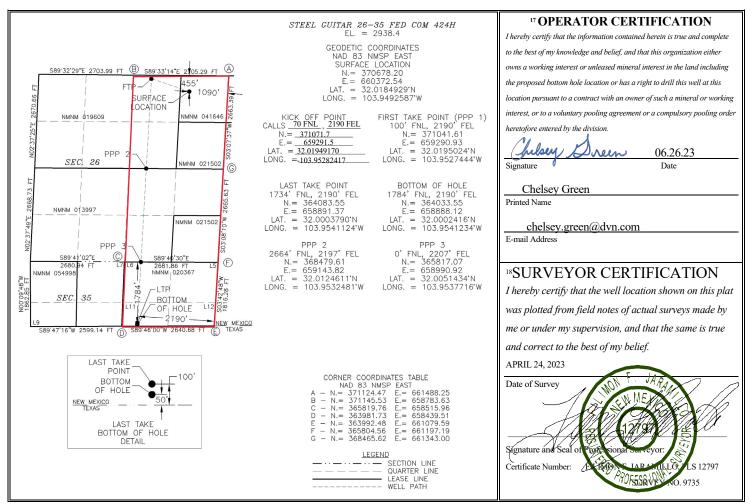

#### Received by OCD: 12/13/2024 3:20:14 AM

x

As Drilled

l	ľ	l	t	e	r	l	t

API #			
Operator Name:		Property Name:	Well Number
WPX ENERGY PERMIAN, LLC		STEEL GUITAR 26-35 FED COM	424H

### Kick Off Point (KOP)

UL	Section	Township	Range	Lot	Feet	From N/S	Feet	From E/W	County
В	26	265	29E		70	NORTH	2190	EAST	EDDY
Latitude			Longitude		NAD				
32.01949170				-103.95282417			83		

### First Take Point (FTP)

UL	Section	Township	Range	Lot	Feet	From N/S	Feet	From E/W	County
B	26	26S	29E		100	NORTH	2190	EAST	EDDY
	Latitude 32.0195024			Longitude 103.9527	7444			NAD 83	

# Last Take Point (LTP)

UL	Section 35	Township 26S	Range 29E	Lot 11	<sup>Feet</sup> 1734	From N/S NORTH	Feet 2190	From E/W EAST	County EDDY
Latitude			Longitud	Longitude			NAD		
32.0	00379	0			103.9	541124			83

Is this well the defining well for the Horizontal Spacing Unit?

Is this well an infill well?

Y

If infill is yes please provide API if available, Operator Name and well number for Defining well for Horizontal Spacing Unit.

Property Name:	Well Number
STEEL GUITAR 26-35 FED COM	415H

KZ 06/29/2018

Received	l hv	OCD:	12/13	/2024	3.20.14	AM
MUUUII		vvv.	1. 11 1	AUAT	J. MU. 17	X . X . X . X

	-		te of New Mez			S	ubmit Electronically 'ia E-permitting	
	Energy, Minerals and Natural Resources Department Oil Conservation Division							
			South St. Fran 1ta Fe, NM 87					
	Ν	ATURAL G	AS MANA	GEMENT P	LAN			
Гhis Natural Gas Manag	gement Plan m	ust be submitted w	rith each Applica	tion for Permit to I	Drill (A	PD) for a new	v or recompleted well	
			1 – Plan D ffective May 25,					
I. Operator: <u>WPX ENE</u>	RGY PERMIAN, I	LC	OGRID:	246289		<b>Date:</b>	/ 15 / 2024	
II. Type: 🛛 Original 🛛	□ Amendment	due to □ 19.15.27	'.9.D(6)(a) NMA	C 🗆 19.15.27.9.D(	(6)(b) N	IMAC 🗆 Oth	er.	
If Other, please describe	:							
III. Well(s): Provide the provided the					wells pr	oposed to be	drilled or proposed to	
Well Name	API	ULSTR	Footages	Anticipated Oil BBL/D		cipated MCF/D	Anticipated Produced Water BBL/D	
See attachment								
IV. Central Delivery P	oint Name:	See attachment		•		[See 19.1	5.27.9(D)(1) NMAC]	
V. Anticipated Schedu proposed to be recomple					vell or s	et of wells pr	oposed to be drilled o	
Well Name	API	Spud Date	TD Reached Date	Completion Commencement		Initial Flow Back Date		
See attachment								
VI. Separation Equipn	nent: 🛛 Attach	a complete descri	ption of how Op	erator will size sep	aration	equipment to	o optimize gas capture	
VII. Operational Prac Subsection A through F			ription of the ac	tions Operator wil	l take t	o comply wi	th the requirements o	
VIII. Best Managemen during active and planne			ete description of	Operator's best n	nanager	nent practice	s to minimize venting	

.

#### NATURAL GAS MANAGEMENT PLAN Section 1 - Plan Description

III. Well(s): Provide the following information for each new or recompleted well or set of wells proposed to be drilled or proposed to be recompleted from a single well pad or connected to a central delivery point.

			Daily Anticipated GAS/OIL/WATER		
Well Name	API	ULSTR & FOOTAGES		Central Delivery Point Name:	
STEEL GUITAR 35-26 FED COM 321H		26-26S-29E, 454 FNL & 2086 FWL	(+/-) 5265 mcfd/(+/-) 1950 bopd/(+/-) 6825 bwpd	STEEL GUITAR 35-26 FED WEST PAD	
STEEL GUITAR 35-26 FED COM 322H		26-26S-29E, 460 FNL & 2146 FWL	(+/-) 5265 mcfd/(+/-) 1950 bopd/(+/-) 6825 bwpd	STEEL GUITAR 35-26 FED WEST PAD	
STEEL GUITAR 35-26 FED COM 323H		26-26S-29E, 466 FNL & 2206 FWL	(+/-) 5265 mcfd/(+/-) 1950 bopd/(+/-) 6825 bwpd	STEEL GUITAR 35-26 FED WEST PAD	
STEEL GUITAR 35-26 FED COM 331H		26-26S-29E, 457 FNL & 2116 FWL	(+/-) 5516 mcfd/(+/-) 1576 bopd/(+/-) 6304 bwpd	STEEL GUITAR 35-26 FED WEST PAD	
STEEL GUITAR 35-26 FED COM 332H		26-26S-29E, 463 FNL & 2176 FWL	(+/-) 5516 mcfd/(+/-) 1576 bopd/(+/-) 6304 bwpd	STEEL GUITAR 35-26 FED WEST PAD	
STEEL GUITAR 35-26 FED COM 441H		26-26S-29E, 442 FNL & 1977 FWL	(+/-) 9000 mcfd/(+/-) 855 bopd/(+/-) 9000 bwpd	STEEL GUITAR 35-26 FED WEST PAD	
STEEL GUITAR 35-26 FED COM 442H		26-26S-29E, 448 FNL & 2036 FWL	(+/-) 9000 mcfd/(+/-) 855 bopd/(+/-) 9000 bwpd	STEEL GUITAR 35-26 FED WEST PAD	
STEEL GUITAR 35-26 FED COM 452H		26-26S-29E, 445 FNL & 2007 FWL	(+/-) 9000 mcfd/(+/-) 855 bopd/(+/-) 9000 bwpd	STEEL GUITAR 35-26 FED WEST PAD	
STEEL GUITAR 26-35 FED COM 324H		26-26S-29E, 655 FNL & 1090 FEL	(+/-) 5265 mcfd/(+/-) 1950 bopd/(+/-) 6825 bwpd	STEEL GUITAR 35-26 FED EAST PAD	
STEEL GUITAR 26-35 FED COM 325H		26-26S-29E, 655 FNL & 1030 FEL	(+/-) 5265 mcfd/(+/-) 1950 bopd/(+/-) 6825 bwpd	STEEL GUITAR 35-26 FED EAST PAD	
STEEL GUITAR 26-35 FED COM 333H		26-26S-29E, 655 FNL & 1120 FEL	(+/-) 5516 mcfd/(+/-) 1576 bopd/(+/-) 6304 bwpd	STEEL GUITAR 35-26 FED EAST PAD	
STEEL GUITAR 26-35 FED COM 334H		26-26S-29E, 655 FNL & 1060 FEL	(+/-) 5516 mcfd/(+/-) 1576 bopd/(+/-) 6304 bwpd	STEEL GUITAR 35-26 FED EAST PAD	
STEEL GUITAR 26-35 FED COM 335H		26-26S-29E, 655 FNL & 1000 FEL	(+/-) 5516 mcfd/(+/-) 1576 bopd/(+/-) 6304 bwpd	STEEL GUITAR 35-26 FED EAST PAD	
STEEL GUITAR 26-35 FED COM 414H		26-26S-29E, 455 FNL & 1060 FEL	(+/-) 7190 mcfd/(+/-) 1563 bopd/(+/-) 8597 bwpd	STEEL GUITAR 35-26 FED EAST PAD	
STEEL GUITAR 26-35 FED COM 415H		26-26S-29E, 455 FNL & 1000 FEL	(+/-) 7190 mcfd/(+/-) 1563 bopd/(+/-) 8597 bwpd	STEEL GUITAR 35-26 FED EAST PAD	
STEEL GUITAR 26-35 FED COM 424H		26-26S-29E, 455 FNL & 1090 FEL	(+/-) 7190 mcfd/(+/-) 1563 bopd/(+/-) 8597 bwpd	STEEL GUITAR 35-26 FED EAST PAD	
STEEL GUITAR 26-35 FED COM 425H		26-26S-29E, 455 FNL & 1030 FEL	(+/-) 7190 mcfd/(+/-) 1563 bopd/(+/-) 8597 bwpd	STEEL GUITAR 35-26 FED EAST PAD	
STEEL GUITAR 35-26 FED COM 410H		26-26S-29E, 455 FNL & 1120 FEL	(+/-) 7190 mcfd/(+/-) 1563 bopd/(+/-) 8597 bwpd	STEEL GUITAR 35-26 FED EAST PAD	
STEEL GUITAR 35-26 FED COM 443H		26-26S-29E, 255 FNL & 1060 FEL	(+/-) 9000 mcfd/(+/-) 855 bopd/(+/-) 9000 bwpd	STEEL GUITAR 35-26 FED EAST PAD	
STEEL GUITAR 35-26 FED COM 444H		26-26S-29E, 255 FNL & 1000 FEL	(+/-) 9000 mcfd/(+/-) 855 bopd/(+/-) 9000 bwpd	STEEL GUITAR 35-26 FED EAST PAD	
STEEL GUITAR 35-26 FED COM 453H		26-26S-29E, 255 FNL & 1090 FEL	(+/-) 7125 mcfd/(+/-) 499 bopd/(+/-) 7125 bwpd	STEEL GUITAR 35-26 FED EAST PAD	
STEEL GUITAR 35-26 FED COM 454H		26-26S-29E, 255 FNL & 1030 FEL	(+/-) 7125 mcfd/(+/-) 499 bopd/(+/-) 7125 bwpd	STEEL GUITAR 35-26 FED EAST PAD	

V. Anticipated Schedule: Provide the following information for each new or recompleted well or set of wells proposed to be drilled or proposed to be recompleted from a single well pad or connected to a central delivery point.

				Completion		First
			TD Reached	Commencem	Initial Flow	Production
Well Name	API	Spud Date	Date	ent Date	back Date	Date
STEEL GUITAR 35-26 FED COM 321H	n/a	6/18/2026	7/18/2026	11/15/2026	11/15/2026	11/15/2026
STEEL GUITAR 35-26 FED COM 322H	n/a	7/4/2026	8/3/2026	12/1/2026	12/1/2026	12/1/2026
STEEL GUITAR 35-26 FED COM 323H	n/a	6/2/2026	7/2/2026	10/30/2026	10/30/2026	10/30/2026
STEEL GUITAR 35-26 FED COM 331H	n/a	5/17/2026	6/16/2026	10/14/2026	10/14/2026	10/14/2026
STEEL GUITAR 35-26 FED COM 332H	n/a	5/1/2026	5/31/2026	9/28/2026	9/28/2026	9/28/2026
STEEL GUITAR 35-26 FED COM 441H	n/a	8/8/2027	9/7/2027	1/5/2028	1/5/2028	1/5/2028
STEEL GUITAR 35-26 FED COM 442H	n/a	9/15/2027	10/15/2027	2/12/2028	2/12/2028	2/12/2028
STEEL GUITAR 35-26 FED COM 452H	n/a	8/27/2027	9/26/2027	1/24/2028	1/24/2028	1/24/2028
STEEL GUITAR 26-35 FED COM 324H	n/a	4/25/2025	5/25/2025	9/22/2025	9/22/2025	9/22/2025
STEEL GUITAR 26-35 FED COM 325H	n/a	5/11/2025	6/10/2025	10/8/2025	10/8/2025	10/8/2025
STEEL GUITAR 26-35 FED COM 333H	n/a	6/12/2025	7/12/2025	11/9/2025	11/9/2025	11/9/2025
STEEL GUITAR 26-35 FED COM 334H	n/a	6/29/2025	7/29/2025	11/26/2025	11/26/2025	11/26/2025
STEEL GUITAR 26-35 FED COM 335H	n/a	5/27/2025	6/26/2025	10/24/2025	10/24/2025	10/24/2025
STEEL GUITAR 26-35 FED COM 414H	n/a	5/21/2025	6/20/2025	10/18/2025	10/18/2025	10/18/2025
STEEL GUITAR 26-35 FED COM 415H	n/a	6/23/2025	7/23/2025	11/20/2025	11/20/2025	11/20/2025
STEEL GUITAR 26-35 FED COM 424H	n/a	6/6/2025	7/6/2025	11/3/2025	11/3/2025	11/3/2025
STEEL GUITAR 26-35 FED COM 425H	n/a	5/4/2025	6/3/2025	10/1/2025	10/1/2025	10/1/2025
STEEL GUITAR 35-26 FED COM 410H	n/a	4/30/2025	5/30/2025	9/27/2025	9/27/2025	9/27/2025
STEEL GUITAR 35-26 FED COM 443H	n/a	6/29/2025	7/29/2025	11/26/2025	11/26/2025	11/26/2025
STEEL GUITAR 35-26 FED COM 444H	n/a	7/18/2025	8/17/2025	12/15/2025	12/15/2025	12/15/2025
STEEL GUITAR 35-26 FED COM 453H	n/a	5/22/2025	6/21/2025	10/19/2025	10/19/2025	10/19/2025
STEEL GUITAR 35-26 FED COM 454H	n/a	6/10/2025	7/10/2025	11/7/2025	11/7/2025	11/7/2025

\* DATES SUBJECT TO CHANGE

Page 5 of 55

Received by OCD: 12/13/2024 3:20:14 AM

# Section 2 – Enhanced Plan EFFECTIVE APRIL 1, 2022

Beginning April 1, 2022, an operator that is not in compliance with its statewide natural gas capture requirement for the applicable reporting area must complete this section.

Operator certifies that it is not required to complete this section because Operator is in compliance with its statewide natural gas capture requirement for the applicable reporting area.

### IX. Anticipated Natural Gas Production:

Well	API	Anticipated Average Natural Gas Rate MCF/D	Anticipated Volume of Natural Gas for the First Year MCF

### X. Natural Gas Gathering System (NGGS):

Operator	System	ULSTR of Tie-in	Anticipated Gathering Start Date	Available Maximum Daily Capacity of System Segment Tie-in

**XI. Map.**  $\Box$  Attach an accurate and legible map depicting the location of the well(s), the anticipated pipeline route(s) connecting the production operations to the existing or planned interconnect of the natural gas gathering system(s), and the maximum daily capacity of the segment or portion of the natural gas gathering system(s) to which the well(s) will be connected.

**XII.** Line Capacity. The natural gas gathering system  $\Box$  will  $\Box$  will not have capacity to gather 100% of the anticipated natural gas production volume from the well prior to the date of first production.

**XIII.** Line Pressure. Operator  $\Box$  does  $\Box$  does not anticipate that its existing well(s) connected to the same segment, or portion, of the natural gas gathering system(s) described above will continue to meet anticipated increases in line pressure caused by the new well(s).

□ Attach Operator's plan to manage production in response to the increased line pressure.

**XIV. Confidentiality:**  $\Box$  Operator asserts confidentiality pursuant to Section 71-2-8 NMSA 1978 for the information provided in Section 2 as provided in Paragraph (2) of Subsection D of 19.15.27.9 NMAC, and attaches a full description of the specific information for which confidentiality is asserted and the basis for such assertion.

# Section 3 - Certifications Effective May 25, 2021

Operator certifies that, after reasonable inquiry and based on the available information at the time of submittal:

 $\square$  Operator will be able to connect the well(s) to a natural gas gathering system in the general area with sufficient capacity to transport one hundred percent of the anticipated volume of natural gas produced from the well(s) commencing on the date of first production, taking into account the current and anticipated volumes of produced natural gas from other wells connected to the pipeline gathering system; or

D Operator will not be able to connect to a natural gas gathering system in the general area with sufficient capacity to transport one hundred percent of the anticipated volume of natural gas produced from the well(s) commencing on the date of first production, taking into account the current and anticipated volumes of produced natural gas from other wells connected to the pipeline gathering system. *If Operator checks this box, Operator will select one of the following:* 

**Well Shut-In.**  $\Box$  Operator will shut-in and not produce the well until it submits the certification required by Paragraph (4) of Subsection D of 19.15.27.9 NMAC; or

Venting and Flaring Plan.  $\Box$  Operator has attached a venting and flaring plan that evaluates and selects one or more of the potential alternative beneficial uses for the natural gas until a natural gas gathering system is available, including:

- (a) power generation on lease;
- (b) power generation for grid;
- (c) compression on lease;
- (d) liquids removal on lease;
- (e) reinjection for underground storage;
- (t) reinjection for temporary storage;
- (g) reinjection for enhanced oil recovery;
- (h) fuel cell production; and
- (i) other alternative beneficial uses approved by the division.

# Section 4 - Notices

1. If, at any time after Operator submits this Natural Gas Management Plan and before the well is spud:

(a) Operator becomes aware that the natural gas gathering system it planned to connect the well(s) to has become unavailable or will not have capacity to transport one hundred percent of the production from the well(s), no later than 20 days after becoming aware of such information, Operator shall submit for OCD's approval a new or revised venting and flaring plan containing the information specified in Paragraph (5) of Subsection D of 19.15.27.9 NMAC; or

(b) Operator becomes aware that it has, cumulatively for the year, become out of compliance with its baseline natural gas capture rate or natural gas capture requirement, no later than 20 days after becoming aware of such information, Operator shall submit for OCD's approval a new or revised Natural Gas Management Plan for each well it plans to spud during the next 90 days containing the information specified in Paragraph (2) of Subsection D of 19.15.27.9 NMAC, and shall file an update for each Natural Gas Management Plan until Operator is back in compliance with its baseline natural gas capture rate or natural gas capture requirement.

2. OCD may deny or conditionally approve an APD if Operator does not make a certification, fails to submit an adequate venting and flaring plan which includes alternative beneficial uses for the anticipated volume of natural gas produced, or if OCD determines that Operator will not have adequate natural gas takeaway capacity at the time a well will be spud.

I certify that, after reasonable inquiry, the statements in and attached to this Natural Gas Management Plan are true and correct to the best of my knowledge and acknowledge that a false statement may be subject to civil and criminal penalties under the Oil and Gas Act.

Signature:
Printed Name: Jeffrens Walla
Printed Name: Jeffrey Walla Title: Surface Land & Regulatory Manager
E-mail Address: jeff.walla@dvn.com
Date: 01/15/2024
Phone: (405) 552-8154
OIL CONSERVATION DIVISION
(Only applicable when submitted as a standalone form)
Approved By:
Title:
Approval Date:
Conditions of Approval:





#### VI. Separation Equipment

WPX Energy Permian, LLC (WPX) utilizes a "stage separation" process in which oil and gas separation is carried out through a series of separators operating at successively reduced pressures. Hydrocarbon liquids are produced into a high-pressure inlet separator, then carried through one or more lower pressure separation vessels before entering the storage tanks. The purpose of this separation process is to attain maximum recovery of liquid hydrocarbons from the fluids and allow maximum capture of produced gas into the sales pipeline. WPX utilizes a series of Low-Pressure Compression units to capture gas off the staged separation and send it to the sales pipeline. This process minimizes the amount of flash gas that enters the end-stage storage tanks that is subsequently vented or flared.



### **VII.** Operational Practices

WPX Energy Permian, LLC will employ best management practices and control technologies to maximize the recovery and minimize waste of natural gas through venting and flaring.

- During drilling operations, WPX will utilize flares and/or combustors to capture and control natural gas, where technically feasible. If flaring is deemed technically in-feasible, WPX will employ best management practices to minimize or reduce venting to the extent possible.
- During completions operations, WPX will utilize Green Completion methods to capture gas produced during well completions that is otherwise vented or flared. If capture is technically infeasible, flares and/or combustors will be used to capture and control flow back fluids entering into frac tanks during initial flowback. Upon indication of first measurable hydrocarbon volumes, WPX will turn operations to onsite separation vessels and flow to the gathering pipeline.
- During production operations, WPX will take every practical effort to minimize waste of natural gas through venting and flaring by:
  - Designing and constructing facilities in a manner consistent to achieve maximum capture and control of hydrocarbon liquids & produced gas
  - Utilizing a closed-loop capture system to collect and route produced gas to sales line via low pressure compression, or to a flare/combustor
  - Flaring in lieu of venting, where technically feasible
  - Utilizing auto-ignitors or continuous pilots, with thermocouples connected to Scada, to quickly detect and resolve issues related to malfunctioning flares/combustors
  - Employ the use of automatic tank gauging to minimize storage tank venting during loading events
  - Installing air-driven or electric-driven pneumatics & combustion engines, where technically feasible to minimize venting to the atmosphere
  - Confirm equipment is properly maintained and repaired through a preventative maintenance and repair program to ensure equipment meets all manufacturer specifications
  - Conduct and document AVO inspections on the frequency set forth in Part 27 to detect and repair any onsite leaks as quickly and efficiently as is feasible



VIII. Best Management Practices during Maintenance

WPX Energy Permian, LLC will utilize best management practices to minimize venting during active and planned maintenance activities. WPX is operating under guidance that production facilities permitted under NOI permits have no provisions to allow high pressure flaring and high pressure flaring is only allowed in disruption scenarios so long as the duration is less than eight hours. When technically feasible, flaring during maintenance activities will be utilized in lieu of venting to the atmosphere. WPX will work with third-party operators during scheduled maintenance of downstream pipeline or processing plants to address those events ahead of time to minimize venting. Actions considered include identifying alternative capture approaches or planning to temporarily reduce production or shut in the well to address these circumstances.

### **Offline Cementing**

### Variance Request

Devon Energy requests to offline cement on intermediate strings that are set in formations shallower than the Wolfcamp. Prior to commencing offline cementing operations, the well will be monitored for any abnormal pressures and confirmed to be static. A dual manifold system (equipped with chokes) for the returns will also be utilized as a redundancy. All equipment used for offline cementing will have a minimum 5M rating to match intermediate sections' 5M BOPE requirements.

### 1. Geologic Formations

TVD of target	10314	Pilot hole depth	N/A
MD at TD:	17274	Deepest expected fresh water	

Basin

Formation	Depth (TVD) from KB	Water/Mineral Bearing/Target Zone?	Hazards*
Rustler	247		
Salt	1152		
Base of Salt	2981		
Delaware	2981		
Cherry Canyon	4037		
Brushy Canyon	4972		
1st Bone Spring Lime	6699		
Bone Spring 1st	7622		
Bone Spring 2nd	8227		
3rd Bone Spring Lime	8693		
Bone Spring 3rd	9512		
Wolfcamp	9853		

\*H2S, water flows, loss of circulation, abnormal pressures, etc.

2	Casing	Program	(Primary	Decign)
4.	Casing	riogram	(I I mai y	Design)

		Wt			Casing Interval		Casing Interval	
Hole Size	Csg. Size	(PPF)	Grade	Conn	From (MD)	To (MD)	From (TVD)	To (TVD)
14 3/4	10 3/4	40 1/2	H40	BTC	0	272	0	272
9 7/8	8 5/8	32	P110	TLW	0	9612	0	9612
7 7/8	5 1/2	17	P110	BTC	0	17274	0	10314

• All casing strings will be tested in accordance with Onshore Oil and Gas Order #2 IILB.1.h Must have table for contingency casing.

#### 3. Cementing Program (Primary Design)

Casing	# Sks	TOC	Wt. ppg	Yld (ft3/sack)	Slurry Description
Surface	182	Surf	13.2	1.44	Lead: Class C Cement + additives
Int 1	248	Surf	9	3.27	Lead: Class C Cement + additives
1111 1	538	4972 13.2 1.44 Tail: Class H / C		Tail: Class H / C + additives	
Int 1	563	Surf	13.2	1.44	Squeeze Lead: Class C Cement + additives
Intermediate	248	Surf	9	3.27	Lead: Class C Cement + additives
Squeeze	538	4972	13.2	1.44	Tail: Class H / C + additives
Production	117	7897	9	3.27	Lead: Class H /C + additives
Production	976	9897	13.2	1.44	Tail: Class H / C + additives

Assuming no returns are established while drilling, Devon requests to pump a two stage cement job on the 8-5/8" intermediate casing string with the first stage being pumped conventionally with the calculated top of cement at the Brushy Canyon and the second stage performed as a bradenhead squeeze with planned cement from the Brushy Canyon to surface. The final cement top will be verified by Echo-meter. Devon will include the Echo-meter verified fluid top and the volume of displacement fluid above the cement slurry in the annulus in all post-drill sundries on wells utilizing this cement program. Devon will report to the BLM the volume of fluid (limited to 1 bbls) used to flush intermediate casing valves following backside cementing procedures.

Casing String	% Excess
Surface	50%
Intermediate 1	30%
Intermediate 1 (Two Stage)	25%
Prod	10%

### 4. Pressure Control Equipment (Three String Design)

BOP installed and tested before drilling which hole?	Size?	Min. Required WP	Туре		~	Tested to:																											
			Annular		Х	50% of rated working pressure																											
Int 1	13-5/8"	5M		d Ram	Х																												
	15-5/0	5141	<b>^</b>	Ram		5M																											
			Doub	le Ram	Х	5111																											
			Other*																														
	13-5/8"	5M	Annular (5M)		Х	50% of rated working pressure																											
Production			Blind Ram		Х																												
Tioduction		13-5/6 5141	15-5/6	5111	5111	5111	5111		5111	5111				5101	5101	5101	5101	5101	5101	5101	5101	5101	5101	5101	5111	5111	5141	5101	5111	Pipe Ram			5M
															le Ram	Х	5111																
			Other*																														
			Annular (5M)																														
			Blind Ram																														
			Pipe Ram																														
			Double Ram																														
			Other*																														
N A variance is requested for	the use of a	a diverter or	the surface	casing. See	attached for s	schematic.																											
Y A variance is requested to r	A variance is requested to run a 5 M annular on a 10M system																																

### 5. Mud Program (Three String Design)

Section	Туре	Weight (ppg)	
Surface	FW Gel	8.5-9	
Intermediate	DBE / Cut Brine	10-10.5	
Production	OBM	10-10.5	

Sufficient mud materials to maintain mud properties and meet minimum lost circulation and weight increase requirements will be kept on location at all times.

What will be used to monitor the loss or gain of fluid?	PVT/Pason/Visual Monitoring

#### 6. Logging and Testing Procedures

Logging, Co	oring and Testing
	Will run GR/CNL from TD to surface (horizontal well - vertical portion of hole). Stated logs run will be in the
Х	Completion Rpeort and sbumitted to the BLM.
	No logs are planned based on well control or offset log information.
	Drill stem test? If yes, explain.
	Coring? If yes, explain.

Additional	logs planned	Interval
	Resistivity	Int. shoe to KOP
	Density	Int. shoe to KOP
Х	CBL	Production casing
Х	Mud log	Intermediate shoe to TD
	PEX	

### 7. Drilling Conditions

Condition	Specfiy what type and where?
BH pressure at deepest TVD	5631
Abnormal temperature	No

Mitigation measure for abnormal conditions. Describe. Lost circulation material/sweeps/mud scavengers.

Hydrogren S	Hydrogren Sulfide (H2S) monitors will be installed prior to drilling out the surface shoe. If H2S is detected in concentrations					
• •	greater than 100 ppm, the operator will comply with the provisions of Onshore Oil and Gas Order #6. If Hydrogen Sulfide is					
encountered	encountered measured values and formations will be provided to the BLM.					
N	H2S is present					
Y	H2S plan attached.					

#### 8. Other facets of operation

Is this a walking operation? Potentially

- 1 If operator elects, drilling rig will batch drill the surface holes and run/cement surface casing; walking the rig to next wells on the pad.
- 2 The drilling rig will then batch drill the intermediate sections and run/cement intermediate casing; the wellbore will be isolated with a blind flange and pressure gauge installed for monitoring the well before walking to the next well.
- 3 The drilling rig will then batch drill the production hole sections on the wells with OBM, run/cement production casing, and install TA caps or tubing heads for completions.

NOTE: During batch operations the drilling rig will be moved from well to well however, it will not be removed from the pad until all wells have production casing run/cemented.

Will be pre-setting casing? Potentially

- 1 Spudder rig will move in and batch drill surface hole.
  - a. Rig will utilize fresh water based mud to drill surface hole to TD. Solids control will be handled entirely on a closed loop basis.,
- 2 After drilling the surface hole section, the spudder rig will run casing and cement following all of the applicable rules and regulations (OnShore Order 2, all COAs and NMOCD regulations).
- $^{3}$  The wellhead will be installed and tested once the surface casing is cut off and the WOC time has been reached.
- 4 A blind flange with the same pressure rating as the wellhead will be installed to seal the wellbore. Pressure will be monitored with a pressure gauge installed on the wellhead.
- 5 Spudder rig operations is expected to take 4-5 days per well on a multi-well pa.
- 6 The NMOCD will be contacted and notified 24 hours prior to commencing spudder rig operations.
- 7 Drilling operations will be performed with drilling rig. A that time an approved BOP stack will be nippled up and tested on the wellhead before drilling operations commences on each well.
  - a. The NMOCD will be contacted / notified 24 hours before the drilling rig moves back on to the pad with the pre-set surface casing.

Attachments

X Directional Plan

Other, describe

### Received by OCD: 12/13/2024 3:20:14 AM



U.S. Department of the Interior BUREAU OF LAND MANAGEMENT

APD ID: 10400093572

Operator Name: WPX ENERGY PERMIAN LLC

Well Name: STEEL GUITAR 26-35 FED COM

Well Type: OIL WELL

Well Number: 424H Well Work Type: Drill

Submission Date: 07/26/2023

Highlighted data reflects the most recent changes

12/12/2024

Drilling Plan Data Report

Show Final Text

# **Section 1 - Geologic Formations**

Formation ID	Formation Name	Elevation	True Vertical	Measured Depth	Lithologies	Mineral Resources	Producing Formatio
14663459	UNKNOWN	2940	0	0	OTHER : SURFACE	NONE	N
14663469	BELL CANYON	-1	2941	2941	SANDSTONE, SHALE	NATURAL GAS, OIL	N
14663461	CHERRY CANYON	-1041	3981	3981	SANDSTONE, SHALE	NATURAL GAS, OIL	N
14663462	BRUSHY CANYON	-2130	5070	5070	SANDSTONE, SHALE	NATURAL GAS, OIL	N
14663463	BONE SPRING 1ST	-4661	7601	7601	SANDSTONE	NATURAL GAS, OIL	N
14663464	BONE SPRING LIME	-4967	7907	7907	LIMESTONE	NATURAL GAS, OIL	N
14663465	BONE SPRING 2ND	-5284	8224	8224	SANDSTONE	NATURAL GAS, OIL	N
14663466	BONE SPRING 3RD	-5747	8687	8687	LIMESTONE	NATURAL GAS, OIL	N
14663467	WOLFCAMP	-6899	9839	9839	SHALE	NATURAL GAS, OIL	Y

# **Section 2 - Blowout Prevention**

Pressure Rating (PSI): 5M

Rating Depth: 10314

**Equipment:** BOP/BOPE will be installed per 43 CFR 3172 requirements prior to drilling below surface casing, a BOP/BOPE system with the above minimum rating will be installed on the wellhead system. BOP/BOPE will be tested by an independent service company per Onshore Oil & Gas Order #2 requirements and MASP (Maximum Anticipated Surface Pressure) calculations. If the system is upgraded, all the components installed will be functional and tested.

# Requesting Variance? YES

Variance request: A variance is requested for the use of a flexible choke line from the BOP stack to the choke manifold. See attached for specs for hydrostatic test chart.

**Testing Procedure:** A multibowl wellhead may be used. The BOP will be tested per 43 CFR 3172 after installation on the surface casing which will cover testing requirements for a maximum of 30 days. If any seal subject to test pressure is broken the system must be tested.

# Choke Diagram Attachment:

MB\_Verb\_5M\_20220701191320.pdf



Commitment Runs Deep



Design Plan Operation and Maintenance Plan Closure Plan

SENM - Closed Loop Systems June 2010

# I. Design Plan

Devon uses MI SWACO closed loop system (CLS). The MI SWACO CLS is designed to maintain drill solids at or below 5%. The equipment is arranged to progressively remove solids from the largest to the smallest size. Drilling fluids can thus be reused and savings is realized on mud and disposal costs. Dewatering may be required with the centrifuges to insure removal of ultra fine solids.

The drilling location is constructed to allow storm water to flow to a central sump normally the cellar. This insures no contamination leaves the drilling pad in the event of a spill. Storm water is reused in the mud system or stored in a reserve fluid tank farm until it can be reused. All lubricants, oils, or chemicals are removed immediately from the ground to prevent the contamination of storm water. An oil trap is normally installed on the sump if an oil spill occurs during a storm.

A tank farm is utilized to store drilling fluids including fresh water and brine fluids. The tank farm is constructed on a 20 ml plastic lined, bermed pad to prevent the contamination of the drilling site during a spill. Fluids from other sites may be stored in these tanks for processing by the solids control equipment and reused in the mud system. At the end of the well the fluids are transported from the tank farm to an adjoining well or to the next well for the rig.


Prior to installing a closed-loop system on site, the topsoil, if present, will be stripped and stockpiled for use as the final cover or fill at the time of closure.

Signs will be posted on the fence surrounding the closed-loop system unless the closed-loop system is located on a site where there is an existing well, that is operated by Devon.

# II. Operations and Maintenance Plan

*Primary Shakers*: The primary shakers make the first removal of drill solids from the drilling mud as it leaves the well bore. The shakers are sized to handle maximum drilling rate at optimal screen size. The shakers normally remove solids down to 74 microns.

*Mud Cleaner*: The Mud Cleaner cleans the fluid after it leaves the shakers. A set of hydrocyclones are sized to handle 1.25 to 1.5 times the maximum circulating rate. This ensures all the fluid is being processed to an average cut point of 25 microns. The wet discharged is dewatered on a shaker equipped with ultra fine mesh screens and generally cut at 40 microns.

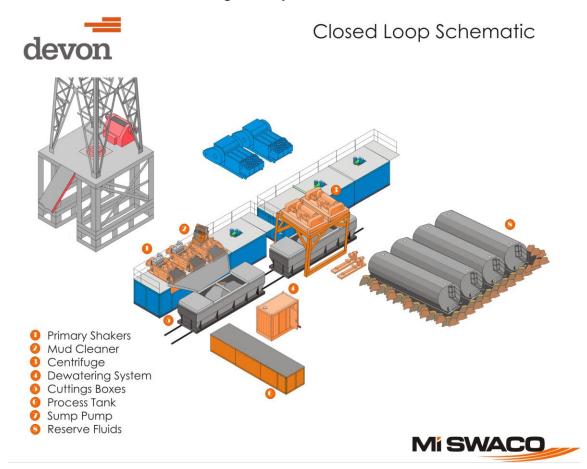

*Centrifuges*: The centrifuges can be one or two in number depending on the well geometry or depth of well. The centrifuges are sized to maintain low gravity solids at 5% or below. They may or may not need a dewatering system to enhance the removal rates. The centrifuges can make a cut point of 8-10 microns depending on bowl speed, feed rate, solids loading and other factors.

The centrifuge system is designed to work on the active system and be flexible to process incoming fluids from other locations. This set-up is also dependent on well factors.

*Dewatering System:* The dewatering system is a chemical mixing and dosing system designed to enhance the solids removal of the centrifuge. Not commonly used in shallow wells. It may contain pH adjustment, coagulant mixing and dosing, and polymer mixing and dosing. Chemical flocculation binds ultra fine solids into a mass that is within the centrifuge operating design. The

dewatering system improves the centrifuge cut point to infinity or allows for the return of clear water or brine fluid. This ability allows for the ultimate control of low gravity solids.

*Cuttings Boxes:* Cuttings boxes are utilized to capture drill solids that are discarded from the solids control equipment. These boxes are set upon a rail system that allows for the removal and replacement of a full box of cuttings with an empty one. They are equipped with a cover that insures no product is spilled into the environment during the transportation phase.

*Process Tank:* (Optional) The process tank allows for the holding and process of fluids that are being transferred into the mud system. Additionally, during times of lost circulation the process tank may hold active fluids that are removed for additional treatment. It can further be used as a mixing tank during well control conditions.

Sump and Sump Pump: The sump is used to collect storm water and the pump is used to transfer this fluid to the active system or to the tank for to hold in reserve. It can also be used to collect fluids that may escape during spills. The location contains drainage ditches that allow the location fluids to drain to the sump.

*Reserve Fluids (Tank Farm):* A series of frac tanks are used to replace the reserve pit. These are steel tanks that are equipped with a manifold system and a transfer pump. These tanks can contain any number of fluids used during the drilling process. These can include fresh water, cut brine, and saturated salt fluid. The fluid can be from the active well or reclaimed fluid from other locations. A 20 ml liner and berm system is employed to ensure the fluids do not migrate to the environment during a spill.

If a leak develops, the appropriate division district office will be notified within 48 hours of the discovery and the leak will be addressed. Spill prevention is accomplished by maintaining pump packing, hoses, and pipe fittings to insure no leaks are occurring. During an upset condition the source of the spill is isolated and repaired as soon as it is discovered. Free liquid is removed by a diaphragm pump and returned to the mud system. Loose topsoil may be used to stabilize the spill and the contaminated soil is excavated and placed in the cuttings boxes. After the well is finished and the rig has moved, the entire location is scrapped and testing will be performed to determine if a release has occurred.

All trash is kept in a wire mesh enclosure and removed to an approved landfill when full. All spent motor oils are kept in separate containers and they are removed and sent to an approved recycling center. Any spilled lubricants, pipe dope, or regulated chemicals are removed from soil and sent to landfills approved for these products.

These operations are monitored by Mi Swaco service technicians. Daily logs are maintained to ensure optimal equipment operation and maintenance. Screen and chemical use is logged to maintain inventory control. Fluid properties are monitored and recorded and drilling mud volumes are accounted for in the mud storage farm. This data is kept for end of well review to insure performance goals are met. Lessons learned are logged and used to help with continuous improvement.

A MI SWACO field supervisor manages from 3-5 wells. They are responsible for training personnel, supervising installations, and inspecting sites for compliance of MI SWACO safety and operational policy.

# III. Closure Plan

A maximum 340' X 340' caliche pad is built per well. All of the trucks and steel tanks fit on this pad. All fluid cuttings go to the steel tanks to be hauled by various trucking companies to an agency approved disposal.

# **Devon Energy** APD VARIANCE DATA

# **OPERATOR NAME:** Devon Energy

# 1. SUMMARY OF Variance:

Devon Energy respectfully requests approval for the following additions to the drilling plan:

1. Potential utilization of a spudder rig to pre-set surface casing.

### 2. Description of Operations

- **1.** A spudder rig contractor may move in their rig to drill the surface hole section and pre-set surface casing on this well.
  - **a.** After drilling the surface hole section, the rig will run casing and cement following all of the applicable rules and regulations (OnShore Order 2, all COAs and NMOCD regulations).
  - **b.** Rig will utilize fresh water based mud to drill surface hole to TD.
- **2.** The wellhead will be installed and tested once the surface casing is cut off and the WOC time has been reached.
- **3.** A blind flange with the same pressure rating as the wellhead will be installed to seal the wellbore. Pressure will be monitored with needle valves installed on two wingvalves.
  - **a.** A means for intervention will be maintained while the drilling rig is not over the well.
- 4. The BLM will be contacted and notified 24 hours prior to commencing spudder rig operations.
- 5. Drilling operation will be performed with the big rig. At that time an approved BOP stack will be nippled up and tested on the wellhead before drilling operations commences on each well.
  - **a.** The BLM will be contacted / notified 24 hours before the big rig moves back on to the pad with the pre-set surface casing.
- **6.** Devon Energy will have supervision on the rig to ensure compliance with all BLM and NMOCD regulations and to oversee operations.
- 7. Once the rig is removed, Devon Energy will secure the wellhead area by placing a guard rail around the cellar area.

# **Devon Energy Annular Preventer Summary**

### 1. Component and Preventer Compatibility Table

The table below, which covers the drilling and casing of the 10M MASP portion of the well, outlines the tubulars and the compatible preventers in use. This table, combined with the mud program, documents that two barriers to flow can be maintained at all times, independent of the rating of the annular preventer.

Component	OD	Preventer	RWP
Drillpipe	4.5"	Fixed lower 4.5"	10M
		Upper 4.5-7" VBR	
HWDP	4.5"	Fixed lower 4.5"	10M
		Upper 4.5-7" VBR	
Drill collars and MWD tools	4.75"	Upper 4.5-7" VBR	10M
Mud Motor	4.75"	Upper 4.5-7" VBR	10M
Production casing	5.5"	Upper 4.5-7" VBR	10M
ALL	0-13-5/8"	Annular	5M
Open-hole	-	Blind Rams	10M

6-3/4" Production hole section, 10M requirement

VBR = Variable Bore Ram. Compatible range listed in chart.

# 2. Well Control Procedures

Well control procedures are specific to the rig equipment and the operation at the time the kick occurs. Below are the minimal high-level tasks prescribed to assure a proper shut-in while drilling, tripping, running casing, pipe out of the hole (open hole), and moving the BHA through the BOPs. The pressure at which control is swapped from the annular to another compatible ram is variable, but the operator will document in the submission their operating pressure limit. The operator may chose an operating pressure less than or equal to RWP, but in no case will it exceed the RWP of the annular preventer.

### General Procedure While Drilling

- 1. Sound alarm (alert crew)
- 2. Space out drill string
- 3. Shut down pumps (stop pumps and rotary)
- 4. Shut-in Well (uppermost applicable BOP, typically annular preventer first. HCR and choke will already be in the closed position.)
- 5. Confirm shut-in
- 6. Notify toolpusher/company representative
- 7. Read and record the following:
  - a. SIDPP and SICP
  - b. Pit gain
  - c. Time
- 8. Regroup and identify forward plan
- 9. If pressure has built or is anticipated during the kill to reach the RWP of the annular preventer, confirm spacing and swap to the upper pipe ram.

# **Devon Energy Annular Preventer Summary**

# General Procedure While Tripping

- 1. Sound alarm (alert crew)
- 2. Stab full opening safety valve and close
- 3. Space out drill string
- 4. Shut-in (uppermost applicable BOP, typically annular preventer first. HCR and choke will already be in the closed position.)
- 5. Confirm shut-in
- 6. Notify toolpusher/company representative
- 7. Read and record the following:
  - a. SIDPP and SICP
    - b. Pit gain
    - c. Time
- 8. Regroup and identify forward plan
- 9. If pressure has built or is anticipated during the kill to reach the RWP of the annular preventer, confirm spacing and swap to the upper pipe ram.

# General Procedure While Running Casing

- 1. Sound alarm (alert crew)
- 2. Stab crossover and full opening safety valve and close
- 3. Space out string
- 4. Shut-in (uppermost applicable BOP, typically annular preventer first. HCR and choke will already be in the closed position.)
- 5. Confirm shut-in
- 6. Notify toolpusher/company representative
- 7. Read and record the following:
  - a. SIDPP and SICP
  - b. Pit gain
  - c. Time
- 8. Regroup and identify forward plan
- 9. If pressure has built or is anticipated during the kill to reach the RWP of the annular preventer, confirm spacing and swap to compatible pipe ram.


# General Procedure With No Pipe In Hole (Open Hole)

- 1. Sound alarm (alert crew)
- 2. Shut-in with blind rams or BSR. (HCR and choke will already be in the closed position.)
- 3. Confirm shut-in
- 4. Notify toolpusher/company representative
- 5. Read and record the following:
  - a. SICP
  - b. Pit gain
  - c. Time
- 6. Regroup and identify forward plan

# **Devon Energy Annular Preventer Summary**

### General Procedures While Pulling BHA thru Stack

- 1. PRIOR to pulling last joint of drillpipe thru the stack.
  - a. Perform flowcheck, if flowing:
  - b. Sound alarm (alert crew)
  - c. Stab full opening safety valve and close
  - d. Space out drill string with tool joint just beneath the upper pipe ram.
  - e. Shut-in using upper pipe ram. (HCR and choke will already be in the closed position.)
  - f. Confirm shut-in
  - g. Notify toolpusher/company representative
  - h. Read and record the following:
    - i. SIDPP and SICP
    - ii. Pit gain
    - iii. Time
  - i. Regroup and identify forward plan
- 2. With BHA in the stack and compatible ram preventer and pipe combo immediately available.
  - a. Sound alarm (alert crew)
  - b. Stab crossover and full opening safety valve and close
  - c. Space out drill string with upset just beneath the compatible pipe ram.
  - d. Shut-in using compatible pipe ram. (HCR and choke will already be in the closed position.)
  - e. Confirm shut-in
  - f. Notify toolpusher/company representative
  - g. Read and record the following:
    - i. SIDPP and SICP
    - ii. Pit gain
    - iii. Time
  - h. Regroup and identify forward plan
- 3. With BHA in the stack and NO compatible ram preventer and pipe combo immediately available.
  - a. Sound alarm (alert crew)
  - b. If possible to pick up high enough, pull string clear of the stack and follow "Open Hole" scenario.
  - c. If impossible to pick up high enough to pull the string clear of the stack:
  - d. Stab crossover, make up one joint/stand of drillpipe, and full opening safety valve and close
  - e. Space out drill string with tooljoint just beneath the upper pipe ram.
  - f. Shut-in using upper pipe ram. (HCR and choke will already be in the closed position.)
  - g. Confirm shut-in
  - h. Notify toolpusher/company representative
  - i. Read and record the following:
    - i. SIDPP and SICP
    - ii. Pit gain
    - iii. Time
  - j. Regroup and identify forward plan

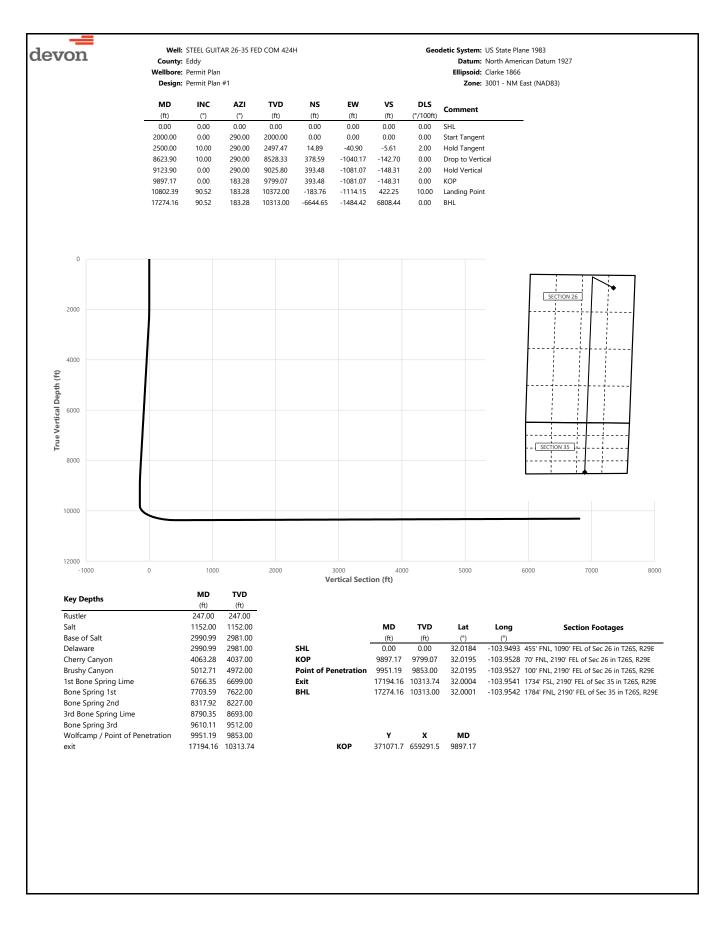

devon		County: Wellbore:			O COM 424H				Geodetic System: US State Plane 1983 Datum: North American Datum 1927 Ellipsoid: Clarke 1866 Zone: 3001 - NM East (NAD83)
	MD	INC	AZI	TVD	NS	EW	vs	DLS	
	(ft)	(°)	(°)	(ft)	(ft)	(ft)	(ft)	(°/100ft)	Comment
-	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	SHL
	100.00	0.00	290.00	100.00	0.00	0.00	0.00	0.00	
	200.00	0.00	290.00	200.00	0.00	0.00	0.00	0.00	
	247.00	0.00	290.00	247.00 300.00	0.00	0.00	0.00 0.00	0.00 0.00	Rustler
	300.00 400.00	0.00 0.00	290.00 290.00	400.00	0.00 0.00	0.00 0.00	0.00	0.00	
	500.00	0.00	290.00	500.00	0.00	0.00	0.00	0.00	
	600.00	0.00	290.00	600.00	0.00	0.00	0.00	0.00	
	700.00	0.00	290.00	700.00	0.00	0.00	0.00	0.00	
	800.00	0.00	290.00	800.00	0.00	0.00	0.00	0.00	
	900.00	0.00	290.00	900.00	0.00	0.00	0.00	0.00	
	1000.00	0.00	290.00	1000.00	0.00	0.00	0.00	0.00	
	1100.00	0.00	290.00	1100.00	0.00	0.00	0.00	0.00	
	1152.00 1200.00	0.00 0.00	290.00 290.00	1152.00 1200.00	0.00 0.00	0.00 0.00	0.00 0.00	0.00 0.00	Salt
	1200.00	0.00	290.00	1300.00	0.00	0.00	0.00	0.00	
	1400.00	0.00	290.00	1400.00	0.00	0.00	0.00	0.00	
	1500.00	0.00	290.00	1500.00	0.00	0.00	0.00	0.00	
	1600.00	0.00	290.00	1600.00	0.00	0.00	0.00	0.00	
	1700.00	0.00	290.00	1700.00	0.00	0.00	0.00	0.00	
	1800.00	0.00	290.00	1800.00	0.00	0.00	0.00	0.00	
	1900.00	0.00	290.00	1900.00	0.00	0.00	0.00	0.00	
	2000.00	0.00	290.00	2000.00	0.00	0.00	0.00	0.00	Start Tangent
	2100.00 2200.00	2.00 4.00	290.00 290.00	2099.98 2199.84	0.60 2.39	-1.64 -6.56	-0.22 -0.90	2.00 2.00	
	2300.00	6.00	290.00	2299.45	5.37	-14.75	-2.02	2.00	
	2400.00	8.00	290.00	2398.70	9.54	-26.20	-3.59	2.00	
	2500.00	10.00	290.00	2497.47	14.89	-40.90	-5.61	2.00	Hold Tangent
	2600.00	10.00	290.00	2595.95	20.82	-57.22	-7.85	0.00	
	2700.00	10.00	290.00	2694.43	26.76	-73.53	-10.09	0.00	
	2800.00	10.00	290.00	2792.91	32.70	-89.85	-12.33	0.00	
	2900.00	10.00	290.00	2891.39	38.64	-106.17	-14.56	0.00	Pass of Salt Delawara
	2990.99 3000.00	10.00 10.00	290.00 290.00	2981.00 2989.87	44.05 44.58	-121.02 -122.49	-16.60 -16.80	0.00 0.00	Base of Salt, Delaware
	3100.00	10.00	290.00	3088.35	50.52	-138.80	-19.04	0.00	
	3200.00	10.00	290.00	3186.83	56.46	-155.12	-21.28	0.00	
	3300.00	10.00	290.00	3285.31	62.40	-171.44	-23.52	0.00	
	3400.00	10.00	290.00	3383.79	68.34	-187.76	-25.76	0.00	
	3500.00	10.00	290.00	3482.27	74.28	-204.07	-28.00	0.00	
	3600.00	10.00	290.00	3580.75	80.22	-220.39	-30.23	0.00	
	3700.00	10.00	290.00	3679.23	86.15	-236.71	-32.47	0.00	
	3800.00 3900.00	10.00 10.00	290.00 290.00	3777.72 3876.20	92.09 98.03	-253.03 -269.34	-34.71 -36.95	0.00 0.00	
	4000.00	10.00	290.00	3974.68	103.97	-285.66	-39.19	0.00	
	4063.28	10.00	290.00	4037.00	107.73	-295.99	-40.60	0.00	Cherry Canyon
	4100.00	10.00	290.00	4073.16	109.91	-301.98	-41.43	0.00	, ,
	4200.00	10.00	290.00	4171.64	115.85	-318.30	-43.66	0.00	
	4300.00	10.00	290.00	4270.12	121.79	-334.61	-45.90	0.00	
	4400.00	10.00	290.00	4368.60	127.73	-350.93	-48.14	0.00	
	4500.00	10.00	290.00	4467.08	133.67	-367.25	-50.38	0.00	
	4600.00 4700.00	10.00 10.00	290.00 290.00	4565.56 4664.04	139.61 145.54	-383.57 -399.89	-52.62 -54.86	0.00 0.00	
	4700.00	10.00	290.00	4664.04 4762.52	145.54 151.48	-399.89 -416.20	-54.86 -57.10	0.00	
	4900.00	10.00	290.00	4861.00	157.42	-432.52	-59.33	0.00	
	5000.00	10.00	290.00	4959.48	163.36	-448.84	-61.57	0.00	
	5012.71	10.00	290.00	4972.00	164.12	-450.91	-61.86	0.00	Brushy Canyon
	5100.00	10.00	290.00	5057.97	169.30	-465.16	-63.81	0.00	
	5200.00	10.00	290.00	5156.45	175.24	-481.47	-66.05	0.00	
	5300.00	10.00	290.00	5254.93	181.18	-497.79	-68.29	0.00	
	5400.00	10.00	290.00	5353.41	187.12	-514.11	-70.53	0.00	
	5500.00 5600.00	10.00 10.00	290.00 290.00	5451.89 5550.37	193.06 199.00	-530.43 -546.74	-72.76 -75.00	0.00 0.00	
	5600.00 5700.00	10.00	290.00 290.00	5550.37 5648.85	204.93	-546.74 -563.06	-75.00 -77.24	0.00	
	5800.00	10.00	290.00	5747.33	2104.93	-579.38	-79.48	0.00	
	5900.00	10.00	290.00	5845.81	216.81	-595.70	-81.72	0.00	
	6000.00	10.00	290.00	5944.29	222.75	-612.01	-83.96	0.00	
	6100.00	10.00	290.00	6042.77	228.69	-628.33	-86.20	0.00	
	6200.00	10.00	290.00	6141.25	234.63	-644.65	-88.43	0.00	
	6300.00	10.00	290.00	6239.73	240.57	-660.97	-90.67	0.00	
	6400.00	10.00	290.00	6338.22	246.51	-677.28	-92.91	0.00	

•

		County: Wellbore:			D COM 424H				Geodetic System: US State Plane 1983 Datum: North American Datum 1927 Ellipsoid: Clarke 1866 Zone: 3001 - NM East (NAD83)
	MD	INC	AZI	TVD	NS	EW	vs	DLS	Comment
	(ft)	(°)	(°)	(ft)	(ft)	(ft)	(ft)	(°/100ft)	
	6500.00 6600.00	10.00 10.00	290.00 290.00	6436.70 6535.18	252.45 258.39	-693.60 -709.92	-95.15 -97.39	0.00 0.00	
	6700.00	10.00	290.00	6633.66	256.39	-709.92	-97.59	0.00	
	6766.35	10.00	290.00	6699.00	268.27	-737.06	-101.11	0.00	1st Bone Spring Lime
	6800.00	10.00	290.00	6732.14	270.26	-742.55	-101.87	0.00	
	6900.00	10.00	290.00	6830.62	276.20	-758.87	-104.10	0.00	
	7000.00	10.00	290.00	6929.10	282.14	-775.19	-106.34	0.00	
	7100.00	10.00	290.00	7027.58	288.08	-791.51	-108.58	0.00	
	7200.00	10.00	290.00	7126.06	294.02	-807.83	-110.82	0.00	
	7300.00	10.00	290.00	7224.54	299.96	-824.14	-113.06	0.00	
	7400.00	10.00	290.00	7323.02	305.90	-840.46	-115.30	0.00	
	7500.00	10.00	290.00	7421.50	311.84	-856.78	-117.53	0.00	
	7600.00	10.00	290.00	7519.99	317.78	-873.10	-119.77	0.00	
	7700.00	10.00	290.00	7618.47	323.72	-889.41	-122.01	0.00	
	7703.59	10.00	290.00	7622.00	323.93	-890.00	-122.09	0.00	Bone Spring 1st
	7800.00	10.00	290.00	7716.95	329.65	-905.73	-124.25	0.00	
	7900.00	10.00	290.00	7815.43	335.59	-922.05	-126.49	0.00	
	8000.00	10.00	290.00	7913.91	341.53	-938.37	-128.73	0.00	
	8100.00	10.00	290.00	8012.39	347.47	-954.68	-130.97	0.00	
;	8200.00	10.00	290.00	8110.87	353.41	-971.00	-133.20	0.00	
;	8300.00	10.00	290.00	8209.35	359.35	-987.32	-135.44	0.00	
;	8317.92	10.00	290.00	8227.00	360.41	-990.24	-135.84	0.00	Bone Spring 2nd
;	8400.00	10.00	290.00	8307.83	365.29	-1003.64	-137.68	0.00	
;	8500.00	10.00	290.00	8406.31	371.23	-1019.95	-139.92	0.00	
1	8600.00	10.00	290.00	8504.79	377.17	-1036.27	-142.16	0.00	
1	8623.90	10.00	290.00	8528.33	378.59	-1040.17	-142.70	0.00	Drop to Vertical
	8700.00	8.48	290.00	8603.44	382.77	-1051.65	-144.27	2.00	
	8790.35	6.67	290.00	8693.00	386.84	-1062.84	-145.81	2.00	3rd Bone Spring Lime
	8800.00	6.48	290.00	8702.58	387.22	-1063.88	-145.95	2.00	
	8900.00	4.48	290.00	8802.12	390.49	-1072.85	-147.18	2.00	
	9000.00	2.48	290.00	8901.93	392.56	-1078.55	-147.96	2.00	
	9100.00	0.48	290.00	9001.90	393.44	-1080.98	-148.30	2.00	
	9123.90	0.00	290.00	9025.80	393.48	-1081.07	-148.31	2.00	Hold Vertical
	9200.00	0.00	183.28	9101.89	393.48	-1081.07	-148.31	0.00	
	9300.00	0.00	183.28	9201.89	393.48	-1081.07	-148.31	0.00	
	9400.00	0.00	183.28	9301.89	393.48	-1081.07	-148.31	0.00	
	9500.00	0.00	183.28	9401.89	393.48	-1081.07	-148.31	0.00	
	9600.00	0.00	183.28	9501.89	393.48	-1081.07	-148.31	0.00	
	9610.11	0.00	183.28	9512.00	393.48	-1081.07	-148.31	0.00	Bone Spring 3rd
	9700.00	0.00	183.28	9601.89	393.48	-1081.07	-148.31	0.00	
	9800.00	0.00	183.28	9701.89	393.48	-1081.07	-148.31	0.00	KOD
	9897.17	0.00	183.28 183.28	9799.07	393.48	-1081.07	-148.31	0.00	КОР
	9900.00 9951 19	0.28 5.40		9801.89 9853.00	393.47 390.94	-1081.07	-148.30 -145.80	10.00	Wolfcamp / Point of Popatration
	9951.19	5.40 10.28	183.28 183.28	9853.00 9901 34	390.94 384 29	-1081.21 -1081.60	-145.80	10.00	Wolfcamp / Point of Penetration
	0000.00 0100.00	10.28		9901.34 9997.69	384.29 358.01		-139.23	10.00	
	0200.00	20.28 30.28	183.28 183.28	9997.69 10087 99	358.01 315.42	-1083.10 -1085.54	-113.25 -71.16	10.00	
	0200.00	30.28 40.28	183.28 183.28	10087.99 10169.52	315.42 257.83	-1085.54 -1088.84	-14.23	10.00 10.00	
	0400.00					-1088.84			
	0400.00	50.28 60.28	183.28 183.28	10239.79 10296.67	186.98 105.02	-1092.90	55.80 136.82	10.00 10.00	
	0600.00	60.28 70.28	183.28	10296.67	105.02 14.44	-11097.60	226.34	10.00	
	0700.00	70.28 80.28	183.28	10338.43	-81.99	-1102.79	226.34 321.67	10.00	
	0800.00	80.28 90.28	183.28	10363.80	-81.99	-1106.32	321.67 419.89	10.00	
	0800.00	90.28 90.52	183.28	10372.02	-181.37 -183.76		419.89 422.25	10.00	Landing Point
	0802.39	90.52 90.52	183.28	10372.00	-281.20	-1114.15 -1119.73	422.25 518.57	0.00	Landing Point
	1000.00	90.52 90.52	183.28	10371.11	-281.20 -381.03			0.00	
						-1125.46	617.24 715.92		
	1100.00	90.52 90.52	183.28 183.28	10369.29	-480.86 -580.70	-1131.18	715.92 814.60	0.00	
	1200.00	90.52	183.28	10368.38	-580.70	-1136.90	814.60	0.00	
	1300.00	90.52	183.28	10367.46	-680.53	-1142.62	913.28	0.00	
	1400.00	90.52	183.28	10366.55	-780.36	-1148.34	1011.96	0.00	
	1500.00	90.52	183.28	10365.64	-880.19	-1154.06	1110.63	0.00	
	1600.00	90.52	183.28	10364.73	-980.02	-1159.78	1209.31	0.00	
	1700.00	90.52	183.28	10363.82	-1079.86	-1165.50	1307.99	0.00	
	1800.00	90.52	183.28		-1179.69	-1171.22	1406.67	0.00	
	1900.00	90.52	183.28		-1279.52	-1176.94	1505.34	0.00	
	2000.00	90.52	183.28		-1379.35	-1182.67	1604.02	0.00	
	2100.00	90.52	183.28		-1479.18	-1188.39	1702.70	0.00	
	2200.00	90.52	183.28		-1579.02	-1194.11	1801.38	0.00	
1	2300.00	90.52	183.28		-1678.85	-1199.83	1900.05	0.00	
	2400.00	90.52	183.28	10357 44	-1778.68	-1205.55	1998.73	0.00	

•

devon				AR 26-35 FED	COM 424H				Geodetic System: US State Plane 1983
0101011		County: Wellbore:	Permit Plar	,					Datum: North American Datum 1927 Ellipsoid: Clarke 1866
			Permit Plar						Zone: 3001 - NM East (NAD83)
	MD (ft)	INC (°)	<b>AZI</b> (°)	TVD (ft)	NS (ft)	EW (ft)	VS (ft)	DLS (°/100ft)	Comment
	12500.00	90.52	183.28	10356.53	-1878.51	-1211.27	2097.41	0.00	
	12600.00	90.52	183.28	10355.61	-1978.34	-1216.99	2196.09	0.00	
	12700.00	90.52	183.28	10354.70	-2078.18	-1222.71	2294.77	0.00	
	12800.00	90.52	183.28	10353.79	-2178.01	-1228.43	2393.44	0.00	
	12900.00	90.52	183.28	10352.88	-2277.84	-1234.15	2492.12	0.00	
	13000.00	90.52	183.28	10351.97	-2377.67	-1239.88	2590.80	0.00	
	13100.00	90.52	183.28	10351.06	-2477.50	-1245.60	2689.48	0.00	
	13200.00 13300.00	90.52 90.52	183.28 183.28	10350.15 10349.23	-2577.34 -2677.17	-1251.32 -1257.04	2788.15 2886.83	0.00 0.00	
	13400.00	90.52	183.28	10348.32	-2777.00	-1262.76	2985.51	0.00	
	13500.00	90.52	183.28	10347.41	-2876.83	-1268.48	3084.19	0.00	
	13600.00	90.52	183.28	10346.50	-2976.66	-1274.20	3182.86	0.00	
	13700.00	90.52	183.28	10345.59	-3076.50	-1279.92	3281.54	0.00	
	13800.00	90.52	183.28	10344.68	-3176.33	-1285.64	3380.22	0.00	
	13900.00	90.52	183.28	10343.76	-3276.16	-1291.37	3478.90	0.00	
	14000.00	90.52	183.28	10342.85	-3375.99	-1297.09	3577.58	0.00	
	14100.00	90.52	183.28	10341.94	-3475.82	-1302.81	3676.25	0.00	
	14200.00	90.52	183.28	10341.03	-3575.66	-1308.53	3774.93	0.00	
	14300.00	90.52	183.28	10340.12	-3675.49	-1314.25	3873.61	0.00	
	14400.00	90.52	183.28	10339.21	-3775.32	-1319.97	3972.29	0.00	
	14500.00 14600.00	90.52 90.52	183.28 183.28	10338.30 10337.38	-3875.15 -3974.98	-1325.69 -1331.41	4070.96	0.00 0.00	
	14700.00	90.52 90.52	183.28	10337.38	-3974.98	-1337.13	4169.64 4268.32	0.00	
	14800.00	90.52	183.28	10335.56	-4174.65	-1342.85	4367.00	0.00	
	14900.00	90.52	183.28	10334.65	-4274.48	-1348.58	4465.67	0.00	
	15000.00	90.52	183.28	10333.74	-4374.31	-1354.30	4564.35	0.00	
	15100.00	90.52	183.28	10332.83	-4474.15	-1360.02	4663.03	0.00	
	15200.00	90.52	183.28	10331.91	-4573.98	-1365.74	4761.71	0.00	
	15300.00	90.52	183.28	10331.00	-4673.81	-1371.46	4860.39	0.00	
	15400.00	90.52	183.28	10330.09	-4773.64	-1377.18	4959.06	0.00	
	15500.00	90.52	183.28	10329.18	-4873.47	-1382.90	5057.74	0.00	
	15600.00	90.52	183.28	10328.27	-4973.31	-1388.62	5156.42	0.00	
	15700.00	90.52	183.28	10327.36	-5073.14	-1394.34	5255.10	0.00	
	15800.00 15900.00	90.52 90.52	183.28 183.28	10326.45 10325.53	-5172.97 -5272.80	-1400.07 -1405.79	5353.77 5452.45	0.00 0.00	
	16000.00	90.52 90.52	183.28	10323.55	-5272.60	-1405.79	5452.45 5551.13	0.00	
	16100.00	90.52	183.28	10323.71	-5472.47	-1417.23	5649.81	0.00	
	16200.00	90.52	183.28	10322.80	-5572.30	-1422.95	5748.48	0.00	
	16300.00	90.52	183.28	10321.89	-5672.13	-1428.67	5847.16	0.00	
	16400.00	90.52	183.28	10320.98	-5771.96	-1434.39	5945.84	0.00	
	16500.00	90.52	183.28	10320.07	-5871.79	-1440.11	6044.52	0.00	
	16600.00	90.52	183.28	10319.15	-5971.63	-1445.83	6143.20	0.00	
	16700.00	90.52	183.28	10318.24	-6071.46	-1451.55	6241.87	0.00	
	16800.00	90.52	183.28	10317.33	-6171.29	-1457.28	6340.55	0.00	
	16900.00	90.52	183.28	10316.42	-6271.12	-1463.00	6439.23	0.00	
	17000.00	90.52	183.28	10315.51	-6370.95	-1468.72	6537.91	0.00	
	17100.00	90.52	183.28	10314.60	-6470.79	-1474.44	6636.58	0.00	
	17194.16	90.52	183.28	10313.74	-6564.79	-1479.83 -1480.16	6729.50	0.00 0.00	exit
	17200.00 17274.16	90.52 90.52	183.28 183.28	10313.68 10313.00	-6570.62 -6644.65	-1480.16 -1484.42	6735.26 6808.44	0.00	BHL
	11214.10	JU.JZ	103.20	10313.00	0044.03	-1404.42	0000.44	0.00	

.

A multibowl wellhead may be used. The BOP will be tested per Onshore Order #2 after installation on the surface casing which will cover testing requirements for a maximum of 30 days. If any seal subject to test pressure is broken the system must be tested.

Devon proposes using a multi-bowl wellhead assembly. This assembly will only be tested when installed on the surface casing. Minimum working pressure of the blowout preventer (BOP) and related equipment (BOPE) required for drilling below the surface casing shoe shall be 5000 (5M) psi.


- Wellhead will be installed by wellhead representatives.
- If the welding is performed by a third party, the wellhead representative will monitor the temperature to verify that it does not exceed the maximum temperature of the seal.
- Wellhead representative will install the test plug for the initial BOP test.
- Wellhead company will install a solid steel body pack-off to completely isolate the lower head after cementing intermediate casing. After installation of the pack-off, the pack-off and the lower flange will be tested to 5M, as shown on the attached schematic. Everything above the pack-off will not have been altered whatsoever from the initial nipple up. Therefore the BOP components will not be retested at that time.
- If the cement does not circulate and one inch operations would have been possible with a standard wellhead, the well head will be cut and top out operations will be conducted.
- Devon will pressure test all seals above and below the mandrel (but still above the casing) to full working pressure rating.
- Devon will test the casing to 0.22 psi/ft or 1500 psi, whichever is greater, as per Onshore Order #2.

After running the surface casing, a 13-5/8" BOP/BOPE system with a minimum rating of 5M will be installed on the wellhead system and will undergo a 250 psi low pressure test followed by a 5,000 psi high pressure test. The 5,000 psi high and 250 psi low test will cover testing requirements a maximum of 30 days, as per Onshore Order #2. If the well is not complete within 30 days of this BOP test, another full BOP test will be conducted, as per Onshore Order #2.

After running the intermediate casing with a mandrel hanger, the 13-5/8" BOP/BOPE system with a minimum rating of 5M will already be installed on the wellhead.

The pipe rams will be operated and checked each 24 hour period and each time the drill pipe is out of the hole. These tests will be logged in the daily driller's log. A 2" kill line and 3" choke line will be incorporated into the drilling spool below the ram BOP. In addition to the rams and annular preventer, additional BOP accessories include a kelly cock, floor safety valve, choke lines, and choke manifold rated at 5,000 psi WP.

Devon's proposed wellhead manufactures will be FMC Technologies, Cactus Wellhead, or Cameron.

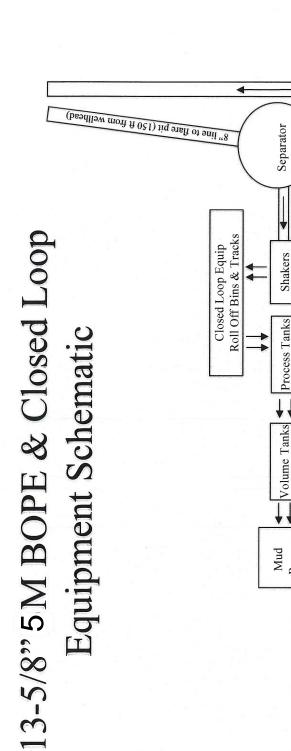


Process Tanks


↓↓

Volume Tanks

Mud Pumps

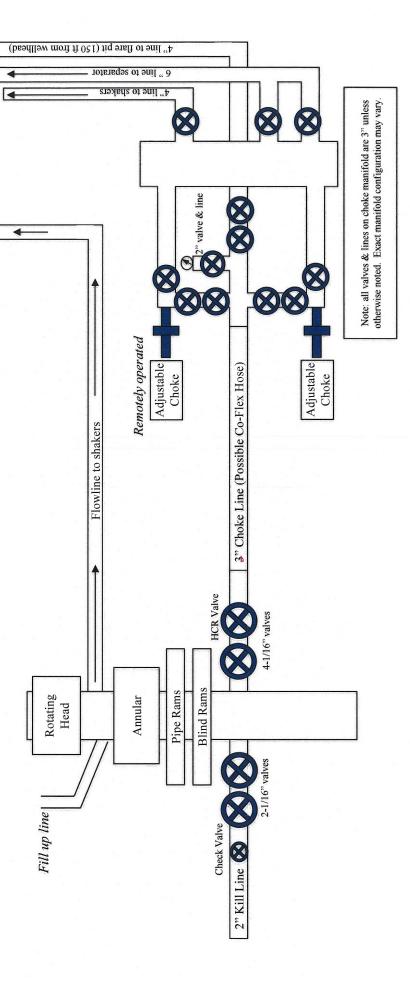

**Equipment Schematic** 

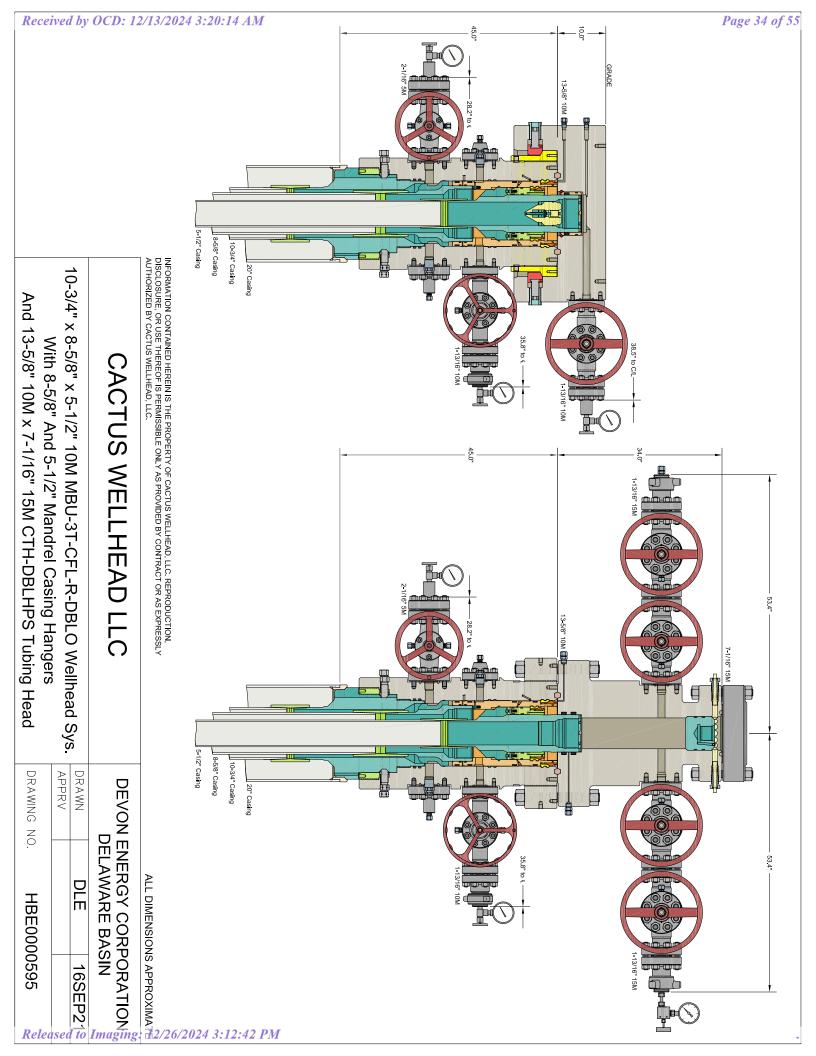

Casing Assumptions and Load Cases

Intermediate

All casing design assumptions were ran in Stress Check to determine safety factor which meet or exceed both WPX Energy and BLM minimum requirements. All casing strings will be filled while running in hole in order to not exceed collapse rating of the pipe.

Intermediate Casing Burst Design						
Load Case	External Pressure	Internal Pressure				
Pressure Test	Formation Pore Pressure	Max mud weight of next hole-				
		section plus Test psi				
Drill Ahead	Formation Pore Pressure	Max mud weight of next hole				
		section				
Fracture @ Shoe	Formation Pore Pressure	Dry gas				

Intermediate Casing Collapse Design							
Load Case External Pressure Internal Pressure							
Full Evacuation	Water gradient in cement, mud	None					
	above TOC						
Cementing	Wet cement weight	Water (8.33ppg)					

Intermediate Casing Tension Design					
Load Case	Assumptions				
Overpull	100kips				
Runing in hole	2 ft/s				
Service Loads	N/A				

Casing Assumptions and Load Cases

Surface

All casing design assumptions were ran in Stress Check to determine safety factor which meet or exceed both WPX Energy and BLM minimum requirements. All casing strings will be filled while running in hole in order to not exceed collapse rating of the pipe.

Surface Casing Burst Design						
Load Case	External Pressure	Internal Pressure				
Pressure Test	Formation Pore Pressure	Max mud weight of next hole-				
		section plus Test psi				
Drill Ahead	Formation Pore Pressure	Max mud weight of next hole				
		section				
Displace to Gas	Formation Pore Pressure	Dry gas from next casing point				

Surface Casing Collapse Design			
Load Case	External Pressure	Internal Pressure	
Full Evacuation	Water gradient in cement, mud above TOC	None	
Cementing	Wet cement weight	Water (8.33ppg)	

Surface Casing Tension Design		
Load Case	Assumptions	
Overpull	100kips	
Runing in hole	3 ft/s	
Service Loads	N/A	

# PECOS DISTRICT DRILLING CONDITIONS OF APPROVAL

<b>OPERATOR'S NAME:</b>	WPX Energy Permian LLC -
LEASE NO.:	NMNM19609
LOCATION:	Section 26, T.26 S., R.29 E., NMPM
COUNTY:	Eddy County, New Mexico 🔹

WELL NAME & NO.:	Steel Guitar 26-35 Fed Com 424H
<b>BOTTOM HOLE FOOTAGE</b>	1784'/N & 2190'/E
ATS/API ID:	ATS-23-2052
APD ID:	10400093572
Sundry ID:	N/a

# COA

<b></b>			
H2S	Yes		
Potash	None 🔽	None	
Cave/Karst Potential	Medium 💌		
Cave/Karst Potential	Critical		
Variance	C None	E Flex Hose	C Other
Wellhead	Conventional and Multibov	vl 🔽	
Other	□ 4 String □ 5 String	Capitan Reef None	□WIPP
Other	Pilot Hole None	C Open Annulus	
Cementing	Contingency Squeeze	Echo-Meter	Primary Cement Squeeze None
Special Requirements	□ Water Disposal/Injection	COM	Unit Unit
Special Requirements	Batch Sundry	Waste Prevention None	
Special Requirements Variance	□ Break Testing	□ Offline Cementing	Casing Clearance

### A. HYDROGEN SULFIDE

A Hydrogen Sulfide (H2S) Drilling Plan shall be activated 500 feet prior to drilling into the **Delaware** formation. As a result, the Hydrogen Sulfide area must meet **43 CFR part 3170 Subpart 3176** requirements, which includes equipment and personnel/public protection items. If Hydrogen Sulfide is encountered, please provide measured values and formations to the BLM.

### **B.** CASING

- 1. The 10-3/4 inch surface casing shall be set at approximately 411 feet (a minimum of 70 feet (Eddy County) into the Rustler Anhydrite and above the salt when present, and below usable fresh water) and cemented to the surface. The surface hole shall be 14 3/4 inch in diameter.
  - a. If cement does not circulate to the surface, the appropriate BLM office shall be notified and a temperature survey utilizing an electronic type temperature survey with surface log readout will be used or a cement bond log shall be run to verify the top of the cement. Temperature survey will be run a minimum of six hours after pumping cement and ideally between 8-10 hours after completing the cement job.
  - b. Wait on cement (WOC) time for a primary cement job will be a minimum of <u>8</u> <u>hours</u> or 500 pounds compressive strength, whichever is greater. (This is to include the lead cement)
  - c. Wait on cement (WOC) time for a remedial job will be a minimum of 4 hours after bringing cement to surface or 500 pounds compressive strength, whichever is greater.
  - d. If cement falls back, remedial cementing will be done prior to drilling out that string.

Cement excess is less than 25%, more cement is required if washout occurs. Adjust cement volume and excess based on a fluid caliper or similar method that reflects the as-drilled size of the wellbore.

Intermediate casing must be kept fluid filled to meet BLM minimum collapse requirement.

2. The minimum required fill of cement behind the 8-5/8 inch intermediate casing is:

#### **Option 1 (Single Stage):**

• Cement to surface. If cement does not circulate see B.1.a, c-d above. Wait on cement (WOC) time for a primary cement job is to include the lead cement slurry due to cave/karst or potash.

### **Option 2:**

Operator has proposed to cement in two stages by conventionally cementing the first stage and performing a bradenhead squeeze on the second stage, contingent upon no returns to surface.

- a. First stage: Operator will cement with intent to reach the top of the **Brushy** Canyon at 4972'.
- b. Second stage:
  - Operator will perform bradenhead squeeze and top-out. Cement to surface. If cement does not reach surface, the appropriate BLM office shall be notified. (Squeeze 563 sxs Class C)
     Wait on cement (WOC) time for a primary cement job is to include the lead cement slurry due to cave/karst or potash.

Operator has proposed to pump down **10-3/4**" X **8-5/8**" annulus after primary cementing stage. <u>Operator must run Echo-meter to verify Cement Slurry/Fluid top in the annulus Or operator shall run a CBL from TD of the **8-5/8**" casing to surface after the second stage <u>BH to verify TOC.</u></u>

Submit results to the BLM. No displacement fluid/wash out shall be utilized at the top of the cement slurry between second stage BH and top out. Operator must run one CBL per Well Pad. Operator may conduct a negative and positive pressure test during completion to remediate sustained casing pressure.

If cement does not reach surface, the next casing string must come to surface.

Operator must use a limited flush fluid volume of 1 bbl following backside cementing procedures.

- In <u>Medium Cave/Karst Areas</u> if cement does not circulate to surface on the first two casing strings, the cement on the 3rd casing string must come to surface.
- 3. The minimum required fill of cement behind the 5-1/2 inch production casing is:
  - Cement should tie-back at least 200 feet into previous casing string. Operator shall provide method of verification.
     Wait on cement (WOC) time for a primary cement job is to include the lead cement slurry due to cave/karst or potash.

### C. PRESSURE CONTROL

1. Variance approved to use flex line from BOP to choke manifold. Manufacturer's specification to be readily available. No external damage to flex line. Flex line to be installed as straight as possible (no hard bends).'

Page 3 of 10

### 2.

### **Option 1:**

- a. Minimum working pressure of the blowout preventer (BOP) and related equipment (BOPE) required for drilling below the surface casing shoe shall be **5000 (5M)** psi.
- b. Minimum working pressure of the blowout preventer (BOP) and related equipment (BOPE) required for drilling below the **8-5/8** inch intermediate casing shoe shall be **5000 (5M)** psi.

### **Option 2:**

Operator has proposed a multi-bowl wellhead assembly. This assembly will only be tested when installed on the **10-3/4** inch surface casing. Minimum working pressure of the blowout preventer (BOP) and related equipment (BOPE) required for drilling below the surface casing shoe shall be **5000 (5M)** psi.

- a. Wellhead shall be installed by manufacturer's representatives, submit documentation with subsequent sundry.
- b. If the welding is performed by a third party, the manufacturer's representative shall monitor the temperature to verify that it does not exceed the maximum temperature of the seal.
- c. Manufacturer representative shall install the test plug for the initial BOP test.
- d. If the cement does not circulate and one inch operations would have been possible with a standard wellhead, the well head shall be cut off, cementing operations performed and another wellhead installed.
- e. Whenever any seal subject to test pressure is broken, all the tests in 43 CFR 3172.6(b)(9) must be followed.

### **D. SPECIAL REQUIREMENT (S)**

### **Communitization Agreement**

- The operator will submit a Communitization Agreement to the Santa Fe Office, 301 Dinosaur Trail Santa Fe, New Mexico 87508, at least 90 days before the anticipated date of first production from a well subject to a spacing order issued by the New Mexico Oil Conservation Division. The Communitization Agreement will include the signatures of all working interest owners in all Federal and Indian leases subject to the Communitization Agreement (i.e., operating rights owners and lessees of record), or certification that the operator has obtained the written signatures of all such owners and will make those signatures available to the BLM immediately upon request.
- The operator will submit an as-drilled survey well plat of the well completion, but are not limited to, those specified in 43 CFR part 3170 Subpart 3171

- If the operator does not comply with this condition of approval, the BLM may take enforcement actions that include, but are not limited to, those specified in 43 CFR 3163.1.
- In addition, the well sign shall include the surface and bottom hole lease numbers. <u>When the Communitization Agreement number is known, it shall also be on the sign.</u>

# **GENERAL REQUIREMENTS**

The BLM is to be notified in advance for a representative to witness:

- a. Spudding well (minimum of 24 hours)
- b. Setting and/or Cementing of all casing strings (minimum of 4 hours)
- c. BOPE tests (minimum of 4 hours)

Eddy County
 EMAIL or call the Carlsbad Field Office, 620 East Greene St., Carlsbad, NM 88220,
 BLM NM CFO DrillingNotifications@BLM.GOV

(575) 361-2822

- 1. Unless the production casing has been run and cemented or the well has been properly plugged, the drilling rig shall not be removed from over the hole without prior approval.
  - a. In the event the operator has proposed to drill multiple wells utilizing a skid/walking rig. Operator shall secure the wellbore on the current well, after installing and testing the wellhead, by installing a blind flange of like pressure rating to the wellhead and a pressure gauge that can be monitored while drilling is performed on the other well(s).
  - b. When the operator proposes to set surface casing with Spudder Rig
    - Notify the BLM when moving in and removing the Spudder Rig.
    - Notify the BLM when moving in the 2<sup>nd</sup> Rig. Rig to be moved in within 90 days of notification that Spudder Rig has left the location.
    - BOP/BOPE test to be conducted per **43** CFR part **3170** Subpart **3172** as soon as 2nd Rig is rigged up on well.
- 2. Floor controls are required for 3M or Greater systems. These controls will be on the rig floor, unobstructed, readily accessible to the driller and will be operational at all times during drilling and/or completion activities. Rig floor is defined as the area immediately around the rotary table; the area immediately above the substructure on which the draw works are located, this does not include the dog house or stairway area.

#### A. CASING

1. Changes to the approved APD casing program need prior approval if the items substituted are of lesser grade or different casing size or are Non-API. The Operator can exchange the components of the proposal with that of superior strength (i.e. changing from J-55 to N-80, or from 36# to 40#). Changes to the approved cement program need prior approval if the altered cement plan has less volume or strength or

Page 6 of 10

if the changes are substantial (i.e. Multistage tool, ECP, etc.). The initial wellhead installed on the well will remain on the well with spools used as needed.

- <u>Wait on cement (WOC) for Potash Areas:</u> After cementing but before commencing any tests, the casing string shall stand cemented under pressure until both of the following conditions have been met: 1) cement reaches a minimum compressive strength of 500 psi for all cement blends of both lead and tail cement, 2) until cement has been in place at least <u>8 hours</u>. WOC time will be recorded in the driller's log. The casing integrity test can be done (prior to the cement setting up) immediately after bumping the plug.
- 3. <u>Wait on cement (WOC) for Water Basin:</u> After cementing but before commencing any tests, the casing string shall stand cemented under pressure until both of the following conditions have been met: 1) cement reaches a minimum compressive strength of 500 psi at the shoe, 2) until cement has been in place at least <u>8 hours</u>. WOC time will be recorded in the driller's log. See individual casing strings for details regarding lead cement slurry requirements. The casing integrity test can be done (prior to the cement setting up) immediately after bumping the plug.
- 4. Provide compressive strengths including hours to reach required 500 pounds compressive strength prior to cementing each casing string. Have well specific cement details onsite prior to pumping the cement for each casing string.
- 5. No pea gravel permitted for remedial or fall back remedial without prior authorization from the BLM engineer.
- 6. On that portion of any well approved for a 5M BOPE system or greater, a pressure integrity test of each casing shoe shall be performed. Formation at the shoe shall be tested to a minimum of the mud weight equivalent anticipated to control the formation pressure to the next casing depth or at total depth of the well. This test shall be performed before drilling more than 20 feet of new hole.
- 7. If hardband drill pipe is rotated inside casing, returns will be monitored for metal. If metal is found in samples, drill pipe will be pulled and rubber protectors which have a larger diameter than the tool joints of the drill pipe will be installed prior to continuing drilling operations.
- 8. Whenever a casing string is cemented in the R-111-P potash area, the NMOCD requirements shall be followed.
- B. PRESSURE CONTROL
- All blowout preventer (BOP) and related equipment (BOPE) shall comply with well control requirements as described in 43 CFR part 3170 Subpart 3172 and API STD 53 Sec. 5.3.

- 2. If a variance is approved for a flexible hose to be installed from the BOP to the choke manifold, the following requirements apply: The flex line must meet the requirements of API 16C. Check condition of flexible line from BOP to choke manifold, replace if exterior is damaged or if line fails test. Line to be as straight as possible with no hard bends and is to be anchored according to Manufacturer's requirements. The flexible hose can be exchanged with a hose of equal size and equal or greater pressure rating. Anchor requirements, specification sheet and hydrostatic pressure test certification matching the hose in service, to be onsite for review. These documents shall be posted in the company man's trailer and on the rig floor.
- 3. 5M or higher system requires an HCR valve, remote kill line and annular to match. The remote kill line is to be installed prior to testing the system and tested to stack pressure.
- 4. If the operator has proposed a multi-bowl wellhead assembly in the APD. The following requirements must be met:
  - a. Wellhead shall be installed by manufacturer's representatives, submit documentation with subsequent sundry.
  - b. If the welding is performed by a third party, the manufacturer's representative shall monitor the temperature to verify that it does not exceed the maximum temperature of the seal.
  - c. Manufacturer representative shall install the test plug for the initial BOP test.
  - d. Whenever any seal subject to test pressure is broken, all the tests in 43 CFR 3172.6(b)(9) must be followed.
  - e. If the cement does not circulate and one inch operations would have been possible with a standard wellhead, the well head shall be cut off, cementing operations performed and another wellhead installed.
- 5. The appropriate BLM office shall be notified a minimum of 4 hours in advance for a representative to witness the tests.
  - a. In a water basin, for all casing strings utilizing slips, these are to be set as soon as the crew and rig are ready and any fallback cement remediation has been done. The casing cut-off and BOP installation can be initiated four hours after installing the slips, which will be approximately six hours after bumping the plug. For those casing strings not using slips, the minimum wait time before cut-off is eight hours after bumping the plug. BOP/BOPE testing can begin after cut-off or once cement reaches 500 psi compressive strength (including lead cement), whichever is greater. However, if the float does not hold, cut-off cannot be initiated until cement reaches 500 psi compressive strength (including lead when specified).
  - b. In potash areas, for all casing strings utilizing slips, these are to be set as soon as the crew and rig are ready and any fallback cement remediation has been

done. For all casing strings, casing cut-off and BOP installation can be initiated at twelve hours after bumping the cement plug. The BOPE test can be initiated after bumping the cement plug with the casing valve open. (only applies to single stage cement jobs, prior to the cement setting up.)

- c. The tests shall be done by an independent service company utilizing a test plug not a cup or J-packer and can be initiated immediately with the casing valve open. The operator also has the option of utilizing an independent tester to test without a plug (i.e. against the casing) pursuant to 43 CFR part 3170
  Subpart 3172 with the pressure not to exceed 70% of the burst rating for the casing. Any test against the casing must meet the WOC time for 8 hours or 500 pounds compressive strength, whichever is greater, prior to initiating the test (see casing segment as lead cement may be critical item).
- d. The test shall be run on a 5000 psi chart for a 2-3M BOP/BOP, on a 10000 psi chart for a 5M BOP/BOPE and on a 15000 psi chart for a 10M BOP/BOPE. If a linear chart is used, it shall be a one hour chart. A circular chart shall have a maximum 2 hour clock. If a twelve hour or twenty-four hour chart is used, tester shall make a notation that it is run with a two hour clock.
- e. The results of the test shall be reported to the appropriate BLM office.
- f. All tests are required to be recorded on a calibrated test chart. A copy of the BOP/BOPE test chart and a copy of independent service company test will be submitted to the appropriate BLM office.
- g. The BOP/BOPE test shall include a low pressure test from 250 to 300 psi. The test will be held for a minimum of 10 minutes if test is done with a test plug and 30 minutes without a test plug. This test shall be performed prior to the test at full stack pressure.
- h. BOP/BOPE must be tested by an independent service company within 500 feet of the top of the Wolfcamp formation if the time between the setting of the intermediate casing and reaching this depth exceeds 20 days. This test does not exclude the test prior to drilling out the casing shoe as per 43 CFR part 3170 Subpart 3172.

#### C. DRILLING MUD

Mud system monitoring equipment, with derrick floor indicators and visual and audio alarms, shall be operating before drilling into the Wolfcamp formation, and shall be used until production casing is run and cemented.

### D. WASTE MATERIAL AND FLUIDS

All waste (i.e. drilling fluids, trash, salts, chemicals, sewage, gray water, etc.) created as a result of drilling operations and completion operations shall be safely contained and disposed of properly at a waste disposal facility. No waste material or fluid shall be disposed of on the well location or surrounding area.

Porto-johns and trash containers will be on-location during fracturing operations or any other crew-intensive operations.

Long Vo (LVO) 10/16/2024

**Approval Date: 12/11/2024** 



# **WPX Energy Permian, LLC**

3500 One Williams Center Tulsa, Oklahoma 74172

# Hydrogen Sulfide (H<sub>2</sub>S) Contingency Plan


For

# Steel Guitar 26-35 Fed Com 424H

Sec-26 T-26S R-29E 455 FNL & 1090' FEL LAT: 32.0184929° N LONG : 103.9492587° W

**Eddy County NM** 

Page 47 of 55

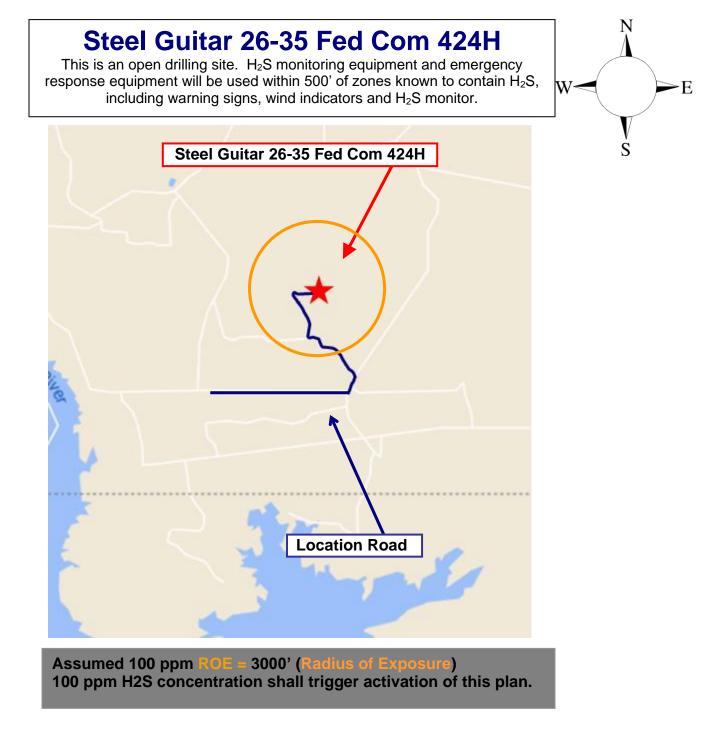

### Escape

Crews shall escape upwind of escaping gas in the event of an emergency release of gas. Escape can be facilitated from the location entrance road. Crews should then block the entrance to the location from the lease road so as not to allow anyone traversing into a hazardous area. The blockade should be at a safe distance outside of the ROE. <u>There are no homes or buildings in or near the ROE</u>.

# Assumed 100 ppm ROE = 3000'

# **100** ppm H<sub>2</sub>S concentration shall trigger activation of this plan.

### Emergency Procedures

In the event of a release of gas containing H<sub>2</sub>S, the first responder(s) must

- Isolate the area and prevent entry by other persons into the 100 ppm ROE.
- Evacuate any public places encompassed by the 100 ppm ROE.
- Be equipped with H<sub>2</sub>S monitors and air packs in order to control the release.
- Use the "buddy system" to ensure no injuries occur during the response
- Take precautions to avoid personal injury during this operation.
- Contact operator and/or local officials to aid in operation. See list of phone numbers attached.
- Have received training in the
  - $\circ$  Detection of H<sub>2</sub>S, and
  - Measures for protection against the gas,
  - Equipment used for protection and emergency response.

### Ignition of Gas Source

Should control of the well be considered lost and ignition considered, take care to protect against exposure to Sulfur Dioxide (SO<sub>2</sub>). Intentional ignition must be coordinated with the NMOCD and local officials. Additionally, the NM State Police may become involved. NM State Police shall be the Incident Command on scene of any major release. Take care to protect downwind whenever there is an ignition of the gas.

Common	Chemical	Specific	Threshold	Hazardous Limit	Lethal
Name	Formula	Gravity	Limit		Concentration
Hydrogen Sulfide	H₂S	1.189 Air = 1	10 ppm	100 ppm/hr	600 ppm
Sulfur	SO <sub>2</sub>	2.21	2 nnm	N/A	1000 nnm
Dioxide	302	Air = 1	2 ppm		1000 ppm

### Characteristics of H<sub>2</sub>S and SO<sub>2</sub>

# **Contacting Authorities**

WPX Energy Corp. personnel must liaison with local and state agencies to ensure a proper response to a major release. Additionally, the OCD must be notified of the release as soon as possible but no later than 4 hours. Agencies will ask for information such as type and volume of release, wind direction, location of release, etc. Be prepared with all information available. The following call list of essential and potential responders has been prepared for use during a release. WPX Energy Corp. Company response must be in coordination with the State of New Mexico's 'Hazardous Materials Emergency Response Plan' (HMER)

# Hydrogen Sulfide Drilling Operation Plan

### I. HYDROGEN SULFIDE (H<sub>2</sub>S) TRAINING

All personnel, whether regularly assigned, contracted, or employed on an unscheduled basis, will receive training from a qualified instructor in the following areas prior to commencing drilling operations on this well:

- 1. The hazards and characteristics of hydrogen sulfide (H<sub>2</sub>S)
- 2. The proper use and maintenance of personal protective equipment and life support systems.
- 3. The proper use of H<sub>2</sub>S detectors, alarms, warning systems, briefing areas, evacuation procedures, and prevailing winds.
- 4. The proper techniques for first aid and rescue procedures.

In addition, supervisory personnel will be trained in the following areas:

- 1. The effects of H<sub>2</sub>S metal components. If high tensile tubulars are to be used, personnel will be trained in their special maintenance requirements.
- 2. Corrective action and shut-in procedures when drilling or reworking a well and blowout prevention and well control procedures.
- 3. The contents and requirements of the H<sub>2</sub>S Drilling Operations Plan.

There will be weekly H<sub>2</sub>S and well control drills for all personnel in each crew.

### II. HYDROGEN SULFIDE TRAINING

Note: All  $H_2S$  safety equipment and systems will be installed, tested, and operational when drilling reaches a depth of 500 feet above, or three days prior to penetrating the first zone containing or reasonably expected to contain  $H_2S$ .

### 1. Well Control Equipment

- A. Flare line
- B. Choke manifold Remotely Operated
- C. Blind rams and pipe rams to accommodate all pipe sizes with properly sized closing unit
- D. Auxiliary equipment may include if applicable: annular preventer and rotating head.
- E. Mud/Gas Separator

# 2. Protective equipment for essential personnel:

30-minute SCBA units located at briefing areas, as indicated on well site diagram, with escape units available in the top doghouse. As it may be difficult to communicate audibly while wearing these units, hand signals shall be utilized.

# 3. H<sub>2</sub>S detection and monitoring equipment:

Portable H<sub>2</sub>S monitors positioned on location for best coverage and response. These units have warning lights which activate when H<sub>2</sub>S levels reach 10 ppm and audible sirens which activate at 15 ppm. Sensor locations:

- Bell nipple
- Possum Belly/Shale shaker
- Rig floor
- Choke manifold
- Cellar

# Visual warning systems:

- A. Wind direction indicators as shown on well site diagram
- B. Caution/ Danger signs shall be posted on roads providing direct access to locations. Signs will be painted a high visibility yellow with black lettering of sufficient size to be reasonable distance from the immediate location. Bilingual signs will be used when appropriate.

# 4. Mud program:

The mud program has been designed to minimize the volume of  $H_2S$  circulated to surface. Proper mud weight, safe drilling practices and the use of  $H_2S$  scavengers will minimize hazards when penetrating  $H_2S$  bearing zones.

# 5. Metallurgy:

- A. All drill strings, casings, tubing, wellhead, blowout preventer, drilling spool, kill lines, choke manifold lines, and valves shall be H<sub>2</sub>S trim.
- B. All elastomers used for packing and seals shall be H<sub>2</sub>S trim.

### 6. Communication:

- A. Company personnel have/use cellular telephones in the field.
- B. Land line (telephone) communications at Office

### 7. Well testing:


- A. Drill stem testing will be performed with a minimum number of personnel in the immediate vicinity, which are necessary to safety and adequately conduct the test. The drill stem testing will be conducted during daylight hours and formation fluids will not be flowed to the surface. All drill-stem-testing operations conducted in an H<sub>2</sub>S environment will use the closed chamber method of testing.
- B. There will be no drill stem testing.

Devon/WPX Energy Corp. Company Call List				
Employee/Company Contact Representative	Position	Phone Number	After Hours Number	
Jonathan Fisher (North)	Drilling Manager	832-967-7912		
Jason Hildebrand (South)	Drilling Manager	405-552-6514		
Rich Downey	Drilling VP	405-228-2415		
Josh Harvey	EHS Manger	405-228-2440	918-500-5536	
Laura Wright	EHS Supervisor	405-552-5334	832-969-8145	
Robert Glover	EHS Professional	575-703-5712	575-703-5712	
Lane Frank	Lead EHS	580-579-7052	580-579-7052	
Rickey Porter	Lead EHS	903-720-8315	903-720-8315	
Ronnie Handy	Lead EHS	918-839-2046	918-839-2046	
Brock Vise	Lead EHS	918-413-3291	918-413-3291	

Hobbs Lea County Communication Authority State Police City Police Sheriff's Office Ambulance Fire Department LEPC (Local Emergency Planning Committee)	397-9265 885-3138 397-9265 396-3611 <b>91</b> 1 397-9308
Lea County Communication Authority State Police City Police Sheriff's Office <b>Ambulance</b> Fire Department LEPC (Local Emergency Planning Committee)	885-3138 397-9265 396-3611 <b>91</b> 1 397-9308
State Police City Police Sheriff's Office Ambulance Fire Department LEPC (Local Emergency Planning Committee)	885-3138 397-9265 396-361 <b>91</b> 1 397-9308
City Police Sheriff's Office Ambulance Fire Department LEPC (Local Emergency Planning Committee)	<u>397-9265</u> 396-361 <b>91</b> 397-9308
Sheriff's Office         Ambulance         Fire Department         LEPC (Local Emergency Planning Committee)	396-361 <b>91</b> 397-9308
Ambulance Fire Department LEPC (Local Emergency Planning Committee)	<b>91</b> <sup>2</sup> 397-9308
Fire Department LEPC (Local Emergency Planning Committee)	397-9308
LEPC (Local Emergency Planning Committee)	
	393-287
NMOCD	393-616
US Bureau of Land Management (Closed)	393-000
Carlsbad	
State Police	885-313
City Police	885-211
Sheriff's Office	887-755
Ambulance	91
Fire Department	885-312
LEPC (Local Emergency Planning Committee)	887-379
US Bureau of Land Management	234-597
NM Emergency Response Commission (Santa Fe)	(505) 476-960
24 HR	(505) 827-912
National Emergency Response Center	(800) 424-8802
National Pollution Control Center: Direct	(703) 872-600
For Oil Spills	(800) 280-711
Emergency Services	
Wild Well Control	(281) 784-470
	(915) 563-335
Cudd Pressure Control (915) 699-0139	(575) 746-275
Halliburton	
Halliburton B. J. Services	(575) 746-356
Halliburton B. J. Services Native Air – Emergency Helicopter – Hobbs	(575) 746-356 (575) 347-983
Halliburton B. J. Services Native Air – Emergency Helicopter – Hobbs For Air Ambulance - Eddy County Dispatch	(575) 746-356 (575) 347-983 (575)-616-715
Halliburton B. J. Services Native Air – Emergency Helicopter – Hobbs	(575) 746-356 (575) 347-983 (575)-616-715 (575)-397-926 (800) 222-122
Halliburton B. J. Services Native Air – Emergency Helicopter – Hobbs For Air Ambulance - Eddy County Dispatch For Air Ambulance - Lea County (LCCA)	(575) 746-356 (575) 347-983 (575)-616-715 (575)-397-926 (800) 222-122
Halliburton B. J. Services Native Air – Emergency Helicopter – Hobbs For Air Ambulance - Eddy County Dispatch For Air Ambulance - Lea County (LCCA) Poison Control (24/7)	(575) 746-356 (575) 347-983 (575)-616-715 (575)-397-926
HalliburtonB. J. ServicesNative Air – Emergency Helicopter – HobbsFor Air Ambulance - Eddy County DispatchFor Air Ambulance - Lea County (LCCA)Poison Control (24/7)Oil & Gas Pipeline 24 Hour Service	(575) 746-356 (575) 347-983 (575)-616-715 (575)-397-926 (800) 222-122
	National Pollution Control Center: Direct         For Oil Spills         Emergency Services         Wild Well Control         Cudd Pressure Control       (915) 699-0139



.

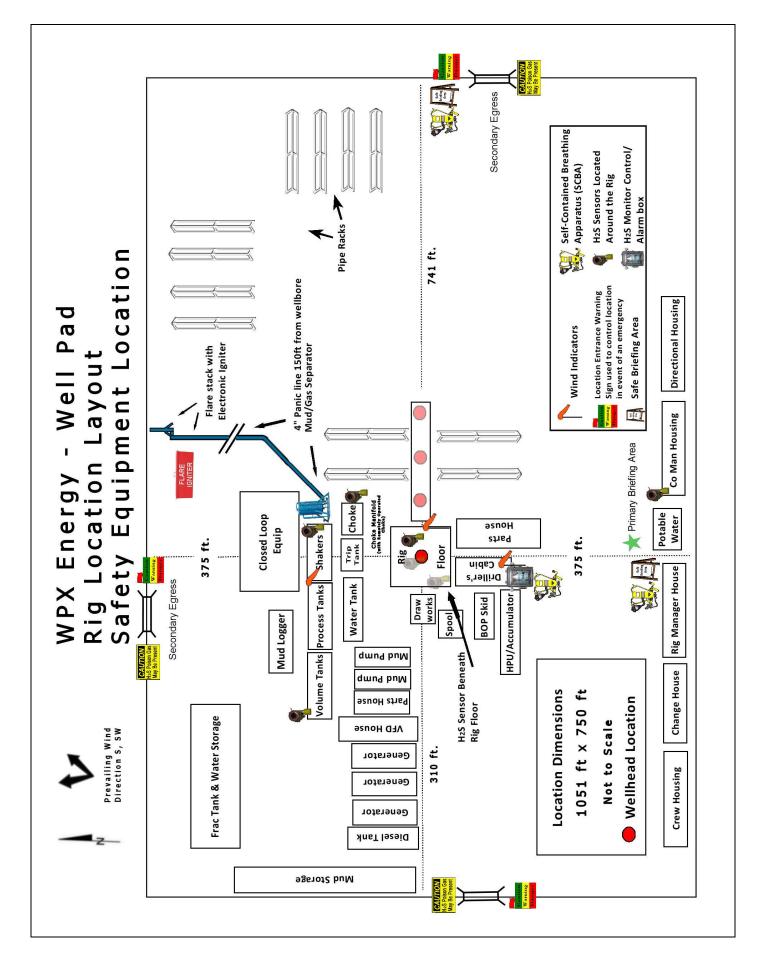

Sante Fe Main Office Phone: (505) 476-3441

General Information Phone: (505) 629-6116

Online Phone Directory https://www.emnrd.nm.gov/ocd/contact-us

# State of New Mexico Energy, Minerals and Natural Resources Oil Conservation Division 1220 S. St Francis Dr. Santa Fe, NM 87505

CONDITIONS

Operator:	OGRID:
WPX Energy Permian, LLC	246289
Devon Energy - Regulatory Action Number:	
Oklahoma City, OK 73102 411587	
	Action Type:
	[C-101] BLM - Federal/Indian Land Lease (Form 3160-3)

#### CONDITIONS

Created By	Condition	Condition Date
wsalter	Cement is required to circulate on both surface and intermediate1 strings of casing.	12/13/2024
wsalter	If cement does not circulate on any string, a Cement Bond Log (CBL) is required for that string of casing.	12/13/2024
ward.rikala	Notify the OCD 24 hours prior to casing & cement.	12/26/2024
ward.rikala	File As Drilled C-102 and a directional Survey with C-104 completion packet.	12/26/2024
ward.rikala	Once the well is spud, to prevent ground water contamination through whole or partial conduits from the surface, the operator shall drill without interruption through the fresh water zone or zones and shall immediately set in cement the water protection string.	12/26/2024
ward.rikala	Oil base muds are not to be used until fresh water zones are cased and cemented providing isolation from the oil or diesel. This includes synthetic oils. Oil based mud, drilling fluids and solids must be contained in a steel closed loop system.	12/26/2024
ward.rikala	Submit C-102 on new C-102 form.	12/26/2024

.

CONDITIONS

Action 411587