Form 3160-3 FORM APPROVED OMB No. 1004-0137 (June 2015) Expires: January 31, 2018 **UNITED STATES** DEPARTMENT OF THE INTERIOR 5. Lease Serial No. BUREAU OF LAND MANAGEMENT APPLICATION FOR PERMIT TO DRILL OR REENTER 6. If Indian, Allotee or Tribe Name 7. If Unit or CA Agreement, Name and No. DRILL REENTER 1a. Type of work: 1b. Type of Well: Oil Well Gas Well Other 8. Lease Name and Well No. 1c. Type of Completion: Hydraulic Fracturing Single Zone Multiple Zone 2. Name of Operator 9. API Well No. 30-025-54254 3a. Address 3b. Phone No. (include area code) 10. Field and Pool, or Exploratory 4. Location of Well (Report location clearly and in accordance with any State requirements.*) 11. Sec., T. R. M. or Blk. and Survey or Area At surface At proposed prod. zone 14. Distance in miles and direction from nearest town or post office* 12. County or Parish 13. State 15. Distance from proposed* 16. No of acres in lease 17. Spacing Unit dedicated to this well location to nearest property or lease line, ft. (Also to nearest drig. unit line, if any) 18. Distance from proposed location* 19. Proposed Depth 20. BLM/BIA Bond No. in file to nearest well, drilling, completed, applied for, on this lease, ft. 21. Elevations (Show whether DF, KDB, RT, GL, etc.) 22. Approximate date work will start* 23. Estimated duration 24. Attachments The following, completed in accordance with the requirements of Onshore Oil and Gas Order No. 1, and the Hydraulic Fracturing rule per 43 CFR 3162.3-3 (as applicable) 1. Well plat certified by a registered surveyor. 4. Bond to cover the operations unless covered by an existing bond on file (see 2. A Drilling Plan. Item 20 above). 3. A Surface Use Plan (if the location is on National Forest System Lands, the 5. Operator certification. SUPO must be filed with the appropriate Forest Service Office). 6. Such other site specific information and/or plans as may be requested by the 25. Signature Name (Printed/Typed) Date Title Approved by (Signature) Name (Printed/Typed) Date Title Office Application approval does not warrant or certify that the applicant holds legal or equitable title to those rights in the subject lease which would entitle the applicant to conduct operations thereon. Conditions of approval, if any, are attached. Title 18 U.S.C. Section 1001 and Title 43 U.S.C. Section 1212, make it a crime for any person knowingly and willfully to make to any department or agency of the United States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction




*(Instructions on page 2)


C-1	02				ls & Na	tural	New Mexico Resources Depa ION DIVISI			Rev	ised July, 2024
Submit Electronically Via OCD Permitting				VOLIC .	V ALI	ION DIVISION					
								Submittal Type:	☐ Amended Repor	t	
									Type.	☐ As Drilled	•
				W	ELLIO	~ A TI	ON INFORMATIO	NT			
API N	lumber		Pool Cod		ELL LOC		Pool Name	IN .			
711 1	30-025	-54254	966			•	BRINNINSTOOL;	WOLFCA	MP. WI	EST	
Prope	rty Code		Property							Well Number	
OGDIE	<u>327369</u>		Operator		DANGER	NOOl	DLE 29-20 FED C	СОМ		801H Ground Level	D) 4:
OGRII	6137		Operator		N ENERG	Y PF	RODUCTION COMPA	NY, L.P.		3681.7'	Lievation
Surfa	ce Owner:	□State □	∟ Fee □Trib					-	□Fee □	Tribal □Federal	
						Surfa	ace Location				
UL	Section	Township	Range	Lot	Ft. from	m N/	S Ft. from E/W	Latitude		Longitude	County
M	29	23-S	33-E		253'	\mathbf{S}	381' W	32.269	165	103.601650	LEA
			l		l R	otton	n Hole Location				
UL	Section	Township	Range	Lot	Ft. from			Latitude		Longitude	County
D	20	23-S	33-E		20'	N	430' W	32.297	449	103.601510	LEA
	100						200	0.00.00		100.001010	
Dedicat	ed Acres 1	Infill or Def	ining Well	Defining	Well API	Overl	apping Spacing Uni	t (Y/N)	Consolid	ation Code	
640		INFILL	g				N	- (-,,		C	
		INFILL		30-025-4	1032	Well setbacks are under Common Ownershi					
order	Numbers					well	setbacks are under	Common	Ownersn	ip: ⊔ies ⊠ino	
					Kic	k Off	Point (KOP)				
UL	Section	Township	Range	Lot	Ft. from			Latitude		Longitude	County
M	29	23-S	33-E		50'	S	430' W	32.268	607	103.601491	LEA
					Fin	at To	ke Point (FTP)				
UL	Section	Township	Range	Lot	Ft. from		` '	Latitude		Longitude	County
M	29	23-S	33-E	Lot	100	•	430' W	32.268	744	103.601491	LEA
141	20	20 0	00 L					08.200		100.001101	
	T			1			ke Point (LTP)				
UL	Section	Township	Range	Lot	Ft. from		·	Latitude	200	Longitude	County
D	20	23-S	33-E		100'	N	430' W	32.297	229	103.601510	LEA
					Spac		Unit Type Horizon	tal Verti	eal (Ground Floor Elev	vation:
OPERATOR CERTIFICATIONS I hereby certify that the information contained herein is true and complete to the best of my knowledge and belief, and, if the well is a vertical or directional well, that this organization either owns a working interest or unleased mineral interest in the land including the proposed bottom hole location or has a right to drill this well at this location pursuant to a contract with an owner of a working interest or unleased mineral interest, or to a voluntary pooling agreement or a compulsory pooling order heretofore entered by the division.				e best at this and ais	SURVEYOR CERTIFIC I hereby certify that the we of actual surveys made by correct to the best of my be	ll location sho me or under so		and that the same is true			
If this well is a horizontal well, I further certify that this organization has received the consent of at least one lessee or owner of a working interest or unleased mineral interest in each tract (in the target pool or formation) in which any part of the well's completed interval will be located or obtained a compulsory pooling order from the division.				il vell's n the				23261 PR C C C C C C C C C C C C C C C C C C C	4		
Signa	ture		Date				Signature and Seal	of Profes	ssional S	Surveyor / ONAL	50.
7,1	21 Ch De	al			1/16/2025						
Print	ed Name	-			1/10/2023	- (Certificate Number	Date of	Survey		
Rebec	ca Deal, Regu	latory Analyst							•		
Emai	l Address						23261	09/20	23		
rebeco	ca.deal@dvn.c	nın									

ACREAGE DEDICATION PLATS

This grid represents a standard section. You may superimpose a non-standard section, or larger area, over this grid. Operators must outline the dedicated acreage in a red box, clearly show the well surface location and bottom hole location, if it is directionally drilled, with the dimensions from the section lines in the cardinal directions. If this is a horizontal wellbore show on this plat the location of the First Take Point and Last Take Point, and the point within the Completed interval (other than the First Take Point or Last Take Point) that is closest to any outer boundary of the tract.

Surveyors shall use the latest United States government survey or dependent resurvey. Well locations will be in reference to the New Mexico Principal Meridian. If the land is not surveyed contact the OCD Engineering Bureau. Independent subdivision surveys will not be acceptable.

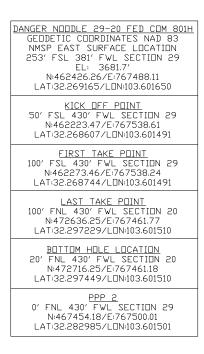

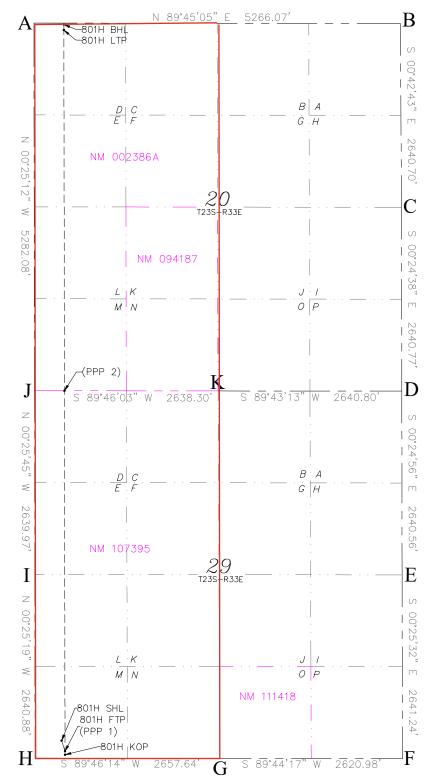

A=N:472734.38 E:767031.04 B=N:472757.23 E:772297.06 C=N:470116.73 E:772329.87 D=N:467476.03 E:772348.79 E=N:464835.54 E:772367.94 F=N:462194.37 E:772387.55 G=N:462182.39 E:769766.60 H=N:462171.74 E:767108.98 I=N:464812.55 E:767089.53 J=N:467452.44 E:767069.75 K=N:467463.14 E:769708.03

State of New Mexico Energy, Minerals and Natural Resources Department

Submit Electronically Via E-permitting

Oil Conservation Division 1220 South St. Francis Dr. Santa Fe, NM 87505

NATURAL GAS MANAGEMENT PLAN

This Natural Gas Management Plan must be submitted with each Application for Permit to Drill (APD) for a new or recompleted well.

Section 1 – Plan Description Effective May 25, 2021

I. Operator: Devon Ene	ergy Production	n Company, L.P.	OGRID:	6137		Date: 10 /5	5 / 2023		
II. Type: ☐ Original ☐ Amendment due to ☐ 19.15.27.9.D(6)(a) NMAC ☐ 19.15.27.9.D(6)(b) NMAC ☐ Other.									
If Other, please describe	:								
III. Well(s): Provide the be recompleted from a si					wells prop	oosed to be dri	lled or proposed to		
Well Name	API	ULSTR	Footages	Anticipated Oil BBL/D	Anticij Gas M		Anticipated roduced Water BBL/D		
See Attached									
V. Anticipated Schedule: Provide the following information for each new or recompleted well or set of wells proposed to be drilled or proposed to be recompleted from a single well pad or connected to a central delivery point. Well Name API Spud Date TD Reached Completion Date Commencement Date Back Date Date									
See Attached									
VI. Separation Equipment: ☐ Attach a complete description of how Operator will size separation equipment to optimize gas capture. VII. Operational Practices: ☐ Attach a complete description of the actions Operator will take to comply with the requirements of Subsection A through F of 19.15.27.8 NMAC. VIII. Best Management Practices: ☐ Attach a complete description of Operator's best management practices to minimize venting during active and planned maintenance.									

Section 2 – Enhanced Plan EFFECTIVE APRIL 1, 2022

Beginning April 1, 2022, an operator that is not in compliance with its statewide natural gas capture requirement for the applicable reporting area must complete this section.

🗵 Operator certifies that it is not required to complete this section because Operator is in compliance with its statewide natural gas capture requirement for the applicable reporting area.

IX. Anticipated Natural Gas Production:

Well	API	Anticipated Average Natural Gas Rate MCF/D	Anticipated Volume of Natural Gas for the First Year MCF		

X. Natural Gas Gathering System (NGGS):

Operator	System	ULSTR of Tie-in	Anticipated Gathering Start Date	Available Maximum Daily Capacity of System Segment Tie-in

XI. Map. \square Attach an accurate and legible map depicting the location of the well(s), the anticipated pipeline route(s) connecting the
production operations to the existing or planned interconnect of the natural gas gathering system(s), and the maximum daily capacity of
the segment or portion of the natural gas gathering system(s) to which the well(s) will be connected.

XII. Line Capacity. The natural	gas gathering system	□ will □ will r	not have capacity to	o gather 10	00% of the antic	ipated nat	tural gas
production volume from the well	prior to the date of firs	t production.					

XIII. Line Pressure. Operator \square does \square does not anticipate that its existing well(s) connected to the same segment, or portion, of the
natural gas gathering system(s) described above will continue to meet anticipated increases in line pressure caused by the new well(s)

l Attach (Onerator's nla	an to manag	nroduction i	n response to	the increased	l line pressure

XIV. Confidentiality: \sqcup Operator asserts confidentiality pursuant to Section 71-2-8 NMSA 1978 for the information pro	vided in
Section 2 as provided in Paragraph (2) of Subsection D of 19.15.27.9 NMAC, and attaches a full description of the specific info	ormation
for which confidentiality is asserted and the basis for such assertion.	

(h)

(i)

Section 3 - Certifications <u>Effective May 25, 2021</u>

Operator certifies that, after reasonable inquiry and based on the available information at the time of submittal: 🗵 Operator will be able to connect the well(s) to a natural gas gathering system in the general area with sufficient capacity to transport one hundred percent of the anticipated volume of natural gas produced from the well(s) commencing on the date of first production, taking into account the current and anticipated volumes of produced natural gas from other wells connected to the pipeline gathering system; or ☐ Operator will not be able to connect to a natural gas gathering system in the general area with sufficient capacity to transport one hundred percent of the anticipated volume of natural gas produced from the well(s) commencing on the date of first production, taking into account the current and anticipated volumes of produced natural gas from other wells connected to the pipeline gathering system. If Operator checks this box, Operator will select one of the following: Well Shut-In. ☐ Operator will shut-in and not produce the well until it submits the certification required by Paragraph (4) of Subsection D of 19.15.27.9 NMAC; or Venting and Flaring Plan.

Operator has attached a venting and flaring plan that evaluates and selects one or more of the potential alternative beneficial uses for the natural gas until a natural gas gathering system is available, including: power generation on lease; (a) power generation for grid; **(b)** (c) compression on lease; (d) liquids removal on lease; (e) reinjection for underground storage; **(f)** reinjection for temporary storage; reinjection for enhanced oil recovery; (g)

Section 4 - Notices

1. If, at any time after Operator submits this Natural Gas Management Plan and before the well is spud:

other alternative beneficial uses approved by the division.

fuel cell production; and

- (a) Operator becomes aware that the natural gas gathering system it planned to connect the well(s) to has become unavailable or will not have capacity to transport one hundred percent of the production from the well(s), no later than 20 days after becoming aware of such information, Operator shall submit for OCD's approval a new or revised venting and flaring plan containing the information specified in Paragraph (5) of Subsection D of 19.15.27.9 NMAC; or
- (b) Operator becomes aware that it has, cumulatively for the year, become out of compliance with its baseline natural gas capture rate or natural gas capture requirement, no later than 20 days after becoming aware of such information, Operator shall submit for OCD's approval a new or revised Natural Gas Management Plan for each well it plans to spud during the next 90 days containing the information specified in Paragraph (2) of Subsection D of 19.15.27.9 NMAC, and shall file an update for each Natural Gas Management Plan until Operator is back in compliance with its baseline natural gas capture rate or natural gas capture requirement.
- 2. OCD may deny or conditionally approve an APD if Operator does not make a certification, fails to submit an adequate venting and flaring plan which includes alternative beneficial uses for the anticipated volume of natural gas produced, or if OCD determines that Operator will not have adequate natural gas takeaway capacity at the time a well will be spud.

I certify that, after reasonable inquiry, the statements in and attached to this Natural Gas Management Plan are true and correct to the best of my knowledge and acknowledge that a false statement may be subject to civil and criminal penalties under the Oil and Gas Act.

Signature:
Printed Name: Jeff Walla
Title: Surface Land and Regulatory Manager
E-mail Address:
Date:
Phone:
OIL CONSERVATION DIVISION
(Only applicable when submitted as a standalone form)
Approved By:
Title:
Approval Date:
Conditions of Approval:

DANGER NOODLE 29 CTB 1

Well Name	STR	N/S Footage	Call	E/W Footage	Call	Anticipated Oil BBL/D	Anticipated Gas MCF/D	Anticipated Produced Water BBL/D
DANGER NOODLE 29-20 FED COM 501H	29-23S-33E	253	FSL	351	FWL	(+/-) 1307bopd	(+/-)914mcfd	(+/-) 1960bwpd
DANGER NOODLE 29-20 FED COM 502H	29-23S-33E	298	FSL	2335	FWL	(+/-) 1307bopd	(+/-)914mcfd	(+/-) 1960bwpd
DANGER NOODLE 29-20 FED COM 801H	29-23S-33E	253	FSL	381	FWL	(+/-) 2049bopd	(+/-)3215mcfd	(+/-)4011bwpd
DANGER NOODLE 29-20 FED COM 802H	29-23S-33E	253	FSL	411	FWL	(+/-) 2049bopd	(+/-)3215mcfd	(+/-)4011bwpd
DANGER NOODLE 29-20 FED COM 803H	29-23S-33E	298	FSL	2305	FWL	(+/-) 2049bopd	(+/-)3215mcfd	(+/-)4011bwpd

Well Name	API	Spud Date	TD Reached Date	Completion Commencement Date	Initial Flow Back Date	First Production Date
DANGER NOODLE 29-20 FED COM 501H		12/11/2024	1/10/2025	5/10/2025	5/10/2025	5/10/2025
DANGER NOODLE 29-20 FED COM 502H		12/28/2024	1/27/2025	5/27/2025	5/27/2025	5/27/2025
DANGER NOODLE 29-20 FED COM 801H		11/13/2024	12/13/2024	4/12/2025	4/12/2025	4/12/2025
DANGER NOODLE 29-20 FED COM 802H		1/10/2025	2/9/2025	6/9/2025	6/9/2025	6/9/2025
DANGER NOODLE 29-20 FED COM 803H		12/12/2024	1/11/2025	5/11/2025	5/11/2025	5/11/2025



VI. Separation Equipment

Devon Energy Production Company, L.P. utilizes a "stage separation" process in which oil and gas separation is carried out through a series of separators operating at successively reduced pressures. Hydrocarbon liquids are produced into a high-pressure inlet separator, then carried through one or more lower pressure separation vessels before entering the storage tanks. The purpose of this separation process is to attain maximum recovery of liquid hydrocarbons from the fluids and allow maximum capture of produced gas into the sales pipeline. Devon utilizes a series of Low-Pressure Compression units to capture gas off the staged separation and send it to the sales pipeline. This process minimizes the amount of flash gas that enters the end-stage storage tanks that is subsequently vented or flared.



VII. Operational Practices

Devon Energy Production Company, L. P. will employ best management practices and control technologies to maximize the recovery and minimize waste of natural gas through venting and flaring.

- During drilling operations, Devon will utilize flares and/or combustors to capture and control
 natural gas, where technically feasible. If flaring is deemed technically in-feasible, Devon will
 employ best management practices to minimize or reduce venting to the extent possible.
- During completions operations, Devon will utilize Green Completion methods to capture gas
 produced during well completions that is otherwise vented or flared. If capture is technically
 in-feasible, flares and/or combustors will be used to capture and control flow back fluids
 entering into frac tanks during initial flowback. Upon indication of first measurable hydrocarbon
 volumes, Devon will turn operations to onsite separation vessels and flow to the gathering
 pipeline.
- During production operations, Devon will take every practical effort to minimize waste of natural gas through venting and flaring by:
 - Designing and constructing facilities in a manner consistent to achieve maximum capture and control of hydrocarbon liquids & produced gas
 - Utilizing a closed-loop capture system to collect and route produced gas to sales line via low pressure compression, or to a flare/combustor
 - o Flaring in lieu of venting, where technically feasible
 - Utilizing auto-ignitors or continuous pilots, with thermocouples connected to Scada, to quickly detect and resolve issues related to malfunctioning flares/combustors
 - Employ the use of automatic tank gauging to minimize storage tank venting during loading events
 - Installing air-driven or electric-driven pneumatics & combustion engines, where technically feasible to minimize venting to the atmosphere
 - Confirm equipment is properly maintained and repaired through a preventative maintenance and repair program to ensure equipment meets all manufacturer specifications
 - Conduct and document AVO inspections on the frequency set forth in Part 27 to detect and repair any onsite leaks as quickly and efficiently as is feasible



VIII. Best Management Practices during Maintenance

Devon Energy Production Company, L.P. will utilize best management practices to minimize venting during active and planned maintenance activities. Devon is operating under guidance that production facilities permitted under NOI permits have no provisions to allow high pressure flaring and high pressure flaring is only allowed in disruption scenarios so long as the duration is less than eight hours. When technically feasible, flaring during maintenance activities will be utilized in lieu of venting to the atmosphere. Devon will work with third-party operators during scheduled maintenance of downstream pipeline or processing plants to address those events ahead of time to minimize venting. Actions considered include identifying alternative capture approaches or planning to temporarily reduce production or shut in the well to address these circumstances.

1. Geologic Formations

TVD of target	13200	Pilot hole depth	N/A
MD at TD:	23380	Deepest expected fresh water	

Basin

Dasiii	D 41.	Water/Mineral	
	Depth	Water/Mineral	
Formation	(TVD)	Bearing/Target	Hazards*
	from KB	Zone?	
Rustler	1117		
Salt	1367		
Base of Salt	4543		
Delaware	4862		
Cherry Canyon	6228		
Brushy Canyon	7365		
Bone Spring 1st	8933		
Bone Spring 2nd	10355		
Bone Spring 3rd	11250		
Wolfcamp	12240		
_			
_			_

^{*}H2S, water flows, loss of circulation, abnormal pressures, etc.

2. Casing Program (Primary Design)

		Wt	Grade		Casing Interval		Casing Interval	
Hole Size	Csg. Size	(PPF)		Conn	From (MD)	To (MD)	From (TVD)	To (TVD)
14 3/4	10 3/4	45 1/2	J-55	ВТС	0	1142	0	1142
9 7/8	8 5/8	32	P110	Sprint FJ	0	12542	0	12542
7 7/8	5 1/2	17	P110	DWC / C-IS+	0	23380	0	13200

[•]All casing strings will be tested in accordance with 43 CFR 3172. Must have table for contingency casing.

3. Cementing Program (Primary Design)

Casing	# Sks	TOC	Wt. ppg	Yld (ft3/sack)	Slurry Description
Surface	688	Surf	13.2	1.44	Lead: Class C Cement + additives
Int 1	380	Surf	9	3.27	Lead: Class C Cement + additives
IIIt I	599	7365	13.2	1.44	Tail: Class H / C + additives
Int 1 Intermediate	864	Surf	13.2	1.44	Squeeze Lead: Class C Cement + additives
	380	Surf	9	3.27	Lead: Class C Cement + additives
Squeeze	599	7365	13.2	1.44	Tail: Class H / C + additives
Production	117	10643	9	3.27	Lead: Class H /C + additives
	1421	12643	13.2	1.44	Tail: Class H / C + additives

Assuming no returns are established while drilling, Devon requests to pump a two stage cement job on the intermediate casing string with the first stage being pumped conventionally with the calculated top of cement at the Brushy Canyon and the second stage performed as a bradenhead squeeze with planned cement from the Brushy Canyon to surface. The final cement top will be verified by Echo-meter. Devon will include the Echo-meter verified fluid top and the volume of displacement fluid above the cement slurry in the annulus in all post-drill sundries on wells utilizing this cement program. Devon will report to the BLM the volume of fluid (limited to 1 bbls) used to flush intermediate casing valves following backside cementing procedures.

Casing String	% Excess
Surface	50%
Intermediate 1	30%
Intermediate 1 (Two Stage)	25%
Prod	10%

4. Pressure Control Equipment (Three String Design)

BOP installed and tested before drilling which hole?	Size?	Min. Required WP	T	ype	✓	Tested to:																										
			Anı	nular	X	50% of rated working pressure																										
Int 1	13-5/8"	5M	Bline	d Ram	X																											
1111, 1	13-3/6	3101	Pipe	Ram		5M																										
			Doub	le Ram	X	J1V1																										
			Other*			1																										
	13-5/8"	101/1	Annul	ar (5M)	X	100% of rated working pressure																										
Production			Blind Ram		X																											
Floduction		13-3/6	13-3/6	13-3/6	13-3/6	10M	TOW	TOM	o TOWI	13-3/8 10101)/6 10WI	-3/6 101/1	5-5/6 10W	1011	10111	10101	10101	10101	10101	10101	10101	10101	10101	10101	10101	10111	10101	10101	Pipe	Ram		10M
			Doub	le Ram	X	TOIVI																										
			Other*																													
			Annul	ar (5M)																												
			Bline	d Ram																												
			Pipe Ram]																										
			Double Ram]																										
			Other*																													
N A variance is requested for	A variance is requested for the use of a diverter on the surface casing. See attached for schematic.																															
Y A variance is requested to a	A variance is requested to run a 5 M annular on a 10M system																															

5. Mud Program (Three String Design)

Section	Туре	Weight (ppg)
Surface	FW Gel	8.5-9
Intermediate	DBE / Cut Brine	10-10.5
Production	OBM	10-10.5

Sufficient mud materials to maintain mud properties and meet minimum lost circulation and weight increase requirements will be kept on location at all times.

What will be used to monitor the loss or gain of fluid?	PVT/Pason/Visual Monitoring

6. Logging and Testing Procedures

Logging, C	Logging, Coring and Testing					
	Will run GR/CNL from TD to surface (horizontal well - vertical portion of hole). Stated logs run will be in the					
X	Completion Report and sbumitted to the BLM.					
	No logs are planned based on well control or offset log information.					
	Drill stem test? If yes, explain.					
	Coring? If yes, explain.					

Additional logs planned		Interval		
	Resistivity	Int. shoe to KOP		
	Density	Int. shoe to KOP		
X	CBL	Production casing		
X	Mud log	Intermediate shoe to TD		
	PEX			

7. Drilling Conditions

Condition	Specfiy what type and where?
BH pressure at deepest TVD	7207
Abnormal temperature	No

Mitigation measure for abnormal conditions. Describe. Lost circulation material/sweeps/mud scavengers.

Hydrogren Sulfide (H2S) monitors will be installed prior to drilling out the surface shoe. If H2S is detected in concentrations greater than 100 ppm, the operator will comply with the provisions of 43 CFR 3176.. If Hydrogen Sulfide is encountered measured values and formations will be provided to the BLM.

meast	values and formations will be provided to the BLM.	
N	H2S is present	
Y	H2S plan attached.	

8. Other facets of operation

Is this a walking operation? Potentially

- 1 If operator elects, drilling rig will batch drill the surface holes and run/cement surface casing; walking the rig to next wells on the pad.
- 2 The drilling rig will then batch drill the intermediate sections and run/cement intermediate casing; the wellbore will be isolated with a blind flange and pressure gauge installed for monitoring the well before walking to the next well.
- 3 The drilling rig will then batch drill the production hole sections on the wells with OBM, run/cement production casing, and install TA caps or tubing heads for completions.

NOTE: During batch operations the drilling rig will be moved from well to well however, it will not be removed from the pad until all wells have production casing run/cemented.

Will be pre-setting casing? Potentially

- 1 Spudder rig will move in and batch drill surface hole.
 - a. Rig will utilize fresh water based mud to drill surface hole to TD. Solids control will be handled entirely on a closed loop basis.,
- 2 After drilling the surface hole section, the spudder rig will run casing and cement following all of the applicable rules and regulations (43 CFR 3172, all COAs and NMOCD regulations).
- 3 The wellhead will be installed and tested once the surface casing is cut off and the WOC time has been reached.
- 4 A blind flange with the same pressure rating as the wellhead will be installed to seal the wellbore. Pressure will be monitored with a pressure gauge installed on the wellhead.
- 5 Spudder rig operations is expected to take 4-5 days per well on a multi-well pa.
- 6 The NMOCD will be contacted and notified 24 hours prior to commencing spudder rig operations.
- 7 Drilling operations will be performed with drilling rig. A that time an approved BOP stack will be nippled up and tested on the wellhead before drilling operations commences on each well.
 - a. The NMOCD will be contacted / notified 24 hours before the drilling rig moves back on to the pad with the pre-set surface casing.

Attachme	nts
X	Directional Plan
	Other, describe



U.S. Department of the Interior BUREAU OF LAND MANAGEMENT

Drilling Plan Data Report

12/03/2024

APD ID: 10400095549 Submission Date: 10/31/2023

Operator Name: DEVON ENERGY PRODUCTION COMPANY LP

Well Name: DANGER NOODLE 29-20 FED COM Well Number: 801H

Well Type: OIL WELL Well Work Type: Drill Highlighted data reflects the most recent changes

Show Final Text

Section 1 - Geologic Formations

Formation ID	Formation Name	Elevation	True Vertical	Measured Depth	Lithologies	Mineral Resources	Producing Formatio
14548276		3683	0	Ö	OTHER : SURFACE	NONE	N
14548277	RUSTLER	2423	1260	1260	ANHYDRITE	NONE	N
14548278	SALADO	1928	1755	1755	SALT	NONE	N
14548279	BASE OF SALT	-1447	5130	5130	SANDSTONE	NATURAL GAS, OIL	N
14548280	CHERRY CANYON	-2417	6100	6100	SANDSTONE	NATURAL GAS, OIL	N
14548294	BRUSHY CANYON	-3622	7305	7305	SANDSTONE	NATURAL GAS, OIL	N
14548283	BONE SPRING LIME	-5287	8970	8970	LIMESTONE	NATURAL GAS, OIL	N
14548290	BONE SPRING 1ST	-6427	10110	10110	SANDSTONE	NATURAL GAS, OIL	N
14548291	BONE SPRING 2ND	-7002	10685	10685	SANDSTONE	NATURAL GAS, OIL	N
14548292	BONE SPRING 3RD	-8262	11945	11945	SANDSTONE	NATURAL GAS, OIL	N
14548293	WOLFCAMP	-8617	12300	12300	SANDSTONE	NATURAL GAS, OIL	Y

Section 2 - Blowout Prevention

Pressure Rating (PSI): 10M Rating Depth: 13200

Equipment: BOP/BOPE will be installed per 43 CFR 3172 requirements prior to drilling below intermediate 1 casing, a BOP/BOPE system with the above minimum rating will be installed on the wellhead system. BOP/BOPE will be tested by an independent service company per 43 CFR 3172 requirements and MASP (Maximum Anticipated Surface Pressure) calculations. If the system is upgraded, all the components installed will be functional and tested.

Requesting Variance? YES

Variance request: A variance is requested for the use of a flexible choke line from the BOP stack to the choke manifold. See attached for specs for hydrostatic test chart. Devon requests a variance to run a 5M annular on a 10M BOP system. See separately attached variance request and support documents in AFMSS.



Commitment Runs Deep



Design Plan
Operation and Maintenance Plan
Closure Plan

SENM - Closed Loop Systems June 2010

I. Design Plan

Devon uses MI SWACO closed loop system (CLS). The MI SWACO CLS is designed to maintain drill solids at or below 5%. The equipment is arranged to progressively remove solids from the largest to the smallest size. Drilling fluids can thus be reused and savings is realized on mud and disposal costs. Dewatering may be required with the centrifuges to insure removal of ultra fine solids.

The drilling location is constructed to allow storm water to flow to a central sump normally the cellar. This insures no contamination leaves the drilling pad in the event of a spill. Storm water is reused in the mud system or stored in a reserve fluid tank farm until it can be reused. All lubricants, oils, or chemicals are removed immediately from the ground to prevent the contamination of storm water. An oil trap is normally installed on the sump if an oil spill occurs during a storm.

A tank farm is utilized to store drilling fluids including fresh water and brine fluids. The tank farm is constructed on a 20 ml plastic lined, bermed pad to prevent the contamination of the drilling site during a spill. Fluids from other sites may be stored in these tanks for processing by the solids control equipment and reused in the mud system. At the end of the well the fluids are transported from the tank farm to an adjoining well or to the next well for the rig.


Prior to installing a closed-loop system on site, the topsoil, if present, will be stripped and stockpiled for use as the final cover or fill at the time of closure.

Signs will be posted on the fence surrounding the closed-loop system unless the closed-loop system is located on a site where there is an existing well, that is operated by Devon.

II. Operations and Maintenance Plan

Primary Shakers: The primary shakers make the first removal of drill solids from the drilling mud as it leaves the well bore. The shakers are sized to handle maximum drilling rate at optimal screen size. The shakers normally remove solids down to 74 microns.

Mud Cleaner: The Mud Cleaner cleans the fluid after it leaves the shakers. A set of hydrocyclones are sized to handle 1.25 to 1.5 times the maximum circulating rate. This ensures all the fluid is being processed to an average cut point of 25 microns. The wet discharged is dewatered on a shaker equipped with ultra fine mesh screens and generally cut at 40 microns.

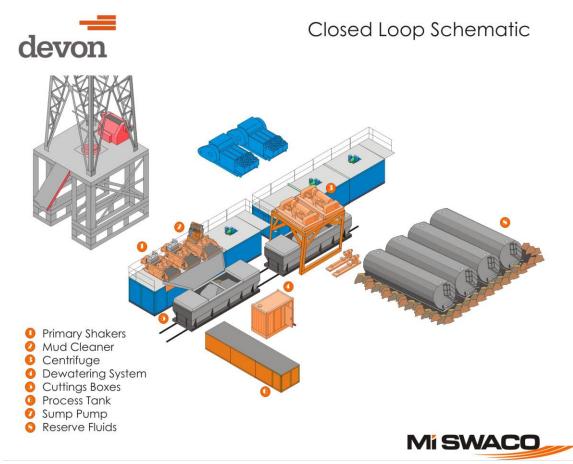

Centrifuges: The centrifuges can be one or two in number depending on the well geometry or depth of well. The centrifuges are sized to maintain low gravity solids at 5% or below. They may or may not need a dewatering system to enhance the removal rates. The centrifuges can make a cut point of 8-10 microns depending on bowl speed, feed rate, solids loading and other factors.

The centrifuge system is designed to work on the active system and be flexible to process incoming fluids from other locations. This set-up is also dependant on well factors.

Dewatering System: The dewatering system is a chemical mixing and dosing system designed to enhance the solids removal of the centrifuge. Not commonly used in shallow wells. It may contain pH adjustment, coagulant mixing and dosing, and polymer mixing and dosing. Chemical flocculation binds ultra fine solids into a mass that is within the centrifuge operating design. The

dewatering system improves the centrifuge cut point to infinity or allows for the return of clear water or brine fluid. This ability allows for the ultimate control of low gravity solids.

Cuttings Boxes: Cuttings boxes are utilized to capture drill solids that are discarded from the solids control equipment. These boxes are set upon a rail system that allows for the removal and replacement of a full box of cuttings with an empty one. They are equipped with a cover that insures no product is spilled into the environment during the transportation phase.

Process Tank: (Optional) The process tank allows for the holding and process of fluids that are being transferred into the mud system. Additionally, during times of lost circulation the process tank may hold active fluids that are removed for additional treatment. It can further be used as a mixing tank during well control conditions.

Sump and Sump Pump: The sump is used to collect storm water and the pump is used to transfer this fluid to the active system or to the tank for to hold in reserve. It can also be used to collect fluids that may escape during spills. The location contains drainage ditches that allow the location fluids to drain to the sump.

Reserve Fluids (Tank Farm): A series of frac tanks are used to replace the reserve pit. These are steel tanks that are equipped with a manifold system and a transfer pump. These tanks can contain any number of fluids used during the drilling process. These can include fresh water, cut brine, and saturated salt fluid. The fluid can be from the active well or reclaimed fluid from other locations. A 20 ml liner and berm system is employed to ensure the fluids do not migrate to the environment during a spill.

If a leak develops, the appropriate division district office will be notified within 48 hours of the discovery and the leak will be addressed. Spill prevention is accomplished by maintaining pump packing, hoses, and pipe fittings to insure no leaks are occurring. During an upset condition the source of the spill is isolated and repaired as soon as it is discovered. Free liquid is removed by a diaphragm pump and returned to the mud system. Loose topsoil may be used to stabilize the spill and the contaminated soil is excavated and placed in the cuttings boxes. After the well is finished and the rig has moved, the entire location is scrapped and testing will be performed to determine if a release has occurred.

All trash is kept in a wire mesh enclosure and removed to an approved landfill when full. All spent motor oils are kept in separate containers and they are removed and sent to an approved recycling center. Any spilled lubricants, pipe

dope, or regulated chemicals are removed from soil and sent to landfills approved for these products.

These operations are monitored by Mi Swaco service technicians. Daily logs are maintained to ensure optimal equipment operation and maintenance. Screen and chemical use is logged to maintain inventory control. Fluid properties are monitored and recorded and drilling mud volumes are accounted for in the mud storage farm. This data is kept for end of well review to insure performance goals are met. Lessons learned are logged and used to help with continuous improvement.

A MI SWACO field supervisor manages from 3-5 wells. They are responsible for training personnel, supervising installations, and inspecting sites for compliance of MI SWACO safety and operational policy.

III. Closure Plan

A maximum 340' X 340' caliche pad is built per well. All of the trucks and steel tanks fit on this pad. All fluid cuttings go to the steel tanks to be hauled by various trucking companies to an agency approved disposal.

Devon Energy APD VARIANCE DATA

OPERATOR NAME: Devon Energy


1. SUMMARY OF Variance:

Devon Energy respectfully requests approval for the following additions to the drilling plan:

1. Potential utilization of a spudder rig to pre-set surface casing.

2. Description of Operations

- 1. A spudder rig contractor may move in their rig to drill the surface hole section and pre-set surface casing on this well.
 - **a.** After drilling the surface hole section, the rig will run casing and cement following all of the applicable rules and regulations (OnShore Order 2, all COAs and NMOCD regulations).
 - **b.** Rig will utilize fresh water based mud to drill surface hole to TD.
- 2. The wellhead will be installed and tested once the surface casing is cut off and the WOC time has been reached.
- **3.** A blind flange with the same pressure rating as the wellhead will be installed to seal the wellbore. Pressure will be monitored with needle valves installed on two wingvalves.
 - **a.** A means for intervention will be maintained while the drilling rig is not over the well.
- **4.** The BLM will be contacted and notified 24 hours prior to commencing spudder rig operations.
- **5.** Drilling operation will be performed with the big rig. At that time an approved BOP stack will be nippled up and tested on the wellhead before drilling operations commences on each well.
 - **a.** The BLM will be contacted / notified 24 hours before the big rig moves back on to the pad with the pre-set surface casing.
- **6.** Devon Energy will have supervision on the rig to ensure compliance with all BLM and NMOCD regulations and to oversee operations.
- 7. Once the rig is removed, Devon Energy will secure the wellhead area by placing a guard rail around the cellar area.

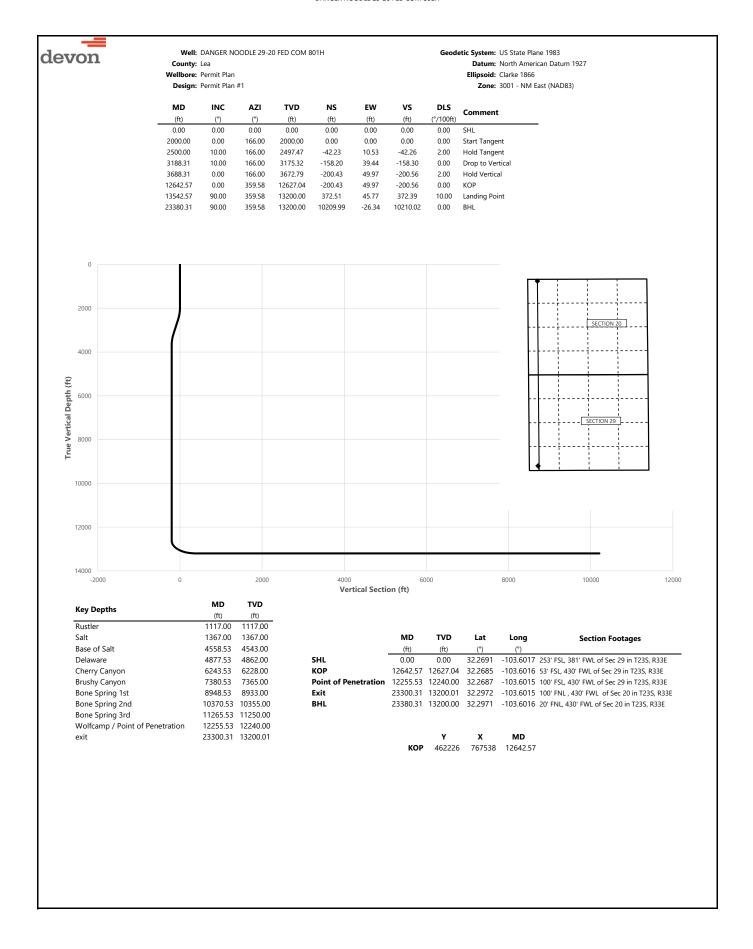



County: Lea
Wellbore: Permit Plan
Design: Permit Plan #1

Geodetic System: US State Plane 1983

Datum: North American Datum 1927 **Ellipsoid:** Clarke 1866

Zone: 3001 - NM Fact (NAD83)

	Design: Permit Plan #1						Zone: 3001 - NM East (NAD83)			
MD (ft)	INC (°)	AZI (°)	TVD (ft)	NS (ft)	EW (ft)	VS (ft)	DLS (°/100ft)	Comment		
0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	SHL		
100.00	0.00	166.00	100.00	0.00	0.00	0.00	0.00			
200.00	0.00	166.00	200.00	0.00	0.00	0.00	0.00			
300.00 400.00	0.00	166.00 166.00	300.00 400.00	0.00	0.00	0.00	0.00			
500.00	0.00	166.00	500.00	0.00	0.00	0.00	0.00			
600.00	0.00	166.00	600.00	0.00	0.00	0.00	0.00			
700.00	0.00	166.00	700.00	0.00	0.00	0.00	0.00			
800.00	0.00	166.00	800.00	0.00	0.00	0.00	0.00			
900.00	0.00	166.00	900.00	0.00	0.00	0.00	0.00			
1000.00	0.00	166.00	1000.00	0.00	0.00	0.00	0.00			
1100.00 1117.00	0.00	166.00 166.00	1100.00 1117.00	0.00	0.00	0.00	0.00	Rustler		
1200.00	0.00	166.00	1200.00	0.00	0.00	0.00	0.00	Naster .		
1300.00	0.00	166.00	1300.00	0.00	0.00	0.00	0.00			
1367.00	0.00	166.00	1367.00	0.00	0.00	0.00	0.00	Salt		
1400.00	0.00	166.00	1400.00	0.00	0.00	0.00	0.00			
1500.00 1600.00	0.00	166.00 166.00	1500.00 1600.00	0.00	0.00	0.00	0.00			
1700.00	0.00	166.00	1700.00	0.00	0.00	0.00	0.00			
1800.00	0.00	166.00	1800.00	0.00	0.00	0.00	0.00			
1900.00	0.00	166.00	1900.00	0.00	0.00	0.00	0.00			
2000.00	0.00	166.00	2000.00	0.00	0.00	0.00	0.00	Start Tangent		
2100.00 2200.00	2.00	166.00	2099.98	-1.69 -6.77	0.42 1.69	-1.69 -6.78	2.00			
2300.00	4.00 6.00	166.00 166.00	2199.84 2299.45	-6.77	3.80	-0.76	2.00 2.00			
2400.00	8.00	166.00	2398.70	-27.05	6.74	-27.07	2.00			
2500.00	10.00	166.00	2497.47	-42.23	10.53	-42.26	2.00	Hold Tangent		
2600.00	10.00	166.00	2595.95	-59.08	14.73	-59.12	0.00			
2700.00	10.00	166.00	2694.43	-75.93	18.93	-75.98	0.00			
2800.00 2900.00	10.00 10.00	166.00 166.00	2792.91 2891.39	-92.78 -109.63	23.13 27.33	-92.84 -109.70	0.00			
3000.00	10.00	166.00	2989.87	-126.47	31.53	-126.56	0.00			
3100.00	10.00	166.00	3088.35	-143.32	35.73	-143.42	0.00			
3188.31	10.00	166.00	3175.32	-158.20	39.44	-158.30	0.00	Drop to Vertical		
3200.00	9.77	166.00	3186.83	-160.15	39.93	-160.25	2.00			
3300.00 3400.00	7.77 5.77	166.00 166.00	3285.66 3384.96	-174.94 -186.37	43.62 46.47	-175.05 -186.49	2.00 2.00			
3500.00	3.77	166.00	3484.61	-194.43	48.48	-194.55	2.00			
3600.00	1.77	166.00	3584.49	-199.11	49.64	-199.24	2.00			
3688.31	0.00	166.00	3672.79	-200.43	49.97	-200.56	2.00	Hold Vertical		
3700.00	0.00	359.58	3684.47	-200.43	49.97	-200.56	0.00			
3800.00 3900.00	0.00	359.58 359.58	3784.47 3884.47	-200.43 -200.43	49.97 49.97	-200.56 -200.56	0.00			
4000.00	0.00	359.58	3984.47	-200.43	49.97	-200.56	0.00			
4100.00	0.00	359.58	4084.47	-200.43	49.97	-200.56	0.00			
4200.00	0.00	359.58	4184.47	-200.43	49.97	-200.56	0.00			
4300.00	0.00	359.58	4284.47	-200.43	49.97	-200.56	0.00			
4400.00 4500.00	0.00	359.58 359.58	4384.47 4484.47	-200.43 -200.43	49.97 49.97	-200.56 -200.56	0.00			
4558.53	0.00	359.58	4543.00	-200.43	49.97	-200.56	0.00	Base of Salt		
4600.00	0.00	359.58	4584.47	-200.43	49.97	-200.56	0.00			
4700.00	0.00	359.58	4684.47	-200.43	49.97	-200.56	0.00			
4800.00	0.00	359.58	4784.47	-200.43	49.97	-200.56	0.00			
4877.53 4900.00	0.00	359.58 359.58	4862.00 4884.47	-200.43 -200.43	49.97 49.97	-200.56 -200.56	0.00	Delaware		
5000.00	0.00	359.58	4984.47	-200.43	49.97	-200.56	0.00			
5100.00	0.00	359.58	5084.47	-200.43	49.97	-200.56	0.00			
5200.00	0.00	359.58	5184.47	-200.43	49.97	-200.56	0.00			
5300.00	0.00	359.58	5284.47	-200.43	49.97	-200.56	0.00			
5400.00 5500.00	0.00	359.58 359.58	5384.47 5484.47	-200.43 -200.43	49.97 49.97	-200.56 -200.56	0.00			
5600.00	0.00	359.58	5584.47	-200.43	49.97	-200.56	0.00			
5700.00	0.00	359.58	5684.47	-200.43	49.97	-200.56	0.00			
5800.00	0.00	359.58	5784.47	-200.43	49.97	-200.56	0.00			
5900.00	0.00	359.58	5884.47	-200.43	49.97	-200.56	0.00			
6000.00 6100.00	0.00	359.58 359.58	5984.47 6084.47	-200.43 -200.43	49.97 49.97	-200.56 -200.56	0.00			
6200.00	0.00	359.58	6184.47	-200.43	49.97	-200.56	0.00			
6243.53	0.00	359.58	6228.00	-200.43	49.97	-200.56	0.00	Cherry Canyon		



County: Lea Wellbore: Permit Plan Design: Permit Plan #1 Geodetic System: US State Plane 1983

Datum: North American Datum 1927 **Ellipsoid:** Clarke 1866

Zone: 3001 - NM East (NAD83)

		Permit Plan						
MD	INC	AZI	TVD	NS	EW	vs	DLS	Commont
(ft)	(°)	(°)	(ft)	(ft)	(ft)	(ft)	(°/100ft)	Comment
5300.00	0.00	359.58	6284.47	-200.43	49.97	-200.56	0.00	
6400.00	0.00	359.58	6384.47	-200.43	49.97	-200.56	0.00	
6500.00	0.00	359.58	6484.47	-200.43	49.97	-200.56	0.00	
6600.00	0.00	359.58	6584.47	-200.43	49.97	-200.56	0.00	
5700.00	0.00	359.58	6684.47	-200.43	49.97	-200.56	0.00	
5800.00	0.00	359.58	6784.47	-200.43	49.97	-200.56	0.00	
5900.00	0.00	359.58	6884.47	-200.43	49.97	-200.56	0.00	
7000.00	0.00	359.58	6984.47	-200.43	49.97	-200.56	0.00	
7100.00	0.00	359.58	7084.47	-200.43	49.97	-200.56	0.00	
7200.00	0.00	359.58	7184.47	-200.43	49.97	-200.56	0.00	
7300.00	0.00	359.58	7284.47	-200.43	49.97	-200.56	0.00	
7380.53	0.00	359.58	7365.00	-200.43	49.97	-200.56	0.00	Brushy Canyon
7400.00	0.00	359.58	7384.47	-200.43	49.97	-200.56	0.00	
7500.00	0.00	359.58	7484.47	-200.43	49.97	-200.56	0.00	
7600.00	0.00	359.58	7584.47	-200.43	49.97	-200.56	0.00	
7700.00	0.00	359.58	7684.47	-200.43	49.97	-200.56	0.00	
7800.00	0.00	359.58	7784.47	-200.43	49.97	-200.56	0.00	
900.00	0.00	359.58	7884.47	-200.43	49.97	-200.56	0.00	
000.00	0.00	359.58	7984.47	-200.43	49.97	-200.56	0.00	
3100.00	0.00	359.58	8084.47	-200.43	49.97	-200.56	0.00	
3200.00	0.00	359.58	8184.47	-200.43	49.97	-200.56	0.00	
300.00	0.00	359.58	8284.47	-200.43	49.97	-200.56	0.00	
3400.00	0.00	359.58	8384.47	-200.43	49.97	-200.56	0.00	
3500.00	0.00	359.58	8484.47	-200.43	49.97	-200.56	0.00	
3600.00	0.00	359.58	8584.47	-200.43	49.97	-200.56	0.00	
3700.00	0.00	359.58	8684.47	-200.43	49.97	-200.56	0.00	
3700.00	0.00	359.58	8784.47	-200.43	49.97	-200.56	0.00	
3900.00	0.00	359.58	8884.47	-200.43	49.97	-200.56	0.00	
3900.00 3948.53	0.00	359.58	8933.00	-200.43	49.97	-200.56		Rone Spring 1st
							0.00	Bone Spring 1st
9000.00	0.00	359.58	8984.47	-200.43	49.97	-200.56	0.00	
9100.00	0.00	359.58	9084.47	-200.43	49.97	-200.56	0.00	
200.00	0.00	359.58	9184.47	-200.43	49.97	-200.56	0.00	
9300.00	0.00	359.58	9284.47	-200.43	49.97	-200.56	0.00	
9400.00	0.00	359.58	9384.47	-200.43	49.97	-200.56	0.00	
9500.00	0.00	359.58	9484.47	-200.43	49.97	-200.56	0.00	
9600.00	0.00	359.58	9584.47	-200.43	49.97	-200.56	0.00	
9700.00	0.00	359.58	9684.47	-200.43	49.97	-200.56	0.00	
9800.00	0.00	359.58	9784.47	-200.43	49.97	-200.56	0.00	
9900.00	0.00	359.58	9884.47	-200.43	49.97	-200.56	0.00	
00.000	0.00	359.58	9984.47	-200.43	49.97	-200.56	0.00	
0100.00	0.00	359.58	10084.47	-200.43	49.97	-200.56	0.00	
0200.00	0.00	359.58	10184.47	-200.43	49.97	-200.56	0.00	
0300.00	0.00	359.58	10284.47	-200.43	49.97	-200.56	0.00	
0370.53	0.00	359.58	10355.00	-200.43	49.97	-200.56	0.00	Bone Spring 2nd
0400.00	0.00	359.58	10384.47	-200.43	49.97	-200.56	0.00	י ע יו
0500.00	0.00	359.58	10484.47	-200.43	49.97	-200.56	0.00	
0600.00	0.00	359.58	10584.47	-200.43	49.97	-200.56	0.00	
0700.00	0.00	359.58	10584.47	-200.43	49.97	-200.56	0.00	
0800.00	0.00	359.58	10784.47	-200.43	49.97	-200.56	0.00	
0900.00	0.00	359.58	10884.47	-200.43	49.97	-200.56	0.00	
1000.00	0.00	359.58	10984.47	-200.43	49.97	-200.56	0.00	
1100.00	0.00	359.58	11084.47	-200.43	49.97	-200.56	0.00	
1200.00	0.00	359.58	11184.47	-200.43	49.97	-200.56	0.00	Deve Code and
1265.53	0.00	359.58	11250.00	-200.43	49.97	-200.56	0.00	Bone Spring 3rd
1300.00	0.00	359.58	11284.47	-200.43	49.97	-200.56	0.00	
1400.00	0.00	359.58	11384.47	-200.43	49.97	-200.56	0.00	
1500.00	0.00	359.58	11484.47	-200.43	49.97	-200.56	0.00	
1600.00	0.00	359.58	11584.47	-200.43	49.97	-200.56	0.00	
1700.00	0.00	359.58	11684.47	-200.43	49.97	-200.56	0.00	
1800.00	0.00	359.58	11784.47	-200.43	49.97	-200.56	0.00	
1900.00	0.00	359.58	11884.47	-200.43	49.97	-200.56	0.00	
2000.00	0.00	359.58	11984.47	-200.43	49.97	-200.56	0.00	
12100.00	0.00	359.58	12084.47	-200.43	49.97	-200.56	0.00	
12200.00	0.00	359.58	12184.47	-200.43	49.97	-200.56	0.00	
12255.53	0.00	359.58	12240.00	-200.43	49.97	-200.56	0.00	Wolfcamp / Point of Penetration
12300.00	0.00	359.58	12284.47	-200.43	49.97	-200.56	0.00	
12400.00	0.00	359.58	12384.47	-200.43	49.97	-200.56	0.00	
12500.00	0.00	359.58	12484.47	-200.43	49.97	-200.56	0.00	
12600.00					49.97	-200.56	0.00	
120UU.UU	0.00	359.58	12584.47	-200.43				
12642.57	0.00	359.58	12627.04	-200.43	49.97	-200.56	0.00	KOP



County: Lea Wellbore: Permit Plan

Design: Permit Plan #1 Geodetic System: US State Plane 1983 Datum: North American Datum 1927

Ellipsoid: Clarke 1866

	Design:	Permit Plan	n #1				Zone: 3001 - NM East (NAD83)			
MD (ft)	INC	AZI (°)	TVD (ft)	NS (ft)	EW (ft)	VS (ft)	DLS (°/100ft)	Comment		
12700.00	(°) 5.74	359.58	12684.38	-197.56	49.95	-197.69	10.00			
12800.00	15.74	359.58	12782.50	-178.94	49.82	-179.07	10.00			
12900.00	25.74	359.58	12875.90	-143.57	49.56	-143.70	10.00			
13000.00	35.74	359.58	12961.74	-92.52	49.18	-92.64	10.00			
13100.00	45.74	359.58	13037.41	-27.33	48.70	-27.46	10.00			
13200.00	55.74	359.58	13100.60	50.00	48.14	49.87	10.00			
13300.00	65.74	359.58	13149.42	137.13	47.50	137.01	10.00			
13400.00	75.74	359.58	13182.35	231.41	46.81	231.29	10.00			
13500.00 13542.57	85.74 90.00	359.58 359.58	13198.42 13200.00	329.98 372.51	46.08 45.77	329.86 372.39	10.00 10.00	Landing Point		
13600.00	90.00	359.58	13200.00	429.94	45.35	429.82	0.00	Landing Form		
13700.00	90.00	359.58	13200.00	529.94	44.62	529.82	0.00			
13800.00	90.00	359.58	13200.00	629.93	43.89	629.82	0.00			
13900.00	90.00	359.58	13200.00	729.93	43.15	729.82	0.00			
14000.00	90.00	359.58	13200.00	829.93	42.42	829.82	0.00			
14100.00	90.00	359.58	13200.00	929.93	41.68	929.82	0.00			
14200.00	90.00	359.58	13200.00	1029.92	40.95	1029.81	0.00			
14300.00	90.00	359.58	13200.00	1129.92	40.22	1129.81	0.00			
14400.00	90.00	359.58	13200.00	1229.92	39.48	1229.81	0.00			
14500.00 14600.00	90.00 90.00	359.58 359.58	13200.00 13200.00	1329.92 1429.91	38.75 38.02	1329.81 1429.81	0.00			
14700.00	90.00	359.58	13200.00	1529.91	37.28	1529.81	0.00			
14800.00	90.00	359.58	13200.00	1629.91	36.55	1629.81	0.00			
14900.00	90.00	359.58	13200.00	1729.90	35.82	1729.81	0.00			
15000.00	90.00	359.58	13200.00	1829.90	35.08	1829.80	0.00			
15100.00	90.00	359.58	13200.00	1929.90	34.35	1929.80	0.00			
15200.00	90.00	359.58	13200.00	2029.90	33.62	2029.80	0.00			
15300.00	90.00	359.58	13200.00	2129.89	32.88	2129.80	0.00			
15400.00	90.00	359.58	13200.00	2229.89	32.15	2229.80	0.00			
15500.00 15600.00	90.00 90.00	359.58 359.58	13200.00 13200.00	2329.89 2429.89	31.41 30.68	2329.80 2429.80	0.00			
15700.00	90.00	359.58	13200.00	2529.88	29.95	2529.80	0.00			
15800.00	90.00	359.58	13200.00	2629.88	29.21	2629.80	0.00			
15900.00	90.00	359.58	13200.00	2729.88	28.48	2729.79	0.00			
16000.00	90.00	359.58	13200.00	2829.87	27.75	2829.79	0.00			
16100.00	90.00	359.58	13200.00	2929.87	27.01	2929.79	0.00			
16200.00	90.00	359.58	13200.00	3029.87	26.28	3029.79	0.00			
16300.00	90.00	359.58	13200.00	3129.87	25.55	3129.79	0.00			
16400.00	90.00	359.58	13200.00	3229.86	24.81	3229.79	0.00			
16500.00 16600.00	90.00 90.00	359.58	13200.00	3329.86	24.08	3329.79	0.00			
16700.00	90.00	359.58 359.58	13200.00 13200.00	3429.86 3529.86	23.35 22.61	3429.79 3529.79	0.00			
16800.00	90.00	359.58	13200.00	3629.85	21.88	3629.78	0.00			
16900.00	90.00	359.58	13200.00	3729.85	21.14	3729.78	0.00			
17000.00	90.00	359.58	13200.00	3829.85	20.41	3829.78	0.00			
17100.00	90.00	359.58	13200.00	3929.85	19.68	3929.78	0.00			
17200.00	90.00	359.58	13200.00	4029.84	18.94	4029.78	0.00			
17300.00	90.00	359.58	13200.00	4129.84	18.21	4129.78	0.00			
17400.00	90.00	359.58	13200.01	4229.84	17.48	4229.78	0.00			
17500.00 17600.00	90.00	359.58 359.58	13200.01 13200.01	4329.83	16.74 16.01	4329.78 4429.78	0.00			
17600.00	90.00 90.00	359.58 359.58	13200.01	4429.83 4529.83	16.01 15.28	4429.78 4529.77	0.00			
17700.00	90.00	359.58	13200.01	4629.83	14.54	4629.77	0.00			
17900.00	90.00	359.58	13200.01	4729.82	13.81	4729.77	0.00			
18000.00	90.00	359.58	13200.01	4829.82	13.08	4829.77	0.00			
18100.00	90.00	359.58	13200.01	4929.82	12.34	4929.77	0.00			
18200.00	90.00	359.58	13200.01	5029.82	11.61	5029.77	0.00			
18300.00	90.00	359.58	13200.01	5129.81	10.88	5129.77	0.00			
18400.00	90.00	359.58	13200.01	5229.81	10.14	5229.77	0.00			
18500.00	90.00	359.58	13200.01	5329.81	9.41	5329.77	0.00			
18600.00 18700.00	90.00 90.00	359.58 359.58	13200.01	5429.80 5529.80	8.67 7.94	5429.76 5529.76	0.00			
18800.00	90.00	359.58	13200.01 13200.01	5629.80	7.94 7.21	5629.76	0.00			
18900.00	90.00	359.58	13200.01	5729.80	6.47	5729.76	0.00			
19000.00	90.00	359.58	13200.01	5829.79	5.74	5829.76	0.00			
19100.00	90.00	359.58	13200.01	5929.79	5.01	5929.76	0.00			
19200.00	90.00	359.58	13200.01	6029.79	4.27	6029.76	0.00			
19300.00	90.00	359.58	13200.01	6129.79	3.54	6129.76	0.00			
19400.00	90.00	359.58	13200.01	6229.78	2.81	6229.76	0.00			
19500.00	90.00	359.58	13200.01	6329.78	2.07	6329.75	0.00			





County: Lea Wellbore: Permit Plan Design: Permit Plan #1 Geodetic System: US State Plane 1983


Datum: North American Datum 1927 **Ellipsoid:** Clarke 1866

Zone: 3001 - NM East (NAD83)

MD	INC	AZI	TVD	NS	EW	vs	DLS	Comment
(ft)	(°)	(°)	(ft)	(ft)	(ft)	(ft)	(°/100ft)	Comment
19600.00	90.00	359.58	13200.01	6429.78	1.34	6429.75	0.00	
19700.00	90.00	359.58	13200.01	6529.78	0.61	6529.75	0.00	
19800.00	90.00	359.58	13200.01	6629.77	-0.13	6629.75	0.00	
19900.00	90.00	359.58	13200.01	6729.77	-0.86	6729.75	0.00	
20000.00	90.00	359.58	13200.01	6829.77	-1.60	6829.75	0.00	
20100.00	90.00	359.58	13200.01	6929.76	-2.33	6929.75	0.00	
20200.00	90.00	359.58	13200.01	7029.76	-3.06	7029.75	0.00	
20300.00	90.00	359.58	13200.01	7129.76	-3.80	7129.75	0.00	
20400.00	90.00	359.58	13200.01	7229.76	-4.53	7229.74	0.00	
20500.00	90.00	359.58	13200.01	7329.75	-5.26	7329.74	0.00	
20600.00	90.00	359.58	13200.01	7429.75	-6.00	7429.74	0.00	
20700.00	90.00	359.58	13200.01	7529.75	-6.73	7529.74	0.00	
20800.00	90.00	359.58	13200.01	7629.75	-7.46	7629.74	0.00	
20900.00	90.00	359.58	13200.01	7729.74	-8.20	7729.74	0.00	
21000.00	90.00	359.58	13200.01	7829.74	-8.93	7829.74	0.00	
21100.00	90.00	359.58	13200.01	7929.74	-9.66	7929.74	0.00	
21200.00	90.00	359.58	13200.01	8029.73	-10.40	8029.74	0.00	
21300.00	90.00	359.58	13200.01	8129.73	-11.13	8129.73	0.00	
21400.00	90.00	359.58	13200.01	8229.73	-11.87	8229.73	0.00	
21500.00	90.00	359.58	13200.01	8329.73	-12.60	8329.73	0.00	
21600.00	90.00	359.58	13200.01	8429.72	-13.33	8429.73	0.00	
21700.00	90.00	359.58	13200.01	8529.72	-14.07	8529.73	0.00	
21800.00	90.00	359.58	13200.01	8629.72	-14.80	8629.73	0.00	
21900.00	90.00	359.58	13200.01	8729.72	-15.53	8729.73	0.00	
22000.00	90.00	359.58	13200.01	8829.71	-16.27	8829.73	0.00	
22100.00	90.00	359.58	13200.01	8929.71	-17.00	8929.72	0.00	
22200.00	90.00	359.58	13200.01	9029.71	-17.73	9029.72	0.00	
22300.00	90.00	359.58	13200.01	9129.71	-18.47	9129.72	0.00	
22400.00	90.00	359.58	13200.01	9229.70	-19.20	9229.72	0.00	
22500.00	90.00	359.58	13200.01	9329.70	-19.93	9329.72	0.00	
22600.00	90.00	359.58	13200.01	9429.70	-20.67	9429.72	0.00	
22700.00	90.00	359.58	13200.01	9529.69	-21.40	9529.72	0.00	
22800.00	90.00	359.58	13200.01	9629.69	-22.14	9629.72	0.00	
22900.00	90.00	359.58	13200.01	9729.69	-22.87	9729.72	0.00	
23000.00	90.00	359.58	13200.01	9829.69	-23.60	9829.71	0.00	
23100.00	90.00	359.58	13200.01	9929.68	-24.34	9929.71	0.00	
23200.00	90.00	359.58	13200.01	10029.68	-25.07	10029.71	0.00	
23300.00	90.00	359.58	13200.01	10129.68	-25.80	10129.71	0.00	
23300.31	90.00	359.58	13200.01	10129.99	-25.81	10130.02	0.00	exit
23380.31	90.00	359.58	13200.00	10209.99	-26.34	10210.02	0.00	BHL

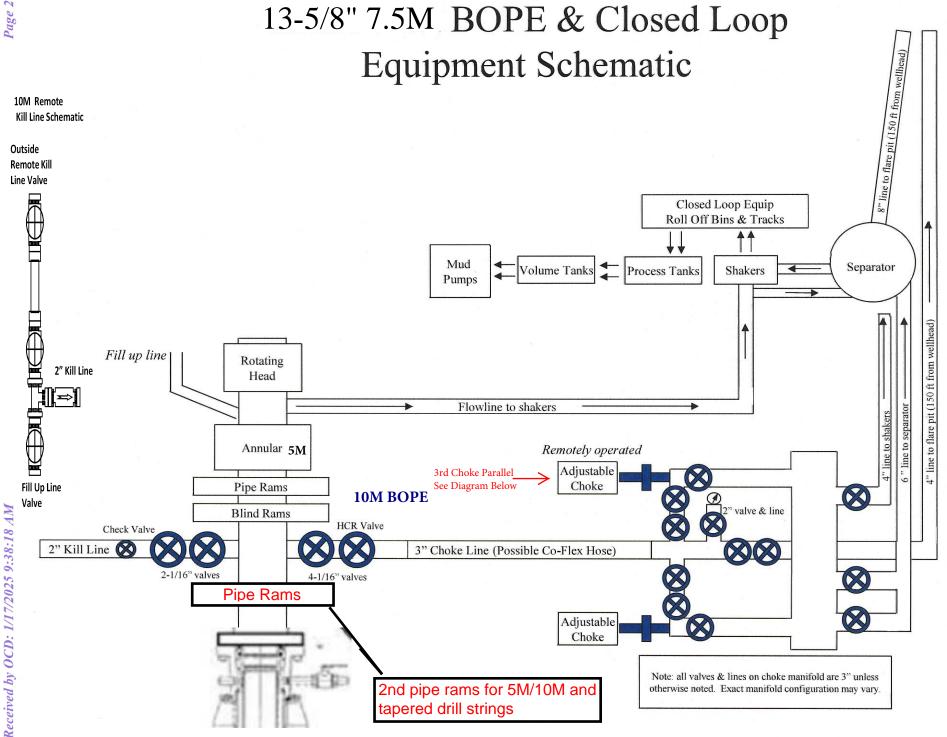

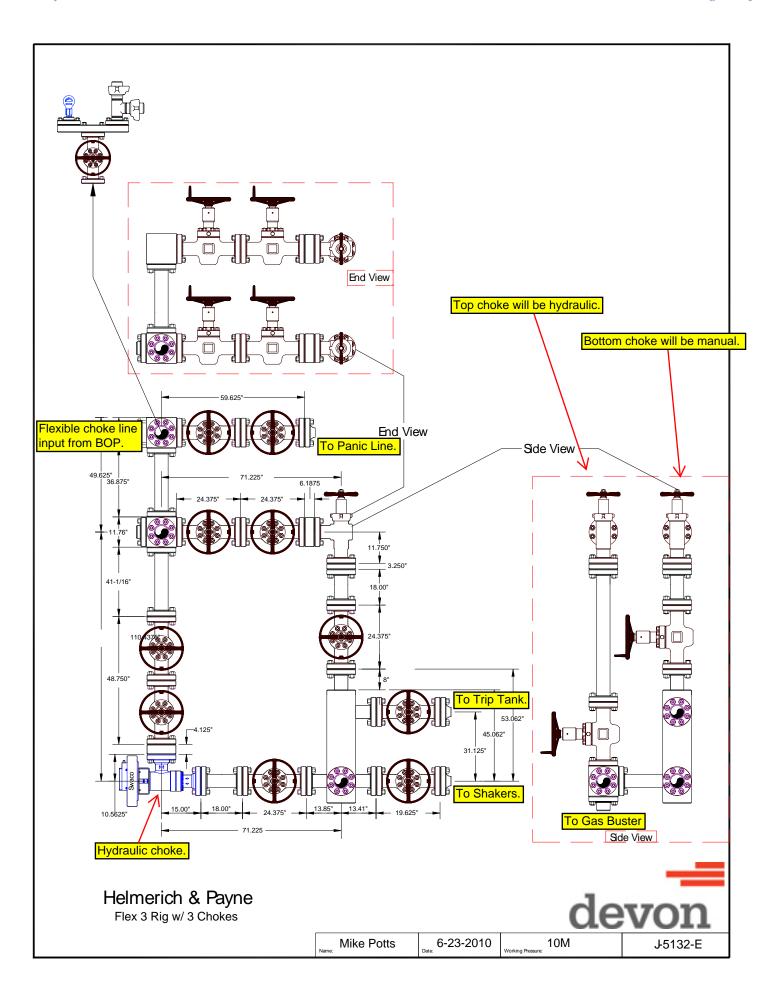

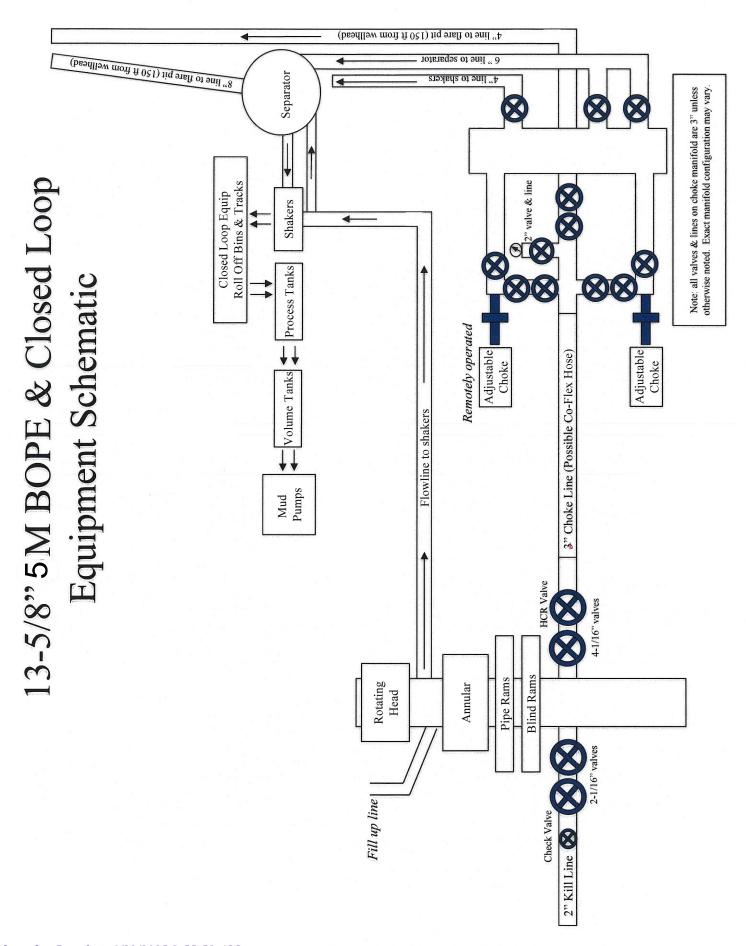

A multibowl wellhead may be used. The BOP will be tested per Onshore Order #2 after installation on the surface casing which will cover testing requirements for a maximum of 30 days. If any seal subject to test pressure is broken the system must be tested.

Devon proposes using a multi-bowl wellhead assembly. Minimum working pressure of the blowout preventer (BOP) and related equipment (BOPE) required for drilling below the surface casing shoe shall be 5000 (5M) psi.


- Wellhead will be installed by wellhead representatives.
- If the welding is performed by a third party, the wellhead representative will monitor the temperature to verify that it does not exceed the maximum temperature of the seal.
- Wellhead representative will install the test plug for the initial BOP test.
- Wellhead company will install a solid steel body pack-off to completely isolate the lower head after cementing intermediate casing. After installation of the pack-off, the pack-off and the lower flange will be tested to 5M, as shown on the attached schematic.
 Everything above the pack-off will not have been altered whatsoever from the initial nipple up. Therefore the BOP components will not be retested at that time.
- If the cement does not circulate and one inch operations would have been possible with a standard wellhead, the well head will be cut and top out operations will be conducted.
- Devon will pressure test all seals above and below the mandrel (but still above the casing) to full working pressure rating.
- Devon will test the casing to 0.22 psi/ft or 1500 psi, whichever is greater, as per Onshore Order #2.


After running the surface casing, a 13-5/8" BOP/BOPE system with a minimum rating of 5M will be installed on the wellhead system and will undergo a 250 psi low pressure test followed by a 5,000 psi high pressure test. The 5,000 psi high and 250 psi low test will cover testing requirements a maximum of 30 days, as per Onshore Order #2. If the well is not complete within 30 days of this BOP test, another full BOP test will be conducted, as per Onshore Order #2.


After running the intermediate casing with a mandrel hanger, the 13-5/8" BOP/BOPE system with a minimum rating of 10M will be installed and tested, with 5M annular being tested to 100% of rated working pressure.

The pipe rams will be operated and checked each 24 hour period and each time the drill pipe is out of the hole. These tests will be logged in the daily driller's log. A 2" kill line and 3" choke line will be incorporated into the drilling spool below the ram BOP. In addition to the rams and annular preventer, additional BOP accessories include a kelly cock, floor safety valve, choke lines, and choke manifold rated at 10,000 psi WP.

Devon's proposed wellhead manufactures will be FMC Technologies, Cactus Wellhead, or Cameron.

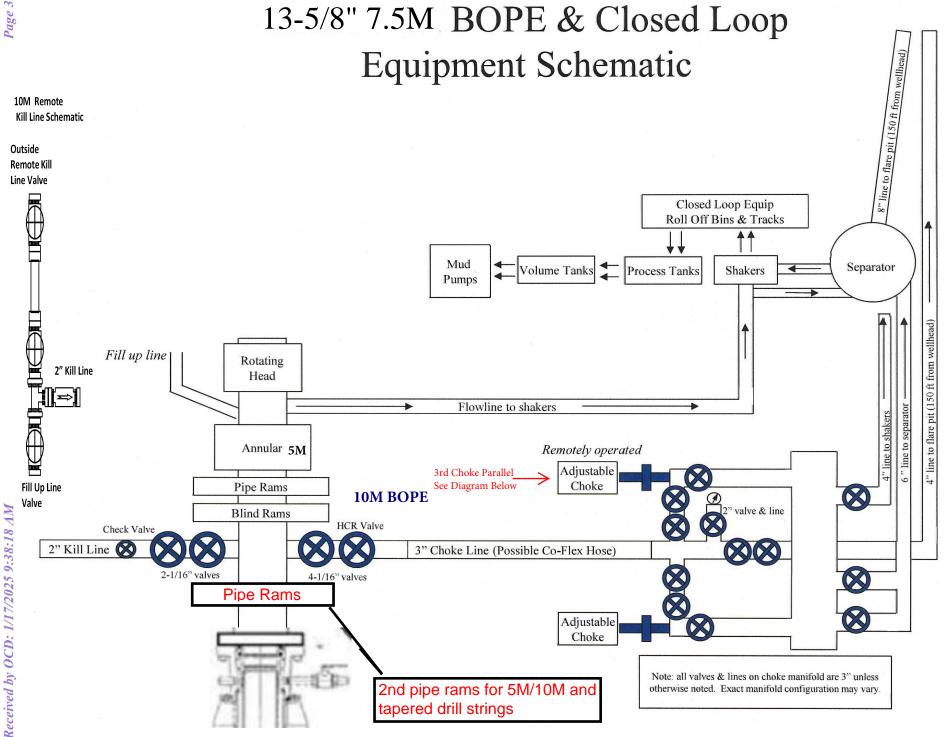

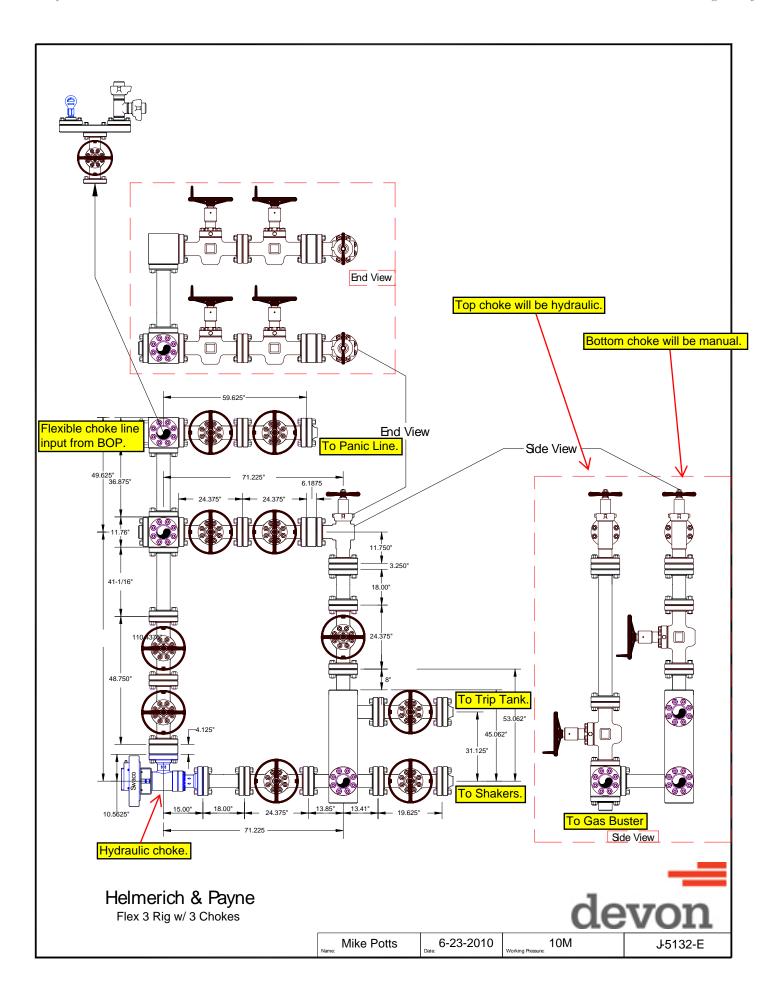

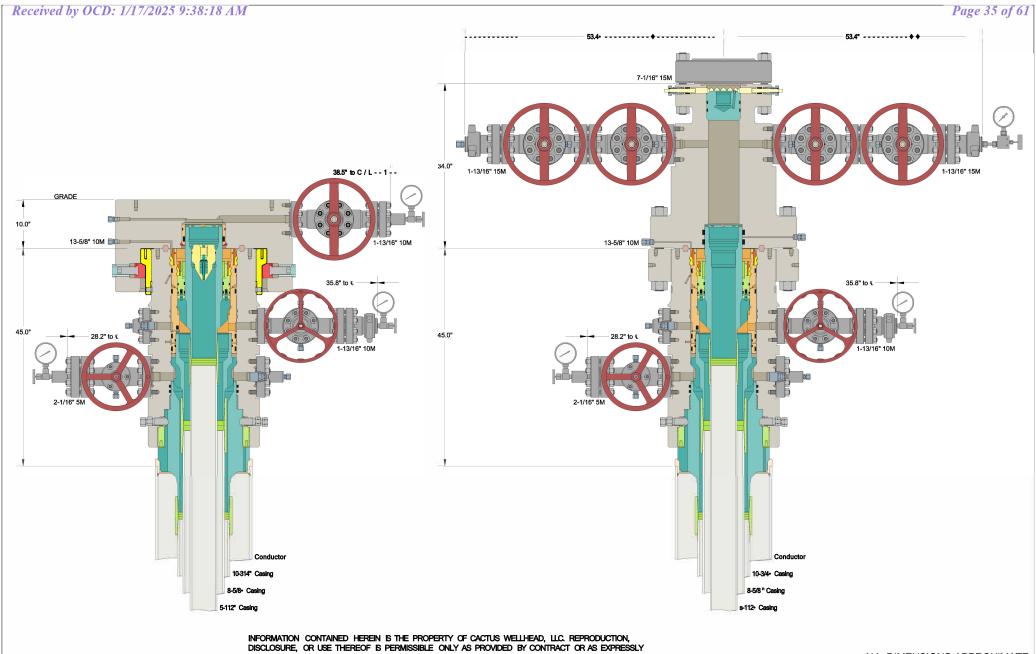

AUTHORIZED BY CACTUS WELLHEAD, LLC.

ALL DIMENSIONS APPROXIMATE

CACTUS WELLHEAD LLC **DEVON ENERGY CORPORATION** DELAWARE BASIN OLE 16SEP21 DRAWN 10-3/4" x 8-5/8" x 5-1/2" 10M MBU-3T-CFL-R-DBLO Wellhead Sys. APPRV With 8-5/8" And 5-1/2" Mandrel Casing Hangers HBE0000595 And 13-5/8" 10M x 7-1/16" 15M CTH-DBLHPS Tubing Head DRAWING NO. Released to Imaging: 1/23/2025 9:55:59 AM

Devon Energy Annular Preventer Summary

1. Component and Preventer Compatibility Table

The table below, which covers the drilling and casing of the 10M MASP portion of the well, outlines the tubulars and the compatible preventers in use. This table, combined with the mud program, documents that two barriers to flow can be maintained at all times, independent of the rating of the annular preventer.

Component	OD	Preventer	RWP
Drillpipe	4.5"	Fixed lower 4.5"	10M
		Upper 4.5-7" VBR	
HWDP	4.5"	Fixed lower 4.5"	10M
		Upper 4.5-7" VBR	
Drill collars and MWD tools	4.75"	Upper 4.5-7" VBR	10M
Mud Motor	4.75"	Upper 4.5-7" VBR	10M
Production casing	5.5"	Upper 4.5-7" VBR	10M
ALL	0-13-5/8"	Annular	5M
Open-hole	-	Blind Rams	10M

6-3/4" Production hole section, 10M requirement

VBR = Variable Bore Ram. Compatible range listed in chart.

2. Well Control Procedures

Well control procedures are specific to the rig equipment and the operation at the time the kick occurs. Below are the minimal high-level tasks prescribed to assure a proper shut-in while drilling, tripping, running casing, pipe out of the hole (open hole), and moving the BHA through the BOPs. The pressure at which control is swapped from the annular to another compatible ram is variable, but the operator will document in the submission their operating pressure limit. The operator may chose an operating pressure less than or equal to RWP, but in no case will it exceed the RWP of the annular preventer.

General Procedure While Drilling

- 1. Sound alarm (alert crew)
- 2. Space out drill string
- 3. Shut down pumps (stop pumps and rotary)
- 4. Shut-in Well (uppermost applicable BOP, typically annular preventer first. HCR and choke will already be in the closed position.)
- 5. Confirm shut-in
- 6. Notify toolpusher/company representative
- 7. Read and record the following:
 - a. SIDPP and SICP
 - b. Pit gain
 - c. Time
- 8. Regroup and identify forward plan
- 9. If pressure has built or is anticipated during the kill to reach the RWP of the annular preventer, confirm spacing and swap to the upper pipe ram.

Devon Energy Annular Preventer Summary

General Procedure While Tripping

- 1. Sound alarm (alert crew)
- 2. Stab full opening safety valve and close
- 3. Space out drill string
- 4. Shut-in (uppermost applicable BOP, typically annular preventer first. HCR and choke will already be in the closed position.)
- 5. Confirm shut-in
- 6. Notify toolpusher/company representative
- 7. Read and record the following:
 - a. SIDPP and SICP
 - b. Pit gain
 - c. Time
- 8. Regroup and identify forward plan
- 9. If pressure has built or is anticipated during the kill to reach the RWP of the annular preventer, confirm spacing and swap to the upper pipe ram.

General Procedure While Running Casing

- 1. Sound alarm (alert crew)
- 2. Stab crossover and full opening safety valve and close
- 3. Space out string
- 4. Shut-in (uppermost applicable BOP, typically annular preventer first. HCR and choke will already be in the closed position.)
- 5. Confirm shut-in
- 6. Notify toolpusher/company representative
- 7. Read and record the following:
 - a. SIDPP and SICP
 - b. Pit gain
 - c. Time
- 8. Regroup and identify forward plan
- 9. If pressure has built or is anticipated during the kill to reach the RWP of the annular preventer, confirm spacing and swap to compatible pipe ram.


General Procedure With No Pipe In Hole (Open Hole)

- 1. Sound alarm (alert crew)
- 2. Shut-in with blind rams or BSR. (HCR and choke will already be in the closed position.)
- 3. Confirm shut-in
- 4. Notify toolpusher/company representative
- 5. Read and record the following:
 - a. SICP
 - b. Pit gain
 - c. Time
- 6. Regroup and identify forward plan

Devon Energy Annular Preventer Summary

General Procedures While Pulling BHA thru Stack

- 1. PRIOR to pulling last joint of drillpipe thru the stack.
 - a. Perform flowcheck, if flowing:
 - b. Sound alarm (alert crew)
 - c. Stab full opening safety valve and close
 - d. Space out drill string with tool joint just beneath the upper pipe ram.
 - e. Shut-in using upper pipe ram. (HCR and choke will already be in the closed position.)
 - f. Confirm shut-in
 - g. Notify toolpusher/company representative
 - h. Read and record the following:
 - i. SIDPP and SICP
 - ii. Pit gain
 - iii. Time
 - i. Regroup and identify forward plan
- 2. With BHA in the stack and compatible ram preventer and pipe combo immediately available.
 - a. Sound alarm (alert crew)
 - b. Stab crossover and full opening safety valve and close
 - c. Space out drill string with upset just beneath the compatible pipe ram.
 - d. Shut-in using compatible pipe ram. (HCR and choke will already be in the closed position.)
 - e. Confirm shut-in
 - f. Notify toolpusher/company representative
 - g. Read and record the following:
 - i. SIDPP and SICP
 - ii. Pit gain
 - iii. Time
 - h. Regroup and identify forward plan
- 3. With BHA in the stack and NO compatible ram preventer and pipe combo immediately available.
 - a. Sound alarm (alert crew)
 - b. If possible to pick up high enough, pull string clear of the stack and follow "Open Hole" scenario.
 - c. If impossible to pick up high enough to pull the string clear of the stack:
 - d. Stab crossover, make up one joint/stand of drillpipe, and full opening safety valve and close
 - e. Space out drill string with tooljoint just beneath the upper pipe ram.
 - f. Shut-in using upper pipe ram. (HCR and choke will already be in the closed position.)
 - g. Confirm shut-in
 - h. Notify toolpusher/company representative
 - i. Read and record the following:
 - i. SIDPP and SICP
 - ii. Pit gain
 - iii. Time
 - i. Regroup and identify forward plan

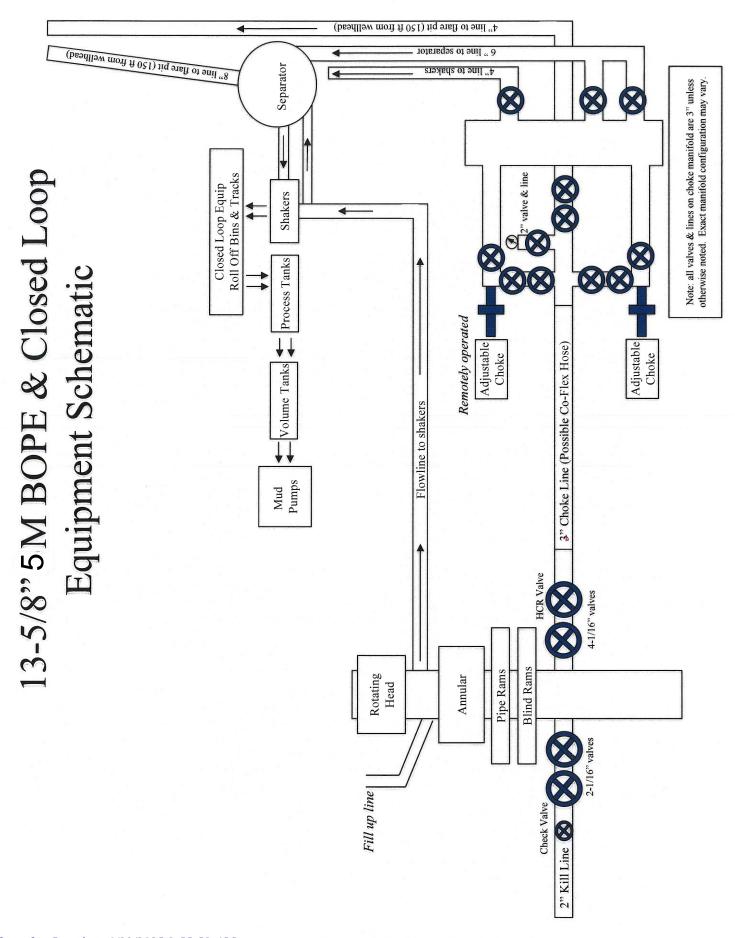

A multibowl wellhead may be used. The BOP will be tested per Onshore Order #2 after installation on the surface casing which will cover testing requirements for a maximum of 30 days. If any seal subject to test pressure is broken the system must be tested.

Devon proposes using a multi-bowl wellhead assembly. This assembly will only be tested when installed on the surface casing. Minimum working pressure of the blowout preventer (BOP) and related equipment (BOPE) required for drilling below the surface casing shoe shall be 5000 (5M) psi.


- Wellhead will be installed by wellhead representatives.
- If the welding is performed by a third party, the wellhead representative will monitor the temperature to verify that it does not exceed the maximum temperature of the seal.
- Wellhead representative will install the test plug for the initial BOP test.
- Wellhead company will install a solid steel body pack-off to completely isolate the lower head after cementing intermediate casing. After installation of the pack-off, the pack-off and the lower flange will be tested to 5M, as shown on the attached schematic.
 Everything above the pack-off will not have been altered whatsoever from the initial nipple up. Therefore the BOP components will not be retested at that time.
- If the cement does not circulate and one inch operations would have been possible with a standard wellhead, the well head will be cut and top out operations will be conducted.
- Devon will pressure test all seals above and below the mandrel (but still above the casing) to full working pressure rating.
- Devon will test the casing to 0.22 psi/ft or 1500 psi, whichever is greater, as per Onshore Order #2.

After running the surface casing, a 13-5/8" BOP/BOPE system with a minimum rating of 5M will be installed on the wellhead system and will undergo a 250 psi low pressure test followed by a 5,000 psi high pressure test. The 5,000 psi high and 250 psi low test will cover testing requirements a maximum of 30 days, as per Onshore Order #2. If the well is not complete within 30 days of this BOP test, another full BOP test will be conducted, as per Onshore Order #2.

After running the intermediate casing with a mandrel hanger, the 13-5/8" BOP/BOPE system with a minimum rating of 5M will already be installed on the wellhead.

The pipe rams will be operated and checked each 24 hour period and each time the drill pipe is out of the hole. These tests will be logged in the daily driller's log. A 2" kill line and 3" choke line will be incorporated into the drilling spool below the ram BOP. In addition to the rams and annular preventer, additional BOP accessories include a kelly cock, floor safety valve, choke lines, and choke manifold rated at 5,000 psi WP.

Devon's proposed wellhead manufactures will be FMC Technologies, Cactus Wellhead, or Cameron.

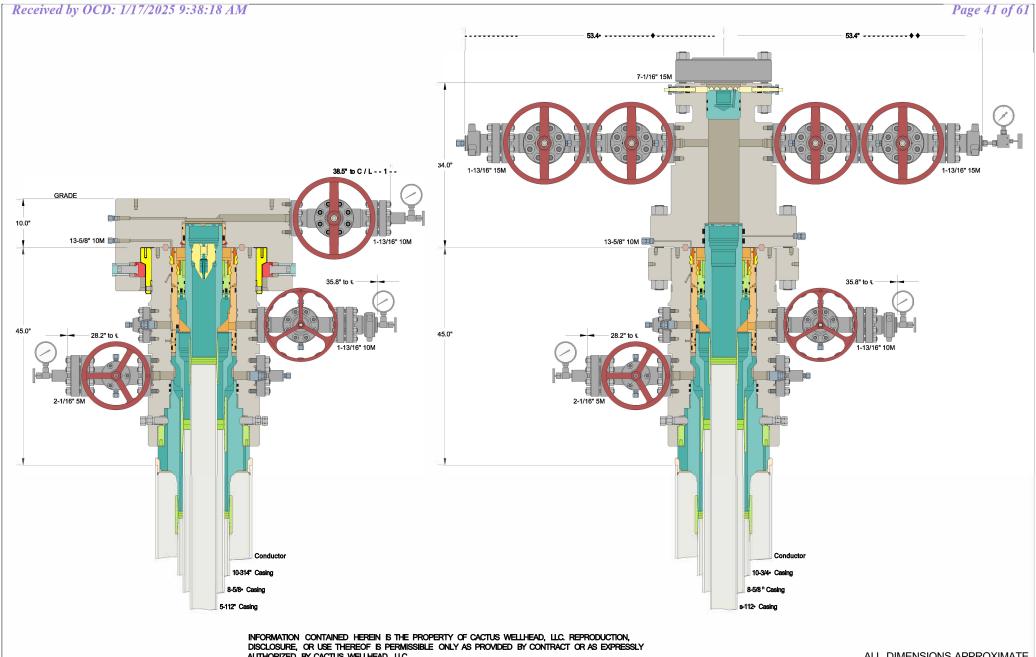

AUTHORIZED BY CACTUS WELLHEAD, LLC.

ALL DIMENSIONS APPROXIMATE

CACTUS WELLHEAD LLC **DEVON ENERGY CORPORATION** DELAWARE BASIN OLE 16SEP21 DRAWN 10-3/4" x 8-5/8" x 5-1/2" 10M MBU-3T-CFL-R-DBLO Wellhead Sys. APPRV With 8-5/8" And 5-1/2" Mandrel Casing Hangers HBE0000595 And 13-5/8" 10M x 7-1/16" 15M CTH-DBLHPS Tubing Head DRAWING NO. Released to Imaging: 1/23/2025 9:55:59 AM

PECOS DISTRICT DRILLING CONDITIONS OF APPROVAL

OPERATOR'S NAME: Devon Energy Production Company LP

LEASE NO.: | **NMNM107395**

LOCATION: Section 29, T.23 S., R.33 E., NMPM

COUNTY: Lea County, New Mexico

WELL NAME & NO.: Danger Noodle 29-20 Fed Com 501H

BOTTOM HOLE FOOTAGE | 20'/N & 380'/W

ATS/API ID: ATS-24-270 APD ID: 10400095545

Sundry ID: N/a

WELL NAME & NO.: Danger Noodle 29-20 Fed Com 502H

BOTTOM HOLE FOOTAGE | 20'/N & 2160'/W

ATS/API ID: ATS-24-271 APD ID: 10400095547

Sundry ID: N/a

WELL NAME & NO.: Danger Noodle 29-20 Fed Com 801H

BOTTOM HOLE FOOTAGE | 20'/N & 430'/W

ATS/API ID: ATS-24-272 APD ID: 10400095549

Sundry ID: N/a

WELL NAME & NO.: Danger Noodle 29-20 Fed Com 802H

BOTTOM HOLE FOOTAGE | 20'/N & 1245'/W

ATS/API ID: ATS-24-273 APD ID: 10400095556

Sundry ID: N/a

WELL NAME & NO.: Danger Noodle 29-20 Fed Com 803H

BOTTOM HOLE FOOTAGE | 20'/N & 2060'/W

ATS/API ID: ATS-24-274 APD ID: 10400095558

Sundry ID: N/a

COA

H2S	Yes		
Potash	Ochoa	None	
Cave/Karst Potential	Low		
Cave/Karst Potential	☐ Critical		
Variance	■ None	Flex Hose	Other
Wellhead	Conventional and Multibov	vl 🔽	
Other	□4 String	Capitan Reef None	□WIPP
Other	Pilot Hole None	□ Open Annulus	
Cementing	Contingency Squeeze None	Echo-Meter Int 1	Primary Cement Squeeze None
Special Requirements	☐ Water Disposal/Injection	✓ COM	□ Unit
Special Requirements	☐ Batch Sundry	Waste Prevention None	
Special Requirements Variance	☐ Break Testing	☐ Offline Cementing	☐ Casing Clearance

A. HYDROGEN SULFIDE

A Hydrogen Sulfide (H2S) Drilling Plan shall be activated 500 feet prior to drilling into the **Delaware** formation. As a result, the Hydrogen Sulfide area must meet **43 CFR part 3170 Subpart 3176** requirements, which includes equipment and personnel/public protection items. If Hydrogen Sulfide is encountered, please provide measured values and formations to the BLM.

B. CASING

- 1. The 10-3/4 inch surface casing shall be set at approximately 1370 feet (a minimum of 25 feet (Lea County) into the Rustler Anhydrite and above the salt when present, and below usable fresh water) and cemented to the surface. The surface hole shall be 14 3/4 inch in diameter.
 - a. If cement does not circulate to the surface, the appropriate BLM office shall be notified and a temperature survey utilizing an electronic type temperature survey with surface log readout will be used or a cement bond log shall be run to verify the top of the cement. Temperature survey will be run a minimum of six hours after pumping cement and ideally between 8-10 hours after completing the cement job.
 - b. Wait on cement (WOC) time for a primary cement job will be a minimum of **8** hours or 500 pounds compressive strength, whichever is greater. (This is to include the lead cement)
 - c. Wait on cement (WOC) time for a remedial job will be a minimum of 4 hours after bringing cement to surface or 500 pounds compressive strength, whichever is greater.
 - d. If cement falls back, remedial cementing will be done prior to drilling out that string.

Intermediate casing must be kept fluid filled to meet BLM minimum collapse requirement.

2. The minimum required fill of cement behind the 8-5/8 inch intermediate casing is:

Option 1 (Single Stage):

• Cement to surface. If cement does not circulate see B.1.a, c-d above. Wait on cement (WOC) time for a primary cement job is to include the lead cement slurry due to cave/karst or potash.

Option 2:

Operator has proposed to cement in two stages by conventionally cementing the first stage and performing a bradenhead squeeze on the second stage, contingent upon no returns to surface.

- a. First stage: Operator will cement with intent to reach the top of the Brushy Canyon at 7365'.
- b. Second stage:
 - Operator will perform bradenhead squeeze and top-out. Cement to surface. If cement does not reach surface, the appropriate BLM office shall be notified. (Squeeze 824 sxs Class C) Wait on cement (WOC) time for a primary cement job is to include the lead cement slurry due to cave/karst or potash.

Operator has proposed to pump down 10-3/4" X 8-5/8" annulus after primary cementing stage. Operator must run Echo-meter to verify Cement Slurry/Fluid top in the annulus Or operator shall run a CBL from TD of the 8-5/8" casing to surface after the second stage BH to verify TOC.

Submit results to the BLM. No displacement fluid/wash out shall be utilized at the top of the cement slurry between second stage BH and top out. Operator must run one CBL per Well Pad. Operator may conduct a negative and positive pressure test during completion to remediate sustained casing pressure.

If cement does not reach surface, the next casing string must come to surface.

Operator must use a limited flush fluid volume of 1 bbl following backside cementing procedures.

- ❖ In Ochoa Potash Areas if cement does not circulate to surface on the first two casing strings, the cement on the 3rd casing string must come to surface.
- 3. The minimum required fill of cement behind the 5-1/2 inch production casing is:
 - Cement should tie-back at least **500 feet** into the previous casing string. Operator shall provide method of verification. Wait on cement (WOC) time for a primary cement job is to include the lead cement slurry due to cave/karst or potash. Cement excess is less than 25%, more cement is required if washout occurs. Adjust cement volume and excess based on a fluid caliper or similar method that reflects the as-drilled size of the wellbore.

C. PRESSURE CONTROL

1. Variance approved to use flex line from BOP to choke manifold. Manufacturer's specification to be readily available. No external damage to flex line. Flex line to be installed as straight as possible (no hard bends).'

2.

Option 1:

- a. Minimum working pressure of the blowout preventer (BOP) and related equipment (BOPE) required for drilling below the surface casing shoe shall be **5000 (5M)** psi.
- b. Minimum working pressure of the blowout preventer (BOP) and related equipment (BOPE) required for drilling below the 8-5/8 inch intermediate casing shoe shall be 5000 (5M) psi.

Option 2:

Operator has proposed a multi-bowl wellhead assembly. This assembly will only be tested when installed on the 10-3/4 inch surface casing. Minimum working pressure of the blowout preventer (BOP) and related equipment (BOPE) required for drilling below the surface casing shoe shall be 5000 (5M) psi.

- a. Wellhead shall be installed by manufacturer's representatives, submit documentation with subsequent sundry.
- b. If the welding is performed by a third party, the manufacturer's representative shall monitor the temperature to verify that it does not exceed the maximum temperature of the seal.
- c. Manufacturer representative shall install the test plug for the initial BOP test.
- d. If the cement does not circulate and one inch operations would have been possible with a standard wellhead, the well head shall be cut off, cementing operations performed and another wellhead installed.
- e. Whenever any seal subject to test pressure is broken, all the tests in 43 CFR 3172.6(b)(9) must be followed.

D. SPECIAL REQUIREMENT (S)

Communitization Agreement

- The operator will submit a Communitization Agreement to the Santa Fe Office, 301 Dinosaur Trail Santa Fe, New Mexico 87508, at least 90 days before the anticipated date of first production from a well subject to a spacing order issued by the New Mexico Oil Conservation Division. The Communitization Agreement will include the signatures of all working interest owners in all Federal and Indian leases subject to the Communitization Agreement (i.e., operating rights owners and lessees of record), or certification that the operator has obtained the written signatures of all such owners and will make those signatures available to the BLM immediately upon request.
- The operator will submit an as-drilled survey well plat of the well completion, but are not limited to, those specified in 43 CFR part 3170 Subpart 3171

- If the operator does not comply with this condition of approval, the BLM may take enforcement actions that include, but are not limited to, those specified in 43 CFR 3163.1.
- In addition, the well sign shall include the surface and bottom hole lease numbers. When the Communitization Agreement number is known, it shall also be on the sign.

GENERAL REQUIREMENTS

The BLM is to be notified in advance for a representative to witness:

- a. Spudding well (minimum of 24 hours)
- b. Setting and/or Cementing of all casing strings (minimum of 4 hours)
- c. BOPE tests (minimum of 4 hours)

✓ Lea County
Call the Hobbs Field Station, 414 West Taylor, Hobbs NM 88240, (575) 689-5981

- 1. Unless the production casing has been run and cemented or the well has been properly plugged, the drilling rig shall not be removed from over the hole without prior approval.
 - a. In the event the operator has proposed to drill multiple wells utilizing a skid/walking rig. Operator shall secure the wellbore on the current well, after installing and testing the wellhead, by installing a blind flange of like pressure rating to the wellhead and a pressure gauge that can be monitored while drilling is performed on the other well(s).
 - b. When the operator proposes to set surface casing with Spudder Rig
 - Notify the BLM when moving in and removing the Spudder Rig.
 - Notify the BLM when moving in the 2nd Rig. Rig to be moved in within 90 days of notification that Spudder Rig has left the location.
 - BOP/BOPE test to be conducted per **43** CFR part **3170** Subpart **3172** as soon as 2nd Rig is rigged up on well.
- 2. Floor controls are required for 3M or Greater systems. These controls will be on the rig floor, unobstructed, readily accessible to the driller and will be operational at all times during drilling and/or completion activities. Rig floor is defined as the area immediately around the rotary table; the area immediately above the substructure on which the draw works are located, this does not include the dog house or stairway area.

A. CASING

1. Changes to the approved APD casing program need prior approval if the items substituted are of lesser grade or different casing size or are Non-API. The Operator can exchange the components of the proposal with that of superior strength (i.e. changing from J-55 to N-80, or from 36# to 40#). Changes to the approved cement program need prior approval if the altered cement plan has less volume or strength or if the changes are substantial (i.e. Multistage tool, ECP, etc.). The initial wellhead installed on the well will remain on the well with spools used as needed.

- 2. Wait on cement (WOC) for Potash Areas: After cementing but before commencing any tests, the casing string shall stand cemented under pressure until both of the following conditions have been met: 1) cement reaches a minimum compressive strength of 500 psi for all cement blends of both lead and tail cement, 2) until cement has been in place at least 8 hours. WOC time will be recorded in the driller's log. The casing integrity test can be done (prior to the cement setting up) immediately after bumping the plug.
- 3. Wait on cement (WOC) for Water Basin: After cementing but before commencing any tests, the casing string shall stand cemented under pressure until both of the following conditions have been met: 1) cement reaches a minimum compressive strength of 500 psi at the shoe, 2) until cement has been in place at least 8 hours. WOC time will be recorded in the driller's log. See individual casing strings for details regarding lead cement slurry requirements. The casing integrity test can be done (prior to the cement setting up) immediately after bumping the plug.
- 4. Provide compressive strengths including hours to reach required 500 pounds compressive strength prior to cementing each casing string. Have well specific cement details onsite prior to pumping the cement for each casing string.
- 5. No pea gravel permitted for remedial or fall back remedial without prior authorization from the BLM engineer.
- 6. On that portion of any well approved for a 5M BOPE system or greater, a pressure integrity test of each casing shoe shall be performed. Formation at the shoe shall be tested to a minimum of the mud weight equivalent anticipated to control the formation pressure to the next casing depth or at total depth of the well. This test shall be performed before drilling more than 20 feet of new hole.
- 7. If hardband drill pipe is rotated inside casing, returns will be monitored for metal. If metal is found in samples, drill pipe will be pulled and rubber protectors which have a larger diameter than the tool joints of the drill pipe will be installed prior to continuing drilling operations.
- 8. Whenever a casing string is cemented in the R-111-P potash area, the NMOCD requirements shall be followed.
- B. PRESSURE CONTROL
- 1. All blowout preventer (BOP) and related equipment (BOPE) shall comply with well control requirements as described in 43 CFR part 3170 Subpart 3172 and API STD 53 Sec. 5.3.
- 2. If a variance is approved for a flexible hose to be installed from the BOP to the choke manifold, the following requirements apply: The flex line must meet the requirements of API 16C. Check condition of flexible line from BOP to choke

manifold, replace if exterior is damaged or if line fails test. Line to be as straight as possible with no hard bends and is to be anchored according to Manufacturer's requirements. The flexible hose can be exchanged with a hose of equal size and equal or greater pressure rating. Anchor requirements, specification sheet and hydrostatic pressure test certification matching the hose in service, to be onsite for review. These documents shall be posted in the company man's trailer and on the rig floor.

- 3. 5M or higher system requires an HCR valve, remote kill line and annular to match. The remote kill line is to be installed prior to testing the system and tested to stack pressure.
- 4. If the operator has proposed a multi-bowl wellhead assembly in the APD. The following requirements must be met:
 - a. Wellhead shall be installed by manufacturer's representatives, submit documentation with subsequent sundry.
 - b. If the welding is performed by a third party, the manufacturer's representative shall monitor the temperature to verify that it does not exceed the maximum temperature of the seal.
 - c. Manufacturer representative shall install the test plug for the initial BOP test.
 - d. Whenever any seal subject to test pressure is broken, all the tests in 43 CFR 3172.6(b)(9) must be followed.
 - e. If the cement does not circulate and one inch operations would have been possible with a standard wellhead, the well head shall be cut off, cementing operations performed and another wellhead installed.
- 5. The appropriate BLM office shall be notified a minimum of 4 hours in advance for a representative to witness the tests.
 - a. In a water basin, for all casing strings utilizing slips, these are to be set as soon as the crew and rig are ready and any fallback cement remediation has been done. The casing cut-off and BOP installation can be initiated four hours after installing the slips, which will be approximately six hours after bumping the plug. For those casing strings not using slips, the minimum wait time before cut-off is eight hours after bumping the plug. BOP/BOPE testing can begin after cut-off or once cement reaches 500 psi compressive strength (including lead cement), whichever is greater. However, if the float does not hold, cut-off cannot be initiated until cement reaches 500 psi compressive strength (including lead when specified).
 - b. In potash areas, for all casing strings utilizing slips, these are to be set as soon as the crew and rig are ready and any fallback cement remediation has been done. For all casing strings, casing cut-off and BOP installation can be initiated at twelve hours after bumping the cement plug. The BOPE test can be

- initiated after bumping the cement plug with the casing valve open. (only applies to single stage cement jobs, prior to the cement setting up.)
- c. The tests shall be done by an independent service company utilizing a test plug not a cup or J-packer and can be initiated immediately with the casing valve open. The operator also has the option of utilizing an independent tester to test without a plug (i.e. against the casing) pursuant to 43 CFR part 3170 Subpart 3172 with the pressure not to exceed 70% of the burst rating for the casing. Any test against the casing must meet the WOC time for 8 hours or 500 pounds compressive strength, whichever is greater, prior to initiating the test (see casing segment as lead cement may be critical item).
- d. The test shall be run on a 5000 psi chart for a 2-3M BOP/BOP, on a 10000 psi chart for a 5M BOP/BOPE and on a 15000 psi chart for a 10M BOP/BOPE. If a linear chart is used, it shall be a one hour chart. A circular chart shall have a maximum 2 hour clock. If a twelve hour or twenty-four hour chart is used, tester shall make a notation that it is run with a two hour clock.
- e. The results of the test shall be reported to the appropriate BLM office.
- f. All tests are required to be recorded on a calibrated test chart. A copy of the BOP/BOPE test chart and a copy of independent service company test will be submitted to the appropriate BLM office.
- g. The BOP/BOPE test shall include a low pressure test from 250 to 300 psi. The test will be held for a minimum of 10 minutes if test is done with a test plug and 30 minutes without a test plug. This test shall be performed prior to the test at full stack pressure.
- h. BOP/BOPE must be tested by an independent service company within 500 feet of the top of the Wolfcamp formation if the time between the setting of the intermediate casing and reaching this depth exceeds 20 days. This test does not exclude the test prior to drilling out the casing shoe as per 43 CFR part 3170 Subpart 3172.

C. DRILLING MUD

Mud system monitoring equipment, with derrick floor indicators and visual and audio alarms, shall be operating before drilling into the Wolfcamp formation, and shall be used until production casing is run and cemented.

D. WASTE MATERIAL AND FLUIDS

All waste (i.e. drilling fluids, trash, salts, chemicals, sewage, gray water, etc.) created as a result of drilling operations and completion operations shall be safely contained and

disposed of properly at a waste disposal facility. No waste material or fluid shall be disposed of on the well location or surrounding area.

Porto-johns and trash containers will be on-location during fracturing operations or any other crew-intensive operations.

Long Vo (LVO) 8/22/2024



Devon Energy Center 333 West Sheridan Avenue Oklahoma City, Oklahoma 73102-5015

Hydrogen Sulfide (H₂S) Contingency Plan

For


Danger Noodle 29-20 Fed Com 801H


Sec-29 T-23S R-33E 253' FSL & 381' FWL LAT. = 32.269165° N (NAD83) LONG = 103.601650° W

Lea County NM

Danger Noodle 29-20 Fed Com 801H

This is an open drilling site. H_2S monitoring equipment and emergency response equipment will be used within 500' of zones known to contain H_2S , including warning signs, wind indicators and H_2S monitor.

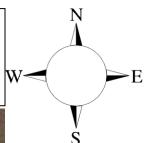

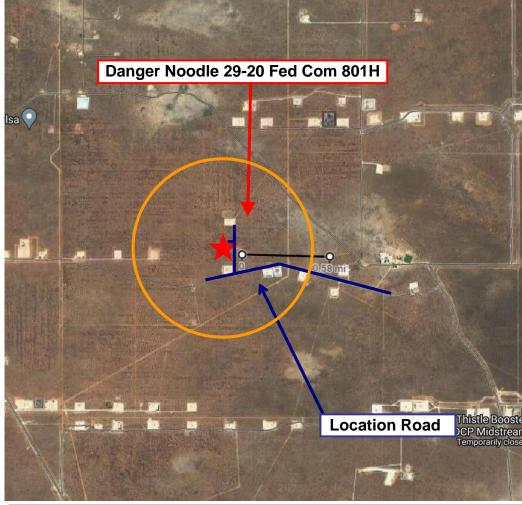

Assumed 100 ppm ROE = 3000' (Radius of Exposure)
100 ppm H2S concentration shall trigger activation of this plan.

Escape

Crews shall escape upwind of escaping gas in the event of an emergency release of gas. Escape can be facilitated from the location entrance road. Crews should then block the entrance to the location from the lease road so as not to allow anyone traversing into a hazardous area. The blockade should be at a safe distance outside of the ROE. There are no homes or buildings in or near the ROE.

Assumed 100 ppm ROE = 3000'

100 ppm H₂S concentration shall trigger activation of this plan.

Emergency Procedures

In the event of a release of gas containing H₂S, the first responder(s) must

- Isolate the area and prevent entry by other persons into the 100 ppm ROE.
- Evacuate any public places encompassed by the 100 ppm ROE.
- Be equipped with H₂S monitors and air packs in order to control the release.
- Use the "buddy system" to ensure no injuries occur during the response
- Take precautions to avoid personal injury during this operation.
- Contact operator and/or local officials to aid in operation. See list of phone numbers attached.
- Have received training in the
 - o Detection of H₂S, and
 - Measures for protection against the gas,
 - Equipment used for protection and emergency response.

Ignition of Gas Source

Should control of the well be considered lost and ignition considered, take care to protect against exposure to Sulfur Dioxide (SO₂). Intentional ignition must be coordinated with the NMOCD and local officials. Additionally the NM State Police may become involved. NM State Police shall be the Incident Command on scene of any major release. Take care to protect downwind whenever there is an ignition of the gas

Characteristics of H₂S and SO₂

Common	Chemical	Specific	Threshold	Hazardous Limit	Lethal
Name	Formula	Gravity	Limit		Concentration
Hydrogen Sulfide	H₂S	1.189 Air = 1	10 ppm	100 ppm/hr	600 ppm
Sulfur	50	2.21	2 nnm	N/A	1000 nnm
Dioxide	SO ₂	Air = 1	2 ppm	IN/A	1000 ppm

Contacting Authorities

Devon Energy Corp. personnel must liaison with local and state agencies to ensure a proper response to a major release. Additionally, the OCD must be notified of the release as soon as possible but no later than 4 hours. Agencies will ask for information such as type and volume of release, wind direction, location of release, etc. Be prepared with all information available. The following call list of essential and potential responders has been prepared for use during a release. Devon Energy Corp. Company response must be in coordination with the State of New Mexico's 'Hazardous Materials Emergency Response Plan' (HMER)

Hydrogen Sulfide Drilling Operation Plan

I. HYDROGEN SULFIDE (H2S) TRAINING

All personnel, whether regularly assigned, contracted, or employed on an unscheduled basis, will receive training from a qualified instructor in the following areas prior to commencing drilling operations on this well:

- 1. The hazards and characteristics of hydrogen sulfide (H₂S)
- 2. The proper use and maintenance of personal protective equipment and life support systems.
- 3. The proper use of H₂S detectors, alarms, warning systems, briefing areas, evacuation procedures, and prevailing winds.
- 4. The proper techniques for first aid and rescue procedures.

In addition, supervisory personnel will be trained in the following areas:

- 1. The effects of H₂S metal components. If high tensile tubulars are to be used, personnel will be trained in their special maintenance requirements.
- 2. Corrective action and shut-in procedures when drilling or reworking a well and blowout prevention and well control procedures.
- 3. The contents and requirements of the H₂S Drilling Operations Plan.

There will be weekly H₂S and well control drills for all personnel in each crew.

II. HYDROGEN SULFIDE TRAINING

Note: All H₂S safety equipment and systems will be installed, tested, and operational when drilling reaches a depth of 500 feet above, or three days prior to penetrating the first zone containing or reasonably expected to contain H₂S.

1. Well Control Equipment

- A. Flare line
- B. Choke manifold Remotely Operated
- C. Blind rams and pipe rams to accommodate all pipe sizes with properly sized closing unit
- D. Auxiliary equipment may include if applicable: annular preventer and rotating head.
- E. Mud/Gas Separator

2. Protective equipment for essential personnel:

30-minute SCBA units located at briefing areas, as indicated on well site diagram, with escape units available in the top doghouse. As it may be difficult to communicate audibly while wearing these units, hand signals shall be utilized.

3. H₂S detection and monitoring equipment:

Portable H₂S monitors positioned on location for best coverage and response. These units have warning lights which activate when H₂S levels reach 10 ppm and audible sirens which activate at 15 ppm. Sensor locations:

- Bell nipple
- Possum Belly/Shale shaker
- Rig floor
- Choke manifold
- Cellar

Visual warning systems:

- A. Wind direction indicators as shown on well site diagram
- B. Caution/ Danger signs shall be posted on roads providing direct access to locations. Signs will be painted a high visibility yellow with black lettering of sufficient size to be reasonable distance from the immediate location. Bilingual signs will be used when appropriate.

4. Mud program:

The mud program has been designed to minimize the volume of H₂S circulated to surface. Proper mud weight, safe drilling practices and the use of H₂S scavengers will minimize hazards when penetrating H₂S bearing zones.

5. Metallurgy:

- A. All drill strings, casings, tubing, wellhead, blowout preventer, drilling spool, kill lines, choke manifold lines, and valves shall be H₂S trim.
- B. All elastomers used for packing and seals shall be H₂S trim.

6. Communication:

- A. Company personnel have/use cellular telephones in the field.
- B. Land line (telephone) communications at Office

7. Well testing:


- A. Drill stem testing will be performed with a minimum number of personnel in the immediate vicinity, which are necessary to safety and adequately conduct the test. The drill stem testing will be conducted during daylight hours and formation fluids will not be flowed to the surface. All drill-stem-testing operations conducted in an H₂S environment will use the closed chamber method of testing.
- B. There will be no drill stem testing.

Devon Energy Corp. Company Call List				
Employee/Company Contact Representative	Position	Phone Number	After Hours Number	
Jonathan Fisher (North)	Drilling Manager	832-967-7912		
Jason Hildebrand (South)	Drilling Manager	405-552-6514		
Rich Downey	Drilling VP	405-228-2415		
Josh Harvey	EHS Manager	405-228-2440	918-500-5536	
Laura Wright	EHS Supervisor	405-552-5334	832-969-8145	
Robert Glover	EHS Professional	575-703-5712	575-703-5712	
Lane Frank	Lead EHS	580-579-7052	580-579-7052	
Rickey Porter	Lead EHS	903-720-8315	903-720-8315	
Ronnie Handy	Lead EHS	918-839-2046	918-839-2046	
Brock Vise	Lead EHS	918-413-3291	918-413-3291	

Agency	Call List		
		 	_

County (575) Lea County Communication Authority 397-9265 State Police 385-3138 City Police 396-3611 Ambulance 911 Fire Department 397-9265 LEPC (Local Emergency Planning Committee) 393-2870 NMOCD 393-6161 US Bureau of Land Management (Closed) 393-0002 Eddy County (575) State Police 885-3137 City Police 885-3117 Sheriff's Office 887-7551 Ambulance 911 Fire Department 885-3125 LEPC (Local Emergency Planning Committee) 887-3798 US Bureau of Land Management 234-5972 NM Emergency Response Commission (Santa Fe) (505) 827-9126 National Emergency Response Center (800) 424-8802 National Pollution Control Center: Direct (703) 872-6000 For Oil Spills (800) 280-7118 Emergency Services Wild Well Control (281) 784-4700 Cudd Pressure Control (915) 699-0139 (915) 563-3356 Halliburton (575) 746-3569 (575) 746-3569	<u>Lea</u>	Hobbs		
City Police 397-9265	County	Lea County Communication Authority	397-9265	
Sheriff's Office 396-3611	<u>(575)</u>	State Police	885-3138	
Ambulance 911		City Police	397-9265	
Fire Department		Sheriff's Office	396-3611	
LEPC (Local Emergency Planning Committee) 393-2870 NMOCD 393-6161 US Bureau of Land Management (Closed) 393-0002		Ambulance	911	
NMOCD		Fire Department	397-9308	
NMOCD		LEPC (Local Emergency Planning Committee)	393-2870	
Eddy Carlsbad State Police 885-3137 (575) City Police 885-2111 Sheriff's Office 887-7551 Ambulance 911 Fire Department 885-3125 LEPC (Local Emergency Planning Committee) 887-3798 US Bureau of Land Management 234-5972 NM Emergency Response Commission (Santa Fe) (505) 476-9600 24 HR (505) 827-9126 National Emergency Response Center (800) 424-8802 National Pollution Control Center: Direct (703) 872-6000 For Oil Spills (800) 280-7118 Emergency Services Wild Well Control (915) 699-0139 (915) 563-3356 Halliburton (575) 746-2757 B. J. Services (575) 746-3569 Give GPS For Air Ambulance - Eddy County Dispatch (575)-616-7155 For Air Ambulance - Lea County (LCCA) (575)-397-9265 Poison Control (24/7) (800) 222-1222 Oil & Gas Pipeline 24 Hour Service (800) 364-4366 NOAA - Website - www.nhc.noaa.gov National Pollution Control Center 202-795-6958			393-6161	
Eddy Carlsbad State Police 885-3137 (575) City Police 885-2111 Sheriff's Office 887-7551 Ambulance 911 Fire Department 885-3125 LEPC (Local Emergency Planning Committee) 887-3798 US Bureau of Land Management 234-5972 NM Emergency Response Commission (Santa Fe) (505) 476-9600 24 HR (505) 827-9126 National Emergency Response Center (800) 424-8802 National Pollution Control Center: Direct (703) 872-6000 For Oil Spills (800) 280-7118 Emergency Services Wild Well Control (915) 699-0139 (915) 563-3356 Halliburton (575) 746-2757 B. J. Services (575) 746-3569 Give GPS For Air Ambulance - Eddy County Dispatch (575)-616-7155 For Air Ambulance - Lea County (LCCA) (575)-397-9265 Poison Control (24/7) (800) 222-1222 Oil & Gas Pipeline 24 Hour Service (800) 364-4366 NOAA - Website - www.nhc.noaa.gov National Pollution Control Center 202-795-6958		US Bureau of Land Management (Closed)	393-0002	
County (575) State Police 885-3137 City Police 885-2111 Sheriff's Office 887-7551 Ambulance 911 Fire Department 885-3125 LEPC (Local Emergency Planning Committee) 887-3798 US Bureau of Land Management 234-5972 NM Emergency Response Commission (Santa Fe) (505) 476-9600 24 HR (505) 827-9126 National Emergency Response Center (800) 424-8802 National Pollution Control Center: Direct (703) 872-6000 For Oil Spills (800) 280-7118 Emergency Services Wild Well Control (281) 784-4700 Cudd Pressure Control (915) 699-0139 (915) 563-3356 Halliburton (575) 746-3757 (575) 746-3757 B. J. Services (575) 746-37569 GPS Native Air – Emergency Helicopter – Hobbs (575) 347-9836 For Air Ambulance - Eddy County Dispatch (575)-397-9265 Poison Control (24/7) (800) 222-1222 Oil & Gas Pipeline 24 Hour Service (800) 364-4366 NOAA – Website - www.nhc.noaa.gov		• ,		
City Police 885-2111 Sheriff's Office 887-7551 Ambulance 911 Fire Department 885-3125 LEPC (Local Emergency Planning Committee) 887-3798 US Bureau of Land Management 234-5972 NM Emergency Response Commission (Santa Fe) (505) 476-9600 24 HR (505) 827-9126 National Emergency Response Center (800) 424-8802 National Pollution Control Center: Direct (703) 872-6000 For Oil Spills (800) 280-7118 Emergency Services Wild Well Control (281) 784-4700 Cudd Pressure Control (915) 699-0139 (915) 563-3356 Halliburton (575) 746-2757 (575) 746-2757 B. J. Services (575) 746-3569 GPS For Air Ambulance - Eddy County Dispatch (575)-616-7155 For Air Ambulance - Lea County (LCCA) (575)-397-9265 Poison Control (24/7) (800) 222-1222 Oil & Gas Pipeline 24 Hour Service (800) 364-4366 NOAA - Website - www.nhc.noaa.gov National Pollution Control Center 202-795-6958	Eddy	Carlsbad		
Sheriff's Office	County	State Police	885-3137	
Ambulance	<u>(575)</u>	City Police	885-2111	
Fire Department		Sheriff's Office	887-7551	
LEPC (Local Emergency Planning Committee) 887-3798 US Bureau of Land Management 234-5972 NM Emergency Response Commission (Santa Fe) (505) 476-9600 24 HR (505) 827-9126 National Emergency Response Center (800) 424-8802 National Pollution Control Center: Direct (703) 872-6000 For Oil Spills (800) 280-7118 Emergency Services (800) 424-4700 Cudd Pressure Control (915) 699-0139 (915) 563-3356 Halliburton (575) 746-2757 B. J. Services (575) 746-3569 Give GPS		Ambulance		
US Bureau of Land Management NM Emergency Response Commission (Santa Fe) 234-5972 NM Emergency Response Commission (Santa Fe) 24 HR (505) 827-9126 National Emergency Response Center National Pollution Control Center: Direct For Oil Spills Emergency Services Wild Well Control Cudd Pressure Control (281) 784-4700 Cudd Pressure Control (915) 699-0139 (915) 563-3356 Halliburton (575) 746-2757 B. J. Services (575) 746-3569 Give GPS For Air Ambulance - Eddy County Dispatch For Air Ambulance - Lea County (LCCA) Poison Control (24/7) (800) 222-1222 Oil & Gas Pipeline 24 Hour Service NOAA - Website - www.nhc.noaa.gov National Pollution Control Center		Fire Department	885-3125	
NM Emergency Response Commission (Santa Fe) (505) 476-9600 24 HR (505) 827-9126 National Emergency Response Center (800) 424-8802 National Pollution Control Center: Direct (703) 872-6000 For Oil Spills (800) 280-7118 Emergency Services (800) 424-8802 Wild Well Control (800) 280-7118 Emergency Services (800) 280-7118 Emergency Services (800) 280-7118 Emergency Services (800) 280-7118 Emergency Services (915) 699-0139 (915) 563-3356 Halliburton (915) 699-0139 (915) 563-3356 Halliburton (575) 746-2757 B. J. Services (575) 746-3569 Give GPS (575) 347-9836 (575) 347-9836 GPS (575) Air Ambulance - Eddy County Dispatch (575)-616-7155 For Air Ambulance - Lea County (LCCA) (575)-397-9265 Poison Control (24/7) (800) 222-1222 Oil & Gas Pipeline 24 Hour Service (800) 364-4366 NOAA - Website - www.nhc.noaa.gov National Pollution Control Center (202-795-6958)		LEPC (Local Emergency Planning Committee)	887-3798	
24 HR			234-5972	
National Emergency Response Center (800) 424-8802 National Pollution Control Center: Direct (703) 872-6000 For Oil Spills (800) 280-7118 Emergency Services Wild Well Control (281) 784-4700 Cudd Pressure Control (915) 699-0139 (915) 563-3356 Halliburton (575) 746-2757 B. J. Services (575) 746-3569 Give Native Air – Emergency Helicopter – Hobbs (575) 347-9836 GPS For Air Ambulance - Eddy County Dispatch (575)-616-7155 position: For Air Ambulance - Lea County (LCCA) (575)-397-9265 Poison Control (24/7) (800) 222-1222 Oil & Gas Pipeline 24 Hour Service (800) 364-4366 NOAA – Website - www.nhc.noaa.gov National Pollution Control Center 202-795-6958		NM Emergency Response Commission (Santa Fe)	(505) 476-9600	
National Pollution Control Center: Direct (703) 872-6000 For Oil Spills (800) 280-7118 Emergency Services Wild Well Control (281) 784-4700 Cudd Pressure Control (915) 699-0139 (915) 563-3356 Halliburton (575) 746-2757 B. J. Services (575) 746-3569 Give GPS Native Air – Emergency Helicopter – Hobbs (575) 347-9836 For Air Ambulance - Eddy County Dispatch (575)-616-7155 For Air Ambulance - Lea County (LCCA) (575)-397-9265 Poison Control (24/7) (800) 222-1222 Oil & Gas Pipeline 24 Hour Service (800) 364-4366 NOAA – Website - www.nhc.noaa.gov National Pollution Control Center 202-795-6958		24 HR	(505) 827-9126	
For Oil Spills (800) 280-7118 Emergency Services Wild Well Control (281) 784-4700 Cudd Pressure Control (915) 699-0139 (915) 563-3356 Halliburton (575) 746-2757 B. J. Services (575) 746-3569 Give Native Air – Emergency Helicopter – Hobbs (575) 347-9836 For Air Ambulance - Eddy County Dispatch (575)-616-7155 position: For Air Ambulance - Lea County (LCCA) (575)-397-9265 Poison Control (24/7) (800) 222-1222 Oil & Gas Pipeline 24 Hour Service (800) 364-4366 NOAA – Website - www.nhc.noaa.gov National Pollution Control Center 202-795-6958		National Emergency Response Center	(800) 424-8802	
Emergency Services Wild Well Control (281) 784-4700 Cudd Pressure Control (915) 699-0139 (915) 563-3356 Halliburton (575) 746-2757 B. J. Services (575) 746-3569 Give Native Air – Emergency Helicopter – Hobbs (575) 347-9836 GPS For Air Ambulance - Eddy County Dispatch (575)-616-7155 For Air Ambulance - Lea County (LCCA) (575)-397-9265 Poison Control (24/7) (800) 222-1222 Oil & Gas Pipeline 24 Hour Service (800) 364-4366 NOAA – Website - www.nhc.noaa.gov National Pollution Control Center (202-795-6958)		National Pollution Control Center: Direct	(703) 872-6000	
Wild Well Control (281) 784-4700 Cudd Pressure Control (915) 699-0139 (915) 563-3356 Halliburton (575) 746-2757 B. J. Services (575) 746-3569 Give Native Air – Emergency Helicopter – Hobbs (575) 347-9836 For Air Ambulance - Eddy County Dispatch (575)-616-7155 position: For Air Ambulance - Lea County (LCCA) (575)-397-9265 Poison Control (24/7) (800) 222-1222 Oil & Gas Pipeline 24 Hour Service (800) 364-4366 NOAA – Website - www.nhc.noaa.gov National Pollution Control Center 202-795-6958		For Oil Spills	(800) 280-7118	
Cudd Pressure Control (915) 699-0139 (915) 563-3356 Halliburton (575) 746-2757 B. J. Services (575) 746-3569 Give Native Air – Emergency Helicopter – Hobbs (575) 347-9836 GPS For Air Ambulance - Eddy County Dispatch (575)-616-7155 position: For Air Ambulance - Lea County (LCCA) (575)-397-9265 Poison Control (24/7) (800) 222-1222 Oil & Gas Pipeline 24 Hour Service (800) 364-4366 NOAA – Website - www.nhc.noaa.gov 202-795-6958		Emergency Services		
Halliburton		Wild Well Control	(281) 784-4700	
B. J. Services		Cudd Pressure Control (915) 699-0139	(915) 563-3356	
Give Native Air – Emergency Helicopter – Hobbs (575) 347-9836 GPS For Air Ambulance - Eddy County Dispatch (575)-616-7155 position: For Air Ambulance - Lea County (LCCA) (575)-397-9265 Poison Control (24/7) (800) 222-1222 Oil & Gas Pipeline 24 Hour Service (800) 364-4366 NOAA – Website - www.nhc.noaa.gov National Pollution Control Center 202-795-6958		Halliburton	(575) 746-2757	
GPS position: For Air Ambulance - Eddy County Dispatch (575)-616-7155 For Air Ambulance - Lea County (LCCA) (575)-397-9265 Poison Control (24/7) (800) 222-1222 Oil & Gas Pipeline 24 Hour Service (800) 364-4366 NOAA - Website - www.nhc.noaa.gov Vational Pollution Control Center 202-795-6958		B. J. Services	(575) 746-3569	
position: For Air Ambulance - Lea County (LCCA) (575)-397-9265 Poison Control (24/7) (800) 222-1222 Oil & Gas Pipeline 24 Hour Service (800) 364-4366 NOAA – Website - www.nhc.noaa.gov National Pollution Control Center 202-795-6958	Give	Native Air – Emergency Helicopter – Hobbs	(575) 347-9836	
Poison Control (24/7) (800) 222-1222 Oil & Gas Pipeline 24 Hour Service (800) 364-4366 NOAA – Website - www.nhc.noaa.gov National Pollution Control Center 202-795-6958	GPS	For Air Ambulance - Eddy County Dispatch	(575)-616-7155	
Oil & Gas Pipeline 24 Hour Service (800) 364-4366 NOAA – Website - www.nhc.noaa.gov National Pollution Control Center 202-795-6958	position:	For Air Ambulance - Lea County (LCCA)	(575)-397-9265	
NOAA – Website - www.nhc.noaa.gov National Pollution Control Center 202-795-6958		Poison Control (24/7)	(800) 222-1222	
National Pollution Control Center 202-795-6958				
		NOAA – Website - www.nhc.noaa.gov		
NPCC – Oil Spills 800-280-7118			202-795-6958	
		NPCC – Oil Spills	800-280-7118	

Prepared in conjunction with Dave Small

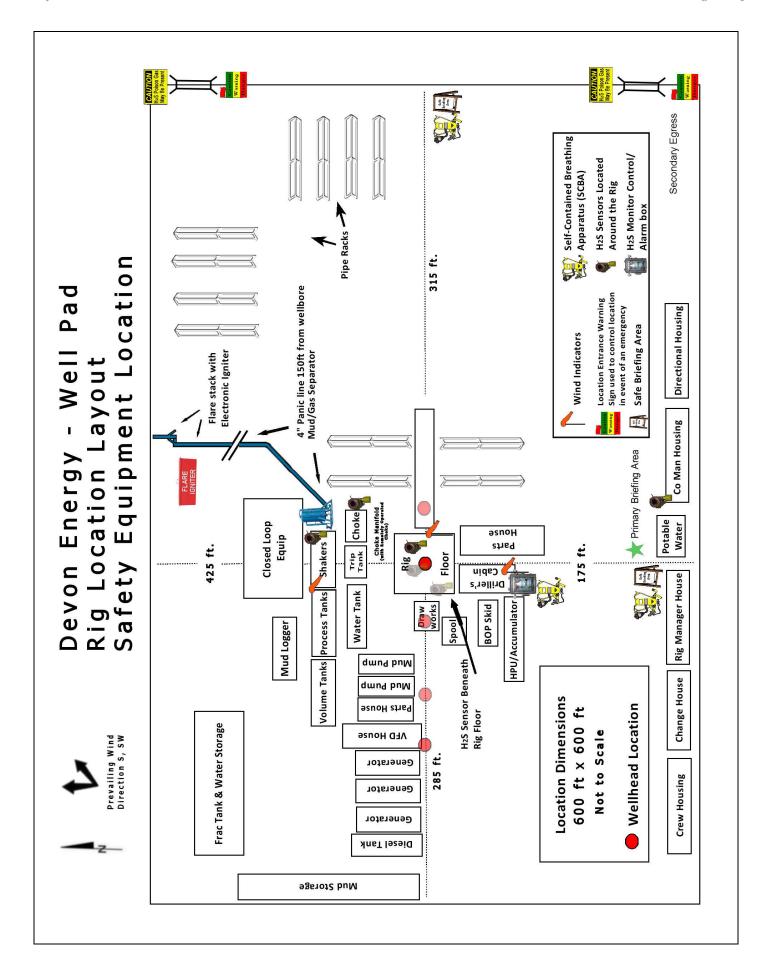

Sante Fe Main Office Phone: (505) 476-3441

General Information Phone: (505) 629-6116

Online Phone Directory https://www.emnrd.nm.gov/ocd/contact-us

State of New Mexico Energy, Minerals and Natural Resources Oil Conservation Division 1220 S. St Francis Dr. Santa Fe, NM 87505

CONDITIONS

Action 421927

CONDITIONS

Operator:	OGRID:
DEVON ENERGY PRODUCTION COMPANY, LP	6137
333 West Sheridan Ave.	Action Number:
Oklahoma City, OK 73102	421927
	Action Type:
	[C-101] BLM - Federal/Indian Land Lease (Form 3160-3)

CONDITIONS

Created By	Condition	Condition Date
wsalter	Cement is required to circulate on both surface and intermediate1 strings of casing.	1/17/2025
wsalter	If cement does not circulate on any string, a Cement Bond Log (CBL) is required for that string of casing.	1/17/2025
pkautz	File As Drilled C-102 and a directional Survey with C-104 completion packet.	1/23/2025
pkautz	Once the well is spud, to prevent ground water contamination through whole or partial conduits from the surface, the operator shall drill without interruption through the fresh water zone or zones and shall immediately set in cement the water protection string.	1/23/2025
pkautz	Oil base muds are not to be used until fresh water zones are cased and cemented providing isolation from the oil or diesel. This includes synthetic oils. Oil based mud, drilling fluids and solids must be contained in a steel closed loop system.	1/23/2025