

# U.S. Department of the Interior BUREAU OF LAND MANAGEMENT

Sundry Print Report of 12
09/24/2025

Well Name: MUDGE A Well Location: T27N / R11W / SEC 6 / County or Parish/State: SAN

NENE / 36.608749 / -108.038925 JUAN / NM

Well Number: 9 Type of Well: OTHER Allottee or Tribe Name:

Lease Number: NMSF078895 Unit or CA Name: Unit or CA Number:

COMPANY

# **Notice of Intent**

**Sundry ID: 2874496** 

Type of Submission: Notice of Intent

Type of Action: Plug and Abandonment

Date proposed operation will begin: 11/01/2026

**Procedure Description:** Hilcorp Energy Company requests permission to P&A the subject well per the attached procedure, current and proposed wellbore schematics. The Pre-Disturbance Site Visit was held on 08/13/2025 with Roger Herrera (BLM), Daniel Sloan (Enterprise), Bertha Spencer (BIA), Alysse Pablo (NAPI), and Bryan Hall (HEC). The Re-Vegetation Plan is attached. A closed loop system will be used.

# **Surface Disturbance**

Is any additional surface disturbance proposed?: No

# **NOI Attachments**

# **Procedure Description**

2025\_09\_19\_MUDGE\_A\_9\_P\_A\_NOI\_20250919121037.pdf

Page 1 of 2

County or Parish/State: SAN Page Well Location: T27N / R11W / SEC 6 /

NENE / 36.608749 / -108.038925

JUAN / NM

Well Number: 9 Allottee or Tribe Name: Type of Well: OTHER

Lease Number: NMSF078895 **Unit or CA Name: Unit or CA Number:** 

**US Well Number: 3004506931 Operator: HILCORP ENERGY** 

**COMPANY** 

# **Conditions of Approval**

# **Specialist Review**

General\_Requirement\_PxA\_20250923144140.pdf

2874496\_A\_9\_3004506931\_NOIA\_KR\_09232025\_20250923144131.pdf

Mudge\_A\_9\_Geo\_KR\_20250923144131.pdf

# **Operator**

I certify that the foregoing is true and correct. Title 18 U.S.C. Section 1001 and Title 43 U.S.C. Section 1212, make it a crime for any person knowingly and willfully to make to any department or agency of the United States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction. Electronic submission of Sundry Notices through this system satisfies regulations requiring a

**Operator Electronic Signature: PRISCILLA SHORTY** Signed on: SEP 19, 2025 12:10 PM

Name: HILCORP ENERGY COMPANY

Title: Regulatory Technician

Street Address: 382 ROAD 3100

City: AZTEC State: NM

Phone: (505) 324-5188

Email address: PSHORTY@HILCORP.COM

# **Field**

**Representative Name:** 

**Street Address:** 

City: State: Zip:

Phone:

**Email address:** 

# **BLM Point of Contact**

**BLM POC Name:** KENNETH G RENNICK **BLM POC Title:** Petroleum Engineer

**BLM POC Phone**: 5055647742 BLM POC Email Address: krennick@blm.gov

**Disposition:** Approved Disposition Date: 09/23/2025

Signature: Kenneth Rennick

Page 2 of 2



# HILCORP ENERGY COMPANY MUDGE A 9 P&A NOI

API #: 3004506931

#### JOB PROCEDURES


- 1. Contact NMOCD and BLM (where applicable) 24 hours prior to MIRU.
- 2. Hold pre-job safety meeting. Verify cathodic is off. Comply with all NMOCD, BLM, and HEC safety and environmental regulations.
- 3. MIRU service rig and associated equipment; NU and test BOP.
- 4. Set a 4-1/2" CIBP or CICR at +/- 1,750' to isolate the PC Perfs.
- 5. Load the well as needed. Pressure test the casing above the plug to 500 psig for 30 min.
- 6. CBL was already run on 7/27/1992, it shows TOC at 1,260'.
- 7. PU & TIH w/ work string to +/- 1,750".
- 8. PLUG #1: 8sx of Class G Cement (15.8 PPG, 1.15 yield); PC Perfs @ 1,775' | PC Top @ 1,796':

  Pump an 8 sack balanced cement plug inside the 4-1/2" casing (est. TOC @ +/- 1,650' & est. BOC @ +/- 1,750'). Wait on Cement for 4 hours, tag TOC w/ work string. \*Note cement plug lengths & volumes account for excess.
- 9. POOH w/ work string. TIH & perforate squeeze holes @ +/- 1,250'. Establish circulation. TIH w/ work string.
- 10. PLUG #2: 136sx of Class G Cement (15.8 PPG, 1.15 yield); FRD Top @ 1,240' | KRD Top @ 733' | OJO Top @ 643':
  Pump 81sx of cement in the 4-1/2" casing X 7" casing annulus (est. TOC @ +/- 493' & est. BOC @ +/- 1,250'). Pump a 55 sack balanced cement plug inside the 4-1/2" casing (est. TOC @ +/- 543' & est. BOC @ +/- 1,250'). WOC for 4 hrs, tag TOC w/ work string. \*Note cement plug lengths and volumes account for excess.
- 11. POOH w/ work string. TIH & perforate squeeze holes @ +/- 143'. Establish circulation.
- 12. PLUG #3: 66sx of Class G Cement (15.8 PPG, 1.15 yield); Surf. Casing Shoe @ 93':

  Pump 38sx of cement in the 7" casing X 10-3/4" casing annulus (est. TOC @ +/- 0' & est. BOC @ +/- 143'). Continue pumping 16sx of cement in the 4-1/2" casing X 7" casing annulus (est. TOC @ +/- 0' & est. BOC @ +/- 143'). Pump a 12 sack balanced cement plug inside the 4-1/2" casing (est. TOC @ +/- 0' & est. BOC @ +/- 143'). \*Note cement plug lengths and volumes account for excess.
- 13. ND BOP, cut off Wellhead. Top off cement in surface casing annulus, if needed. Install a P&A marker with cement to comply with regulations. Rig down, move off location, cut off anchors, and restore location.




# HILCORP ENERGY COMPANY MUDGE A 9 P&A NOI

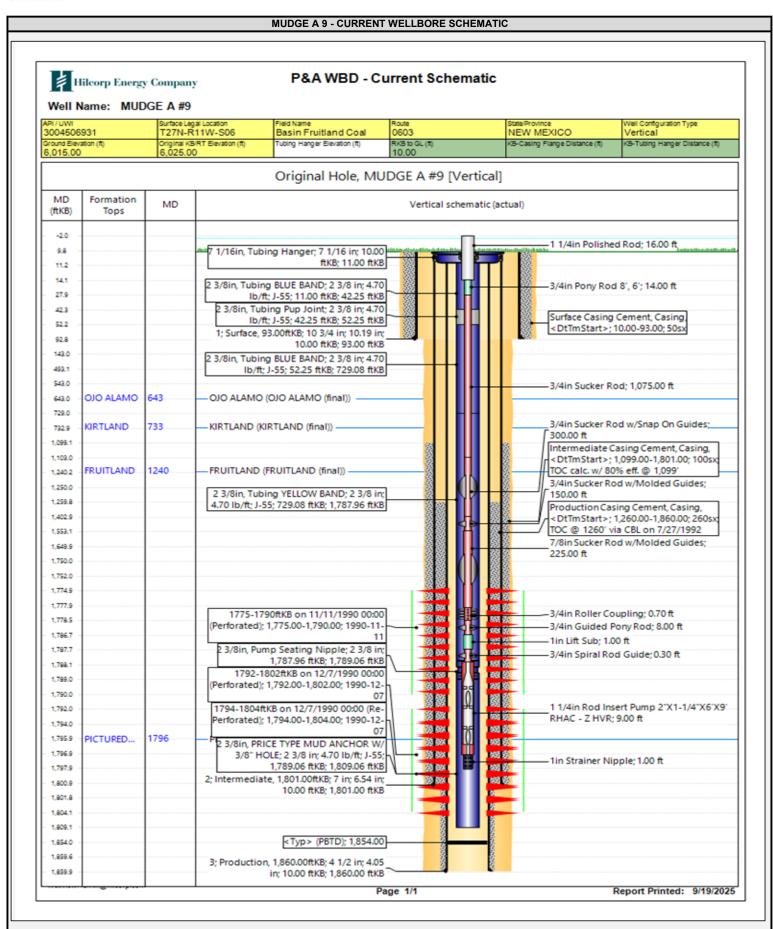



#### HILCORP ENERGY COMPANY MUDGE A 9 P&A NOI

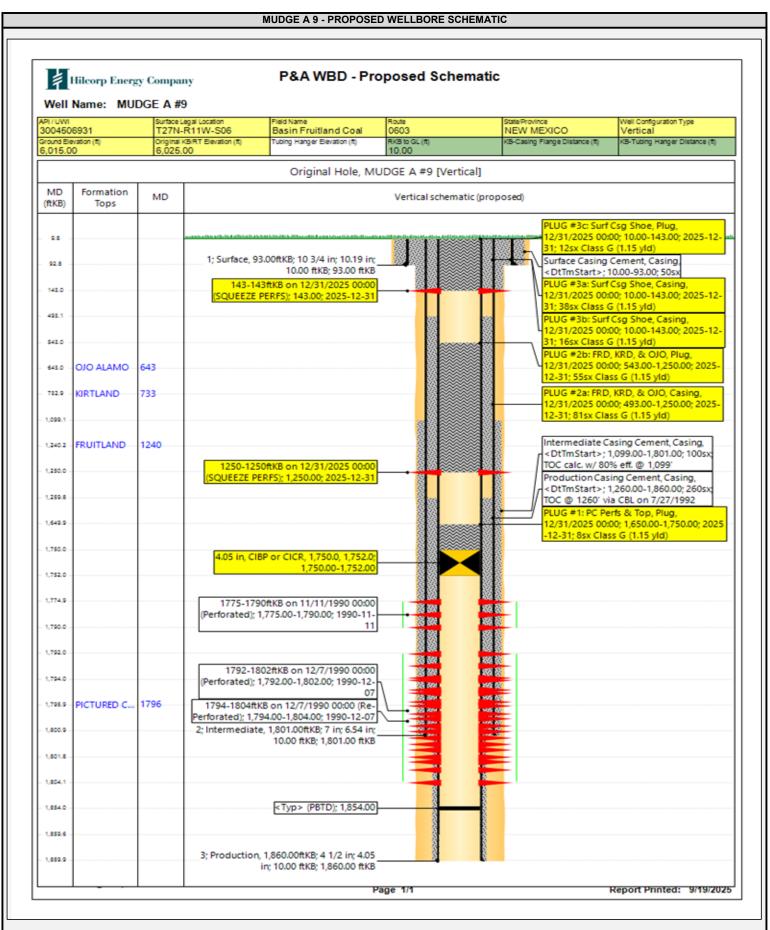

Hilcorp Energy
P&A Final Reclamation Plan
Mudge A 9

API: 30-045-06931 T27N-R11W-Sec.6 -Unit A LAT: 36.608704 LONG: -108.038876 NAD 27 990' FNL & 990' FEL

San Juan County, NM

#### 1. PRE- RECLAMATION SITE INSPECTION

A pre-reclamation site inspection was completed with Roger Herrera (BLM), Daniel Sloan (Enterprise), Bertha Spencer (BIA), Alysse Pablo (NAPI) and Bryan Hall Hilcorp Energy SJ South Construction Foreman on August 13, 2025.

#### 2. LOCATION RECLAMATION PROCEDURE

- 1. Removal of all equipment, separator, meter run, anchors, flowlines, BGT, Tank, and Pumping
- 2. Remove contaminated soil around Pumping unit and test underneath.
- 3. Cose BGT per NMOCD Regulations, if location has a BGT permit.
- 4. All trash and debris will be removed within a 50' buffer outside of the location disturbance during reclamation.
- 5. Remove Salt Cedar bushes off location and haul off.
- 6. Place available gravel on main road.
- 7. HEC will remove pipeline 50' off location and cap.
- 8. Rip and seed bare ground.

#### 3. ACCESS ROAD RECLAMATION PROCEDURE


1. N/A

#### 4. **SEEDING PROCEDURE**

- 1. Crested wheat/Indian Rice grass seed mix will be used for all reclaimed and disturbed areas of the well pad and lease road.
- 2. Drill seed method will be done where applicable, and all other disturbed areas will be broadcast seeded and harrowed. Broadcast seeding will be applied at a double the rate of seed.
- 3. The time of the seeding will be when the ground is not frozen or saturated.

#### 5. WEED MANAGEMENT

1. No noxious weeds were identified during this onsite.

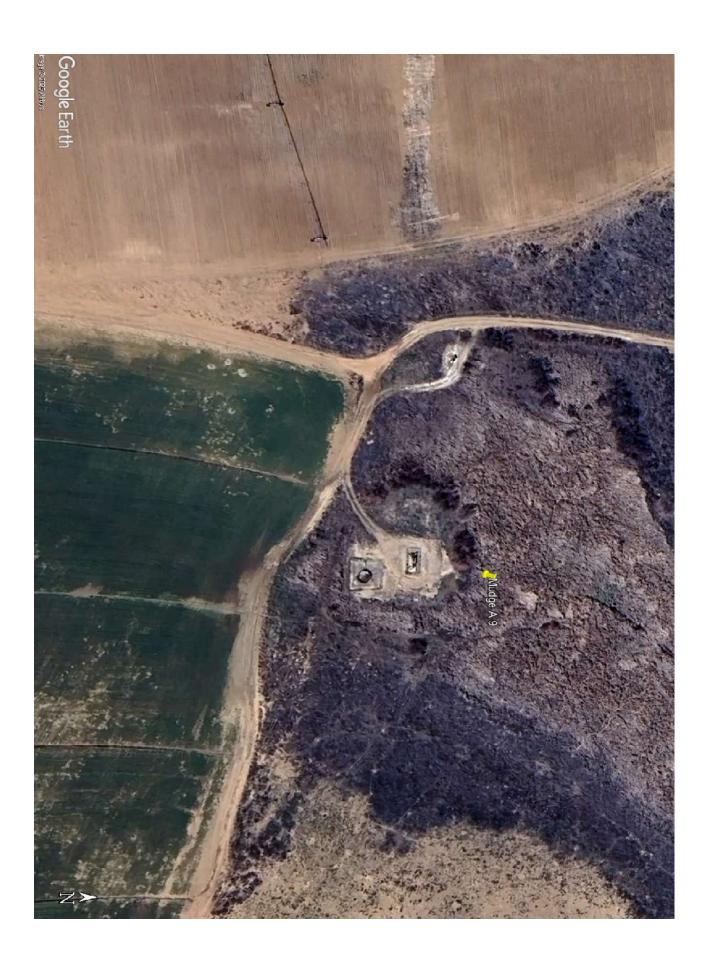



# United States Department of the Interior

BUREAU OF LAND MANAGEMENT Farmington District Office 6251 College Boulevard, Suite A Farmington, New Mexico 87402 http://www.blm.gov/nm



# **CONDITIONS OF APPROVAL**

September 23, 2025

### Notice of Intent - Plug and Abandonment

**Operator:** Hilcorp Energy Company

**Lease:** NMSF 0078895

**Well(s):** Mudge 9, US Well # 30-045-06931

**Location:** Sec 6 T27N R11W (San Juan County, NM)

**Sundry Notice ID #: 2874496** 

The Notice of Intent to Plug and Abandon is accepted with the following Conditions of Approval (COA):

- 1. Plugging operations authorized are subject to the attached "General Requirements for Permanent Abandonment of Wells on Federal and Indian Lease."
- 2. The following modifications to your plugging program are to be made:
  - a. No changes to the procedure.
- 3. Notification: Farmington Office is to be notified at least 24 hours before the plugging operations commence at (505) 564 7750.

You are also required to place cement excesses per 4.2 and 4.4 of the attached General Requirements.

K. Rennick 9/23/2025

#### **BLM - FFO - Geologic Report**

Date Completed 9/23/2025

Well No. Mudge A 9 Surf. Loc. 990 FNL 990 FEL

US Well No. 30-045-06931 Sec. 6 T. 27N R. 11W

Lease No. NMSF 0078895

Pictured Cliffs Ss

**Bottom Perforations** 

County San Juan State New Mexico

Operator Hilcorp Energy Company Formation Basin Fruitland Coal TVD 1860 PBTD 1854 Elevation KB 6025

TVD 1860 PBTD 1854 Elevation GL 6015

**Geologic Formations** Est. tops Remarks Surface Casing 93 643 Ojo Alamo Ss Aquifer (possible freshwater) Kirtland Shale 733 Possible gas Fruitland 1240 Coal/ Gas/ Water **Upper Perforations** 1775 Probable Gas

1796

1804

Remarks: Reference Well:

No available raster logs for the well. Operator selected formation tops approriated for the area. No changes to the procedure.

Prepared by: Kenneth Rennick

# GENERAL REQUIREMENTS FOR PERMANENT ABANDONMENT OF WELLS ON FEDERAL AND INDIAN LEASES FARMINGTON FIELD OFFICE

- 1.0 The approved plugging plans may contain variances from the following <u>minimum general</u> requirements.
  - 1.1 Modification of the approved plugging procedure is allowed only with the prior approval of the Authorized Officer, Farmington Field Office.
  - 1.2 Requirements may be added to address specific well conditions.
- 2.0 Materials used must be accurately measured. (densometer/scales)
- 3.0 A tank or lined pit must be used for containment of any fluids from the wellbore during plugging operations and all pits are to be fenced with woven wire. These pits will be fenced on three sides and once the rig leaves location, the fourth side will be fenced.
  - 3.1 Pits are not to be used for disposal of any hydrocarbons. If hydrocarbons are present in the pit, the fluids must be removed prior to filling in.
- 4.0 All cement plugs are to be placed through a work string. Cement may be bull-headed down the casing with prior approval. Cement caps on top of bridge plugs or cement retainers may be placed by dump bailer.
  - 4.1 The cement shall be as specified in the approved plugging plan.
  - 4.2 All cement plugs placed inside casing shall have sufficient volume to fill a minimum of 100' of the casing, or annular void(s) between casings, plus an excess volume sufficient to provide for 50 linear feet of fill above the plug.
  - 4.3 Surface plugs may be no less than 50' in length.
  - 4.4 All cement plugs placed to fill annular void(s) between casing and the formation shall be of sufficient volume to fill a minimum of 100' of the annular space plus 100% excess, calculated using the bit size, or 100' of annular capacity, determined from a caliper log, plus an excess volume sufficient to provide for 50 linear feet of fill above the plug.
  - 4.5 All cement plugs placed to fill an open hole shall be of sufficient volume to fill a minimum of 100' of hole, as calculated from a caliper log, plus an excess volume sufficient to provide for 50 linear feet of fill above the plug. In the absence of a caliper log, an excess of 100% shall be required.
  - 4.6 A cement bond log or other accepted cement evaluation tool is required to be run if one had not been previously ran or cement did not circulate to surface during the original casing cementing job or subsequent cementing jobs.

2

- 5.1 The top of any cement plug verified by tagging must be at or above the depth specified in the approved plan, without regard to any excess.
- 5.2 Testing will not be required for any cement plug that is mechanically contained by use of a bridge plug and/or cement retainer, if casing integrity has been established.
- 5.3 Any cement plug which is the only isolating medium, for a fresh water interval or a zone containing a prospectively valuable deposit of minerals, shall be tested by tagging.
- 5.4 If perforations are required below the surface casing shoe, a 30 minute minimum wait time will be required to determine if gas and/or water flows are present. If flow is present, the well will be shut-in for a minimum of one hour and the pressure recorded. Short or long term venting may be necessary to evacuate trapped gas. If only a water flow occurs with no associated gas, shut well in and record the pressures. Contact the Engineer as it may be necessary to change the cement weight and additives.
- 6.0 Before setting any cement plugs the hole needs to be rolled. All wells are to be controlled by means of a fluid that is to be of a weight and consistency necessary to stabilize the wellbore. This fluid shall be left in place as filler between all plugs.
  - 6.1 Drilling mud may be used as the wellbore fluid in open hole plugging operations.
  - 6.2 The wellbore fluid used in cased holes shall be of sufficient weight to balance known pore pressures in all exposed formations.
- 7.0 A blowout preventer and related equipment (BOPE) shall be installed and tested prior to working in a wellbore with any exposed zone(s); (1) that are over pressured, (2) where the pressures are unknown, or (3) known to contain  $H_2S$ .
- 8.0 Within 30 days after plugging work is completed, file a Sundry Notice, Subsequent Report of Abandonment (Form 3160-5), through the Automated Fluid Minerals Support System (AFMSS) with the Field Manager, Bureau of Land Management, 6251 College Blvd., Suite A, Farmington, NM 87402. The report should show the manner in which the plugging work was carried out, the extent, by depth(s), of cement plugs placed, and the size and location, by depth(s), of casing left in the well. Show <u>date</u> well was plugged.
- 9.0 All permanently abandoned wells are to be marked with a permanent monument as specified in 43 CFR 3162.6(d). Unless otherwise approved.
- 10.0 If this well is located in a Specially Designated Area (SDA), compliance with the appropriate seasonal closure requirements will be necessary.

All of the above are minimum requirements. Failure to comply with the above conditions of approval may result in an assessment for noncompliance and/or a Shut-in Order being issued pursuant to 43 CFR 3163.1. You are further advised that any instructions, orders or decisions issued by the Bureau of Land Management are subject to administrative review pursuant to 43 CFR 3165.3 and appeal pursuant to 43 CFR 3165.4 and 43 CFR 4.700.

Sante Fe Main Office Phone: (505) 476-3441

General Information Phone: (505) 629-6116

Online Phone Directory https://www.emnrd.nm.gov/ocd/contact-us

# State of New Mexico Energy, Minerals and Natural Resources Oil Conservation Division 1220 S. St Francis Dr. Santa Fe, NM 87505

CONDITIONS

Action 508711

#### **CONDITIONS**

Operator:	OGRID:
HILCORP ENERGY COMPANY	372171
	Action Number:
Houston, TX 77002	508711
	Action Type:
	[C-103] NOI Plug & Abandon (C-103F)

#### CONDITIONS

Created By		Condition Date
loren.diede	Notify the OCD inspection supervisor via email 24 hours prior to beginning Plug & Abandon (P&A) operations.	9/25/2025
loren.diede	Submit photo and GPS coordinates of the P&A marker with the final P&A reports. The API# on the marker should be clearly legible.	9/25/2025