

Submit 1 Copy To Appropriate District Office  
 District I – (575) 393-6161  
 1625 N. French Dr., Hobbs, NM 88240  
 District II – (575) 748-1283  
 811 S. First St., Artesia, NM 88210  
 District III – (505) 334-6178  
 1000 Rio Brazos Rd., Aztec, NM 87410  
 District IV – (505) 476-3460  
 1220 S. St. Francis Dr., Santa Fe, NM 87505

State of New Mexico  
 Energy, Minerals and Natural Resources  
 OIL CONSERVATION DIVISION  
 1220 South St. Francis Dr.  
 Santa Fe, NM 87505

<p><b>SUNDRY NOTICES AND REPORTS ON WELLS</b>  (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)</p>		<b>WELL API NO.</b> <b>30-025-23096</b>
		5. Indicate Type of Lease <input checked="" type="checkbox"/> STATE <input type="checkbox"/> FEE <input type="checkbox"/>
<p>1. Type of Well: Oil Well <input type="checkbox"/> Gas Well <input checked="" type="checkbox"/> Other <b>SWD</b></p> <p>2. Name of Operator <b>Walsh &amp; Watts Inc</b></p> <p>3. Address of Operator <b>155 Walsh Drive Aledo, TX 76008</b></p> <p>4. Well Location    Unit Letter <b>P</b> : <b>660</b> feet from the <b>S</b> line and <b>660</b> feet from the <b>E</b> line    Section <b>12</b> Township <b>18S</b> Range <b>36E</b> NMPM <b>Lea</b> County <b>Lea</b></p>		6. State Oil & Gas Lease No. <b>332449</b>
		7. Lease Name or Unit Agreement Name <b>Lea OR State</b>
		8. Well Number <b>#003</b>
		9. OGRID Number <b>24558</b>
		10. Pool name or Wildcat Junction San Andres
<p>11. Elevation (Show whether DR, RKB, RT, GR, etc.) <b>3789' KB</b></p>		

## 12. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data

**NOTICE OF INTENTION TO:**

PERFORM REMEDIAL WORK  PLUG AND ABANDON  TEMPORARILY ABANDON  CHANGE PLANS  PULL OR ALTER CASING  MULTIPLE COMPL  DOWNHOLE COMMINGLE  CLOSED-LOOP SYSTEM  OTHER:

**SUBSEQUENT REPORT OF:**

REMEDIAL WORK  ALTERING CASING  COMMENCE DRILLING OPNS.  P AND A  CASING/CEMENT JOB

Notify OCD 24 hrs. prior to any work done, gilbert.cordero@emrnd.nm.gov so a CO may be assigned.

13. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion.

1. Set 5 1/2 CIBP @ 4892'. Circ hole w/ MLF. Pressure test csg **500psi/30min - Run CBL to surface - Spot 40 sx cmt @ 4892-4692'.**
2. Perf & Sqz 80 sx cmt @ 2980-2780'. WOC & Tag (B/Salt)
3. Perf & Sqz 80 sx cmt @ 1800-1600'. WOC & Tag (T/Salt)
4. Perf & Sqz 120 sx cmt @ 400' to surface. (8 5/8" Shoe) - **WOC & Bubble Test**
5. Cut off wellhead, verify cmt at surface, weld on Dry Hole Marker.

Spud Date:

04/11/1969

Rig Release Date:

**\*\*\*SEE ATTACHED COA's\*\*\*****MUST BE PLUGGED BY 1/1/27**

I hereby certify that the information above is true and complete to the best of my knowledge and belief.


SIGNATURE Alexandra Fleming TITLE Petroleum Engineer/ Regulatory Tech DATE 01/22/2026

Type or print name For State Use Only E-mail address: \_\_\_\_\_ PHONE: \_\_\_\_\_

APPROVED BY: Reed Cordero TITLE Compliance Supervisor DATE 1/23/26  
 Conditions of Approval (if any):


<b>Walsh &amp; Watts</b>		<b>CURRENT</b>
Author:	<b>Alexandra Fleming</b>	
Well Name	<b>Lea "OR" State</b>	Well No. <b>#3</b>
	<b>Arkansas</b>	
Field/Pool	<b>Junction San</b>	API #: <b>30-025-23096</b>
	<b>Andres</b>	
County	<b>Lea</b>	Location: <b>660 FSL &amp; 660 FEL</b>
State	<b>NM</b>	<b>Sec12, T18S, R36E</b>
Spud Date	<b>4/11/1969</b>	GL: <b>3789</b>

Description	O.D.	Grade	Weight	Depth	Hole	Cmt Sx	TOC
Surface Csg	8 5/8		24#	350	12 1/4	250	0
Prod Csg	5 1/2		14#	5,202	7 7/8	295	3500' TS

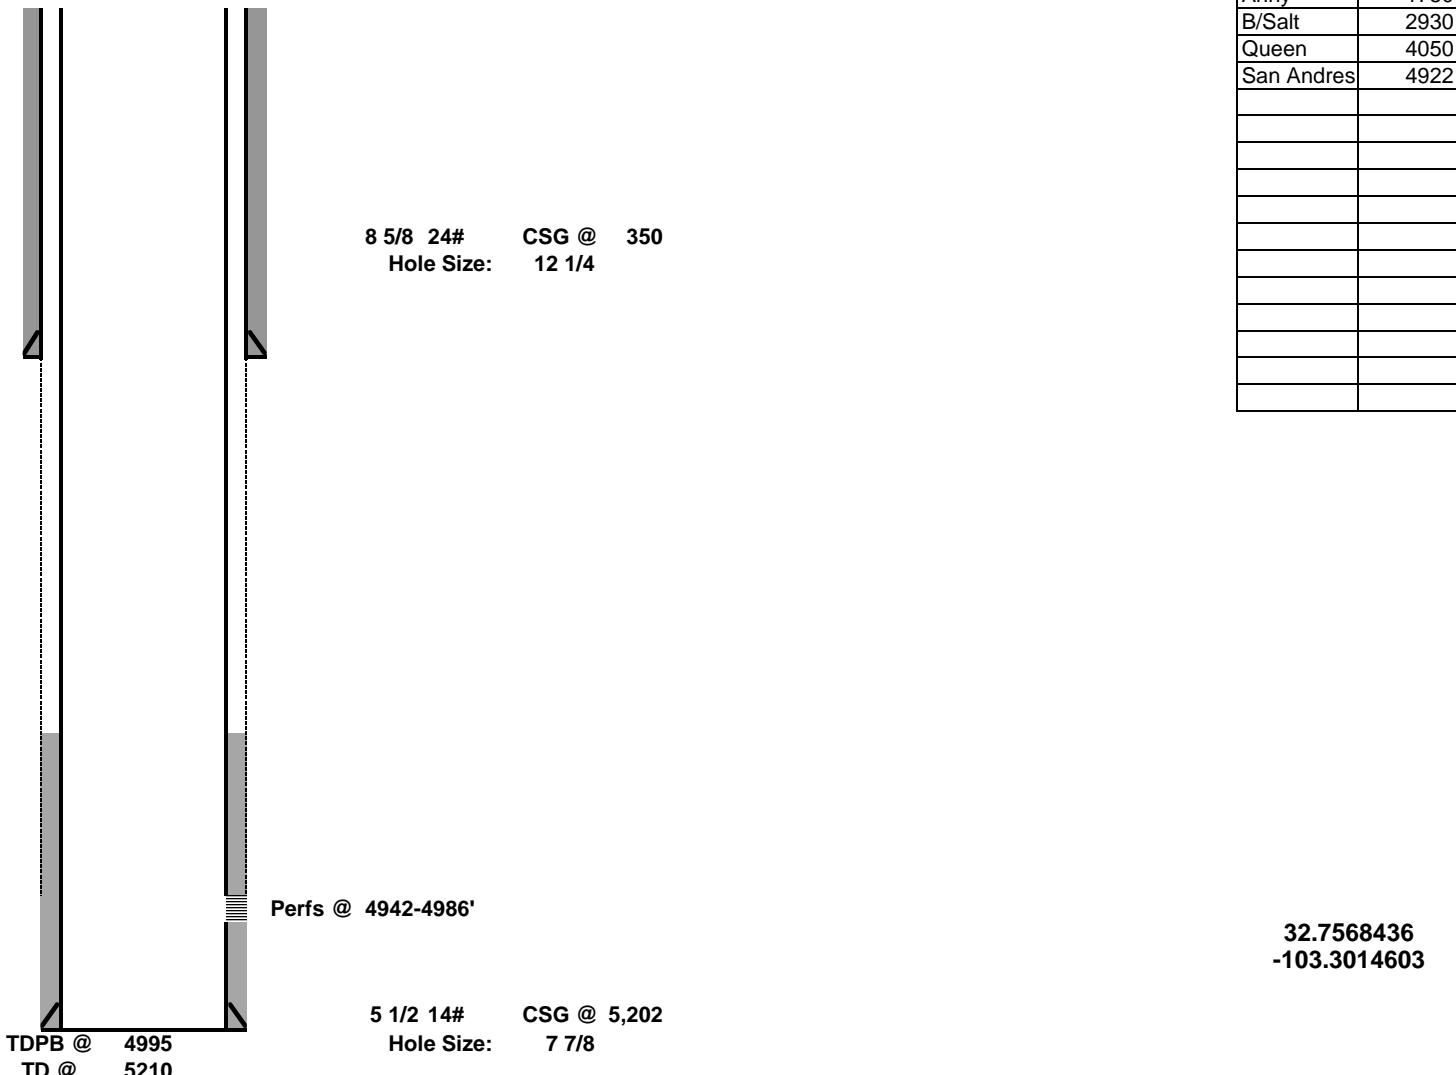

<b>Walsh &amp; Watts</b>		<b>PROPOSED</b>	
Author:	<u>Alexandra Fleming</u>		
Well Name	<u>Lea "OR" State</u>	Well No.	<u>#3</u>
	<u>Arkansas</u>		
Field/Pool	<u>Junction San</u>	API #:	<u>30-025-23096</u>
	<u>Andres</u>		
County	<u>Lea</u>	Location:	<u>660 FSL &amp; 660 FEL</u>
State	<u>NM</u>		<u>Sec12, T18S, R36E</u>
Spud Date	<u>4/11/1969</u>	GL:	<u>3789</u>

Description	O.D.	Grade	Weight	Depth	Hole	Cmt Sx	TOC
Surface Csg	8 5/8		24#	350	12 1/4	250	0
Prod Csg	5 1/2		14#	5,202	7 7/8	295	3500' TS

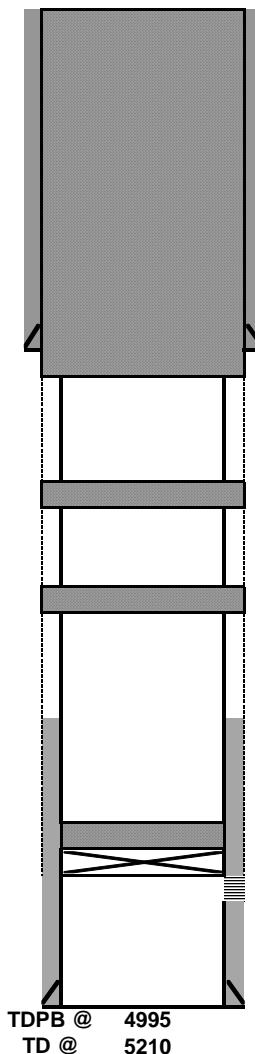

8 5/8 24# CSG @ 350  
Hole Size: 12 1/4

#### 4. Perf & Sqz 120 sx cmt @ 400' to surface. (8 5/8" Shoe)

### 3. Perf & Sqz 80 sx cmt @ 1800-1600'. WOC & Tag (T/Salt)

## 2. Perf & Sqz 80 sx cmt @ 2980-2780'. WOC & Tag (B/Salt)

1. Set 5 1/2 CIBP @ 4892'. Circ hole w/ MLF. Pressure test csg. Spot 40 sx cmt @ 4892-4692'.

Perfs @ 4942-4986'

5 1/2 14# CSG @ 5,202  
Hole Size: 7 7/8

32.7568436  
-103.3014603

Sante Fe Main Office  
Phone: (505) 476-3441

General Information  
Phone: (505) 629-6116

Online Phone Directory  
<https://www.emnrd.nm.gov/ocd/contact-us>

**State of New Mexico**  
**Energy, Minerals and Natural Resources**  
**Oil Conservation Division**  
**1220 S. St Francis Dr.**  
**Santa Fe, NM 87505**

CONDITIONS

Action 545652

**CONDITIONS**

Operator:  WALSH & WATTS INC 155 Walsh Drive Aledo, TX 76008	OGRID: 24558
	Action Number: 545652
	Action Type: [C-103] NOI Plug & Abandon (C-103F)

**CONDITIONS**

Created By	Condition	Condition Date
gcordero	Adhere to current Plug & Abandon (P&A) Conditions Of Approvals (COA).	1/23/2026
gcordero	A Cement Bond Log (CBL) is required to be submitted to electronic permitting.	1/23/2026
gcordero	Submit Cement Bond Logs (CBL) prior to submittal of C-103P.	1/23/2026