

Submit 3 Copies To Appropriate District Office
District I
1625 N. French Dr., Hobbs, NM 88240
District II
1301 W. Grand Ave., Artesia, NM 88210
District III
1000 Rio Brazos Rd., Aztec, NM 87410
District IV
1220 S. St. Francis Dr., Santa Fe, NM 87505

State of New Mexico
Energy, Minerals and Natural Resources

OIL CONSERVATION DIVISION
1220 South St. Francis Dr.
Santa Fe, NM 87505

Form C-103
Revised March 25, 1999

WELL API NO. 30-025-02751 02571
5. Indicate Type of Lease STATE <input checked="" type="checkbox"/> FEE <input type="checkbox"/>
6. State Oil & Gas Lease No. B-11610

SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)		7. Lease Name or Unit Agreement Name: WILSON STATE
1. Type of Well: Oil Well <input type="checkbox"/> Gas Well <input type="checkbox"/> Other -SWD		7. Well No. 1
2. Name of Operator HAL J. RASMUSSEN OPERATING, INC.		8. Pool name or Wildcat WILSON YATES 7 RVRS ASSOC.
3. Address of Operator 550 W. TEXAS, SUITE 200, MIDLAND, TEXAS 79701		
4. Well Location Unit Letter <u>G</u> : 2310 feet from the <u>NORTH</u> line and 1650 feet from the <u>EAST</u> line Section <u>23</u> Township <u>21S</u> Range <u>34E</u> NMPM LEA County		
10. Elevation (Show whether DR, RKB, RT, GR, etc.) 3682 GL		

11. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☒
TEMPORARILY ABANDON ☐ CHANGE PLANS ☐
PULL OR ALTER CASING ☐ MULTIPLE COMPLETION ☐
OTHER: ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐ ALTERING CASING ☐
COMMENCE DRILLING OPNS. ☐ PLUG AND ABANDONMENT ☐
CASING TEST AND CEMENT JOB ☐
OTHER: ☐

12. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed completion or recompilation.

THE COMMISSION MUST BE NOTIFIED 24 HOURS PRIOR TO THE BEGINNING OF PLUGGING OPERATIONS FOR THE C-103 TO BE APPROVED.

Propose to P&A as follows:

1. Set CIBP @ 3550' + dump bail 35' cement plug (Bottom) - TAG
2. 25 sx cement plug 1560' - 1700' Tag (Top Salt @ 1740')
3. 100 sx cement 124' - 224' Perf @ 224' and Sqz & Tag (Surface Shoe)
4. 10 sx surface plug w/ regulation marker

I hereby certify that the information above is true and complete to the best of my knowledge and belief.


SIGNATURE Michael P. Jobe TITLE Agent

Type or print name Michael P. Jobe

(This space for State use)

APPROVED BY _____ TITLE NATURAL SCIENCE MANAGER - 2 DATE _____

Conditions of approval, if any:

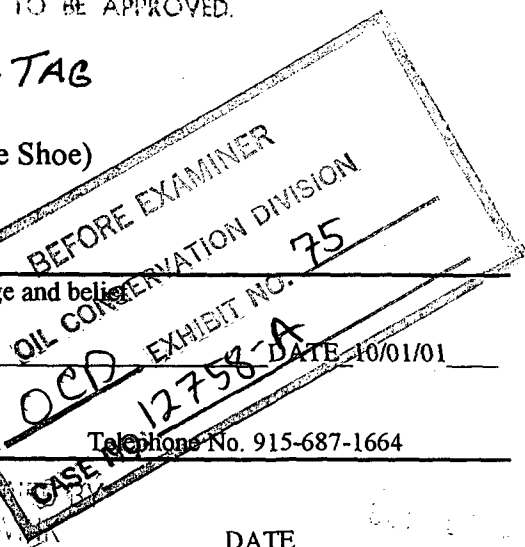

Hal J. Rasmussen Operating, Inc.

Lease WILSON STATE

Well # 1

Location: G-23-21S-34E

Formation @ TD: 7 RVRS

Formation @ PBTD: 7 RVRS

Surface plug
10 sx

16" @ 174' w/ 200 sx cmt (Circ)

Plug #3 124' - 224' Perf and Sqz. w/ 90 sx

TOC: 1537 Deter. By: Calc

Plug #2 1540' - 1700' 25 sx

T. Salt: 1740

Plug #1 CIBP @ 3550' w/35' (Proposed)

7" @ 3600' w/ 350 sx cmt

T.S

Plug	Type	Sacks Cmnt	Depth	
			from	to
Plug #1	CIBP w/35'		3550	
Plug #2	Perf & Sqz	25 sx	1540	1700
Plug #3	Shoe Perf & Sqz	90 sx	124	224
Plug #4	Surface	10 sx		
Plug #5				
Plug #6				

TD: 3900'
PBTD: 3900