

Submit 3 Copies To Appropriate District Office
 District I
 1625 N. French Dr., Hobbs, NM 88240
 District II
 811 South First, Artesia, NM 88210
 District III
 1000 Rio Brazos Rd., Aztec, NM 87410
 District IV
 1220 S. St. Francis Dr., Santa Fe, NM 87502

Form C-103
 Revised March 25, 1999

S OKE TO TRACY
HEADSTREAM
4/5/02. HE IS
TRYING TO FIND
A P&A RIG - WILL
CALL ME AND LET
ME KNOW AS SOON
AS POSSIBLE -
GARY

WELL API NO.
 30-025-28480

Indicate Type of Lease
 STATE FEE

State Oil & Gas Lease No.
 018031

Lease Name or Unit Agreement Name:
 Ian Simon 5 St

8. Well No.

9. Pool name or Wildcat
 San Simon Wolfcamp

10. Elevation (Show whether DR, RKB, RT, GR, etc.)
 3631 (GL)

SUNDRY NOTI
 (DO NOT USE THIS FORM FOR PROPOS
 DIFFERENT RESERVOIR. USE "APPLIC
 PROPOSALS.)

1. Type of Well:
 Oil Well Gas Well

2. Name of Operator Greka E

3. Address of Operator Greka Energy, Suite 220, Houston, Tx 77042
 3000 Wilcrest

4. Well Location
 Unit Letter **EG** : 1980 feet from the **N** line and 1980 feet from the **E** line
 Section **5** Township **22S** Range **35E** NMPM County **Lea**


10. Elevation (Show whether DR, RKB, RT, GR, etc.)
 3631 (GL)

11. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:		SUBSEQUENT REPORT OF:	
PERFORM REMEDIAL WORK <input type="checkbox"/>	PLUG AND ABANDON <input checked="" type="checkbox"/>	REMEDIAL WORK <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	CHANGE PLANS <input type="checkbox"/>	COMMENCE DRILLING OPNS. <input type="checkbox"/>	PLUG AND ABANDONMENT <input type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>	MULTIPLE COMPLETION <input type="checkbox"/>	CASING TEST AND CEMENT JOB <input type="checkbox"/>	
OTHER: <input type="checkbox"/>		OTHER: <input type="checkbox"/>	

12. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed completion or recompilation.

See attached well bore schematic.
 Attempt to sting out of pkr. If unsuccessful will cut tbg @ ~11550'.
 Pump 25sx cmt plug @ 7' csg shoe @ 10975'. (10674' - 11070')
 Pump 25sx cmt plug @ 7950' in cased hole.
 Pump 25sx cmt plug @ 9 5/8" csg shoe @ 5750'. (5597' - 5800')
 Cut 7" csg @ TOC, ~5200'. POH csg. Pump 25sx cmt plug @ stub. (5097' - 5200')
 Pump 25sx cmt plug @ 1800' @ salt zone.
 Pump 25sx cmt plug @ 13 3/8" csg shoe @ 1075'. (1022' - 1125')
 Pump 13sx cmt plug @ surf. (0' - 60')
 Cut off wellhead and install deadman marker

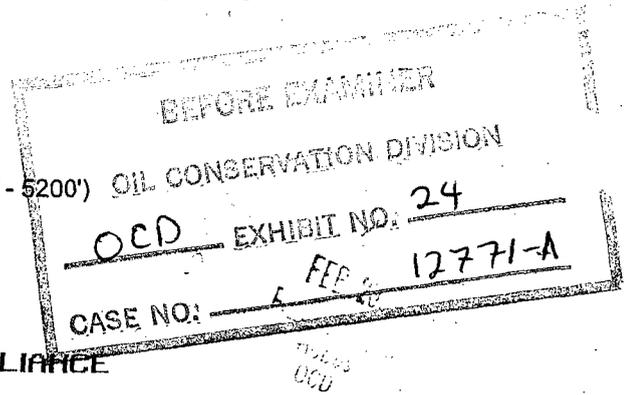

WELL MUST BE IN COMPLIANCE WITH RULE 202 BY

4/15/02

I hereby certify that the information abo

SIGNATURE [Signature] TITLE PROP FOREMAN DATE 2-12-02

Type or print name Tracy Headstream Telephone No. (505) 390-7462

(This space for State use)

APPROVED BY CHRIS WILLIAMS ORIGINAL SIGNED BY CHRIS WILLIAMS DATE 2-12-02
 Conditions of approval, if any: C.C. DISTRICT SUPERVISOR/GENERAL MANAGER

THE COMMISSION MUST BE NOTIFIED 24 HOURS PRIOR TO THE BEGINNING OF PLUGGING OPERATIONS FOR THE C-103 TO BE APPROVED.

FEB 12 2002

[Signature]