Form 3160-5 (June 2015)

UNITED STATES DEPARTMENT OF THE INTERIOR BUREAU OF LAND MANAGEMENT

NMOCD Rec'd: 9/24/2020

Operator Copy

FORM APPROVED

OMB	NO. 100	4-0	137
Expires:	January	31,	201
esse Serial No			

SUNDRY NOTICES AND REPORTS ON WELLS Do not use this form for proposals to drill or to re-enter an abandoned well. Use form 3160-3 (APD) for such proposals.			Lease Serial No. NMLC047311B If Indian, Allottee or Tribe Name				
SUBMIT IN TRIPLICATE - Other instructions on page 2			7. If Unit or CA/Agreement, Name and/or No.				
1. Type of Well Oil Well Gas Well Other					8. Well Name and No. OXY CHOCOLATE COOKIES FED 2		
Name of Operator OXY USA WTP LIMITED PTN	Contact: IRSHIP E-Mail: LESLIE_R	LESLIE REE\ EEVE\$@OXY.(ES OM		9. API Well No. 30-015-32145-0	0-S1	
3a. Address 3b. Phone No. (Ph: 713-497)			(include area code) 7-2492		10. Field and Pool or Exploratory Area EAST LOCO HILLS-WOLFCAMP		
4. Location of Well (Footage, Sec., T	, R., M., or Survey Description)			11. County or Parish, State		
Sec 25 T18S R29E NENW 660FNL 1980FWL			EDDY COUNTY, NM				
12. CHECK THE AF	PPROPRIATE BOX(ES)	TO INDICAT	E NATURE O	F NOTICE,	REPORT, OR OTH	ER DATA	
TYPE OF SUBMISSION	TYPE OF ACTION						
Notice of Intent	☐ Acidize	□ Deep	en	☐ Product	ion (Start/Resume)	■ Water Shut-Off	
_	☐ Alter Casing	☐ Hydr	aulic Fracturing	☐ Reclama	ation	■ Well Integrity	
☐ Subsequent Report	Casing Repair	□ New	Construction	☐ Recomp	lete	☐ Other	
☐ Final Abandonment Notice	☐ Change Plans	🔀 Plug	and Abandon	☐ Tempor	arily Abandon		
	☐ Convert to Injection	Plug	Back	☐ Water D	Pisposal		
13. Describe Proposed or Completed Operation: Clearly state all pertinent details, including estimated starting date of any proposed work and approximate duration thereof. If the proposal is to deepen directionally or recomplete horizontally, give subsurface locations and measured and true vertical depths of all pertinent markers and zones. Attach the Bond under which the work will be performed or provide the Bond No. on file with BLM/BIA. Required subsequent reports must be filed within 30 days following completion of the involved operations. If the operation results in a multiple completion or recompletion in a new interval, a Form 3160-4 must be filed once testing has been completed. Final Abandonment Notices must be filed only after all requirements, including reclamation, have been completed and the operator has determined that the site is ready for final inspection. OXY USA WTP LP respectfully requests to plug and abandon the subject well. Due to COVID and the economic environment, OXY requests approval with an estimated date of work for August 2021. The plan is as follows: OXY Chocolate Cookies Federal #002 - 30-015-32145							
	Perfs-9494'-9546'; 11214		2 @ 11183°	055.	ATTAQUED EC) D	
13-3/8"48# csg @ 405' w/ 360sx, 17-1/2" hole, TOC-Surf-Circ		SEE A	SEE ATTACHED FOR				
9-5/8" 36# & 40# csg @ 3203' w/ 1290sx, 12-1/4" hole, TOC-Surf-Circ 5-1/2" 17# csg @ 11650' w/ 755sx, 8-3/4" hole, TOC ~7556'-CBL 2-7/8? tubing @ 9434?					PPROVAL		
14. I hereby certify that the foregoing is Commi Name (Printed/Typed) LESLIE R	#Electronic Submission	'P LIMITED P†I	IRSHIP, sent to AH MCKINNEY o	the Carlsbac	(20DLM0591SE)		
rame(s talled syped) EEGERE (c	LLVLO		THE TEGOL	ATOKT AD	VIOOR		
Signature (Electronic Submission) Date 08/11/2020			020				
ed for record – NMOCD gc 10/2/20	20 THIS SPACE FO	R FEDERA	OR STATE	OFFICE US	SE	392.07032.227	
	011					9-2-20	
Approved By	U. Comos _	1	Title SA	ET		Date	
Conditions of approval, if any, are attached certify that the applicant holds legal or equivalent would entitle the applicant to condu	iitable title to those rights in the	not warrant or subject lease	Office CF	0			
Fitle 19 M C Continu 1001 and Title 42 1	U.S.C. Carrier 1212 it a		an Imaminata and		la de escridencia.		

Fitle 18 U.S.C. Section 1001 and Title 43 U.S.C. Section 1212, make it a crime for any person knowingly and willfully to make to any department or agency of the United States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction.

Accept

Additional data for EC transaction #525052 that would not fit on the form

32. Additional remarks, continued

1. POOH w/ production equipment and tubing.

2. RIH & set CIBP @ 9444', Tag, M&P 65sx class h cmt to 895*- WOC-Tag

3. M&P 25sx class h cmt from 8738' to 8546'-WOC-Tag

4. M&P 25sx class h cmt from 7951' to 7759 WOC-Tag

5. Perf @ 7000', sqz 40sx class c cmt from 7000' to 6000' WOC-Tag

6. Perf @ 4010', sqz 40sx class c cmt from 4010' to 3940' WOC-Tag

7. Perf @ 3253', sqz 90sx class c cmt from 3253' to 3030' WOC-Tag

8. Perf @ 2650', sqz 255sx class c cmt from 2660' to 2020' WOC-Tag

9. Perf @ 500', sqz 200sx class c cmt from 500' to Surface

10# MLF between plugs - Above ground steel tanks will be utilized




OXY USA WTP LP - Current OXY Chocolate Cookies Federal #002 API No. 30-015-32145

> EST T/Sart 466 3/5014 996 Yates 1144 772 1570 Ou 2148 GB 2508 SH 2978 AS 3828

Actual
W(8986
S+ 1035)
A+ 10698

MR 10 857 PBTD-11150'

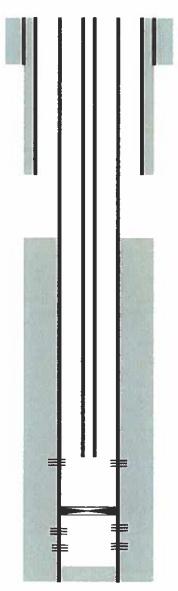

TD - 11650' TVD

Spud 2/16/2002

17-1/2" hole @ 405' / 13-3/8" 48# csg @ 405' w/ 360 sx-TOC-Surf-Circ.

12-1/4" hole @ 3203' 9-5/8" 36# & 40# csg @ 3203' w/ 1290 sx-TOC-Surf-Circ.

8-3/4" hole @ 11650' 5-1/2" 17# csg @ 11650' w/ 755sx TOC ~7556'-CBL

2-7/8" tbg @ 9434'

Perfs 9494' - 9546"

CIBP @ 11183' + 35' c--++
Perfs 11214' - 11447'

OXY USA WTP LP - Proposed OXY Chocolate Cookies Federal #002 API No. 30-015-32145

OXY Chocolate Cookies Federal #002 Perf @ 500', sqz 200sx class c cmt from 500' to surface

Perf @ 2659', sqz 255sx class c cmt 2659' to 2020' WOC-Tag

Perf @ 3253', sqz 90sx class c cmt from 3253' to 3030' WOC-Tag

Perf @ 4010' sqz 40sx class c cmt from 4010' to 3910' WOC-Tag


Perf @ 7000', sqz 40sx class c cmt from 7000' to 6900' WOC - Tag

M&P 25sx class h cmt from 7951' to 7759' - WOC - Tag

M&P 25sx class h cmt from 8738' to 8546' WOC-Tag

CIBP @ 9444', Tag, M&P 65sx class h cmt to 8952' - WOC-Tag

PBTD - 11150'

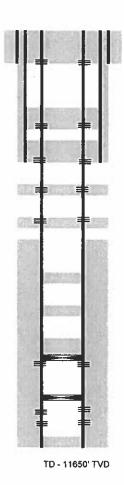

Spud 2/16/2002

17-1/2" hole @ 405' 13-3/8" 48# csg @ 405' w/ 360 sx-TOC-Surf-Circ.

12-1/4" hole @ 3203' 9-5/8" 36# & 40# csg @ 3203' w/ 1290 sx-TOC-Surf-Circ.

8-3/4" hole @ 11650' 5-1/2" 17# csg @ 11650' w/ 755sx TOC ~7556'-CBL

Perfs 9494' - 9546'

CIBP @ 11183' Perfs 11214' - 11447'

BUREAU OF LAND MANAGEMENT Carlsbad Field Office 620 East Greene Street Carlsbad, New Mexico 88220

575-234-5972

Permanent Abandonment of Federal Wells Conditions of Approval

Failure to comply with the following Conditions of Approval may result in a Notice of Incidents of Noncompliance (INC) in accordance with 43 CFR 3163.1.

1. Plugging operations shall commence within <u>ninety (90)</u> days from the approval date of this Notice of Intent to Abandon.

If you are unable to plug the well by the 90th day provide this office, prior to the 90th day, with the reason for not meeting the deadline and a date when we can expect the well to be plugged. Failure to do so will result in enforcement action.

The rig used for the plugging procedure cannot be released and moved off without the prior approval of the authorized officer. Failure to do so may result in enforcement action.

- 2. <u>Notification:</u> Contact the appropriate BLM office at least 24 hours prior to the commencing of any plugging operations. For wells in Chaves and Roosevelt County, call 575-627-0272; Eddy County, call 575-361-2822; Lea County, call 575-393-3612.
- 3. <u>Blowout Preventers</u>: A blowout preventer (BOP), as appropriate, shall be installed before commencing any plugging operation. The BOP must be installed and maintained as per API and manufacturer recommendations. The minimum BOP requirement is a 2M system for a well not deeper than 9,090 feet; a 3M system for a well not deeper than 13,636 feet; and a 5M system for a well not deeper than 22,727 feet.
- 4. <u>Mud Requirement:</u> Mud shall be placed between all plugs. Minimum consistency of plugging mud shall be obtained by mixing at the rate of 25 sacks (50 pounds each) of gel per 100 barrels of brine water. Minimum nine (9) pounds per gallon.
- 5. Cement Requirement: Sufficient cement shall be used to bring any required plug to the specified depth and length. Any given cement volumes on the proposed plugging procedure are merely estimates and are not final. Unless specific approval is received, no plug except the surface plug shall be less than 25 sacks of cement. Any plug that requires a tag will have a minimum WOC time of 4 hours.

In lieu of a cement plug across perforations in a cased hole (not for any other plugs), a bridge plug set within 50 feet to 100 feet above the perforations shall be capped with 25 sacks of cement. If a bailer is used to cap this plug, 35 feet of cement shall be sufficient. Before pumping or bailing cement on top of CIBP, tag will be required to verify depth. Based on depth, a tag of the cement may be deemed necessary.

			2	
		SK		
\$7)				

Unless otherwise specified in the approved procedure, the cement plug shall consist of either Neat Class "C", for up to 7,500 feet of depth or Neat Class "H", for deeper than 7,500 feet plugs.

6. Dry Hole Marker: All casing shall be cut-off at the base of the cellar or 3 feet below final restored ground level (whichever is deeper). The BLM is to be notified a minimum of 4 hours prior to the wellhead being cut off to verify that cement is to surface in the casing and all annuluses. Wellhead cut off shall commence within ten (10) calendar days of the well being plugged. If the cut off cannot be done by the 10th day, the BLM is to be contacted with justification to receive an extension for completing the cut off.

The well bore shall then be capped with a 4-inch pipe, 10-feet in length, 4 feet above ground and embedded in cement, unless otherwise noted in COA (requirements will be attached). The following information shall be permanently inscribed on the dry hole marker: well name and number, name of the operator, lease serial number, surveyed location (quarter-quarter section, section, township and range or other authorized survey designation acceptable to the authorized officer such as metes and bounds).

- 7. <u>Subsequent Plugging Reporting:</u> Within 30 days after plugging work is completed, file one original and three copies of the Subsequent Report of Abandonment, Form 3160-5 to BLM. The report should give in detail the manner in which the plugging work was carried out, the extent (by depths) of cement plugs placed, and the size and location (by depths) of casing left in the well. **Show date well was plugged.**
- 8. <u>Trash</u>: All trash, junk and other waste material shall be contained in trash cages or bins to prevent scattering and will be removed and deposited in an approved sanitary landfill. Burial on site is not permitted.

Following the submission and approval of the Subsequent Report of Abandonment, surface restoration will be required. See attached reclamation objectives.