

Submit 3 Copies To Appropriate District
Office
District I
1625 N. French Dr., Hobbs, NM 87240
District II
811 South First, Artesia, NM 87210
District III
1000 Rio Brazos Rd., Aztec, NM 87410
District IV
2040 South Pacheco, Santa Fe, NM 87505

State of New Mexico
Energy, Minerals and Natural Resources

Form C-103
Revised March 25, 1999

OIL CONSERVATION DIVISION
2040 South Pacheco
Santa Fe, NM 87505

WELL API NO.

30-007-20206

5. Indicate Type of Lease

STATE ☐ FEE ☒

6. State Oil & Gas Lease No.

7. Lease Name or Unit Agreement Name:

VPR A

8. Well No. 56

9. Pool name or Wildcat

SUNDRY NOTICES AND REPORTS ON WELLS

(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)

1. Type of Well:

Oil Well ☐ Gas Well ☒ Other ☒ Coalbed Methane

2. Name of Operator

EL PASO ENERGY RATON, L.L.C.

3. Address of Operator

PO BOX 190 RATON, NM 87740

4. Well Location

Unit Letter P : 646' feet from the South line and 1151' feet from the East line

Section 23 Township 32N Range 20E NMPM Colfax County

10. Elevation (Show whether DR, RKB, RT, GR, etc.)

7674' (GR)

11. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☒

TEMPORARILY ABANDON ☐ CHANGE PLANS ☐

PULL OR ALTER CASING ☐ MULTIPLE COMPLETION ☐

OTHER: ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐ ALTERING CASING ☐

COMMENCE DRILLING OPNS. ☐ PLUG AND ABANDONMENT ☐

CASING TEST AND CEMENT JOB ☐

OTHER: ☐

12. Proposed procedure for P & A:

- 1) Spot balanced 100' cement plug from 1925 to 1825' (across bottom set of perf's from 1833' - 1855', frac stage 1, but not across perf's from 1786 to 1810'). Let set up.
 - 2) Set retainer @ 1650'. Pump cement into perforations at 1786-1810' and the channel up the backside. Volumes to be determined.
 - 3) Spot 50'+ of cement on top of retainer.
 - 4) Fill hole with 9#/gal. mud containing corrosion inhibitor as request by state of NM
 - 5) Set CIBP @ 1050' (below Raton perforations from 934' to 1016').
 - 6) Spot 300' cement plug from 1050' to 750'.
 - 7) Fill hole with 9#/gal. mud containing corrosion inhibitor as request by state of NM
 - 8) Spot approx. 350' cement plug back to surface.
 - 9) Dress off surface plug, cut off casing to required depth (3' below ground level), weld on plate, and install marker with
El Paso, VPRA56, 646'FSL, 1151'FEL, Sec. 23-32N-20E
API No. 30-007-20206
as required by New Mexico Oil & Gas Conservation Division.
 - 10) File reports as required by New Mexico Oil & Gas Conservation Division.
- I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE DR Lankford TITLE Engineer DATE 03/19/02


Type or print name Donald R. Lankford Telephone No. (505) 445-6721
(This space for State use)

APPROVED BY [Signature] TITLE DISTRICT SUPERVISOR DATE 3/21/02
Conditions of approval, if any:

Operator	El Paso Energy Raton LLC	Well Name:	VPRA-56
		API #	30-007-20206
Surface Elevation		Location (qtr,qtr)	SE/4
		Sec, Twp, Rng,	23-T32N-20E
Vermejo Producing Formation		Footage Loc.	646' FSL, 1151'FEL

Wellbore Diagram

Top of Cement
Surface

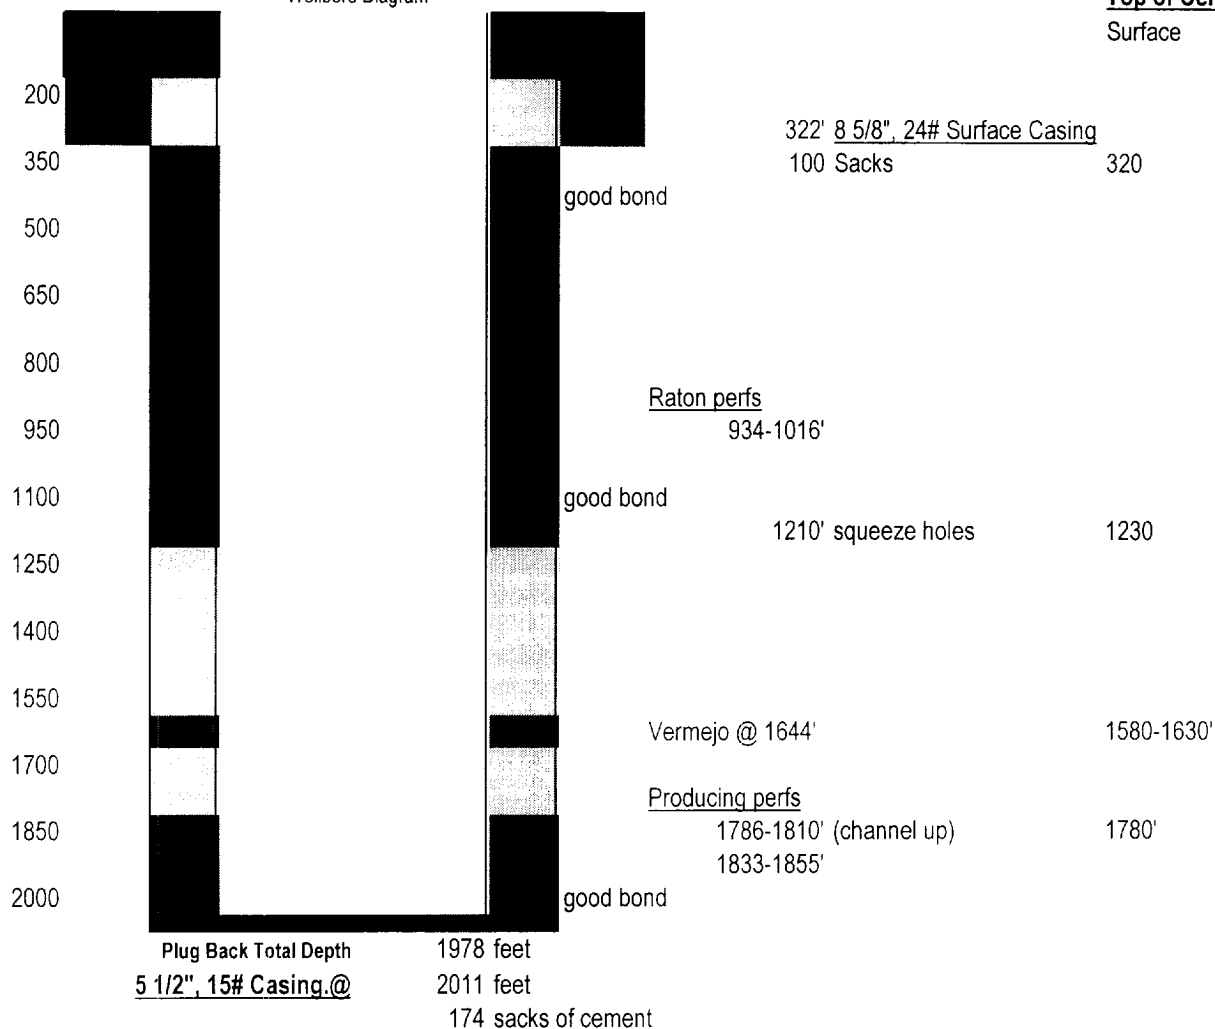

Operator El Paso Energy Raton LLC

Well Name:

VPRA-56

Surface Elevation

7674'

Vermejo Producing Formation

API #

30-007-20206

Location (qtr,qtr)

SE/4

Sec, Twp, Rng,

23-T32N-20E

Footage Loc.

646' FSL, 1151'FEL

**Proposed
Wellbore Diagram**

**Top of Cement
Surface**

