


District I  
1625 N. French Dr., Hobbs, NM 88240  
District II  
811 South First, Artesia, NM 88210  
District III  
1000 Rio Brazos Rd., Aztec, NM 87410  
District IV  
1220 S. St. Francis Dr., Santa Fe, NM 87505

State of New Mexico  
Energy, Minerals and Natural Resources

Form C-103  
Revised March 25, 1999

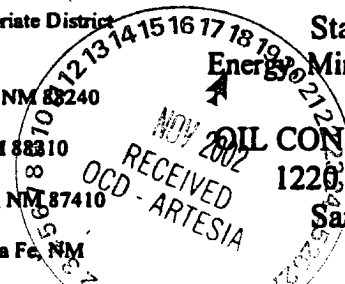

OIL CONSERVATION DIVISION  
1220 South St. Francis Dr.  
Santa Fe, NM 87505

WELL API NO. 30-015-23350
5. Indicate Type of Lease STATE <input checked="" type="checkbox"/> FEE <input type="checkbox"/>
6. State Oil & Gas Lease No. B11594-6
7. Lease Name or Unit Agreement Name: State B 14 Com
8. Well No. 1
9. Pool name or Wildcat Loco Hills Wolfcamp

**SUNDRY NOTICES AND REPORTS ON WELLS**  
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)

1. Type of Well: Oil Well <input type="checkbox"/> Gas Well <input type="checkbox"/> Other Plug & Abandon
2. Name of Operator H.E.C. Petroleum, Inc.
3. Address of Operator 500 W. Illinois - Midland, TX 79701

4. Well Location Unit Letter <u>P</u> : <u>660</u> feet from the <u>South</u> line and <u>990</u> feet from the <u>East</u> line Section <u>14</u> Township <u>18S</u> Range <u>28E</u> NMPM <u>Eddy</u> County	10. Elevation (Show whether DR, RKB, RT, GR, etc.) 3539.5' GR
---	--

11. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data

<b>NOTICE OF INTENTION TO:</b> PERFORM REMEDIAL WORK <input type="checkbox"/> PLUG AND ABANDON <input type="checkbox"/> TEMPORARILY ABANDON <input type="checkbox"/> CHANGE PLANS <input type="checkbox"/> PULL OR ALTER CASING <input type="checkbox"/> MULTIPLE COMPLETION <input type="checkbox"/> OTHER: <input type="checkbox"/>	<b>SUBSEQUENT REPORT OF:</b> REMEDIAL WORK <input type="checkbox"/> ALTERING CASING <input type="checkbox"/> COMMENCE DRILLING OPNS. <input type="checkbox"/> PLUG AND ABANDONMENT <input checked="" type="checkbox"/> CASING TEST AND CEMENT JOB <input type="checkbox"/> OTHER: <input type="checkbox"/>
---	--

12. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion.

11-1-2002 - Moved in and rigged up pulling unit and plugging equipment.  
 11-2-4-02 - Blew well down. Nippled down wellhead and nipped up BOP. Rigged up tubing equipment. Tried to release packer. Shut well in for night.  
 11-5-2002 - Released packer. TOOH with tubing and packer. Shut well in for night.  
 11-6-2002 - RIH with tubing and set CIBP at 9000'. Pulled up hole. Circulated hole with plugging mud. Spotted 5 sacks Class C Neat cement on top of CIBP (9000-8949'). POOH. Shut well in for night.  
 11-7-2002 - RIH to 4450'. Spotted 25 sacks Class C Neat cement from 4450-4197'. POOH with tubing. Rigged down tubing equipment and nipped down BOP. Nippled down wellhead. Shut well in for night.  
 11-8-2002 - Rigged up wireline. RIH and stacked out at 2480'. POOH and rigged down wireline. Nippled up wellhead and BOP. Rigged up tubing equipment. RIH with tubing open ended and fell thru at 2480'. RIH to 4450' - did not tag cement. Spotted 25 sacks Class C Neat cement from 4450-4197'. POOH with tubing. WOC. Shut well in for night.

CONTINUED ON NEXT PAGE:

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE Rusty Klein TITLE Agent for BCM & Associates DATE Nov. 14, 2002  
 Type or print name Rusty Klein Telephone No. 505-748-2159  
 (This space for State use)  
 APPROVED BY [Signature] TITLE Wild Leg ID DATE MAR 24 2003  
 Conditions of approval, if any:

H.E.C. CORPORATION  
State B 14 Com #1  
Section 14-T18S-R28E  
Eddy County, New Mexico

SUNDRY NOTICE CONTINUED:

11-9-11-2002 - RIH with tubing and tagged cement at 4156'. POOH with tubing. Rigged down tubing equipment. Nippled down BOP and wellhead. Rigged up wireline. RIH and cut 5-1/2" casing at 3122'. POOH and rigged down wireline. Rigged up casing equipment. Worked casing free. POOH with 63 joints of 5-1/2" casing. Shut well in for night.  
11-12-2002 - Finished laying down 5-1/2" casing (total of 81 joints). Rigged down casing equipment. Nippled up wellhead and BOP. Rigged up tubing equipment. RIH with 2-3/8" tubing open ended to 3177'. Spotted 50 sacks Class C Neat cement from 3177-2965'. POOH. WOC 4 hours. RIH with tubing and tagged cement at 2958'. POOH. Shut well in for night.  
11-13-2002 - RIH to 947'. Spotted 45 sacks Class C Neat cement from 947-737'. POOH. WOC 4 hours. RIH with tubing and tagged cement at 779'. Pulled up hole to 519'. Spotted 45 sacks Class C Neat cement from 519-319'. POOH. WOC. Shut well in for night.  
11-14-2002 - RIH with tubing and tagged cement at 354'. POOH and rigged down tubing equipment. Nippled down BOP. RIH with tubing to 60'. Circulated 15 sacks Class C Neat cement. POOH. Nippled down wellhead. Rigged down pulling unit and plugging equipment. Installed regulation abandonment marker. PLUGGED AND ABANDONED - FINAL REPORT. Plugging completed 11-13-2002.



Rusty Klein  
Agent for BCM & Associates  
November 14, 2002