Rec'd 09/01/2020 - NMOCD

| Form | 3160-3 |
|-------|--------|
| (June | 2015) |

FORM APPROVED


| (June 2015) | | | Expires: January | | | | | | |
|----------------------------------------------------------------------------------------------------------------------------------------|--------------------------------|---------------|-------------------------------------------------------|-------------------|--|--|--|--|--|
| UNITED STAT DEPARTMENT OF THE BUREAU OF LAND MAI | INTERIOR | | 5. Lease Serial No. NMNM059386 | | | | | | |
| APPLICATION FOR PERMIT TO | DRILL OR REENTER | | 6. If Indian, Allotee or Tribe Name | | | | | | |
| la. Type of work: | REENTER | | 7. If Unit or CA Agreeme | nt, Name and No. | | | | | |
| 1b. Type of Well: 🔽 Oil Well 🗌 Gas Well | Other | | 8. Lease Name and Well 1 | No | | | | | |
| 1c. Type of Completion: Hydraulic Fracturing | Single Zone Multiple Zone | • | CORRAL CANYON 36- | | | | | | |
| | _ | | 5H | | | | | | |
| 2. Name of Operator OXY USA INCORPORATED | | | 9. API Well No. 30 015 47388 | | | | | | |
| 3a. Address | 3b. Phone No. (include area of | code) | 10. Field and Pool, or Exploratory | | | | | | |
| 5 Greenway Plaza, Suite 110 Houston TX 77046 | (713)366-5716 | | PIERCE CROSSING BONE SPRING, EA | | | | | | |
| Location of Well (Report location clearly and in accordance At surface LOT 2 / 200 FNL / 2070 FEL / LAT 32.160 | <i>y</i> 1 <i>y</i> | | 11. Sec., T. R. M. or Blk. SEC 1 / T25S / R29E / I | ~ | | | | | |
| At proposed prod. zone NENE / 20 FNL / 1260 FEL / L | AT 32.195589 / LONG -103.93 | 33547 | | | | | | | |
| 14. Distance in miles and direction from nearest town or post of 8 miles | office* | | 12. County or Parish EDDY | 13. State NM | | | | | |
| 15. Distance from proposed* 20 feet | 16. No of acres in lease | 17. Spac | ing Unit dedicated to this we | ell | | | | | |
| location to nearest 20 leet property or lease line, ft. (Also to nearest drig. unit line, if any) | 240 | 640 | | | | | | | |
| 18. Distance from proposed location* | 19. Proposed Depth | 20. BLM | /BIA Bond No. in file | | | | | | |
| to nearest well, drilling, completed, applied for, on this lease, ft. 35 feet | 7982 feet / 18889 feet | FED: ES | SB000226 | | | | | | |
| 21. Elevations (Show whether DF, KDB, RT, GL, etc.) | 22. Approximate date work w | vill start* | 23. Estimated duration | | | | | | |
| 3127 feet | 06/15/2021 | | 20 days | | | | | | |
| | 24. Attachments | | | | | | | | |
| The following, completed in accordance with the requirements (as applicable) | of Onshore Oil and Gas Order N | o. 1, and the | Hydraulic Fracturing rule pe | r 43 CFR 3162.3-3 | | | | | |

| Well plat certified by a registered surveyor. A Drilling Plan. A Surface Use Plan (if the location is on National Forest System Lan SUPO must be filed with the appropriate Forest Service Office). | Bond to cover the operations unless covere Item 20 above). Operator certification. Such other site specific information and/or p BLM. | | | | | | |
|-----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-----------------------------------------------------|------------------------------|--|--|--|--|
| 25. Signature | Name | (Printed/Typed) | Date | | | | |
| (Electronic Submission) | David | David Stewart / Ph: (713)366-5716 07/17/20 | | | | | |
| Title Sr. Regulatory Advisor | | | | | | | |
| Approved by (Signature) | Name | (Printed/Typed) | Date | | | | |
| (Electronic Submission) | Cody | Layton / Ph: (575)234-5959 | 08/28/2020 | | | | |
| Title | Office | | | | | | |
| Assistant Field Manager Lands & Minerals | CARL | SBAD | | | | | |
| Application approval does not warrant or certify that the applicant hold applicant to conduct operations thereon. | s legal o | or equitable title to those rights in the subject h | ease which would entitle the | | | | |

Conditions of approval, if any, are attached.

Title 18 U.S.C. Section 1001 and Title 43 U.S.C. Section 1212, make it a crime for any person knowingly and willfully to make to any department or agency of the United States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction.



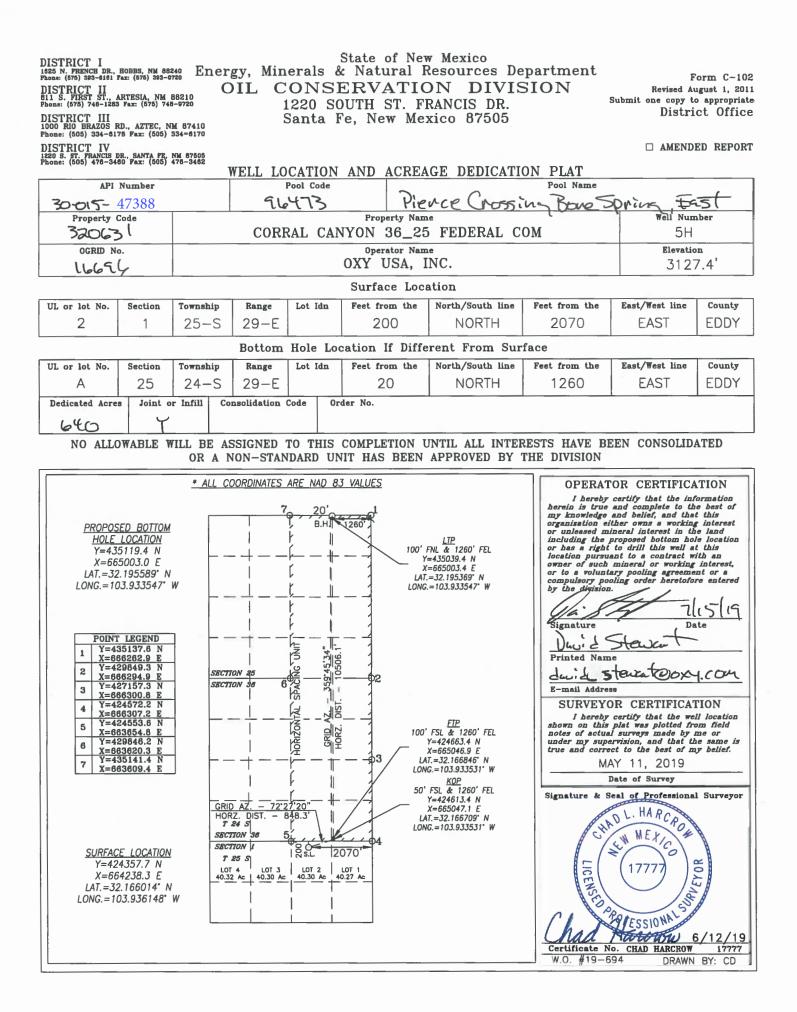

Oil Conservation Division 1220 South St. Francis Dr. Santa Fe, NM 87505

GAS CAPTURE PLAN

Date: 07/10/2019

 \boxtimes Original

Operator & OGRID No.: OXY USA INC. - 16696

□ Amended - Reason for Amendment:

This Gas Capture Plan outlines actions to be taken by the Operator to reduce well/production facility flaring/venting for new completion (new drill, recomplete to new zone, re-frac) activity.

Note: Form C-129 must be submitted and approved prior to exceeding 60 days allowed by Rule (Subsection A of 19.15.18.12 NMAC).

Well(s)/Production Facility – Name of facility

The well(s) that will be located at the production facility are shown in the table below.

| Well Name | API | Well Location (ULSTR) | Footages | Expected MCF/D | Flared or Vented | Comments |
|--------------------------------|---------|-----------------------------|------------------|-------------------|---------------------|----------|
| Corral Canyon 36-25 Fd Com 3H | Pending | 2-1-25S-29E | 200 FNL 2170 FEL | 3,100 | 0 | |
| Corral Canyon 36-25 Fd Com 4H | Pending | 2-1-25S-29E | 200 FNL 2105 FEL | 3,100 | 0 | |
| Corral Canyon 36-25 Fd Com 5H | Pending | 2-1-25S-29E | 200 FNL 2070 FEL | 3,100 | 0 | |
| Corral Canyon 36-25 Fd Com 13H | Pending | 2-1-25S-29E | 200 FNL 2140 FEL | 3,900 | 0 | |

Gathering System and Pipeline Notification

Well(s) will be connected to a production facility after flowback operations are complete, where a gas transporter system is in place. The gas produced from the production facility is sent to <u>ETC Texas Pipeline, LTD ("ETC"</u>) and is connected to <u>ETC</u> high pressure gathering system located in Eddy County, New Mexico. <u>OXY USA INC. ("OXY"</u>) provides (periodically) to <u>ETC</u> a drilling, completion and estimated first production date for wells that are scheduled to be drilled in the foreseeable future. In addition, <u>OXY</u> and <u>ETC</u> have periodic conference calls to discuss changes to drilling and completion schedules. Gas from these wells will be processed at Orla Plant Processing Plant located in Sec. 35, Block 57, T2, T&P RR CO, Reeves, County, Texas. The actual flow of the gas will be based on compression operating parameters and gathering system pressures.

Flowback Strategy

After the fracture treatment/completion operations, well(s) will be produced to temporary production tanks and gas will be flared or vented. During flowback, the fluids and sand content will be monitored. When the produced fluids contain minimal sand, the wells will be turned to production facilities. Gas sales should start as soon as the wells start flowing through the production facilities, unless there are operational issues on <u>Enterprise</u> system at that time. Based on current information, it is <u>OXY's</u> belief the system can take this gas upon completion of the well(s).

Safety requirements during cleanout operations from the use of underbalanced air cleanout systems may necessitate that sand and non-pipeline quality gas be vented and/or flared rather than sold on a temporary basis.

Alternatives to Reduce Flaring

Below are alternatives considered from a conceptual standpoint to reduce the amount of gas flared.

- Power Generation On lease
 - Only a portion of gas is consumed operating the generator, remainder of gas will be flared
- Compressed Natural Gas On lease
 - Gas flared would be minimal, but might be uneconomical to operate when gas volume declines
- NGL Removal On lease
 - o Plants are expensive, residue gas is still flared, and uneconomical to operate when gas volume declines

PECOS DISTRICT DRILLING CONDITIONS OF APPROVAL

| OPERATOR'S NAME: | OXY USA INCORPORATED |
|----------------------------|----------------------------------|
| LEASE NO.: | NMNM059386 |
| WELL NAME & NO.: | 5H – CORRAL CANYON 36-25 FED COM |
| SURFACE HOLE FOOTAGE: | 200'/N & 2070'/E |
| BOTTOM HOLE FOOTAGE | 20'/N & 1260'/E |
| LOCATION: | SECTION 1, T25S, R29E, NMPM |
| COUNTY: | EDDY |

COA

| H2S | C Yes | 🖸 No | |
|----------------------|------------------|----------------|------------|
| Potash | None | C Secretary | © R-111-P |
| Cave/Karst Potential | • Low | C Medium | C High |
| Cave/Karst Potential | Critical | | |
| Variance | C None | • Flex Hose | C Other |
| Wellhead | Conventional | C Multibowl | Soth |
| Other | □4 String Area | Capitan Reef | □ WIPP |
| Other | Fluid Filled | Cement Squeeze | Pilot Hole |
| Special Requirements | 🗆 Water Disposal | COM | 🗖 Unit |

A. HYDROGEN SULFIDE

Hydrogen Sulfide (H2S) monitors shall be installed prior to drilling out the surface shoe. If H2S is detected in concentrations greater than 100 ppm, the Hydrogen Sulfide area shall meet Onshore Order 6 requirements, which includes equipment and personnel/public protection items. If Hydrogen Sulfide is encountered, provide measured values and formations to the BLM.

B. CASING

Casing Design:

- 1. The **10-3/4** inch surface casing shall be set at approximately **798** feet (a minimum of **70 feet (Eddy County)** into the Rustler Anhydrite and above the salt) and cemented to the surface.
 - a. If cement does not circulate to the surface, the appropriate BLM office shall be notified and a temperature survey utilizing an electronic type temperature survey with surface log readout will be used or a cement bond log shall be run to verify the top of the cement. Temperature survey will be run a minimum of six hours after pumping cement and ideally between 8-10 hours after

Page 1 of 9

completing the cement job.

- b. Wait on cement (WOC) time for a primary cement job will be a minimum of <u>8</u>
 <u>hours</u> or 500 pounds compressive strength, whichever is greater. (This is to include the lead cement)
- c. Wait on cement (WOC) time for a remedial job will be a minimum of 4 hours after bringing cement to surface or 500 pounds compressive strength, whichever is greater.
- d. If cement falls back, remedial cementing will be done prior to drilling out that string.
- 2. The **7-5/8** inch intermediate casing shall be set at approximately **7475** feet. The minimum required fill of cement behind the **7-5/8** inch intermediate casing is:

Option 1 (Single Stage):

• Cement to surface. If cement does not circulate see B.1.a, c-d above. Wait on cement (WOC) time for a primary cement job is to include the lead cement slurry due to cave/karst or potash.

Option 2:

Operator has proposed a DV tool, the depth may be adjusted as long as the cement is changed proportionally. The DV tool may be cancelled if cement circulates to surface on the first stage.

- a. First stage to DV tool: Cement to circulate. If cement does not circulate off the DV tool, contact the appropriate BLM office before proceeding with second stage cement job.
- b. Second stage above DV tool:
 - Cement to surface. If cement does not circulate, contact the appropriate BLM office.
 Wait on cement (WOC) time for a primary cement job is to include the lead cement slurry due to cave/karst or potash.

Operator has proposed to pump down 10-3/4" X 7-5/8" annulus. <u>Operator must run</u> a CBL from TD of the 7-5/8" casing to surface. Submit results to BLM.

3. The minimum required fill of cement behind the 5-1/2 inch production casing is:

Option 1 (Single Stage):

• Cement should tie-back at least **200 feet** into previous casing string. Operator shall provide method of verification.

Page 2 of 9

Option 2:

Operator has proposed a DV tool, the depth may be adjusted as long as the cement is changed proportionally. The DV tool may be cancelled if cement circulates to surface on the first stage.

- a. First stage to DV tool: Cement to circulate. If cement does not circulate off the DV tool, contact the appropriate BLM office before proceeding with second stage cement job.
- b. Second stage above DV tool:
 - Cement should tie-back at least **200 feet** into previous casing string. Operator shall provide method of verification.

C. PRESSURE CONTROL

1. Variance approved to use flex line from BOP to choke manifold. Manufacturer's specification to be readily available. No external damage to flex line. Flex line to be installed as straight as possible (no hard bends).'

2.

Option 1:

- a. Minimum working pressure of the blowout preventer (BOP) and related equipment (BOPE) required for drilling below the surface casing shoe shall be **3000 (3M)** psi.
- b. Minimum working pressure of the blowout preventer (BOP) and related equipment (BOPE) required for drilling below the intermediate casing shoe shall be **3000** (**3M**) psi.

Option 2:

- 1. Operator has proposed a multi-bowl wellhead assembly. This assembly will only be tested when installed on the surface casing. Minimum working pressure of the blowout preventer (BOP) and related equipment (BOPE) required for drilling below the surface casing shoe shall be **3000** (**3M**) psi.
 - a. Wellhead shall be installed by manufacturer's representatives, submit documentation with subsequent sundry.
 - b. If the welding is performed by a third party, the manufacturer's representative shall monitor the temperature to verify that it does not exceed the maximum temperature of the seal.
 - c. Manufacturer representative shall install the test plug for the initial BOP test.

Page 3 of 9

- d. If the cement does not circulate and one inch operations would have been possible with a standard wellhead, the well head shall be cut off, cementing operations performed and another wellhead installed.
- e. Whenever any seal subject to test pressure is broken, all the tests in OOGO2.III.A.2.i must be followed.

D. SPECIAL REQUIREMENT (S)

Communitization Agreement

- The operator will submit a Communitization Agreement to the Santa Fe Office, 301 Dinosaur Trail Santa Fe, New Mexico 87508, at least 90 days before the anticipated date of first production from a well subject to a spacing order issued by the New Mexico Oil Conservation Division. The Communitization Agreement will include the signatures of all working interest owners in all Federal and Indian leases subject to the Communitization Agreement (i.e., operating rights owners and lessees of record), or certification that the operator has obtained the written signatures of all such owners and will make those signatures available to the BLM immediately upon request.
- If the operator does not comply with this condition of approval, the BLM may take enforcement actions that include, but are not limited to, those specified in 43 CFR 3163.1.
- In addition, the well sign shall include the surface and bottom hole lease numbers. <u>When the Communitization Agreement number is known, it shall also be on the sign.</u>

Offline Cementing

Contact the BLM prior to the commencement of any offline cementing procedure.

BOP Break Testing Variance

• BOP break testing is not permitted on this well pending submittion of break testing sundry.

Page 4 of 9

GENERAL REQUIREMENTS

The BLM is to be notified in advance for a representative to witness:

- a. Spudding well (minimum of 24 hours)
- b. Setting and/or Cementing of all casing strings (minimum of 4 hours)
- c. BOPE tests (minimum of 4 hours)
 - Eddy County Call the Carlsbad Field Office, 620 East Greene St., Carlsbad, NM 88220, (575) 361-2822
 - Lea County
 Call the Hobbs Field Station, 414 West Taylor, Hobbs NM 88240, (575) 393-3612
- 1. Unless the production casing has been run and cemented or the well has been properly plugged, the drilling rig shall not be removed from over the hole without prior approval.
 - a. In the event the operator has proposed to drill multiple wells utilizing a skid/walking rig. Operator shall secure the wellbore on the current well, after installing and testing the wellhead, by installing a blind flange of like pressure rating to the wellhead and a pressure gauge that can be monitored while drilling is performed on the other well(s).
 - b. When the operator proposes to set surface casing with Spudder Rig
 - Notify the BLM when moving in and removing the Spudder Rig.
 - Notify the BLM when moving in the 2nd Rig. Rig to be moved in within 90 days of notification that Spudder Rig has left the location.
 - BOP/BOPE test to be conducted per Onshore Oil and Gas Order No. 2 as soon as 2nd Rig is rigged up on well.
- 2. Floor controls are required for 3M or Greater systems. These controls will be on the rig floor, unobstructed, readily accessible to the driller and will be operational at all times during drilling and/or completion activities. Rig floor is defined as the area immediately around the rotary table; the area immediately above the substructure on which the draw works are located, this does not include the dog house or stairway area.
- 3. The record of the drilling rate along with the GR/N well log run from TD to surface (horizontal well vertical portion of hole) shall be submitted to the BLM office as well as all other logs run on the borehole 30 days from completion. If available, a digital copy of the logs is to be submitted in addition to the paper copies. The Rustler top and top and bottom of Salt are to be recorded on the Completion Report.

A. CASING

- 1. Changes to the approved APD casing program need prior approval if the items substituted are of lesser grade or different casing size or are Non-API. The Operator can exchange the components of the proposal with that of superior strength (i.e. changing from J-55 to N-80, or from 36# to 40#). Changes to the approved cement program need prior approval if the altered cement plan has less volume or strength or if the changes are substantial (i.e. Multistage tool, ECP, etc.). The initial wellhead installed on the well will remain on the well with spools used as needed.
- Wait on cement (WOC) for Potash Areas: After cementing but before commencing any tests, the casing string shall stand cemented under pressure until both of the following conditions have been met: 1) cement reaches a minimum compressive strength of 500 psi for all cement blends, 2) until cement has been in place at least <u>24</u> <u>hours</u>. WOC time will be recorded in the driller's log. The casing intergrity test can be done (prior to the cement setting up) immediately after bumping the plug.
- 3. <u>Wait on cement (WOC) for Water Basin:</u> After cementing but before commencing any tests, the casing string shall stand cemented under pressure until both of the following conditions have been met: 1) cement reaches a minimum compressive strength of 500 psi at the shoe, 2) until cement has been in place at least <u>8 hours</u>. WOC time will be recorded in the driller's log. See individual casing strings for details regarding lead cement slurry requirements. The casing intergrity test can be done (prior to the cement setting up) immediately after bumping the plug.
- 4. Provide compressive strengths including hours to reach required 500 pounds compressive strength prior to cementing each casing string. Have well specific cement details onsite prior to pumping the cement for each casing string.
- 5. No pea gravel permitted for remedial or fall back remedial without prior authorization from the BLM engineer.
- 6. On that portion of any well approved for a 5M BOPE system or greater, a pressure integrity test of each casing shoe shall be performed. Formation at the shoe shall be tested to a minimum of the mud weight equivalent anticipated to control the formation pressure to the next casing depth or at total depth of the well. This test shall be performed before drilling more than 20 feet of new hole.
- 7. If hardband drill pipe is rotated inside casing, returns will be monitored for metal. If metal is found in samples, drill pipe will be pulled and rubber protectors which have a larger diameter than the tool joints of the drill pipe will be installed prior to continuing drilling operations.
- 8. Whenever a casing string is cemented in the R-111-P potash area, the NMOCD requirements shall be followed.

Page 6 of 9

B. PRESSURE CONTROL

- 1. All blowout preventer (BOP) and related equipment (BOPE) shall comply with well control requirements as described in Onshore Oil and Gas Order No. 2 and API RP 53 Sec. 17.
- 2. If a variance is approved for a flexible hose to be installed from the BOP to the choke manifold, the following requirements apply: The flex line must meet the requirements of API 16C. Check condition of flexible line from BOP to choke manifold, replace if exterior is damaged or if line fails test. Line to be as straight as possible with no hard bends and is to be anchored according to Manufacturer's requirements. The flexible hose can be exchanged with a hose of equal size and equal or greater pressure rating. Anchor requirements, specification sheet and hydrostatic pressure test certification matching the hose in service, to be onsite for review. These documents shall be posted in the company man's trailer and on the rig floor.
- 3. 5M or higher system requires an HCR valve, remote kill line and annular to match. The remote kill line is to be installed prior to testing the system and tested to stack pressure.
- 4. If the operator has proposed a multi-bowl wellhead assembly in the APD. The following requirements must be met:
 - a. Wellhead shall be installed by manufacturer's representatives, submit documentation with subsequent sundry.
 - b. If the welding is performed by a third party, the manufacturer's representative shall monitor the temperature to verify that it does not exceed the maximum temperature of the seal.
 - c. Manufacturer representative shall install the test plug for the initial BOP test.
 - d. Whenever any seal subject to test pressure is broken, all the tests in OOGO2.III.A.2.i must be followed.
 - e. If the cement does not circulate and one inch operations would have been possible with a standard wellhead, the well head shall be cut off, cementing operations performed and another wellhead installed.
- 5. The appropriate BLM office shall be notified a minimum of 4 hours in advance for a representative to witness the tests.
 - a. In a water basin, for all casing strings utilizing slips, these are to be set as soon as the crew and rig are ready and any fallback cement remediation has been done. The casing cut-off and BOP installation can be initiated four hours after installing the slips, which will be approximately six hours after bumping the plug. For those casing strings not using slips, the minimum wait time before cut-off is eight hours after bumping the plug. BOP/BOPE testing can begin after cut-off or once cement reaches 500 psi compressive strength (including

lead when specified), whichever is greater. However, if the float does not hold, cut-off cannot be initiated until cement reaches 500 psi compressive strength (including lead when specified).

- b. In potash areas, for all casing strings utilizing slips, these are to be set as soon as the crew and rig are ready and any fallback cement remediation has been done. For all casing strings, casing cut-off and BOP installation can be initiated at twelve hours after bumping the plug. However, **no tests** shall commence until the cement has had a minimum of 24 hours setup time, except the casing pressure test can be initiated immediately after bumping the plug (only applies to single stage cement jobs).
- c. The tests shall be done by an independent service company utilizing a test plug not a cup or J-packer. The operator also has the option of utilizing an independent tester to test without a plug (i.e. against the casing) pursuant to Onshore Order 2 with the pressure not to exceed 70% of the burst rating for the casing. Any test against the casing must meet the WOC time for water basin (8 hours) or potash (24 hours) or 500 pounds compressive strength, whichever is greater, prior to initiating the test (see casing segment as lead cement may be critical item).
- d. The test shall be run on a 5000 psi chart for a 2-3M BOP/BOP, on a 10000 psi chart for a 5M BOP/BOPE and on a 15000 psi chart for a 10M BOP/BOPE. If a linear chart is used, it shall be a one hour chart. A circular chart shall have a maximum 2 hour clock. If a twelve hour or twenty-four hour chart is used, tester shall make a notation that it is run with a two hour clock.
- e. The results of the test shall be reported to the appropriate BLM office.
- f. All tests are required to be recorded on a calibrated test chart. A copy of the BOP/BOPE test chart and a copy of independent service company test will be submitted to the appropriate BLM office.
- g. The BOP/BOPE test shall include a low pressure test from 250 to 300 psi. The test will be held for a minimum of 10 minutes if test is done with a test plug and 30 minutes without a test plug. This test shall be performed prior to the test at full stack pressure.
- h. BOP/BOPE must be tested by an independent service company within 500 feet of the top of the Wolfcamp formation if the time between the setting of the intermediate casing and reaching this depth exceeds 20 days. This test does not exclude the test prior to drilling out the casing shoe as per Onshore Order No. 2.

C. DRILLING MUD

Mud system monitoring equipment, with derrick floor indicators and visual and audio alarms, shall be operating before drilling into the Wolfcamp formation, and shall be used until production casing is run and cemented.

D. WASTE MATERIAL AND FLUIDS

All waste (i.e. drilling fluids, trash, salts, chemicals, sewage, gray water, etc.) created as a result of drilling operations and completion operations shall be safely contained and disposed of properly at a waste disposal facility. No waste material or fluid shall be disposed of on the well location or surrounding area.

Porto-johns and trash containers will be on-location during fracturing operations or any other crew-intensive operations.

NMK08102020

Page 9 of 9

WAFMSS

U.S. Department of the Interior BUREAU OF LAND MANAGEMENT

APD ID: 10400043733

Operator Name: OXY USA INCORPORATED Well Name: CORRAL CANYON 36-25 FED COM Well Type: OIL WELL

Submission Date: 07/17/2019

Zip: 77046

Well Number: 5H Well Work Type: Drill Highlighted data reflects the most recent changes

08/31/2020

Application Data Report

Show Final Text

| Section 1 - General | | |
|------------------------------------|------------------------------|-----------------------------------------|
| APD ID: 10400043733 | Tie to previous NOS? | Submission Date: 07/17/2019 |
| BLM Office: CARLSBAD | User: Jana Lyn A. Mendiola | a Title: Regulatory Coordinator |
| Federal/Indian APD: FED | Is the first lease penetrate | d for production Federal or Indian? FED |
| Lease number: NMNM059386 | Lease Acres: 240 | |
| Surface access agreement in place? | Allotted? | Reservation: |
| Agreement in place? NO | Federal or Indian agreeme | ent: |
| Agreement number: | | |
| Agreement name: | | |
| Keep application confidential? NO | | |
| Permitting Agent? NO | APD Operator: OXY USA I | NCORPORATED |
| Operator letter of designation: | | |

Operator Info

Operator Organization Name: OXY USA INCORPORATED Operator Address: 5 Greenway Plaza, Suite 110 Operator PO Box: Operator City: Houston State: TX Operator Phone: (713)366-5716

Operator Internet Address:

Section 2 - Well Information

Well in Master Development Plan? NOMaster Development Plan name:Well in Master SUPO? NOMaster SUPO name:Well in Master Drilling Plan? NOMaster Drilling Plan name:Well Name: CORRAL CANYON 36-25 FED COMWell Number: 5HWell API Number:Field/Pool or Exploratory? Field and PoolField Name: PIERCE
CROSSING BONE SPRING,
EASTPool Name: BONE SPRING

Well Number: 5H

Is the proposed well in an area containing other mineral resources? POTASH

| Is the propo | sed well in a Helium produ | iction area? N | Use Existing Well Pad? | NO | New surface disturbance? |
|--------------|----------------------------|----------------|------------------------------------------------|--------|--------------------------|
| Type of Wel | I Pad: MULTIPLE WELL | | Multiple Well Pad Name | | Number: 3H |
| Well Class: | HORIZONTAL | | CORRAL CANYON 36-2 COM Number of Legs: 1 | 25 FED | |
| Well Work T | ype: Drill | | | | |
| Well Type: C | DIL WELL | | | | |
| Describe We | ell Type: | | | | |
| Well sub-Ty | pe: INFILL | | | | |
| Describe su | b-type: | | | | |
| Distance to | town: 8 Miles | Distance to ne | arest well: 35 FT | Distan | ce to lease line: 20 FT |
| Reservoir w | ell spacing assigned acres | Measurement: | 640 Acres | | |
| Well plat: | CorralCanyon36_25FdCon | n5H_C102_2019 | 0716070458.pdf | | |
| | CorralCanyon36_25FdCon | n5H_SitePlanAm | nd_20200115134313.pdf | | |
| Well work st | tart Date: 06/15/2021 | | Duration: 20 DAYS | | |

Section 3 - Well Location Table

Survey Type: RECTANGULAR

Describe Survey Type:

Datum: NAD83

Survey number:

Vertical Datum: NAVD88

Reference Datum:


| Wellbore | NS-Foot | NS Indicator | EW-Foot | EW Indicator | Twsp | Range | Section | Aliquot/Lot/Tract | Latitude | Longitude | County | State | Meridian | Lease Type | Lease Number | Elevation | MD | TVD | Will this well produce from this lease? |
|------------------|---------|--------------|----------|--------------|------|-------|---------|-------------------|---------------|---------------------|----------|-------------------|----------|------------|--------------|---------------|----------|----------|--------------------------------------------|
| SHL Leg #1 | 200 | FNL | 207 0 | FEL | 25S | 29E | 1 | Lot 2 | 32.16601 4 | - 103.9361 48 | EDD Y | NEW MEXI CO | | S | STATE | 312 7 | 0 | 0 | |
| KOP Leg #1 | 50 | FSL | 126 0 | FEL | 24S | 29E | 36 | Aliquot SESE | 32.16670 9 | - 103.9335 31 | EDD Y | NEW MEXI CO | | S | STATE | - 444 4 | 771 3 | 757 1 | |

Operator Name: OXY USA INCORPORATED

Well Name: CORRAL CANYON 36-25 FED COM

Well Number: 5H

| Wellbore | NS-Foot | NS Indicator | EW-Foot | EW Indicator | Twsp | Range | Section | Aliquot/Lot/Tract | Latitude | Longitude | County | State | Meridian | Lease Type | Lease Number | Elevation | MD | TVD | Will this well produce from this lease? |
|--------------------|----------|--------------|----------|--------------|------|-------|---------|-------------------|---------------|---------------------|----------|-------------------|-------------------|------------|----------------|---------------|-----------|----------|-----------------------------------------|
| PPP Leg #1-1 | 132 0 | FSL | 126 7 | FEL | 24S | 29E | 25 | Aliquot NESE | 32.18472 6 | - 103.9335 42 | EDD Y | NEW MEXI CO | NEW MEXI CO | F | NMNM 065408 | - 484 9 | 149 27 | 797 6 | |
| PPP Leg #1-2 | 3 | FSL | 127 0 | FEL | 24S | 29E | 25 | Aliquot SESE | 32.18108 8 | - 103.9335 4 | EDD Y | 1 | NEW MEXI CO | F | NMNM 059386 | - 484 7 | 136 07 | 797 4 | |
| PPP Leg #1-3 | 100 | FSL | 126 0 | FEL | 24S | 29E | 36 | Aliquot SESE | 32.16684 6 | - 103.9335 31 | EDD Y | 1 | NEW MEXI CO | S | STATE | - 484 0 | 843 2 | 796 7 | |
| EXIT Leg #1 | 100 | FNL | 126 0 | FEL | 24S | 29E | 25 | Aliquot NENE | 32.19536 9 | - 103.9335 47 | EDD Y | 1 | NEW MEXI CO | F | NMNM 065408 | - 485 5 | 188 09 | 798 2 | |
| BHL Leg #1 | 20 | FNL | 126 0 | FEL | 24S | 29E | 25 | Aliquot NENE | 32.19558 9 | - 103.9335 47 | EDD Y | 1 | NEW MEXI CO | F | NMNM 065408 | - 485 5 | 188 89 | 798 2 | |

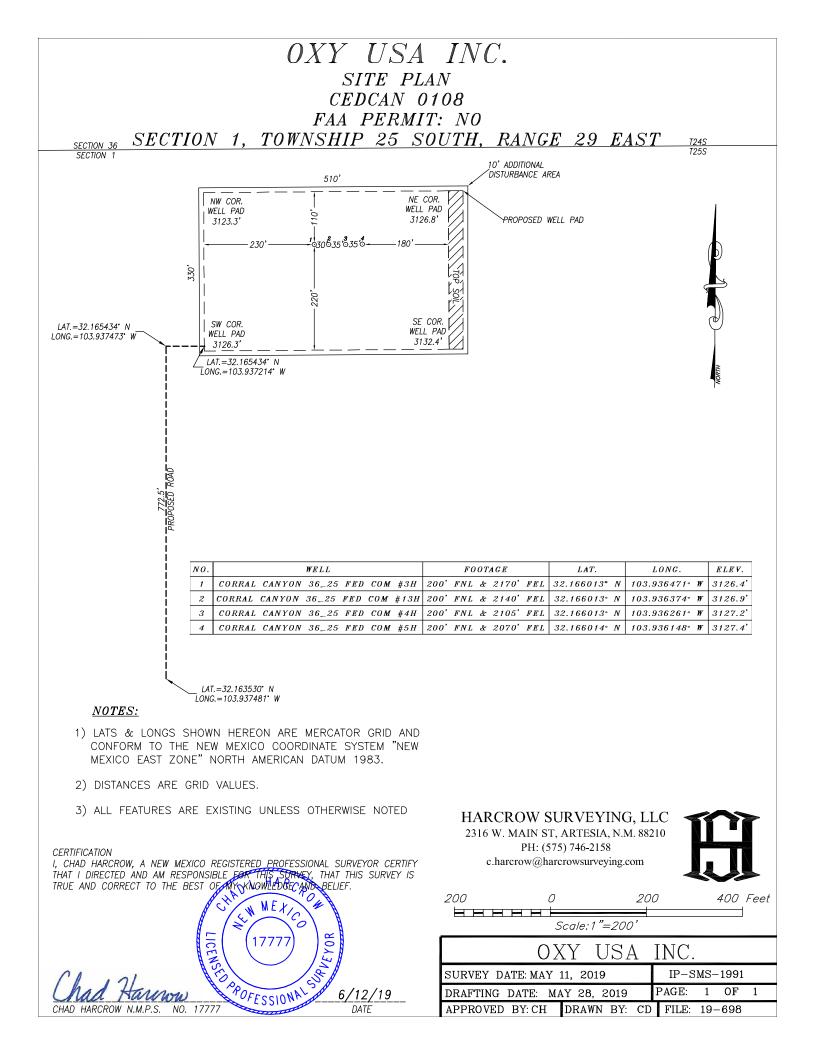

WAFMSS

U.S. Department of the Interior BUREAU OF LAND MANAGEMENT

APD ID: 10400043733

Submission Date: 07/17/2019

Highlighted data reflects the most recent changes

Show Final Text

08/31/2020

Drilling Plan Data Report

Operator Name: OXY USA INCORPORATED Well Name: CORRAL CANYON 36-25 FED COM

Well Number: 5H

Well Type: OIL WELL

Well Work Type: Drill

Section 1 - Geologic Formations

| Formation | Formation Name | Elevation | True Vertical Depth | Measured Depth | Lithologies | Mineral Resources | Producing Formation |
|-----------|----------------|-----------|------------------------|-------------------|------------------------------------------|------------------------------------------------------|------------------------|
| 498782 | RUSTLER | 3127 | 404 | 404 | ANHYDRITE, DOLOMITE, SHALE | USEABLE WATER | N |
| 498783 | SALADO | 2269 | 858 | 858 | ANHYDRITE, DOLOMITE, HALITE, SHALE | OTHER : SALT | N |
| 498780 | CASTILE | 1260 | 1867 | 1867 | ANHYDRITE | OTHER : salt | N |
| 498784 | LAMAR | -229 | 3356 | 3356 | LIMESTONE, SANDSTONE, SILTSTONE | NATURAL GAS, OIL, OTHER : BRINE | N |
| 498785 | BELL CANYON | -240 | 3367 | 3367 | SANDSTONE, SILTSTONE | NATURAL GAS, OIL, OTHER, USEABLE WATER : BRINE | N |
| 498786 | CHERRY CANYON | -1155 | 4282 | 4295 | SANDSTONE, SILTSTONE | NATURAL GAS, OIL, OTHER : BRINE | N |
| 498787 | BRUSHY CANYON | -2490 | 5617 | 5698 | LIMESTONE, SANDSTONE, SILTSTONE | NATURAL GAS, OIL, OTHER : BRINE | N |
| 498781 | BONE SPRING | -4046 | 7173 | 7301 | LIMESTONE, SANDSTONE, SILTSTONE | NATURAL GAS, OIL | Y |

Section 2 - Blowout Prevention

Pressure Rating (PSI): 5M

Rating Depth: 7981

Equipment: 13-5/8" 5/10M Annular, Blind Ram, Double Ram

Requesting Variance? YES

Variance request: Request for the use of a flexible choke line from the BOP to Choke Manifold.

Testing Procedure: OXY will utilize a 5M annular with a 10M BOPE stack. The BOP/BOPE will be tested by an independent service company to 250 psi low and the high pressure indicated above per Onshore Order 2 requirements. The System may be upgraded to a higher pressure but still tested to the working pressure listed in the table above. If the system is upgraded all the components installed will be functional and tested. Pipe rams will be operationally checked each 24 hour period. Blind rams will be operationally checked on each trip out of the hole. These checks will be noted on the daily tour sheets. Other accessories to the BOP equipment will include a Kelly cock and floor safety valve (inside BOP) and choke lines and choke manifold. A multibowl wellhead or a unionized multibowl wellhead system will be employed. The wellhead and connection to the BOPE will meet all API 6A requirements. The BOP will be tested per Onshore Order #2 after installation on the surface casing which will cover testing requirements for a maximum of 30 days. If any seal subject to test pressure is broken the system will be tested. We will test the flange connection of the wellhead with a test port that is directly in the flange. BOP Break Testing Request - As per the agreement reached in the OXY/BLM meeting on Feb 22, 2018, OXY requests permission to allow BOP Break Testing under the following conditions: 1. After a full BOP test is conducted on the first well on the pad. 2. When skidding to drill an intermediate section that the casing point is either shallower than the 3rd Bone Spring or 10000'

TVD. 3. Full BOP test will be required prior to drilling any production section.

Choke Diagram Attachment:

 $CorralCanyon 36_25 FdCom 5H_ChkManifold_20190716075951.pdf$

BOP Diagram Attachment:

CorralCanyon36_25FdCom5H_BOP_20190716080009.pdf

CorralCanyon36_25FdCom5H_FlexHoseCert_20190716080024.pdf

Section 3 - Casing

| Casing ID | String Type | Hole Size | Csg Size | Condition | Standard | Tapered String | Top Set MD | Bottom Set MD | Top Set TVD | Bottom Set TVD | Top Set MSL | Bottom Set MSL | Calculated casing length MD | Grade | Weight | Joint Type | Collapse SF | Burst SF | Joint SF Type | Joint SF | Body SF Type | Body SF |
|-----------|------------------|-----------|----------|-----------|----------|----------------|------------|---------------|-------------|----------------|-------------|----------------|--------------------------------|------------|--------|------------|-------------|----------|---------------|----------|--------------|---------|
| 1 | SURFACE | 14.7 5 | 10.75 | NEW | API | N | 0 | 798 | 0 | 798 | | | 798 | J-55 | 40.5 | BUTT | 1.12 5 | 1.2 | BUOY | 1.4 | BUOY | 1.4 |
| 2 | INTERMED IATE | 9.87 5 | 7.625 | NEW | API | N | 0 | 7612 | 0 | 7475 | | | 7612 | HCL -80 | 26.4 | BUTT | 1.12 5 | 1.2 | BUOY | 1.4 | BUOY | 1.4 |
| 3 | PRODUCTI ON | 6.75 | 5.5 | NEW | API | N | 0 | 18889 | 0 | 7982 | | | 18889 | P- 110 | | | 1.12 5 | 1.2 | BUOY | 1.4 | BUOY | 1.4 |

Casing Attachments

Casing ID: 1

String Type: SURFACE

Inspection Document:

Spec Document:

Tapered String Spec:

Casing Design Assumptions and Worksheet(s):

CorralCanyon36_25FdCom5H_CsgCriteria_20190716080128.pdf

Well Number: 5H

Casing Attachments

Casing ID: 2 String Type: INTERMEDIATE

Inspection Document:

Spec Document:

Tapered String Spec:

Casing Design Assumptions and Worksheet(s):

CorralCanyon36_25FdCom5H_CsgCriteria_20190716080223.pdf

Casing ID: 3 String Type: PRODUCTION

Inspection Document:

Spec Document:

Tapered String Spec:

Casing Design Assumptions and Worksheet(s):

CorralCanyon36_25FdCom5H_CsgCriteria_20190716080255.pdf

 $CorralCanyon 36_25 FdCom 5H_5.5_20_P110_DQX_20190716080312.pdf$

CorralCanyon36_25FdCom5H_5.5_20_P110CY_TMKUPDQWTORQ_20190716080311.pdf

CorralCanyon36_25FdCom5H_5.5_20_P110HC_TMKUPSFTORQ_20190716080312.pdf

| Section | 4 - Ce | emen | t | | | | | | | | | |
|-------------|-----------|---------------------|--------|-----------|--------------|-------|---------|-------|---------|-----|-------------|-------------|
| String Type | Lead/Tail | Stage Tool Depth | Top MD | Bottom MD | Quantity(sx) | Yield | Density | Cu Ft | Excess% | | Cement type | Additives |
| SURFACE | Lead | | 0 | 798 | 654 | 1.33 | 14.8 | 870 | 100 | CIC | | Accelerator |

| INTERMEDIATE | Lead | 0 | 5867 | 722 | 1.92 | 12.9 | 1386 | 10 | CIC | Accelerator |
|--------------|------|---|------|-----|------|------|------|----|-----|-------------|
| | | | | | | | | | | |

Well Number: 5H

| String Type | Lead/Tail | Stage Tool Depth | Top MD | Bottom MD | Quantity(sx) | Yield | Density | Cu Ft | Excess% | | Cement type | Additives |
|--------------|-----------|---------------------|--------|-----------|--------------|-------|---------|-------|---------|-----|-------------|-------------------------------|
| INTERMEDIATE | Tail | | 5867 | 7612 | 246 | 1.65 | 13.2 | 406 | 5 | СІН | | Retarder. Dispersant, Salt |
| PRODUCTION | Lead | | 7112 | 1888 9 | 863 | 1.38 | 13.2 | 1191 | 20 | СІН | | Retarder, Dispersant, Salt |

Section 5 - Circulating Medium

Mud System Type: Closed

Will an air or gas system be Used? NO

Description of the equipment for the circulating system in accordance with Onshore Order #2:

Diagram of the equipment for the circulating system in accordance with Onshore Order #2:

Describe what will be on location to control well or mitigate other conditions: Sufficient mud materials to maintain mud properties and meet minimum lost circulation and weight increase requirements. The following is a general list of products: Barite, Bentonite, Gypsum, Lime, Soda Ash, Caustic Soda, Nut Plug, Cedar Fiber, Cotton Seed Hulls, Drilling Paper, Salt Water Clay, CaCl2.

Describe the mud monitoring system utilized: PVT/MD Totco/Visual Monitoring

Circulating Medium Table

| Top Depth | Bottom Depth | Mud Type | Min Weight (lbs/gal) | Max Weight (Ibs/gal) | Density (Ibs/cu ft) | Gel Strength (lbs/100 sqft) | Hd | Viscosity (CP) | Salinity (ppm) | Filtration (cc) | Additional Characteristics |
|-----------|--------------|-------------------------------------------------------------------|----------------------|----------------------|---------------------|-----------------------------|----|----------------|----------------|-----------------|----------------------------|
| 798 | 7612 | OTHER : Saturated Brine Based Mud and/or Oil-Base Mud | 8 | 10 | | | | | | | |
| 7612 | 1888 9 | OTHER : Water- Based and/or Oil-Based Mud | 8 | 9.6 | | | | | | | |
| 0 | 798 | WATER-BASED MUD | 8.6 | 8.8 | | | | | | | |

Operator Name: OXY USA INCORPORATED

Well Name: CORRAL CANYON 36-25 FED COM

Section 6 - Test, Logging, Coring

List of production tests including testing procedures, equipment and safety measures:

GR from TD to surface (horizontal well - vertical portion of hole). Mud Log from intermediate shoe to TD.

List of open and cased hole logs run in the well: GR,MUDLOG

Coring operation description for the well:

No coring is planned at this time.

Section 7 - Pressure

Anticipated Bottom Hole Pressure: 3985

Anticipated Surface Pressure: 2228.96

Anticipated Bottom Hole Temperature(F): 144

Anticipated abnormal pressures, temperatures, or potential geologic hazards? NO

Describe:

Contingency Plans geoharzards description:

Contingency Plans geohazards attachment:

Hydrogen Sulfide drilling operations plan required? YES

Hydrogen sulfide drilling operations plan:

CorralCanyon36_25FdCom5H_H2S1_20190716080742.pdf CorralCanyon36_25FdCom5H_H2S2_20190716080743.pdf CorralCanyon36_25FdCom5H_H2S3ECL_20190716080743.pdf

Section 8 - Other Information

Proposed horizontal/directional/multi-lateral plan submission:

CorralCanyon36_25FdCom5H_DirectPlan_20190716080828.pdf CorralCanyon36_25FdCom5H_DirectPlot_20190716080828.pdf

Other proposed operations facets description:

OXY requests the option to set casing shallower yet still below the salts if losses or hole conditions require this. Cement volumes may be adjusted if casing is set shallower and a DV tool may be run in case hole conditions merit pumping a second stage cement job to comply with permitted top of cement. If cement circulated to surface during first stage we will drop a cancelation cone and not pump the second stage.

OXY respectfully requests a variance to cement the 7-5/8" intermediate casing string offline, see attached for additional information.

OXY requests to pump a two stage Intermediate casing cement job with the first stage being pumped conventionally with the calculated TOC @ the Brushy Canyon and the second stage performed as a bradenhead squeeze with planned cement from the Brushy Canyon to Surface.

Oxy requests the option to run production casing with DQX, SF TORQ and/or DQW TORQ connections to

accommodate hole conditions or drilling operations.

Annular Clearance Variance Request - As per the agreement reached in the Oxy/BLM meeting on Feb 22, 2018, Oxy requests permission to allow deviation from the 0.422" annular clearance requirement from Onshore Order #2 under the following conditions:

1. Annular clearance to meet or exceed 0.422" between intermediate casing ID and production casing coupling only on the first 500' overlap between both casings.

2. Annular clearance less than 0.422" is acceptable for the curve and lateral portions of the production open hole section.

Well will be drilled with a walking/skidding operation. Plan to drill the multiple well pad in batch by section: all surface sections, intermediate sections and production sections. The wellhead will be secured with a night cap whenever the rig is not over the well.

OXY requests the option to contract a Surface Rig to drill, set surface casing, and cement for this well. If the timing between rigs is such that OXY would not be able to preset surface, the Primary Rig will MIRU and drill the well in its entirety per the APD. Please see the attached document for information on the spudder rig.

Other proposed operations facets attachment:

CorralCanyon36_25FdCom5H_DrillPlan_20190716080926.pdf CorralCanyon36_25FdCom5H_GasCapPlan_20190716080941.pdf CorralCanyon36_25FdCom5H_SpudRigData_20190716080957.pdf

Other Variance attachment:

CorralCanyon36_25FdCom5H_OfflineCmtgDetail_20190716081012.pdf




Permian Drilling Hydrogen Sulfide Drilling Operations Plan Corral Canyon 36-25 Federal Com 5H

Open drill site. No homes or buildings are near the proposed location.

1. Escape

Personnel shall escape upwind of wellbore in the event of an emergency gas release. Escape can take place through the lease road on the Southeast side of the location. Personnel need to move to a safe distance and block the entrance to location. If the primary route is not an option due to the wind direction, then a secondary egress route should be taken.

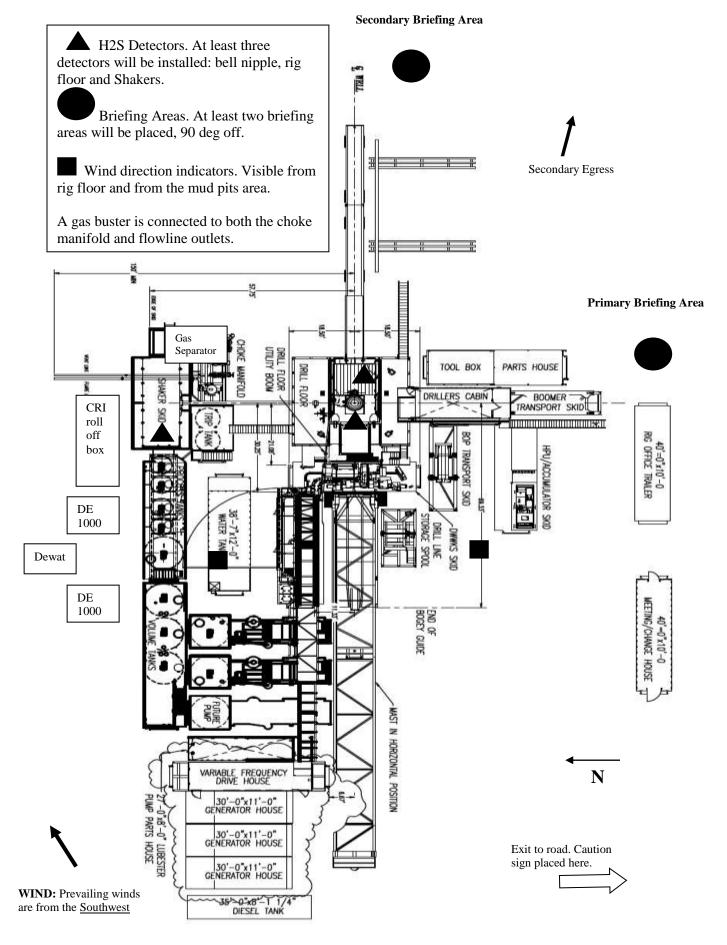



Permian Drilling Hydrogen Sulfide Drilling Operations Plan New Mexico

<u>Scope</u>

This contingency plan establishes guidelines for the public, all company employees, and contract employees who's work activities may involve exposure to hydrogen sulfide (H2S) gas.

While drilling this well, it is possible to encounter H2S bearing formations. At all times, the first barrier to control H2S emissions will be the drilling fluid, which will have a density high enough to control influx.

Objective

- 1. Provide an immediate and predetermined response plan to any condition when H2S is detected. All H2S detections in excess of 10 parts per million (ppm) concentration are considered an Emergency.
- 2. Prevent any and all accidents, and prevent the uncontrolled release of hydrogen sulfide into the atmosphere.
- 3. Provide proper evacuation procedures to cope with emergencies.
- 4. Provide immediate and adequate medical attention should an injury occur.

Discussion

| Implementation: | This plan with all details is to be fully implemented before drilling to <u>commence</u> . |
|-----------------------------------|---------------------------------------------------------------------------------------------------------------------|
| Emergency response Procedure: | This section outlines the conditions and denotes steps to be taken in the event of an emergency. |
| Emergency equipment Procedure: | This section outlines the safety and emergency equipment that will be required for the drilling of this well. |
| Training provisions: | This section outlines the training provisions that must be adhered to prior to drilling. |
| Drilling emergency call lists: | Included are the telephone numbers of all persons to be contacted should an emergency exist. |
| Briefing: | This section deals with the briefing of all people involved in the drilling operation. |
| Public safety: | Public safety personnel will be made aware of any potential evacuation and any additional support needed. |
| Check lists: | Status check lists and procedural check lists have been included to insure adherence to the plan. |
| General information: | A general information section has been included to supply support information. |

<u>Hydrogen Sulfide Training</u>

All personnel, whether regularly assigned, contracted, or employed on an unscheduled basis, will receive training from a qualified instructor in the following areas prior to commencing drilling operations on the well:

- 1. The hazards and characteristics of H2S.
- 2. Proper use and maintenance of personal protective equipment and life support systems.
- 3. H2S detection.
- 4. Proper use of H2S detectors, alarms, warning systems, briefing areas, evacuation procedures and prevailing winds.
- 5. Proper techniques for first aid and rescue procedures.
- 6. Physical effects of hydrogen sulfide on the human body.
- 7. Toxicity of hydrogen sulfide and sulfur dioxide.
- 8. Use of SCBA and supplied air equipment.
- 9. First aid and artificial respiration.
- 10. Emergency rescue.

In addition, supervisory personnel will be trained in the following areas:

- 1. The effects of H2S on metal components. If high tensile strength tubular is to be used, personnel will be trained in their special maintenance requirements.
- 2. Corrective action and shut-in procedures when drilling a well, blowout prevention and well control procedures.
- 3. The contents and requirements of the H2S Drilling Operations Plan.

H2S training refresher must have been taken within one year prior to drilling the well. Specifics on the well to be drilled will be discussed during the pre-spud meeting. H2S and well control (choke) drills will be performed while drilling the well, at least on a weekly basis. This plan shall be available in the well site. All personnel will be required to carry the documentation proving that the H2S training has been taken.

Service company and visiting personnel

- A. Each service company that will be on this well will be notified if the zone contains H2S.
- B. Each service company must provide for the training and equipment of their employees before they arrive at the well site.
- C. Each service company will be expected to attend a well site briefing

Emergency Equipment Requirements

1. <u>Well control equipment</u>

The well shall have hydraulic BOP equipment for the anticipated pressures. Equipment is to be tested on installation and follow Oxy Well Control standard, as well as BLM Onshore Order #2.

Special control equipment:

- A. Hydraulic BOP equipment with remote control on ground. Remotely operated choke.
- B. Rotating head
- C. Gas buster equipment shall be installed before drilling out of surface pipe.

2. <u>Protective equipment for personnel</u>

- A. Four (4) 30-minute positive pressure air packs (2 at each briefing area) on location.
- B. Adequate fire extinguishers shall be located at strategic locations.
- C. Radio / cell telephone communication will be available at the rig.
 - Rig floor and trailers.
 - Vehicle.

3. <u>Hydrogen sulfide sensors and alarms</u>

- A. H2S sensor with alarms will be located on the rig floor, at the bell nipple, and at the flow line. These monitors will be set to alarm at 10 ppm with strobe light, and audible alarm.
- B. Hand operated detectors with tubes.
- C. H2S monitor tester (to be provided by contract Safety Company.)
- D. There shall be one combustible gas detector on location at all times.

4. <u>Visual Warning Systems</u>

A. One sign located at each location entrance with the following language:

Caution – potential poison gas Hydrogen sulfide No admittance without authorization

Wind sock – wind streamers:

- A. One 36" (in length) wind sock located at protection center, at height visible from rig floor.
- B. One 36" (in length) wind sock located at height visible from pit areas.

Condition flags

A. One each condition flag to be displayed to denote conditions.

green – normal conditions yellow – potential danger red – danger, H2S present

B. Condition flag shall be posted at each location sign entrance.

5. <u>Mud Program</u>

The mud program is designed to minimize the risk of having H2S and other formation fluids at surface. Proper mud weight and safe drilling practices will be applied. H2S scavengers will be used to minimize the hazards while drilling. Below is a summary of the drilling program.

Mud inspection devices:

Garrett gas train or hatch tester for inspection of sulfide concentration in mud system.

6. <u>Metallurgy</u>

- A. Drill string, casing, tubing, wellhead, blowout preventers, drilling spools or adapters, kill lines, choke manifold, lines and valves shall be suitable for the H2S service.
- B. All the elastomers, packing, seals and ring gaskets shall be suitable for H2S service.

7. <u>Well Testing</u>

No drill stem test will be performed on this well.

8. <u>Evacuation plan</u>

Evacuation routes should be established prior to well spud for each well and discussed with all rig personnel.

- 9. <u>Designated area</u>
 - A. Parking and visitor area: all vehicles are to be parked at a predetermined safe distance from the wellhead.
 - B. There will be a designated smoking area.
 - C. Two briefing areas on either side of the location at the maximum allowable distance from the well bore so they offset prevailing winds perpendicularly, or at a 45-degree angle if wind direction tends to shift in the area.

Emergency procedures

- A. In the event of any evidence of H2S level above 10 ppm, take the following steps:
 - 1. The Driller will pick up off bottom, shut down the pumps, slow down the pipe rotation.
 - 2. Secure and don escape breathing equipment, report to the upwind designated safe briefing / muster area.
 - 3. All personnel on location will be accounted for and emergency search should begin for any missing, the Buddy System will be implemented.
 - 4. Order non-essential personnel to leave the well site, order all essential personnel out of the danger zone and upwind to the nearest designated safe briefing / muster area.
 - 5. Entrance to the location will be secured to a higher level than our usual "Meet and Greet" requirement, and the proper condition flag will be displayed at the entrance to the location.
 - 6. Take steps to determine if the H2S level can be corrected or suppressed and, if so, proceed as required.
- B. If uncontrollable conditions occur:
 - 1. Take steps to protect and/or remove any public in the down-wind area from the rig – partial evacuation and isolation. Notify necessary public safety personnel and appropriate regulatory entities (i.e. BLM) of the situation.

- 2. Remove all personnel to the nearest upwind designated safe briefing / muster area or off location.
- 3. Notify public safety personnel of safe briefing / muster area.
- 4. An assigned crew member will blockade the entrance to the location. No unauthorized personnel will be allowed entry to the location.
- 5. Proceed with best plan (at the time) to regain control of the well. Maintain tight security and safety procedures.
- C. Responsibility:
 - 1. Designated personnel.
 - a. Shall be responsible for the total implementation of this plan.
 - b. Shall be in complete command during any emergency.
 - c. Shall designate a back-up.

| All personnel: 1. | On alarm, don escape unit and report to the nearest upwind designated safe briefing / muster area upw |
|------------------------|-------------------------------------------------------------------------------------------------------|
| 2. | Check status of personnel (buddy system). |
| 3. | Secure breathing equipment. |
| 4. | Await orders from supervisor. |
| Drill site manager: 1. | Don escape unit if necessary and report to nearest upwind designated safe briefing / muster area. |
| 2. | 1 0 0 |
| 3. | Determine H2S concentrations. |
| 4. | |
| Tool pusher: 1. | Don escape unit Report to up nearest upwind designated safe briefing / muster area. |
| 2. | 5 |
| 3. | |
| 4. | |
| Driller: 1. | Don escape unit, shut down pumps, continue |

| | 2. 3. 4. 5. 6. | rotating DP. Check monitor for point of release. Report to nearest upwind designated safe briefing / muster area. Check status of personnel (in an attempt to rescue, use the buddy system). Assigns least essential person to notify Drill Site Manager and tool pusher by quickest means in case of their absence. Assumes the responsibilities of the Drill Site Manager and tool pusher until they arrive should they be absent. |
|---------------------------------------------|------------------------------------------------------------------------|-----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| Derrick man Floor man #1 Floor man #2 | 1. | Will remain in briefing / muster area until instructed by supervisor. |
| Mud engineer: | 1. 2. | Report to nearest upwind designated safe briefing / muster area. When instructed, begin check of mud for ph and H2S level. (Garett gas train.) |
| Safety personnel: | 1. | Mask up and check status of all personnel and secure operations as instructed by drill site manager. |

Taking a kick

When taking a kick during an H2S emergency, all personnel will follow standard Well control procedures after reporting to briefing area and masking up.

Open-hole logging

All unnecessary personnel off floor. Drill Site Manager and safety personnel should monitor condition, advise status and determine need for use of air equipment.

Running casing or plugging

Following the same "tripping" procedure as above. Drill Site Manager and safety personnel should determine if all personnel have access to protective equipment.

Ignition procedures

The decision to ignite the well is the responsibility of the operator (Oxy Drilling Management). The decision should be made only as a last resort and in a situation where it is clear that:

- 1. Human life and property are endangered.
- 2. There is no hope controlling the blowout under the prevailing conditions at the well.

Instructions for igniting the well

- 1. Two people are required for the actual igniting operation. They must wear self-contained breathing units and have a safety rope attached. One man (tool pusher or safety engineer) will check the atmosphere for explosive gases with the gas monitor. The other man is responsible for igniting the well.
- 2. Primary method to ignite: 25 mm flare gun with range of approximately 500 feet.
- 3. Ignite upwind and do not approach any closer than is warranted.
- 4. Select the ignition site best for protection, and which offers an easy escape route.
- 5. Before firing, check for presence of combustible gas.
- 6. After lighting, continue emergency action and procedure as before.
- 7. All unassigned personnel will remain in briefing area until instructed by supervisor or directed by the Drill Site Manager.

<u>Remember</u>: After well is ignited, burning hydrogen sulfide will convert to sulfur dioxide, which is also highly toxic. **<u>Do not assume the area is safe after the well is ignited.</u>**

Status check list

Note: All items on this list must be completed before drilling to production casing point.

- 1. H2S sign at location entrance.
- 2. Two (2) wind socks located as required.
- 3. Four (4) 30-minute positive pressure air packs (2 at each Briefing area) on location for all rig personnel and mud loggers.
- 4. Air packs inspected and ready for use.
- 5. Cascade system and hose line hook-up as needed.
- 6. Cascade system for refilling air bottles as needed.
- 7. Condition flag on location and ready for use.
- 8. H2S detection system hooked up and tested.
- 9. H2S alarm system hooked up and tested.
- 10. Hand operated H2S detector with tubes on location.
- 11. 1 100' length of nylon rope on location.
- 12. All rig crew and supervisors trained as required.
- 13. All outside service contractors advised of potential H2S hazard on well.
- 14. No smoking sign posted and a designated smoking area identified.
- 15. Calibration of all H2S equipment shall be noted on the IADC report.

Procedural check list during H2S events

Perform each tour:

- 1. Check fire extinguishers to see that they have the proper charge.
- 2. Check breathing equipment to ensure that it in proper working order.
- 3. Make sure all the H2S detection system is operative.

Perform each week:

- 1. Check each piece of breathing equipment to make sure that demand or forced air regulator is working. This requires that the bottle be opened and the mask assembly be put on tight enough so that when you inhale, you receive air or feel air flow.
- 2. BOP skills (well control drills).
- 3. Check supply pressure on BOP accumulator stand by source.
- 4. Check breathing equipment mask assembly to see that straps are loosened and turned back, ready to put on.
- 5. Check pressure on breathing equipment air bottles to make sure they are charged to full volume. (Air quality checked for proper air grade "D" before bringing to location)
- 6. Confirm pressure on all supply air bottles.
- 7. Perform breathing equipment drills with on-site personnel.
- 8. Check the following supplies for availability.
 - A. Emergency telephone list.
 - B. Hand operated H2S detectors and tubes.

General evacuation plan

- 1. When the company approved supervisor (Drill Site Manager, consultant, rig pusher, or driller) determines the H2S gas cannot be limited to the well location and the public will be involved, he will activate the evacuation plan.
- 2. Drill Site Manager or designee will notify local government agency that a hazardous condition exists and evacuation needs to be implemented.
- 3. Company or contractor safety personnel that have been trained in the use of H2S detection equipment and self-contained breathing equipment will monitor H2S concentrations, wind directions, and area of exposure. They will delineate the outer perimeter of the hazardous gas area. Extension to the evacuation area will be determined from information gathered.
- 4. Law enforcement personnel (state police, police dept., fire dept., and sheriff's dept.) Will be called to aid in setting up and maintaining road blocks. Also, they will aid in evacuation of the public if necessary.
- 5. After the discharge of gas has been controlled, company safety personnel will determine when the area is safe for re-entry.

<u>Important:</u> Law enforcement personnel will not be asked to come into a contaminated area. Their assistance will be limited to uncontaminated areas. Constant radio contact will be maintained with them.

Emergency actions

Well blowout – if emergency

- 1. Evacuate all personnel to "Safe Briefing / Muster Areas" or off location if needed.
- 2. If sour gas evacuate rig personnel.
- 3. If sour gas evacuate public within 3000 ft radius of exposure.
- 4. Don SCBA and shut well in if possible using the buddy system.
- 5. Notify Drilling Superintendent and call 911 for emergency help (fire dept and ambulance) if needed.
- 6. Implement the Blowout Contingency Plan, and Drilling Emergency Action Plan.
- 6. Give first aid as needed.

Person down location/facility

- 1. If immediately possible, contact 911. Give location and wait for confirmation.
- 2. Don SCBA and perform rescue operation using buddy system.

Toxic effects of hydrogen sulfide

Hydrogen sulfide is extremely toxic. The acceptable ceiling concentration for eight-hour exposure is 10 ppm, which is .001% by volume. Hydrogen sulfide is heavier than air (specific gravity -1.192) and colorless. It forms an explosive mixture with air between 4.3 and 46.0 percent by volume. Hydrogen sulfide is almost as toxic as hydrogen cyanide and is between five and six times more toxic than carbon monoxide. Toxicity data for hydrogen sulfide and various other gases are compared in table i. Physical effects at various hydrogen sulfide exposure levels are shown in table ii.

| Common | Chemical | Specific | Threshold | Hazardous | Lethal concentration |
|---------------------|----------|-------------------|--------------|--------------|----------------------|
| name | formula | gravity (sc=1) | limit (1) | limit (2) | (3) |
| Hydrogen Cyanide | Hcn | 0.94 | 10 ppm | 150 ppm/hr | 300 ppm |
| Hydrogen Sulfide | H2S | 1.18 | 10 ppm | 250 ppm/hr | 600 ppm |
| Sulfur Dioxide | So2 | 2.21 | 5 ppm | - | 1000 ppm |
| Chlorine | Cl2 | 2.45 | 1 ppm | 4 ppm/hr | 1000 ppm |
| Carbon Monoxide | Co | 0.97 | 50 ppm | 400 ppm/hr | 1000 ppm |
| Carbon Dioxide | Co2 | 1.52 | 5000 ppm | 5% | 10% |
| Methane | Ch4 | 0.55 | 90,000 ppm | Combustibl | e above 5% in air |

Table i <u>Toxicity of various gases</u>

1) threshold limit – concentration at which it is believed that all workers may be repeatedly exposed day after day without adverse effects.

- 2) hazardous limit concentration that will cause death with short-term exposure.
- 3) lethal concentration concentration that will cause death with short-term exposure.

Toxic effects of hydrogen sulfide

Table ii Physical effects of hydrogen sulfide

| | | Concentration | Physical effects |
|-------------|------------|---------------|------------------------------|
| Percent (%) | <u>Ppm</u> | Grains | |
| | | 100 std. Ft3* | |
| 0.001 | <10 | 00.65 | Obvious and unpleasant odor. |

| 0.002 | 10 | 01.30 | Safe for 8 hours of exposure. |
|-------|------|-------|------------------------------------------------------------------------------------|
| 0.010 | 100 | 06.48 | Kill smell in 3 – 15 minutes. May sting eyes and throat. |
| 0.020 | 200 | 12.96 | Kills smell shortly; stings eyes and throat. |
| 0.050 | 500 | 32.96 | Dizziness; breathing ceases in a few minutes; needs prompt artificial respiration. |
| 0.070 | 700 | 45.36 | Unconscious quickly; death will result if not rescued promptly. |
| 0.100 | 1000 | 64.30 | Unconscious at once; followed by death within minutes. |

*at 15.00 psia and 60'f.

Use of self-contained breathing equipment (SCBA)

- 1. Written procedures shall be prepared covering safe use of SCBA's in dangerous atmosphere, which might be encountered in normal operations or in emergencies. Personnel shall be familiar with these procedures and the available SCBA.
- 2 SCBA's shall be inspected frequently at random to insure that they are properly used, cleaned, and maintained.
- 3. Anyone who may use the SCBA's shall be trained in how to insure proper facepiece to face seal. They shall wear SCBA's in normal air and then wear them in a test atmosphere. (note: such items as facial hair {beard or sideburns} and eyeglasses will not allow proper seal.) Anyone that may be reasonably expected to wear SCBA's should have these items removed before entering a toxic atmosphere. A special mask must be obtained for anyone who must wear eyeglasses or contact lenses.
- 4. Maintenance and care of SCBA's:
 - a. A program for maintenance and care of SCBA's shall include the following:
 - 1. Inspection for defects, including leak checks.
 - 2. Cleaning and disinfecting.
 - 3. Repair.
 - 4. Storage.
 - b. Inspection, self-contained breathing apparatus for emergency use shall be inspected monthly.
 - 1. Fully charged cylinders.
 - 2. Regulator and warning device operation.
 - 3. Condition of face piece and connections.
 - 4. Rubber parts shall be maintained to keep them pliable and prevent deterioration.
 - c. Routinely used SCBA's shall be collected, cleaned and disinfected as frequently as necessary to insure proper protection is provided.
- 5. Persons assigned tasks that requires use of self-contained breathing equipment shall be certified physically fit (medically cleared) for breathing equipment usage at least annually.
- 6. SCBA's should be worn when:
 - A. Any employee works near the top or on top of any tank unless test reveals less than 10 ppm of H2S.

- B. When breaking out any line where H2S can reasonably be expected.
- C. When sampling air in areas to determine if toxic concentrations of H2S exists.
- D. When working in areas where over 10 ppm H2S has been detected.
- E. At any time there is a doubt as to the H2S level in the area to be entered.

<u>Rescue</u> First aid for H2S poisoning

Do not panic!

Remain calm – think!

- 1. Don SCBA breathing equipment.
- 2. Remove victim(s) utilizing buddy system to fresh air as quickly as possible. (go up-wind from source or at right angle to the wind. Not down wind.)
- 3. Briefly apply chest pressure arm lift method of artificial respiration to clean the victim's lungs and to avoid inhaling any toxic gas directly from the victim's lungs.
- 4. Provide for prompt transportation to the hospital, and continue giving artificial respiration if needed.
- 5. Hospital(s) or medical facilities need to be informed, before-hand, of the possibility of H2S gas poisoning no matter how remote the possibility is.
- 6. Notify emergency room personnel that the victim(s) has been exposed to H2S gas.

Besides basic first aid, everyone on location should have a good working knowledge of artificial respiration.

Revised CM 6/27/2012

OXY Permian Delaware NM Basin Drilling & Completions Incident Reporting OXY Permian Crisis Team Hotline Notification

| Person | Location | Office Phone | Cell/Mobile Phone |
|----------------------------------------------------|-------------|-------------------|-------------------|
| Drilling & Completions Department | | | |
| Drilling & Completions Manager: John Willis | Houston | (713) 366-5556 | (713) 259-1417 |
| Drilling Superintendent: Simon Benavides | Houston | (713) 215-7403 | (832) 528-3547 |
| Completions Superintendent: Chris Winter | Houston | (713) 366-5212 | (806) 239-8774 |
| Drilling Eng. Supervisor: Diego Tellez | Houston | (713) 350-4602 | (713) 303-4932 |
| Drilling Eng. Supervisor: Randy Neel | Houston | (713) 215-7987 | (713) 517-5544 |
| Completions Eng. Supervisor: Evan Hinkel | Houston | (713) 366-5436 | (281) 236-6153 |
| Drilling & Completions HES Lead. Ryan Green | Houston | 713-336-5753 | 281-520-5216 |
| Drilling & Completions HES Advisor:Kenny Williams | Carlsbad | (432) 686-1434 | (337) 208-0911 |
| Drilling & Completions HES Advisor:Kyle Holden | Carlsbad | (432) 686-1435 | (661) 369-5328 |
| Drilling & Completions HES Advisor Sr:Dave Schmidt | Carlsbad | | (559) 310-8572 |
| Drilling & Completions HES Advisor. :Seth Doyle | Carlsbad | | (337) 499-0756 |
| HES / Enviromental & Regulatory Department | nt Location | Office | Cell Phone |
| Jon Hamil-HES Manager | Houston | (713) 497-2494 | (832) 537-9885 |
| Mark Birk-HES Manager | Houston | (713) 350-4615 | (949) 413-3127 |
| Austin Tramell | Midland | (432) 699-4208 | (575) 499-4919 |
| Rico Munoz | Midland | (432) 699-8366 | (432) 803-4116 |
| Amber DuckWorth | Midland | | (832) 966-1879 |
| Kelley Montgomery- Regulatory Manager | Houston | (713) 366-5716 | (832) 454-8137 |
| Sandra Musallam -Regulatory Lead | Houston | +1 (713) 366-5106 | +1 (713) 504-8577 |
| Bishop, Steve-DOT Pipeline Coordinator | Midland | 432-685-5614 | |
| Wilson, Dusty-Safety Advisor | Midland | 432-685-5771 | (432) 254-2336 |
| John W Dittrich Eniromental Advisor | Midland | | (575) 390-2828 |
| William (Jack) Calhoun-Environmental Lead | Houston | +713 (350) 4906 | (281) 917-8571 |
| Robert Barrow-Risk Engineer Manager | Houston | (713) 366-5611 | (832) 867-5336 |
| Sarah Holmes-HSE Cordinator | Midland | 432-685-5758 | |
| Administrative | Location | Office | |
| Sarah Holmes | Midland | 432-685-5830 | |
| Robertson, Debbie | Midland | 432-685-5812 | |
| Laci Hollaway | Midland | (432) 685-5716 | (432) 631-6341 |
| Administrative | Location | Office | |
| Rosalinda Escajeda | Midland | 432-685-5831 | |

| Location | Office Phone | Cell/Mobile Phone |
|------------------------|---------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| Hobbs | 575-397-8247 | |
| Levelland | 806-894-8347 | |
| North Cowden | 432-385-3120 | |
| Location | Office | |
| Orla, TX | (337) 205-9314 | |
| Location | Office | |
| | (877) 502-9466 | |
| | | |
| | | |
| Carlsbad, NM | (505) 887-6544 | |
| Hobbs, NM | (505) 393-3612 | |
| Roswell, NM | (505) 393-3612 | |
| Santa Fe, NM | (505) 988-6030 | |
| Santa Fe. NM | (505) 827-3549 (505) 490-2375 | |
| Austin, TX | (512) 463-6788 | |
| Dallas, Texas | (214) 665-6444 | |
| Lubbock, Texas | (806) 472-7681 | |
| | (800) 424-8802 | |
| | (202) 282-9201 | |
| Santa Fe, NM | (505) 827-1494 | |
| Artesia, NM | (505) 748-1283 | After Hours (505) 370- 7545 |
| Hobbs, NM | (505) 393-6161 | |
| Santa Fe, NM | (505) 471-1068 | |
| Santa Fe, NM | (505) 476-3470 | |
| Hobbs, NM | (505) 827-9329 | |
| Santa Fe, NM | (505) 827-9222 | |
| District 1 San Antonio | , (210) 227-1313 | |
| District 7C San Angelo | (325) 657-7450 | |
| District 8, 8A Midland | (432) 684-5581 | |
| Austin, TX | (512) 463-7727 | |
| Region 2 Lubbock, TX | (806) 796-3494 | |
| Region 3 Abilene, TX | (325) 698-9674 | |
| Region 7 Midland, TX | (432) 570-1359 | |
| Region 9 San Antonio, | (512) 734-7981 | |
| Region 8 San Angelo | (325) 655-9479 | |
| | | |
| Abernathy, TX | (806) 298-2524 | |
| | | |
| | (| 1 |
| Artesia, NM | (505) 748-3333 | |
| | HobbsLevellandNorth CowdenLocationOrla, TXLocationCarlsbad, NMHobbs, NMRoswell, NMSanta Fe, NMSanta Fe, NMSanta Fe, NMJallas, TexasLubbock, TexasLubbock, TexasWashington, D. C.Santa Fe, NMSanta Fe, NMDallas, TexasLubbock, TexasLubbock, TexasKastin Fe, NMSanta Fe, NMSanta Fe, NMDallas, TexasLubbock, TexasDallas, TexasLubbock, TexasDistrict Tasa AntonioDistrict 1 San AntonioDistrict 7C San AngeleDistrict 7C San AngeleDistrict 7C San AngeleDistrict 8, 8A MidlandAustin, TXRegion 2 Lubbock, TXRegion 7 Midland, TXRegion 7 Midland, TXRegion 9 San Antonio | Hobbs 575-397-8247 Levelland 806-894-8347 North Cowden 432-385-3120 Location Office Orla, TX (337) 205-9314 Location Office Orla, TX (337) 205-9314 Location Office Carlsbad, NM (505) 887-6544 Hobbs, NM (505) 393-3612 Roswell, NM (505) 988-6030 Santa Fe, NM (505) 827-3549 Santa Fe, NM (505) 490-2375 Austin, TX (512) 463-6788 Dallas, Texas (214) 665-6444 Lubbock, Texas (806) 472-7681 Washington, D. C. (800) 424-8802 Quartical Fe, NM (505) 827-1494 Artesia, NM (505) 748-1283 Hobbs, NM (505) 476-3470 Hobbs, NM (505) 827-9329 Santa Fe, NM (505) 476-3470 Hobbs, NM (505) 827-9329 Santa Fe, NM (505) 827-9329 Santa Fe, NM (505) 827-9329 Santa Fe, NM (505) 827-9329 |

| Person | Location | Office Phone | Cell/Mobile Phone |
|----------------------------------------|-----------------------|---------------------|--------------------------|
| Cogdell Memorial Hospital | Snyder, TX | (325) 573-6374 | |
| Covenant Hospital Levelland | Levelland, TX | (806) 894-4963 | |
| Covenant Medical Center | Lubbock, TX | (806) 725-1011 | |
| Covenant Medical Center Lakeside | Lubbock, TX | (806) 725-6000 | |
| Covenant Family Health | Synder, TX | (325) 573-1300 | |
| Crockett County Hospital | Ozona, TX | (325) 392-2671 | |
| Guadalupe Medical Center | Carlsbad, NM | (505) 887-6633 | |
| Lea Regional Hospital | Hobbs, NM | (505) 492-5000 | |
| McCamey Hospital | McCamey, TX | (432) 652-8626 | |
| Medical Arts Hospital | Lamesa, TX | (806) 872-2183 | |
| Medical Center Hospital | Odessa, TX | (432) 640-4000 | |
| Medi Center Hospital | San Angelo, TX | (325) 653-6741 | |
| Memorial Hospital | Ft. Stockton | (432) 336-2241 | |
| Memorial Hospital | Seminole, TX | (432) 758-5811 | |
| Midland Memorial Hospital | Midland, TX | (432) 685-1111 | |
| Nor-Lea General Hospital | Lovington, NM | (505) 396-6611 | |
| Odessa Regional Hospital | Odessa, TX | (432) 334-8200 | |
| Permian General Hospital | Andrews, TX | (432) 523-2200 | |
| Reagan County Hospital | Big Lake, TX | (325) 884-2561 | |
| Reeves County Hospital | Pecos, TX | (432) 447-3551 | |
| Shannon Medical Center | San Angelo, TX | (325) 653-6741 | |
| Union County General Hospital | Clayton, NM | (505) 374-2585 | |
| University Medical Center | Lubbock, TX | (806) 725-8200 | |
| Val Verde Regional Medical Center | Del Rio, TX | (830) 775-8566 | |
| Ward Memorial Hospital | Monahans, TX | (432) 943-2511 | |
| Yoakum County Hospital | Denver City, TX | (806) 592-5484 | |
| Law Enforcement - Sheriff | | | |
| | Androws County (Andr | (122) 522 5545 | |
| Andrews Cty Sheriff's Department | Andrews County (Andr | (432) 523-5545 | |
| Crane Cty Sheriff's Department | Crane, County (Crane) | (432) 558-3571 | |
| Crockett Cty Sheriff's Department | Crockett County (Ozor | (325) 392-2661 | |
| Dawson Cty Sheriff's Department | Dawson County (Lame | (806) 872-7560 | |
| Ector Cty Sheriff's Department | Ector County (Odessa) | (432) 335-3050 | |
| Eddy Cty Sheriff's Department | Eddy County (Artesia) | (505) 746-2704 | |
| Eddy Cty Sheriff's Department | Eddy County (Carlsbac | (505) 887-7551 | |
| Gaines Cty Sheriff's Department | Gaines County (Semin | (432) 758-9871 | |
| Hockley Cty Sheriff's Department | Hockley County(Level | (806) 894-3126 | |
| Kent Cty (Jayton City Sheriff's Dept.) | Kent County(Jayton) | (806) 237-3801 | |
| Lea Cty Sheriff's Department | Lea County (Eunice) | (505) 384-2020 | |
| Lea Cty Sheriff's Department | Lea County (Hobbs) | (505) 393-2515 | |
| Lea Cty Sheriff's Department | Lea County (Lovingtor | (505) 396-3611 | |
| Lubbock Cty Sheriff's Department | Lubbock Cty (Abernatl | (806) 296-2724 | |
| Midland Cty Sheriff's Department | Midland County (Midl | (432) 688-1277 | |

| Person | Location | Office Phone | Cell/Mobile Phone |
|----------------------------------|-----------------------|---------------------|--------------------------|
| Pecos Cty Sheriff's Department | Pecos County (Iraan) | (432) 639-2251 | |
| Reeves Cty Sheriff's Department | Reeves County (Pecos) | (432) 445-4901 | |
| Scurry Cty Sheriff's Department | Scurry County (Snyder | (325) 573-3551 | |
| Terry Cty Sheriff's Department | Terry County (Brownfi | | |
| Union Cty Sheriff's Department | Union County (Claytor | (505) 374-2583 | |
| Upton Cty Sheriff's Department | Upton County (Rankin | (432) 693-2422 | |
| Ward Cty Sheriff's Department | Ward County (Monaha | (432) 943-3254 | |
| Yoakum City Sheriff's Department | Yoakum Co. (Denever | (806) 456-2377 | |
| | | | |
| Law Enforcement - Police | | | |
| Abernathy City Police | Abernathy, TX | (806) 298-2545 | |
| Andrews City Police | Andrews, TX | (432) 523-5675 | |
| Artesia City Police | Artesia, NM | (505) 746-2704 | |
| Brownfield City Police | Brownfield, TX | (806) 637-2544 | |
| Carlsbad City Police | Carlsbad, NM | (505) 885-2111 | |
| Clayton City Police | Clayton, NM | (505) 374-2504 | |
| Denver City Police | Denver City, TX | (806) 592-3516 | |
| Eunice City Police | Eunice, NM | (505) 394-2112 | |
| Hobbs City Police | Hobbs, NM | 393-2677 | |
| Jal City Police | Jal, NM | (505) 395-2501 | |
| Jayton City Police | Jayton, TX | (806) 237-3801 | |
| Lamesa City Police | Lamesa, TX | (806) 872-2121 | |
| Levelland City Police | Levelland, TX | (806) 894-6164 | |
| Lovington City Police | Lovington, NM | (505) 396-2811 | |
| Midland City Police | Midland, TX | (432) 685-7113 | |
| Monahans City Police | Monahans, TX | (432) 943-3254 | |
| Odessa City Police | Odessa, TX | (432) 335-3378 | |
| Seminole City Police | Seminole, TX | (432) 758-9871 | |
| Snyder City Police | Snyder, TX | (325) 573-2611 | |
| Sundown City Police | Sundown, TX | (806) 229-8241 | |
| | | | |
| Law Enforcement - FBI | | | |
| FBI | Alburqueque, NM | (505) 224-2000 | |
| FBI | Midland, TX | (432) 570-0255 | |
| Law Enforcement - DPS | | | |
| NM State Police | Artesia, NM | (505) 746-2704 | |
| NM State Police | Carlsbad, NM | (505) 885-3137 | |
| NM State Police | Eunice, NM | (505) 392-5588 | |
| NM State Police | Hobbs, NM | (505) 392-5588 | |
| NM State Police | Clayton, NM | (505) 374-2473; 911 | |
| TX Dept of Public Safety | Andrews, TX | (432) 524-1443 | |
| TX Dept of Public Safety | Big Lake, TX | (325) 884-2301 | |

| Person | Location | Office Phone | Cell/Mobile Phone |
|-----------------------------------------|---------------------|---------------------|-------------------|
| TX Dept of Public Safety | Brownfield, TX | (806) 637-2312 | |
| TX Dept of Public Safety | Iraan, TX | (432) 639-3232 | |
| TX Dept of Public Safety | Lamesa, TX | (806) 872-8675 | |
| TX Dept of Public Safety | Levelland, TX | (806) 894-4385 | |
| TX Dept of Public Safety | Lubbock, TX | (806) 747-4491 | |
| TX Dept of Public Safety | Midland, TX | (432) 697-2211 | |
| TX Dept of Public Safety | Monahans, TX | (432) 943-5857 | |
| TX Dept of Public Safety | Odessa, TX | (432) 332-6100 | |
| TX Dept of Public Safety | Ozona, TX | (325) 392-2621 | |
| TX Dept of Public Safety | Pecos, TX | (432) 447-3533 | |
| TX Dept of Public Safety | Seminole, TX | (432) 758-4041 | |
| TX Dept of Public Safety | Snyder, TX | (325) 573-0113 | |
| TX Dept of Public Safety | Terry County TX | (806) 637-8913 | |
| TX Dept of Public Safety | Yoakum County TX | (806) 456-2377 | |
| | | | |
| Firefighting & Rescue | | | |
| Abernathy | Abernathy, TX | (806) 298-2022 | |
| Amistad/Rosebud | Amistad/Rosebud, NM | (505) 633-9113 | |
| Andrews | Andrews, TX | 523-3111 | |
| Artesia | Artesia, NM | (505) 746-5051 | |
| Big Lake | Big Lake, TX | (325) 884-3650 | |
| Brownfield-Administrative & other calls | Brownfield, TX | (816) 637-4547 | |
| Brownfield emergency only | Brownfield, TX | -911 | |
| Carlsbad | Carlsbad, NM | (505) 885-3125 | |
| Clayton | Clayton, NM | (505) 374-2435 | |
| Cotton Center | Cotton Center, TX | (806) 879-2157 | |
| Crane | Crane, TX | (432) 558-2361 | |
| Del Rio | Del Rio, TX | (830) 774-8650 | |
| Denver City | Denver City, TX | (806) 592-3516 | |
| Eldorado | Eldorado, TX | (325) 853-2691 | |
| Eunice | Eunice, NM | (505) 394-2111 | |
| Garden City | Garden City, TX | (432) 354-2404 | |
| Goldsmith | Goldsmith, TX | (432) 827-3445 | |
| Hale Center | Hale Center, TX | (806) 839-2411 | |
| Halfway | Halfway, TX | | |
| Hobbs | Hobbs, NM | (505) 397-9308 | |
| Jal | Jal, NM | (505) 395-2221 | |
| Jayton | Jayton, TX | (806) 237-3801 | |
| Kermit | Kermit, TX | (432) 586-3468 | |
| Lamesa | Lamesa, TX | (806) 872-4352 | |
| Levelland | Levelland, TX | (806) 894-3154 | |
| Lovington | Lovington, NM | (505) 396-2359 | |
| Maljamar | Maljamar, NM | (505) 676-4100 | |

| Person | Location | Office Phone | Cell/Mobile Phone |
|-----------------------|---------------------|---------------------|-------------------|
| McCamey | McCamey, TX | (432) 652-8232 | |
| Midland | Midland, TX | (432) 685-7346 | |
| Monahans | Monahans, TX | (432) 943-4343 | |
| Nara Visa | Nara Visa, NM | (505) 461-3300 | |
| Notrees | Notress, TX | (432) 827-3445 | |
| Odessa | Odessa, TX | (432) 335-4659 | |
| Ozona | Ozona, TX | (325) 392-2626 | |
| Pecos | Pecos, TX | (432) 445-2421 | |
| Petersburg | Petersburg, TX | (806) 667-3461 | |
| Plains | Plains, TX | (806) 456-8067 | |
| Plainview | Plainview, TX | (806) 296-1170 | |
| Rankin | Rankin, TX | (432) 693-2252 | |
| San Angelo | San Angelo, TX | (325) 657-4355 | |
| Sanderson | Sanderson, TX | (432) 345-2525 | |
| Seminole | Seminole, TX | 758-9871 | |
| Smyer | Smyer, TX | (806) 234-3861 | |
| Snyder | Snyder, TX | (325) 573-6215 | |
| Sundown | Sundown, TX | 911 | |
| Tucumcari | Tucumcari, NM | 911 | |
| West Odessa | Odessa, TX | (432) 381-3033 | |
| | | | |
| Ambulance | | | |
| Abernathy Ambulance | Abernathy, TX | (806) 298-2241 | |
| Amistad/Rosebud | Amistad/Rosebud, NM | (505) 633-9113 | |
| Andrews Ambulance | Andrews, TX | (432) 523-5675 | |
| Artesia Ambulance | Artesia, NM | (505) 746-2701 | |
| Big Lake Ambulance | Big Lake, TX | (325) 884-2423 | |
| Big Spring Ambulance | Big Spring, TX | (432) 264-2550 | |
| Brownfield Ambulance | Brownfield, TX | (806) 637-2511 | |
| Carlsbad Ambulance | Carlsbad, NM | (505) 885-2111; 911 | |
| Clayton, NM | Clayton, NM | (505) 374-2501 | |
| Denver City Ambulance | Denver City, TX | (806) 592-3516 | |
| Eldorado Ambulance | Eldorado, TX | (325) 853-3456 | |
| Eunice Ambulance | Eunice, NM | (505) 394-3258 | |
| Goldsmith Ambulance | Goldsmith, TX | (432) 827-3445 | |
| Hobbs, NM | Hobbs, NM | (505) 397-9308 | |
| Jal, NM | Jal, NM | (505) 395-2501 | |
| Jayton Ambulance | Jayton, TX | (806) 237-3801 | |
| Lamesa Ambulance | Lamesa, TX | (806) 872-3464 | |
| Levelland Ambulance | Levelland, TX | (806) 894-8855 | |
| Lovington Ambulance | Lovington, NM | (505) 396-2811 | |
| McCamey Hospital | McCamey, TX | (432) 652-8626 | |
| Midland Ambulance | Midland, TX | (432) 685-7499 | |

| Person | Location | Office Phone | Cell/Mobile Phone |
|----------------------------------|----------------|---------------------|-------------------|
| Monahans Ambulance | Monahans, TX | 3731 | |
| Nara Visa, NM | Nara Visa, NM | (505) 461-3300 | |
| Odessa Ambulance | Odessa, TX | (432) 335-3378 | |
| Ozona Ambulance | Ozona, TX | (325) 392-2671 | |
| Pecos Ambulance | Pecos, TX | (432) 445-4444 | |
| Rankin Ambulance | Rankin, TX | (432) 693-2443 | |
| San Angelo Ambulance | San Angelo, TX | (325) 657-4357 | |
| Seminole Ambulance | Seminole, TX | 758-9871 | |
| Snyder Ambulance | Snyder, TX | (325) 573-1911 | |
| Stanton Ambulance | Stanton, TX | (432) 756-2211 | |
| Sundown Ambulance | Sundown, TX | 911 | |
| Tucumcari, NM | Tucumcari, NM | 911 | |
| Medical Air Ambulance Service | | | |
| AEROCARE - Methodist Hospital | Lubbock, TX | (800) 627-2376 | |
| San Angelo Med-Vac Air Ambulance | San Angelo, TX | (800) 277-4354 | |
| Southwest Air Ambulance Service | Stanford, TX | (800) 242-6199 | |
| Southwest MediVac | Snyder, TX | (800) 242-6199 | |
| Southwest MediVac | Hobbs, NM | (800) 242-6199 | |
| Odessa Care Star | Odessa, TX | (888) 624-3571 | |
| NWTH Medivac | Amarillo, TX | (800) 692-1331 | |

OXY

PRD NM DIRECTIONAL PLANS (NAD 1983) CORRAL CANYON 36-25 FED COM CORRAL CANYON 36_25 FED COM 5H

Wellbore #1

Plan: Permitting Plan

Standard Planning Report

13 June, 2019

| Database: Company: Project: Site: Well: Wellbore: Design: | PRD I CORF CORF Wellb | NEERING DES NM DIRECTIO RAL CANYON RAL CANYON | NAL PLANS (36-25 FED C | OM | TVD Refe MD Refer North Ref | ence: | | Well CORRAL RKB=26.5' @ 3 RKB=26.5' @ 3 Grid Minimum Curva | 153.90ft 153.90ft | 25 FED COM 5H |
|-----------------------------------------------------------------------------|--------------------------------|--------------------------------------------------------|----------------------------------|------------------------------|-----------------------------------|-----------------------------|-----------------------------------------|------------------------------------------------------------------------|------------------------|------------------------------------------------------|
| Project | PRD N | IM DIRECTION | IAL PLANS (N | NAD 1983) | | | | | | |
| Map System: Geo Datum: Map Zone: | North Ar | e Plane 1983 nerican Datum xico Eastern Z | | | System Da | tum: | | ean Sea Level | ale factor | |
| Site | CORR | AL CANYON 3 | 6-25 FED CC | M | | | | | | |
| Site Position: From: Position Unce | Map rtainty: | | North Eastin 00 ft Slot F | - | | 197.64 usft | Latitude: Longitude: Grid Converg | gence: | 1 | 32° 9' 55.801317 N 103° 56' 30.391750 W 0.21 ° |
| Well | CORR | AL CANYON 3 | 6_25 FED CC | M 5H | | | | | | |
| Well Position | +N/-S +E/-W | | | orthing: isting: | | 424,358.01 664,237.97 | | itude: Igitude: | | 32° 9' 57.653465 N 103° 56' 10.136408 W |
| Position Unce | rtainty | 2 | 2.00 ft W | ellhead Eleva | ation: | 0.0 | 00 ft Gro | ound Level: | | 3,127.40 ft |
| Wellbore | Wellbo | ore #1 | | | | | | | | |
| Magnetics | Мо | del Name | Sample | e Date | Declina (°) | tion | Dip A (° | | | Strength nT) |
| | | HDGM | | 6/13/2019 | | 6.85 | | 59.85 | | 47,871 |
| Design | Permit | ting Plan | | | | | | | | |
| Audit Notes: | | | | | | | | | | |
| Version: | | | Phas | e: i | PROTOTYPE | Tie | On Depth: | | 0.00 | |
| Vertical Section | on: | De | epth From (T (ft) | VD) | +N/-S (ft) | +E/ (f | | | ection (°) | |
| | | | 0.00 | | 0.00 | 0.0 | 00 | 4 | .06 | |
| Plan Sections | | | | | | | | | | |
| Measured Depth (ft) | Inclination (°) | Azimuth (°) | Vertical Depth (ft) | +N/-S (ft) | +E/-W (ft) | Dogleg Rate (°/100ft) | Build Rate (°/100ft) | Turn Rate (°/100ft) | TFO (°) | Target |
| 0.00 3,442.00 4,342.18 | 0.00 0.00 18.00 | 0.00 0.00 120.89 | 0.00 3,442.00 4,327.44 | 0.00 0.00 -72.02 | 0.00 0.00 120.37 | 0.00 0.00 2.00 | 0.00 0.00 2.00 | 0.00 0.00 0.00 | 0.00 0.00 120.89 | |
| 6,151.40 7,712.87 8,432.05 | 18.00 18.00 89.92 | 120.89 359.75 359.75 | 6,048.08 7,571.00 7,966.90 | -359.15 -238.80 305.29 | 600.21 811.51 809.18 | 0.00 2.00 10.00 | 0.00 0.00 10.00 | 0.00 -7.76 0.00 | 0.00 -149.33 | FTP (Corral Canyon |
| 18,889.12 | 89.92 | 359.75 | 7,980.90 | 10,762.25 | 764.46 | 0.00 | 0.00 | 0.00 | | PBHL (Corral |

| Database: | HOPSPP | Local Co-ordinate Reference: | Well CORRAL CANYON 36_25 FED COM 5H |
|-----------|-------------------------------------|------------------------------|-------------------------------------|
| Company: | ENGINEERING DESIGNS | TVD Reference: | RKB=26.5' @ 3153.90ft |
| Project: | PRD NM DIRECTIONAL PLANS (NAD 1983) | MD Reference: | RKB=26.5' @ 3153.90ft |
| Site: | CORRAL CANYON 36-25 FED COM | North Reference: | Grid |
| Well: | CORRAL CANYON 36_25 FED COM 5H | Survey Calculation Method: | Minimum Curvature |
| Wellbore: | Wellbore #1 | | |
| Design: | Permitting Plan | | |

| Measured Depth (ft) | Inclination (°) | Azimuth (°) | Vertical Depth (ft) | +N/-S (ft) | +E/-W (ft) | Vertical Section (ft) | Dogleg Rate (°/100ft) | Build Rate (°/100ft) | Turn Rate (°/100ft) |
|---------------------------|--------------------|----------------|---------------------------|---------------|---------------|-----------------------------|-----------------------------|----------------------------|---------------------------|
| 0.00 | 0.00 | 0.00 | 0.00 | 0.00 | 0.00 | 0.00 | 0.00 | 0.00 | 0.00 |
| 100.00 | 0.00 | 0.00 | 100.00 | 0.00 | 0.00 | 0.00 | 0.00 | 0.00 | 0.00 |
| 200.00 | 0.00 | 0.00 | 200.00 | 0.00 | 0.00 | 0.00 | 0.00 | 0.00 | 0.00 |
| 300.00 | 0.00 | 0.00 | 300.00 | 0.00 | 0.00 | 0.00 | 0.00 | 0.00 | 0.00 |
| 400.00 | 0.00 | 0.00 | 400.00 | 0.00 | 0.00 | 0.00 | 0.00 | 0.00 | 0.00 |
| 500.00 | 0.00 | 0.00 | 500.00 | 0.00 | 0.00 | 0.00 | 0.00 | 0.00 | 0.00 |
| 600.00 | 0.00 | 0.00 | 600.00 | 0.00 | 0.00 | 0.00 | 0.00 | 0.00 | 0.00 |
| 700.00 | 0.00 | 0.00 | 700.00 | 0.00 | 0.00 | 0.00 | 0.00 | 0.00 | 0.00 |
| 800.00 | 0.00 | 0.00 | 800.00 | 0.00 | 0.00 | 0.00 | 0.00 | 0.00 | 0.00 |
| 900.00 | 0.00 | 0.00 | 900.00 | 0.00 | 0.00 | 0.00 | 0.00 | 0.00 | 0.00 |
| 1,000.00 | 0.00 | 0.00 | 1,000.00 | 0.00 | 0.00 | 0.00 | 0.00 | 0.00 | 0.00 |
| 1,100.00 | 0.00 | 0.00 | 1,100.00 | 0.00 | 0.00 | 0.00 | 0.00 | 0.00 | 0.00 |
| 1,200.00 | 0.00 | 0.00 | 1,200.00 | 0.00 | 0.00 | 0.00 | 0.00 | 0.00 | 0.00 |
| 1,300.00 | 0.00 | 0.00 | 1,300.00 | 0.00 | 0.00 | 0.00 | 0.00 | 0.00 | 0.00 |
| 1,400.00 | 0.00 | 0.00 | 1,400.00 | 0.00 | 0.00 | 0.00 | 0.00 | 0.00 | 0.00 |
| 1,500.00 | 0.00 | 0.00 | 1,500.00 | 0.00 | 0.00 | 0.00 | 0.00 | 0.00 | 0.00 |
| 1,600.00 | 0.00 | 0.00 | 1,600.00 | 0.00 | 0.00 | 0.00 | 0.00 | 0.00 | 0.00 |
| 1,700.00 | 0.00 | 0.00 | 1,700.00 | 0.00 | 0.00 | 0.00 | 0.00 | 0.00 | 0.00 |
| 1,800.00 | 0.00 | 0.00 | 1,800.00 | 0.00 | 0.00 | 0.00 | 0.00 | 0.00 | 0.00 |
| 1,900.00 | 0.00 | 0.00 | 1,900.00 | 0.00 | 0.00 | 0.00 | 0.00 | 0.00 | 0.00 |
| 2,000.00 | 0.00 | 0.00 | 2,000.00 | 0.00 | 0.00 | 0.00 | 0.00 | 0.00 | 0.00 |
| 2,100.00 | 0.00 | 0.00 | 2,100.00 | 0.00 | 0.00 | 0.00 | 0.00 | 0.00 | 0.00 |
| 2,200.00 | 0.00 | 0.00 | 2,200.00 | 0.00 | 0.00 | 0.00 | 0.00 | 0.00 | 0.00 |
| 2,300.00 | 0.00 | 0.00 | 2,300.00 | 0.00 | 0.00 | 0.00 | 0.00 | 0.00 | 0.00 |
| 2,400.00 | 0.00 | 0.00 | 2,400.00 | 0.00 | 0.00 | 0.00 | 0.00 | 0.00 | 0.00 |
| 2,500.00 | 0.00 | 0.00 | 2,500.00 | 0.00 | 0.00 | 0.00 | 0.00 | 0.00 | 0.00 |
| 2,600.00 | 0.00 | 0.00 | 2,600.00 | 0.00 | 0.00 | 0.00 | 0.00 | 0.00 | 0.00 |
| 2,700.00 | 0.00 | 0.00 | 2,700.00 | 0.00 | 0.00 | 0.00 | 0.00 | 0.00 | 0.00 |
| 2,800.00 | 0.00 | 0.00 | 2,800.00 | 0.00 | 0.00 | 0.00 | 0.00 | 0.00 | 0.00 |
| 2,900.00 | 0.00 | 0.00 | 2,900.00 | 0.00 | 0.00 | 0.00 | 0.00 | 0.00 | 0.00 |
| 3,000.00 | 0.00 | 0.00 | 3,000.00 | 0.00 | 0.00 | 0.00 | 0.00 | 0.00 | 0.00 |
| 3,100.00 | 0.00 | 0.00 | 3,100.00 | 0.00 | 0.00 | 0.00 | 0.00 | 0.00 | 0.00 |
| 3,200.00 | 0.00 | 0.00 | 3,200.00 | 0.00 | 0.00 | 0.00 | 0.00 | 0.00 | 0.00 |
| 3,300.00 | 0.00 | 0.00 | 3,300.00 | 0.00 | 0.00 | 0.00 | 0.00 | 0.00 | 0.00 |
| 3,400.00 | 0.00 | 0.00 | 3,400.00 | 0.00 | 0.00 | 0.00 | 0.00 | 0.00 | 0.00 |
| 3.442.00 | 0.00 | 0.00 | 3,442.00 | 0.00 | 0.00 | 0.00 | 0.00 | 0.00 | 0.00 |
| 3,500.00 | 1.16 | 120.89 | 3,500.00 | -0.30 | 0.00 | -0.27 | 2.00 | 2.00 | 0.00 |
| 3,600.00 | 3.16 | 120.89 | 3,599.92 | -2.24 | 3.74 | -0.27 -1.97 | 2.00 | 2.00 | 0.00 |
| 3,700.00 | 5.16 | 120.89 | 3,699.65 | -5.96 | 9.96 | -5.24 | 2.00 | 2.00 | 0.00 |
| 3,800.00 | 7.16 | 120.89 | 3,799.07 | -11.47 | 19.17 | -10.08 | 2.00 | 2.00 | 0.00 |
| 3,900.00 | 9.16 | 120.89 | 3,898.05 | -18.76 | 31.35 | -16.49 | 2.00 | 2.00 | 0.00 |
| 4,000.00 | 11.16 | 120.89 | 3,996.48 | -27.82 | 46.49 | -24.45 | 2.00 | 2.00 | 0.00 |
| 4,100.00 | 13.16 | 120.89 | 4,094.23 | -38.63 | 64.56 | -33.96 | 2.00 | 2.00 | 0.00 |
| 4,200.00 | 15.16 | 120.89 | 4,191.19 | -51.19 | 85.55 | -45.00 | 2.00 | 2.00 | 0.00 |
| 4,300.00 | 17.16 | 120.89 | 4,287.23 | -65.48 | 109.43 | -57.56 | 2.00 | 2.00 | 0.00 |
| 4,342.18 | 18.00 | 120.89 | 4,327.44 | -72.02 | 120.37 | -63.31 | 2.00 | 2.00 | 0.00 |
| 4,342.18 | 18.00 | 120.89 | 4,327.44 4,382.43 | -72.02 | 120.37 | -03.31 -71.38 | 0.00 | 2.00 | 0.00 |
| 4,500.00 | 18.00 | 120.89 | 4,477.53 | -97.07 | 162.22 | -85.33 | 0.00 | 0.00 | 0.00 |
| 4,600.00 | 18.00 | 120.89 | 4,572.64 | -112.94 | 188.75 | -99.28 | 0.00 | 0.00 | 0.00 |
| 4,700.00 | 18.00 | 120.89 | 4,667.74 | -128.81 | 215.27 | -113.23 | 0.00 | 0.00 | 0.00 |
| 4,800.00 | 18.00 | 120.89 | 4,762.84 | -144.68 | 241.79 | -127.18 | 0.00 | 0.00 | 0.00 |
| 4,900.00 | 18.00 | 120.89 | 4,857.95 | -160.55 | 268.31 | -127.18 | 0.00 | 0.00 | 0.00 |
| 5,000.00 | 18.00 | 120.89 | 4,953.05 | -176.42 | 294.84 | -155.08 | 0.00 | 0.00 | 0.00 |
| 5,100.00 | 18.00 | 120.89 | 5,048.15 | -192.29 | 321.36 | -169.04 | 0.00 | 0.00 | 0.00 |
| | - | | | | | | | | |

| Database: | HOPSPP | Local Co-ordinate Reference: | Well CORRAL CANYON 36_25 FED COM 5H |
|-----------|-------------------------------------|------------------------------|-------------------------------------|
| Company: | ENGINEERING DESIGNS | TVD Reference: | RKB=26.5' @ 3153.90ft |
| Project: | PRD NM DIRECTIONAL PLANS (NAD 1983) | MD Reference: | RKB=26.5' @ 3153.90ft |
| Site: | CORRAL CANYON 36-25 FED COM | North Reference: | Grid |
| Well: | CORRAL CANYON 36_25 FED COM 5H | Survey Calculation Method: | Minimum Curvature |
| Wellbore: | Wellbore #1 | | |
| Design: | Permitting Plan | | |

| Measured Depth (ft) | Inclination (°) | Azimuth (°) | Vertical Depth (ft) | +N/-S (ft) | +E/-W (ft) | Vertical Section (ft) | Dogleg Rate (°/100ft) | Build Rate (°/100ft) | Turn Rate (°/100ft) |
|---------------------------|--------------------|----------------|---------------------------|---------------|---------------|-----------------------------|-----------------------------|----------------------------|---------------------------|
| 5,200.00 | 18.00 | 120.89 | 5,143.26 | -208.16 | 347.88 | -182.99 | 0.00 | 0.00 | 0.00 |
| 5,300.00 | 18.00 | 120.89 | 5.238.36 | -224.03 | 374.40 | -196.94 | 0.00 | 0.00 | 0.00 |
| 5,400.00 | 18.00 | 120.89 | 5,333.47 | -239.90 | 400.92 | -210.89 | 0.00 | 0.00 | 0.00 |
| 5,500.00 | 18.00 | 120.89 | 5,428.57 | -255.77 | 427.45 | -224.84 | 0.00 | 0.00 | 0.00 |
| 5,600.00 | 18.00 | 120.89 | 5,523.67 | -271.64 | 453.97 | -238.79 | 0.00 | 0.00 | 0.00 |
| 5,700.00 | 18.00 | 120.89 | 5,618.78 | -287.51 | 480.49 | -252.74 | 0.00 | 0.00 | 0.00 |
| 5,800.00 | 18.00 | 120.89 | 5.713.88 | -303.38 | 507.01 | -266.69 | 0.00 | 0.00 | 0.00 |
| 5,900.00 | 18.00 | 120.89 | 5,808.98 | -319.25 | 533.54 | -280.64 | 0.00 | 0.00 | 0.00 |
| 6,000.00 | 18.00 | 120.89 | 5,904.09 | -335.12 | 560.06 | -294.59 | 0.00 | 0.00 | 0.00 |
| 6,100.00 | 18.00 | 120.89 | 5,999.19 | -350.99 | 586.58 | -308.54 | 0.00 | 0.00 | 0.00 |
| 6,151.40 | 18.00 | 120.89 | 6,048.08 | -359.15 | 600.21 | -308.54 | 0.00 | 0.00 | 0.00 |
| 6,200.00 | 17.17 | 119.22 | 6,094.40 | -366.50 | 612.92 | -322.16 | 2.00 | -1.71 | -3.46 |
| 6,300.00 | 15.52 | 115.22 | 6,190.36 | -379.41 | 637.92 | -322.10 | 2.00 | -1.66 | -3.40 |
| | 13.95 | 115.22 | | | | | | | |
| 6,400.00 | | | 6,287.07 | -389.30 | 661.32 | -341.47 | 2.00 | -1.57 | -4.89 |
| 6,500.00 | 12.51 | 104.28 | 6,384.42 | -396.16 | 683.12 | -346.76 | 2.00 | -1.45 | -6.05 |
| 6,600.00 | 11.23 | 96.78 | 6,482.29 | -399.98 | 703.29 | -349.15 | 2.00 | -1.28 | -7.50 |
| 6,700.00 | 10.18 | 87.58 | 6,580.55 | -400.76 | 721.79 | -348.61 | 2.00 | -1.05 | -9.20 |
| 6,800.00 | 9.45 | 76.65 | 6,679.10 | -398.49 | 738.60 | -345.16 | 2.00 | -0.74 | -10.93 |
| 6,900.00 | 9.09 | 64.40 | 6,777.80 | -393.18 | 753.72 | -338.79 | 2.00 | -0.35 | -12.25 |
| 7,000.00 | 9.17 | 51.79 | 6,876.54 | -384.84 | 767.11 | -329.52 | 2.00 | 0.08 | -12.62 |
| 7,100.00 | 9.67 | 39.93 | 6,975.20 | -373.47 | 778.76 | -317.35 | 2.00 | 0.50 | -11.86 |
| 7,200.00 | 10.52 | 29.59 | 7,073.66 | -359.08 | 788.66 | -302.30 | 2.00 | 0.86 | -10.34 |
| 7,300.00 | 11.66 | 21.02 | 7,171.80 | -341.71 | 796.79 | -284.40 | 2.00 | 1.14 | -8.57 |
| 7,400.00 | 13.00 | 14.06 | 7,269.49 | -321.36 | 803.15 | -263.65 | 2.00 | 1.34 | -6.95 |
| 7,500.00 | 14.50 | 8.46 | 7,366.63 | -298.07 | 807.73 | -240.09 | 2.00 | 1.49 | -5.61 |
| 7,600.00 | 16.10 | 3.91 | 7,463.09 | -271.85 | 810.52 | -213.74 | 2.00 | 1.60 | -4.55 |
| 7,700.00 | 17.78 | 0.19 | 7,558.75 | -242.75 | 811.51 | -184.64 | 2.00 | 1.68 | -3.73 |
| 7,712.87 | 18.00 | 359.75 | 7,571.00 | -238.80 | 811.51 | -180.70 | 2.00 | 1.72 | -3.34 |
| 7,800.00 | 26.71 | 359.75 | 7,651.50 | -205.69 | 811.37 | -147.68 | 10.00 | 10.00 | 0.00 |
| 7,900.00 | 36.71 | 359.75 | 7,736.46 | -153.19 | 811.14 | -95.33 | 10.00 | 10.00 | 0.00 |
| 8,000.00 | 46.71 | 359.75 | 7,811.02 | -86.73 | 810.86 | -29.06 | 10.00 | 10.00 | 0.00 |
| 8,100.00 | 56.71 | 359.75 | 7,872.90 | -8.34 | 810.52 | 49.11 | 10.00 | 10.00 | 0.00 |
| 8,200.00 | 66.71 | 359.75 | 7,920.23 | 79.61 | 810.15 | 136.81 | 10.00 | 10.00 | 0.00 |
| 8,300.00 | 76.71 | 359.75 | 7,951.56 | 174.43 | 809.74 | 231.37 | 10.00 | 10.00 | 0.00 |
| 8,400.00 | 86.71 | 359.75 | 7,965.96 | 273.26 | 809.32 | 329.92 | 10.00 | 10.00 | 0.00 |
| 8,432.05 | 89.92 | 359.75 | 7,966.90 | 305.29 | 809.18 | 361.86 | 10.00 | 10.00 | 0.00 |
| 8,500.00 | 89.92 | 359.75 | 7,967.00 | 373.24 | 808.89 | 429.62 | 0.00 | 0.00 | 0.00 |
| 8,600.00 | 89.92 | 359.75 | 7,967.14 | 473.24 | 808.46 | 529.34 | 0.00 | 0.00 | 0.00 |
| 8,700.00 | 89.92 | 359.75 | 7,967.28 | 573.24 | 808.04 | 629.05 | 0.00 | 0.00 | 0.00 |
| 8,800.00 | 89.92 | 359.75 | 7,967.43 | 673.24 | 807.61 | 728.77 | 0.00 | 0.00 | 0.00 |
| 8,900.00 | 89.92 | 359.75 | 7,967.57 | 773.24 | 807.18 | 828.49 | 0.00 | 0.00 | 0.00 |
| 9,000.00 | 89.92 | 359.75 | 7,967.71 | 873.24 | 806.75 | 928.21 | 0.00 | 0.00 | 0.00 |
| 9,100.00 | 89.92 | 359.75 | 7,967.86 | 973.24 | 806.32 | 1,027.92 | 0.00 | 0.00 | 0.00 |
| 9,200.00 | 89.92 | 359.75 | 7,968.00 | 1,073.24 | 805.90 | 1,127.64 | 0.00 | 0.00 | 0.00 |
| 9,300.00 | 89.92 | 359.75 | 7,968.15 | 1,173.24 | 805.47 | 1,127.04 | 0.00 | 0.00 | 0.00 |
| 9,300.00 9,400.00 | 89.92 | 359.75 | 7,968.29 | 1,173.24 | 805.04 | 1,327.07 | 0.00 | 0.00 | 0.00 |
| 9,500.00 | 89.92 | 359.75 | 7,968.43 | 1,373.23 | 804.61 | 1,426.79 | 0.00 | 0.00 | 0.00 |
| 9,600.00 | 89.92 | 359.75 | 7,968.58 | 1,473.23 | 804.19 | 1,526.51 | 0.00 | 0.00 | 0.00 |
| 9,700.00 | 89.92 | 359.75 | 7,968.72 | 1,573.23 | 803.76 | 1,626.23 | 0.00 | 0.00 | 0.00 |
| 9,700.00 | 89.92 | 359.75 | 7,968.86 | 1,673.23 | 803.33 | 1,725.94 | 0.00 | 0.00 | 0.00 |
| 9,800.00 9,900.00 | 89.92 89.92 | 359.75 | 7,968.00 | 1,073.23 | 802.90 | 1,725.94 | 0.00 | 0.00 | 0.00 |
| 10,000.00 | 89.92 | 359.75 | 7.969.15 | 1,873.23 | 802.48 | 1,925.38 | 0.00 | 0.00 | 0.00 |
| 10,000.00 | 89.92 | 359.75 | 7,969.29 | 1,973.23 | 802.48 | 2,025.10 | 0.00 | 0.00 | 0.00 |
| 10,100.00 | 89.92 | 359.75 | 7,969.44 | 2,073.23 | 802.05 | 2,025.10 | 0.00 | 0.00 | 0.00 |

| Database: | HOPSPP | Local Co-ordinate Reference: | Well CORRAL CANYON 36_25 FED COM 5H |
|-----------|-------------------------------------|------------------------------|-------------------------------------|
| Company: | ENGINEERING DESIGNS | TVD Reference: | RKB=26.5' @ 3153.90ft |
| Project: | PRD NM DIRECTIONAL PLANS (NAD 1983) | MD Reference: | RKB=26.5' @ 3153.90ft |
| Site: | CORRAL CANYON 36-25 FED COM | North Reference: | Grid |
| Well: | CORRAL CANYON 36_25 FED COM 5H | Survey Calculation Method: | Minimum Curvature |
| Wellbore: | Wellbore #1 | | |
| Design: | Permitting Plan | | |

| Measured Depth (ft) | Inclination (°) | Azimuth (°) | Vertical Depth (ft) | +N/-S (ft) | +E/-W (ft) | Vertical Section (ft) | Dogleg Rate (°/100ft) | Build Rate (°/100ft) | Turn Rate (°/100ft) |
|---------------------------|--------------------|------------------|---------------------------|----------------------|------------------|-----------------------------|-----------------------------|----------------------------|---------------------------|
| 10,300.00 | 89.92 | 359.75 | 7,969.58 | 2,173.23 | 801.19 | 2,224.53 | 0.00 | 0.00 | 0.00 |
| 10,400.00 | 89.92 | 359.75 | 7,969.72 | 2,273.22 | 800.76 | 2,324.25 | 0.00 | 0.00 | 0.00 |
| 10,500.00 | 89.92 | 359.75 | 7,969.87 | 2,373.22 | 800.34 | 2,423.97 | 0.00 | 0.00 | 0.00 |
| 10,600.00 | 89.92 | 359.75 | 7,970.01 | 2,473.22 | 799.91 | 2,523.68 | 0.00 | 0.00 | 0.00 |
| 10,700.00 | 89.92 | 359.75 | 7,970.15 | 2,573.22 | 799.48 | 2,623.40 | 0.00 | 0.00 | 0.00 |
| 10,700.00 | 89.92 | 359.75 | 7,970.30 | 2,673.22 | 799.05 | 2,023.40 | 0.00 | 0.00 | 0.00 |
| 10,900.00 | 89.92 | 359.75 | 7,970.30 | 2,073.22 | 799.03 | 2,822.83 | 0.00 | 0.00 | 0.00 |
| 10,900.00 | | | | | | | | | |
| 11,000.00 | 89.92 | 359.75 | 7,970.58 | 2,873.22 | 798.20 | 2,922.55 | 0.00 | 0.00 | 0.00 |
| 11,100.00 | 89.92 | 359.75 | 7,970.73 | 2,973.22 | 797.77 | 3,022.27 | 0.00 | 0.00 | 0.00 |
| 11,200.00 | 89.92 | 359.75 | 7,970.87 | 3,073.22 | 797.34 | 3,121.99 | 0.00 | 0.00 | 0.00 |
| 11,300.00 | 89.92 | 359.75 | 7,971.01 | 3,173.22 | 796.92 | 3,221.70 | 0.00 | 0.00 | 0.00 |
| 11,400.00 | 89.92 | 359.75 | 7,971.16 | 3,273.21 | 796.49 | 3,321.42 | 0.00 | 0.00 | 0.00 |
| 11,500.00 | 89.92 | 359.75 | 7,971.30 | 3,373.21 | 796.06 | 3,421.14 | 0.00 | 0.00 | 0.00 |
| 11,600.00 | 89.92 | 359.75 | 7,971.44 | 3,473.21 | 795.63 | 3,520.86 | 0.00 | 0.00 | 0.00 |
| 11,700.00 | 89.92 | 359.75 | 7,971.59 | 3,573.21 | 795.20 | 3,620.57 | 0.00 | 0.00 | 0.00 |
| 11,800.00 | 89.92 | 359.75 | 7,971.73 | 3,673.21 | 794.78 | 3,720.29 | 0.00 | 0.00 | 0.00 |
| 11,900.00 | 89.92 | 359.75 | 7,971.87 | 3,773.21 | 794.35 | 3,820.01 | 0.00 | 0.00 | 0.00 |
| | | | | | | | | | |
| 12,000.00 | 89.92 | 359.75 | 7,972.02 | 3,873.21 | 793.92 | 3,919.73 | 0.00 | 0.00 | 0.00 |
| 12,100.00 | 89.92 | 359.75 | 7,972.16 | 3,973.21 | 793.49 | 4,019.44 | 0.00 | 0.00 | 0.00 |
| 12,200.00 | 89.92 | 359.75 | 7,972.31 | 4,073.21 | 793.07 | 4,119.16 | 0.00 | 0.00 | 0.00 |
| 12,300.00 | 89.92 | 359.75 | 7,972.45 | 4,173.21 | 792.64 | 4,218.88 | 0.00 | 0.00 | 0.00 |
| 12,400.00 | 89.92 | 359.75 | 7,972.59 | 4,273.20 | 792.21 | 4,318.60 | 0.00 | 0.00 | 0.00 |
| 12,500.00 | 89.92 | 359.75 | 7,972.74 | 4,373.20 | 791.78 | 4,418.31 | 0.00 | 0.00 | 0.00 |
| 12,600.00 | 89.92 | 359.75 | 7,972.88 | 4,473.20 | 791.36 | 4,518.03 | 0.00 | 0.00 | 0.00 |
| 12,700.00 | 89.92 | 359.75 | 7,973.02 | 4,573.20 | 790.93 | 4,617.75 | 0.00 | 0.00 | 0.00 |
| 12,800.00 | 89.92 | 359.75 | 7,973.17 | 4,673.20 | 790.50 | 4,717.46 | 0.00 | 0.00 | 0.00 |
| 12,900.00 | 89.92 | 359.75 | 7,973.31 | 4,773.20 | 790.07 | 4,817.18 | 0.00 | 0.00 | 0.00 |
| 13,000.00 | 89.92 | 359.75 | 7,973.45 | 4,873.20 | 789.64 | 4,916.90 | 0.00 | 0.00 | 0.00 |
| 13,100.00 | 89.92 | 359.75 | 7,973.60 | 4,973.20 | 789.22 | 4,910.90 5,016.62 | 0.00 | 0.00 | 0.00 |
| 13,200.00 | 89.92 | 359.75 | 7,973.74 | 5,073.20 | 788.79 | 5,116.33 | 0.00 | 0.00 | 0.00 |
| 13,300.00 | 89.92 | 359.75 | 7,973.88 | 5,173.20 | 788.36 | 5,216.05 | 0.00 | 0.00 | 0.00 |
| 13,400.00 | 89.92 | 359.75 | 7,974.03 | 5,273.19 | 787.93 | 5,315.77 | 0.00 | 0.00 | 0.00 |
| | | | | | | | | | |
| 13,500.00 | 89.92 | 359.75 | 7,974.17 | 5,373.19 | 787.51 | 5,415.49 | 0.00 | 0.00 | 0.00 |
| 13,600.00 | 89.92 | 359.75 | 7,974.31 | 5,473.19 | 787.08 | 5,515.20 | 0.00 | 0.00 | 0.00 |
| 13,700.00 | 89.92 | 359.75 | 7,974.46 | 5,573.19 | 786.65 | 5,614.92 | 0.00 | 0.00 | 0.00 |
| 13,800.00 | 89.92 | 359.75 | 7,974.60 | 5,673.19 | 786.22 | 5,714.64 | 0.00 | 0.00 | 0.00 |
| 13,900.00 | 89.92 | 359.75 | 7,974.74 | 5,773.19 | 785.80 | 5,814.36 | 0.00 | 0.00 | 0.00 |
| 14,000.00 | 89.92 | 359.75 | 7,974.89 | 5,873.19 | 785.37 | 5,914.07 | 0.00 | 0.00 | 0.00 |
| 14,100.00 | 89.92 | 359.75 | 7,975.03 | 5,973.19 | 784.94 | 6,013.79 | 0.00 | 0.00 | 0.00 |
| 14,200.00 | 89.92 | 359.75 | 7,975.17 | 6,073.19 | 784.51 | 6,113.51 | 0.00 | 0.00 | 0.00 |
| 14,300.00 | 89.92 | 359.75 | 7,975.32 | 6,173.19 | 784.08 | 6,213.23 | 0.00 | 0.00 | 0.00 |
| 14,400.00 | 89.92 | 359.75 | 7,975.46 | 6,273.18 | 783.66 | 6,312.94 | 0.00 | 0.00 | 0.00 |
| 14,500.00 | 89.92 | 359.75 | 7,975.60 | 6,373.18 | | | 0.00 | 0.00 | 0.00 |
| 14,500.00 | 89.92 89.92 | 359.75 359.75 | 7,975.60 7,975.75 | 6,373.18 6,473.18 | 783.23 782.80 | 6,412.66 6,512.38 | 0.00 | 0.00 | 0.00 |
| | | | | | | | | | |
| 14,700.00 14,800.00 | 89.92 89.92 | 359.75 359.75 | 7,975.89 7,976.03 | 6,573.18 | 782.37 | 6,612.09 | 0.00 | 0.00 | 0.00 |
| 14,800.00 | 89.92 89.92 | 359.75 359.75 | 7,976.03 7,976.18 | 6,673.18 6,773.18 | 781.95 781.52 | 6,711.81 6,811.53 | 0.00 0.00 | 0.00 0.00 | 0.00 0.00 |
| | | | | | | | | | |
| 15,000.00 | 89.92 | 359.75 | 7,976.32 | 6,873.18 | 781.09 | 6,911.25 | 0.00 | 0.00 | 0.00 |
| 15,100.00 | 89.92 | 359.75 | 7,976.46 | 6,973.18 | 780.66 | 7,010.96 | 0.00 | 0.00 | 0.00 |
| 15,200.00 | 89.92 | 359.75 | 7,976.61 | 7,073.18 | 780.24 | 7,110.68 | 0.00 | 0.00 | 0.00 |
| 15,300.00 | 89.92 | 359.75 | 7,976.75 | 7,173.18 | 779.81 | 7,210.40 | 0.00 | 0.00 | 0.00 |
| 15,400.00 | 89.92 | 359.75 | 7,976.90 | 7,273.17 | 779.38 | 7,310.12 | 0.00 | 0.00 | 0.00 |
| 15,500.00 | 89.92 | 359.75 | 7,977.04 | 7,373.17 | 778.95 | 7,409.83 | 0.00 | 0.00 | 0.00 |
| 15,600.00 | 89.92 | 359.75 | 7,977.18 | 7,473.17 | 778.52 | 7,509.55 | 0.00 | 0.00 | 0.00 |


| Database: | HOPSPP | Local Co-ordinate Reference: | Well CORRAL CANYON 36_25 FED COM 5H |
|-----------|-------------------------------------|------------------------------|-------------------------------------|
| Company: | ENGINEERING DESIGNS | TVD Reference: | RKB=26.5' @ 3153.90ft |
| Project: | PRD NM DIRECTIONAL PLANS (NAD 1983) | MD Reference: | RKB=26.5' @ 3153.90ft |
| Site: | CORRAL CANYON 36-25 FED COM | North Reference: | Grid |
| Well: | CORRAL CANYON 36_25 FED COM 5H | Survey Calculation Method: | Minimum Curvature |
| Wellbore: | Wellbore #1 | | |
| Design: | Permitting Plan | | |

| Measured Depth (ft) | Inclination (°) | Azimuth (°) | Vertical Depth (ft) | +N/-S (ft) | +E/-W (ft) | Vertical Section (ft) | Dogleg Rate (°/100ft) | Build Rate (°/100ft) | Turn Rate (°/100ft) |
|---------------------------|--------------------|------------------|---------------------------|----------------------|------------------|-----------------------------|-----------------------------|----------------------------|---------------------------|
| 15,700.00 15,800.00 | 89.92 89.92 | 359.75 359.75 | 7,977.33 7,977.47 | 7,573.17 7,673.17 | 778.10 777.67 | 7,609.27 7,708.99 | 0.00 0.00 | 0.00 0.00 | 0.00 0.00 |
| 15,900.00 | 89.92 | 359.75 | 7,977.61 | 7,773.17 | 777.24 | 7,808.70 | 0.00 | 0.00 | 0.00 |
| 16,000.00 | 89.92 | 359.75 | 7,977.76 | 7,873.17 | 776.81 | 7,908.42 | 0.00 | 0.00 | 0.00 |
| 16,100.00 | 89.92 | 359.75 | 7,977.90 | 7,973.17 | 776.39 | 8,008.14 | 0.00 | 0.00 | 0.00 |
| 16,200.00 | 89.92 | 359.75 | 7,978.04 | 8,073.17 | 775.96 | 8,107.86 | 0.00 | 0.00 | 0.00 |
| 16,300.00 | 89.92 | 359.75 | 7,978.19 | 8,173.16 | 775.53 | 8,207.57 | 0.00 | 0.00 | 0.00 |
| 16,400.00 | 89.92 | 359.75 | 7,978.33 | 8,273.16 | 775.10 | 8,307.29 | 0.00 | 0.00 | 0.00 |
| 16,500.00 | 89.92 | 359.75 | 7,978.47 | 8,373.16 | 774.68 | 8,407.01 | 0.00 | 0.00 | 0.00 |
| 16,600.00 | 89.92 | 359.75 | 7,978.62 | 8,473.16 | 774.25 | 8,506.72 | 0.00 | 0.00 | 0.00 |
| 16,700.00 | 89.92 | 359.75 | 7,978.76 | 8,573.16 | 773.82 | 8,606.44 | 0.00 | 0.00 | 0.00 |
| 16,800.00 | 89.92 | 359.75 | 7,978.90 | 8,673.16 | 773.39 | 8,706.16 | 0.00 | 0.00 | 0.00 |
| 16,900.00 | 89.92 | 359.75 | 7,979.05 | 8,773.16 | 772.96 | 8,805.88 | 0.00 | 0.00 | 0.00 |
| 17,000.00 | 89.92 | 359.75 | 7,979.19 | 8,873.16 | 772.54 | 8,905.59 | 0.00 | 0.00 | 0.00 |
| 17,100.00 | 89.92 | 359.75 | 7,979.33 | 8,973.16 | 772.11 | 9,005.31 | 0.00 | 0.00 | 0.00 |
| 17,200.00 | 89.92 | 359.75 | 7,979.48 | 9,073.16 | 771.68 | 9,105.03 | 0.00 | 0.00 | 0.00 |
| 17,300.00 | 89.92 | 359.75 | 7,979.62 | 9,173.15 | 771.25 | 9,204.75 | 0.00 | 0.00 | 0.00 |
| 17,400.00 | 89.92 | 359.75 | 7,979.76 | 9,273.15 | 770.83 | 9,304.46 | 0.00 | 0.00 | 0.00 |
| 17,500.00 | 89.92 | 359.75 | 7,979.91 | 9,373.15 | 770.40 | 9,404.18 | 0.00 | 0.00 | 0.00 |
| 17,600.00 | 89.92 | 359.75 | 7,980.05 | 9,473.15 | 769.97 | 9,503.90 | 0.00 | 0.00 | 0.00 |
| 17,700.00 | 89.92 | 359.75 | 7,980.19 | 9,573.15 | 769.54 | 9,603.62 | 0.00 | 0.00 | 0.00 |
| 17,800.00 | 89.92 | 359.75 | 7,980.34 | 9,673.15 | 769.12 | 9,703.33 | 0.00 | 0.00 | 0.00 |
| 17,900.00 | 89.92 | 359.75 | 7,980.48 | 9,773.15 | 768.69 | 9,803.05 | 0.00 | 0.00 | 0.00 |
| 18,000.00 | 89.92 | 359.75 | 7,980.62 | 9,873.15 | 768.26 | 9,902.77 | 0.00 | 0.00 | 0.00 |
| 18,100.00 | 89.92 | 359.75 | 7,980.77 | 9,973.15 | 767.83 | 10,002.49 | 0.00 | 0.00 | 0.00 |
| 18,200.00 | 89.92 | 359.75 | 7,980.91 | 10,073.15 | 767.41 | 10,102.20 | 0.00 | 0.00 | 0.00 |
| 18,300.00 | 89.92 | 359.75 | 7,981.06 | 10,173.14 | 766.98 | 10,201.92 | 0.00 | 0.00 | 0.00 |
| 18,400.00 | 89.92 | 359.75 | 7,981.20 | 10,273.14 | 766.55 | 10,301.64 | 0.00 | 0.00 | 0.00 |
| 18,500.00 | 89.92 | 359.75 | 7,981.34 | 10,373.14 | 766.12 | 10,401.35 | 0.00 | 0.00 | 0.00 |
| 18,600.00 | 89.92 | 359.75 | 7,981.49 | 10,473.14 | 765.69 | 10,501.07 | 0.00 | 0.00 | 0.00 |
| 18,700.00 | 89.92 | 359.75 | 7,981.63 | 10,573.14 | 765.27 | 10,600.79 | 0.00 | 0.00 | 0.00 |
| 18,800.00 | 89.92 | 359.75 | 7,981.77 | 10,673.14 | 764.84 | 10,700.51 | 0.00 | 0.00 | 0.00 |
| 18,889.12 | 89.92 | 359.75 | 7,981.90 | 10,762.25 | 764.46 | 10,789.37 | 0.00 | 0.00 | 0.00 |

| Design Targets | | | | | | | | | |
|-----------------------------------------------------------|------------------|-----------------|-------------|---------------|---------------|--------------------|-------------------|---------------------|-------------------|
| Target Name - hit/miss target [- Shape | Dip Angle (°) | Dip Dir. (°) | TVD (ft) | +N/-S (ft) | +E/-W (ft) | Northing (usft) | Easting (usft) | Latitude | Longitude |
| FTP (Corral Canyon - plan hits target cent - Point | 0.00 er | 0.00 | 7,966.90 | 305.29 | 809.18 | 424,663.28 | 665,047.09 | 32° 10' 0.644743 N | 103° 56' 0.709848 |
| PBHL (Corral Canyon - plan hits target cent - Point | 0.00 er | 0.01 | 7,981.90 | 10,762.25 | 764.46 | 435,119.45 | 665,002.37 | 32° 11' 44.119500 N | 103° 56' 0.778045 |

| Database: | HOPSPP | Local Co-ordinate Reference: | Well CORRAL CANYON 36_25 FED COM 5H |
|-------------------------------|------------------------------------------------------------------|------------------------------|-------------------------------------|
| Company: | ENGINEERING DESIGNS | TVD Reference: | RKB=26.5' @ 3153.90ft |
| Project: | PRD NM DIRECTIONAL PLANS (NAD 1983) | MD Reference: | RKB=26.5' @ 3153.90ft |
| Site: | CORRAL CANYON 36-25 FED COM | North Reference: | Grid |
| Well: Wellbore: Design: | CORRAL CANYON 36_25 FED COM 5H Wellbore #1 Permitting Plan | Survey Calculation Method: | Minimum Curvature |

| Measured | Vertical | Local Coor | dinates | |
|---------------|---------------|---------------|---------------|------------------------|
| Depth (ft) | Depth (ft) | +N/-S (ft) | +E/-W (ft) | Comment |
| 3,442.00 | 3,442.00 | 0.00 | 0.00 | Build 2.00°/100' |
| 4,342.18 | 4,327.44 | -72.02 | 120.37 | Hold 18.00° Tangent |
| 6,151.40 | 6,048.08 | -359.15 | 600.21 | Turn 2.00°/100' |
| 7,712.87 | 7,571.00 | -238.80 | 811.51 | KOP, Build 10.00°/100' |
| 8,432.05 | 7,966.90 | 305.29 | 809.18 | Landing Point |
| 18,889.12 | 7,981.90 | 10,762.25 | 764.46 | TD at 18889.12' MD |

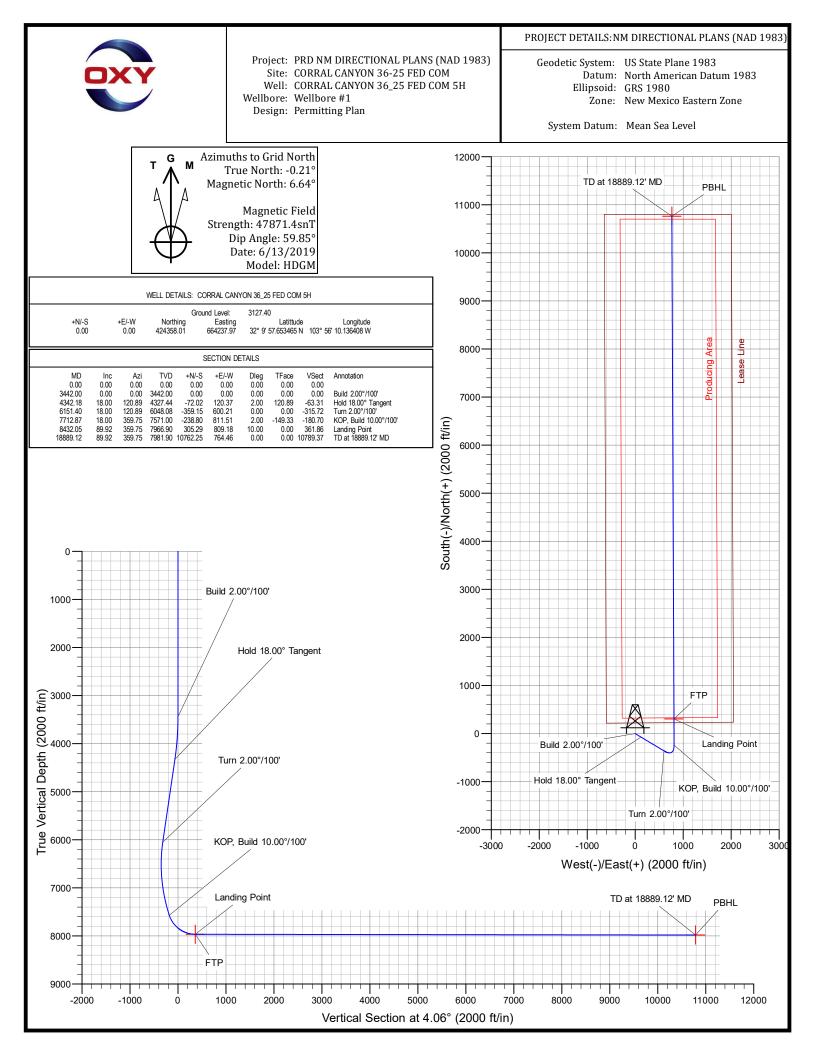

1. Geologic Formations

| TVD of target | 7981' | Pilot Hole Depth | N/A |
|---------------|--------|----------------------------------|------|
| MD at TD: | 18889' | Deepest Expected fresh water: | 404' |

Delaware Basin

| Formation | TVD - RKB | Expected Fluids |
|----------------|-----------|------------------------|
| Rustler | 404 | |
| Salado | 858 | Salt |
| Castile | 1,867 | Salt |
| Lamar/Delaware | 3,356 | Oil/Gas/Brine |
| Bell Canyon | 3,367 | Oil/Gas/Brine |
| Cherry Canyon | 4,282 | Oil/Gas/Brine |
| Brushy Canyon | 5,617 | Losses |
| Bone Spring | 7,173 | Oil/Gas |

*H2S, water flows, loss of circulation, abnormal pressures, etc.

2. Casing Program

| | | | | | | | | | Buoyant | Buoyant |
|----------------|------------|---------|-----------|--------|---------|-------|----------|---------------|-----------|----------|
| Hala Cina (in) | Casing Int | terval | Csg. Size | Weight | Cuada | Com | SF | CE Dame | Body SF | Joint SF |
| Hole Size (in) | From (ft) | To (ft) | (in) | (lbs) | Grade | Conn. | Collapse | SF Burst | Tension | Tension |
| 14.75 | 0 | 798 | 10.75 | 40.5 | J-55 | BTC | 1.125 | 1.2 | 1.4 | 1.4 |
| 9.875 | 0 | 7612 | 7.625 | 26.4 | L-80 HC | BTC | 1.125 | 1.2 | 1.4 | 1.4 |
| 6.75 | 0 | 18889 | 5.5 | 20 | P-110 | DQX | 1.125 | 1.2 | 1.4 | 1.4 |
| | | | | | | | SF Value | s will meet o | or Exceed | |

All casing strings will be tested in accordance with Onshore Oil and Gas Order #2 III.B.1.h

*Oxy requests the option to set casing shallower yet still below the salts if losses or hole conditions require this. Cement volumes may be adjusted if casing is set shallower and a DV tool may be run in case hole conditions merit pumping a second stage cement job to comply with permitted top of cement. If cement circulated to surface during first stage, we will drop a cancelation cone and not pump the second stage.

*Oxy requests the option to run production casing with DQX, SF TORQ, and/or DQW TORQ connections to accommodate hole conditions or drilling operations.

Annular Clearance Variance Request

As per the agreement reached in the Oxy/BLM meeting on Feb 22, 2018, Oxy requests permission to allow deviation from the 0.422" annular clearance requirement from Onshore Order #2 under the following conditions:

- 1. Annular clearance to meet or exceed 0.422" between intermediate casing ID and production casing coupling only on the first 500' overlap between both casings.
- 2. Annular clearance less than 0.422" is acceptable for the curve and lateral portions of the production open hole section.

| | Y or N |
|--------------------------------------------------------------------------------------------------------------------------------------------------|--------|
| Is casing new? If used, attach certification as required in Onshore Order #1 | Y |
| Does casing meet API specifications? If no, attach casing specification sheet. | Y |
| Is premium or uncommon casing planned? If yes attach casing specification sheet. | Y |
| Does the above casing design meet or exceed BLM's minimum standards? If not provide justification (loading assumptions, casing design criteria). | Y |
| Will the intermediate pipe be kept at a minimum 1/3 fluid filled to avoid approaching the collapse pressure rating of the casing? | Y |
| Is well located within Capitan Reef? | N |
| If yes, does production casing cement tie back a minimum of 50' above the Reef? | |
| Is well within the designated 4 string boundary. | |
| Is well located in SOPA but not in R-111-P? | N |
| If yes, are the first 2 strings cemented to surface and 3 rd string cement tied back 500' into previous casing? | |
| Is well located in R-111-P and SOPA? | N |
| If yes, are the first three strings cemented to surface? | |
| Is 2 nd string set 100' to 600' below the base of salt? | |
| Is well located in high Cave/Karst? | N |
| If yes, are there two strings cemented to surface? | |
| (For 2 string wells) If yes, is there a contingency casing if lost circulation occurs? | |
| Is well located in critical Cave/Karst? | N |
| If yes, are there three strings cemented to surface? | |

3. Cementing Program

| Casing String | # Sks | Wt. (lb/gal) | Yld (ft3/sack) | H20 (gal/sk) | 500# Comp. Strength (hours) | Slurry Description | |
|-------------------------------|-----------------|-----------------|-------------------|-----------------|--------------------------------------|--------------------------------------------|--|
| Surface (Lead) | N/A | N/A | N/A | N/A | N/A | N/A | |
| Surface (Tail) | 654 | 14.8 | 1.33 | 6.365 | 5:26 | Class C Cement, Accelerator | |
| Intermediate 1st Stage (Lead) | N/A | N/A | N/A | N/A | N/A | N/A | |
| Intermediate 1st Stage (Tail) | 246 | 13.2 | 1.65 | 8.640 | 11:54 | Class H Cement, Retarder, Dispersant, Salt | |
| Intermediate 2nd Stage | (Tail Slurry) t | o be pumped a | as Bradenhead | Squeeze fror | n surface, dov | on the Intermediate annulus | |
| Intermediate 2nd Stage (Lead) | N/A | N/A | N/A | N/A | N/A | N/A | |
| Intermediate 2nd Stage (Tail) | 722 | 12.9 | 1.92 | 10.41 | 23:10 | Class C Cement, Accelerator | |
| Production (Lead) | N/A | N/A | N/A | N/A | N/A | N/A | |
| Production (Tail) | 863 | 13.2 | 1.38 | 6.686 | 3:39 | Class H Cement, Retarder, Dispersant, Salt | |

| Casing String | Top (ft) | Bottom (ft) | % Excess |
|-------------------------------|----------|-------------|----------|
| Surface (Lead) | N/A | N/A | N/A |
| Surface (Tail) | 0 | 798 | 100% |
| Intermediate 1st Stage (Lead) | N/A | N/A | N/A |
| Intermediate 1st Stage (Tail) | 5867 | 7612 | 5% |
| Intermediate 2nd Stage (Lead) | N/A | N/A | N/A |
| Intermediate 2nd Stage (Tail) | 0 | 5867 | 10% |
| Production (Lead) | N/A | N/A | N/A |
| Production (Tail) | 7112 | 18889 | 20% |

*OXY requests a variance to cement the 7-5/8" intermediate casing string offline, see attached for additional information.

4. Pressure Control Equipment

| BOP installed and tested before drilling which hole? | Size? | Min. Required WP | Туре | | ~ | Tested to: | | | | | | | | | |
|------------------------------------------------------------|---------------------------------------------|------------------------|---------|--------------------|----|-------------------------|------|------|--------------------|------|------|------|----------|-----|---|
| | | 3M | Annular | | 1 | 70% of working pressure | | | | | | | | | |
| 0.975" Hele | 13-5/8" | | Blind R | am | ✓ | | | | | | | | | | |
| 9.875" Hole | 13-5/8 | 13-5/8 | 13-5/8 | 13-5/8** | 3M | Pipe Ram | | | 250 mai / 2000 mai | | | | | | |
| | | 3111 | | | | 5101 | 21/1 | 3111 | 21/1 | 5111 | 3111 | 3111 | Double I | Ram | ✓ |
| | | | | | | Other* | | | | | | | | | |
| | | 3M | Annul | ar | 1 | 70% of working pressure | | | | | | | | | |
| 6.75" Hole | 12 5/0" | | Blind R | am | ✓ | | | | | | | | | | |
| 0.75 Hole | 6.75" Hole 13-5/8" 3M Pipe Rar Double Ra | 214 | Pipe Ra | am | | 250 psi / 3000 psi | | | | | | | | | |
| | | Ram | ✓ | 250 psi / 5000 psi | | | | | | | | | | | |
| | | | Other* | | | | | | | | | | | | |

*Specify if additional ram is utilized.

Oxy will utilize a 5M annular with a 10M BOPE stack. The BOP/BOPE will be tested by an independent service company to 250 psi low and the high pressure indicated above per Onshore Order 2 requirements. The System may be upgraded to a higher pressure but still tested to the working pressure listed in the table above. If the system is upgraded all the components installed will be functional and tested.

Pipe rams will be operationally checked each 24 hour period. Blind rams will be operationally checked on each trip out of the hole. These checks will be noted on the daily tour sheets. Other accessories to the BOP equipment will include a Kelly cock and floor safety valve (inside BOP) and choke lines and choke manifold. See attached schematics.

| Formation integrity test will be performed per Onshore Order #2. On Exploratory wells or on that portion of any well approved for a 5M BOPE system or greater, a pressure integrity test of each casing shoe shall be performed. Will be tested in | | | | | |
|----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|---------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|--|--|--|--|
| accordance with Onshore Oil and Gas Order #2 III.B.1.i. A variance is requested for the use of a flexible choke line from the BOP to Choke Manifold. See attached for specs and hydrostatic test chart. | | | | | |
| Y | Are anchors required by manufacturer? | | | | |
| and co per Or requir system that is rotary | tibowl or a unionized multibowl wellhead system will be employed. The wellhead onnection to the BOPE will meet all API 6A requirements. The BOP will be tested ashore Order #2 after installation on the surface casing which will cover testing ements for a maximum of 30 days. If any seal subject to test pressure is broken the a must be tested. We will test the flange connection of the wellhead with a test port directly in the flange. We are proposing that we will run the wellhead through the prior to cementing surface casing as discussed with the BLM on October 8, 2015. tached schematics. | | | | |

BOP Break Testing Request

As per the agreement reached in the Oxy/BLM meeting on Feb 22, 2018, Oxy requests permission to allow BOP Break Testing under the following conditions:

- After a full BOP test is conducted on the first well on the pad.
- When skidding to drill an intermediate section that casing point is either shallower than the third Bone Spring or 10,000 feet TVD.
- Full BOP test will be required prior to drilling any production hole.

5. Mud Program

| De | pth | Trme | Weight | Viceosity | Water Loss |
|-----------|---------|-----------------------------------------------|----------|-----------|------------|
| From (ft) | To (ft) | Туре | (ppg) | Viscosity | water Loss |
| 0 | 798 | Water-Based Mud | 8.6-8.8 | 40-60 | N/C |
| 798 | 7612 | Saturated Brine- Based or Oil-Based Mud | 8.0-10.0 | 35-45 | N/C |
| 7612 | 18889 | Water-Based or Oil- Based Mud | 8.0-9.6 | 38-50 | N/C |

Sufficient mud materials to maintain mud properties and meet minimum lost circulation and weight increase requirements will be kept on location at all times. The following is a general list of products: Barite, Bentonite, Gypsum, Lime, Soda Ash, Caustic Soda, Nut Plug, Cedar Fiber, Cotton Seed Hulls, Drilling Paper, Salt Water Clay, CACL2. Oxy will use a closed mud system.

| What will be used to monitor the loss or gain | PVT/MD Totco/Visual Monitoring |
|-----------------------------------------------|--------------------------------|
| of fluid? | |

6. Logging and Testing Procedures

| Logg | ing, Coring and Testing. |
|------|------------------------------------------------------------------------------------------|
| Yes | Will run GR from TD to surface (horizontal well – vertical portion of hole). Stated logs |
| | run will be in the Completion Report and submitted to the BLM. |
| No | Logs are planned based on well control or offset log information. |
| No | Drill stem test? If yes, explain |
| No | Coring? If yes, explain |

| Addi | tional logs planned | Interval |
|------|---------------------|----------|
| No | Resistivity | |
| No | Density | |
| No | CBL | |
| Yes | Mud log | ICP - TD |
| No | PEX | |

7. Drilling Conditions

| Condition | Specify what type and where? |
|-------------------------------|------------------------------|
| BH Pressure at deepest TVD | 3985 psi |
| Abnormal Temperature | No |
| BH Temperature at deepest TVD | 144°F |

Pump high viscosity sweeps as needed for hole cleaning. The mud system will be monitored visually/manually as well as with an electronic PVT. The necessary mud products for additional weight and fluid loss control will be on location at all times. Appropriately weighted mud will be used to isolate potential gas, oil, and water zones until such time as casing can be cemented into place for zonal isolation.

Hydrogen Sulfide (H2S) monitors will be installed prior to drilling out the surface shoe. If H2S is detected in concentrations greater than 100 ppm, the operator will comply with the provisions of Onshore Oil and Gas Order #6. If Hydrogen Sulfide is encountered, measured values and formations will be provided to the BLM.

N H2S is present

Y H2S Plan attached

8. Other facets of operation

| | Yes/No |
|------------------------------------------------------------------------------------|--------|
| Will the well be drilled with a walking/skidding operation? If yes, describe. | Yes |
| • We plan to drill the four well pad in batch by section: all surface sections, | |
| intermediate sections and production sections. The wellhead will be | |
| secured with a night cap whenever the rig is not over the well. | |
| Will more than one drilling rig be used for drilling operations? If yes, describe. | Yes |
| • Oxy requests the option to contract a Surface Rig to drill, set surface | |
| casing, and cement for this well. If the timing between rigs is such that | |
| Oxy would not be able to preset surface, the Primary Rig will MIRU and | |
| drill the well in its entirety per the APD. Please see the attached document | |
| for information on the spudder rig. | |

Total estimated cuttings volume: 1313.3 bbls.

9. Company Personnel

| Name | <u>Title</u> | Office Phone | Mobile Phone |
|-----------------|------------------------------|---------------------|--------------|
| Garrett Granier | Drilling Engineer | 713-513-6633 | 832-265-0581 |
| William Turner | Drilling Engineer Supervisor | 713-350-4951 | 661-817-4586 |
| Simon Benavides | Drilling Superintendent | 713-522-8652 | 281-684-6897 |
| Diego Tellez | Drilling Manager | 713-350-4602 | 713-303-4932 |

