

District I – (575) 393-6161  
1625 N. French Dr., Hobbs, NM 88240  
District II – (575) 748-1283  
811 S. First St., Artesia, NM 88210  
District III – (505) 334-6178  
1000 Rio Brazos Rd., Aztec, NM 87410  
District IV – (505) 476-3460  
1220 S. St. Francis Dr., Santa Fe, NM 87505

State of New Mexico  
Energy, Minerals and Natural Resources

OIL CONSERVATION DIVISION  
1220 South St. Francis Dr.  
Santa Fe, NM 87505

SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)		WELL API NO. 30-015-25402
1. Type of Well: Oil Well <input checked="" type="checkbox"/> Gas Well <input type="checkbox"/> Other <input type="checkbox"/>		5. Indicate Type of Lease STATE <input checked="" type="checkbox"/> FEE <input type="checkbox"/>
2. Name of Operator ALAMO PERMIAN RESOURCES LLC		6. State Oil & Gas Lease No. B-3823
3. Address of Operator 415 W. WALL ST., SUITE 500 MIDLAND, TX 79701		7. Lease Name or Unit Agreement Name STATE AE
4. Well Location Unit Letter <u>G</u> : 1650 feet from the <u>N</u> line and <u>2310</u> feet from the <u>E</u> line Section <u>4</u> Township <u>18S</u> Range <u>28E</u> NMPM County <u>EDDY</u>		8. Well Number <u>1</u>
11. Elevation (Show whether DR, RKB, RT, GR, etc.)		9. OGRID Number 274841
10. Pool name or Wildcat ARTESIA; Queen-Grayburg-San Andres		

12. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☐  
 TEMPORARILY ABANDON ☐ CHANGE PLANS ☐  
 PULL OR ALTER CASING ☐ MULTIPLE COMPL ☐  
 DOWNHOLE COMMINGLE ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐ ALTERING CASING ☐  
 COMMENCE DRILLING OPNS. ☐ P AND A ☐  
 CASING/CEMENT JOB ☐

OTHER: ☐

OTHER: ☒ RETURN TO PRODUCTION

13. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion.

04/24/12


MIRU. Long-stroke pump, very little action. Put truck on well. Pressure would not hold. POOH w/120 3/4" rods & pump. ND WH, NU BOP. PU 6 jts 2 3/8" tbg, tag btm @ 3220'. POOH w/6 jts 2 3/8" tbg, laying down. SDFN.

04/25/12

POOH w/96 jts 2 3/8" tbg. TIH w/5 1/2" scraper & 4 3/8" bit. Tag btm @ 3220'. POOH w/tbg. RIH w/15' mule shoe, SN & 2" bit. Tag btm @ 3220'. POOH w/tbg. RIH w/15' mule shoe, SN, 2 3/8" endurance joint, 28 stands of 2 3/8" tbg & 5 1/2"x2 3/8" tubing anchor. RIH w/rest of tbg. Set tbg anchor @ 1919'. Set SN @ 3114'. ND BOP, NU WH. SDFN.

04/26/12

RIH w/120 3/4" rods & pump. Checked pump action, good. HWO. RD.

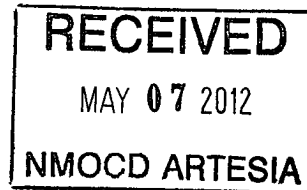

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE Tom Fulvi TITLE Regulatory Affairs Coordinator DATE 05/03/2012

Type or print name Tom Fulvi E-mail address: tfulvi@alamoresources.com PHONE: 432 897 0673

For State Use Only

APPROVED BY: L R Wade TITLE Dist H Spewise DATE 05/11/2012

Conditions of Approval (if any):