Office	e of New Mexico	Form C-103
	erals and Natural Resources	Revised August 1, 2011 WELL API NO.
1625 N., French Dr., Hobbs, NM 88240 <u>District II</u> – (575) 748-1283		30-015-21812
811 S. First St., Artesia, NM 88210 OIL CONS	ERVATION DIVISION	5. Indicate Type of Lease
District III – (505) 334-6178 1220 S 1000 Rio Brazos Rd., Aztec, NM 87410	South St. Francis Dr.	STATE FEE
District IV (505) 476-3460 San	ta Fe, NM 87505	6. State Oil & Gas Lease No.
1220 S. St. Francis Dr., Santa Fe, NM 87505		
SUNDRY NOTICES AND REPORT	TS ON WELLS	7. Lease Name or Unit Agreement Name
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT"		Jackson Estate BY
PROPOSALS.)	•	8. Well Number
	Other	7
2. Name of Operator		9 OGRID Number
Yates Petroleum Corporation 3. Address of Operator		025575 10. Pool name or Wildcat
105 South Fourth Street, Artesia, NM 88210		Eagle Creek; San Andres
4. Well Location		
Unit Letter F: 1650 feet from the	ne North line and	650 feet from the West line
Section 22 Township	17S Range 25E	NMPM Eddy County
11. Elevation (Shi	ow whether DR, RKB, RT, GR, etc.) 3537'GR	
The control of the co		
12. Check Appropriate Box	to Indicate Nature of Notice,	Report or Other Data
NOTICE OF INTENTION TO:	l Sur	SEQUENT REPORT OF:
PERFORM REMEDIAL WORK PLUG AND ABAN		
TEMPORARILY ABANDON CHANGE PLANS		
PULL OR ALTER CASING MULTIPLE COMP		_
DOWNHOLE COMMINGLE		
<u>—</u>		
OTHER:	OTHER:	
13. Describe proposed or completed operations. (C		
of starting any proposed work). SEE RULE 19 proposed completion or recompletion.	15.7.14 NMAC. For Multiple Con	npletions: Attach wellbore diagram of
proposed completion of recompletion.		•
Yates Petroleum Corporation plans to plug and abandon	this well as follows:	
1 NULDOR TOU with any dustion aminused		
 NU BOP. TOH with production equipment. RIH with bit and scraper across perfs at 1450' and cir 	roulate Class "C" coment to 500' wi	th 115 av. Notas If fill is to and and and
unable to get across perfs then TOH and TIH with a CIB		
3. Cut off wellhead and verify that there is cement behin	nd all casing strings at surface. If so	cement to surface with 60 sy. If not then
RU wireline unit, perforate and circulate cement to surfa		
casing.		
4. Install dry hole marker and clean location.	Approval Granted providing is complete by une 1	g work _
W/ III	is complete by time !	8.2013
Wellbore schematics attached	is complete p4-2-2-2	RECEIVED
NOTE: Yates Petroleum Corporation will use steel pits	and no earth pits	1
		MAR 1 4 2013
Spud Date:	Rig Release Date:	NMOCD ARTESIA
Spud Date.	Nig Release Date.	LIMOUD ANTESIA
I hereby certify that the information above is true and co	mplete to the best of my knowledge	and belief.
SIGNATURE (CA)	TITLE Regulatory Reporting Su	pervisor DATE March 13, 2013
	il address: <u>tinah@yatespetroleun</u>	n.com PHONE: <u>575-748-4168</u>
For State Use Only	1 000	al:al
APPROVED BY WOOL	TITLE UNT ET DYPOWI	SO7 DATE 3/18/2013
Conditions of Approval (if any): AHAChe	TITLE SIST EL SUPEWI L'COA'S	, ,

Well Name: <u>Jackson Estate BY #7</u> Field: <u>Eagle Creek</u> Location: 1650' FNL & 1650' FWL Sec 22-17S-25E


County: Eddy State: New Mexico
GL: 3,537' Zero: KB:

Spud Date: 5/18/1976 Completion Date: 6/3/1976

BEFORE

Comments: API # 30015218120000

-
Depth Set
308'
1,170′
1,485'

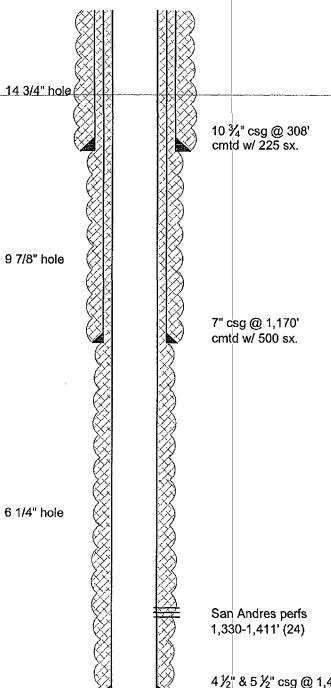

4½" & 5½" csg @ 1,485' cmtd w/ 150 sx.

TD 1,485'

DATE: 2/4/2013

Well Name: <u>Jackson Estate BY #7</u> Field: <u>Eagle Creek</u> Location: <u>1650' FNL & 1650' FWL Sec 22-17S-25E</u>

County: Eddy State: New Mexico
GL: 3.537' Zero: KB:

GL: 3,537' Zero: KB: Spud Date: 5/18/1976 Completion Date: 6/3/1976

Comments: API # 30015218120000

AFTER

Cement to surface w/ 175 sx.

Casing Program		
Depth Set		
308'		
1,170'		
1,485'		

9 7/8" hole

10 3/4" csg @ 308' cmtd w/ 225 sx.

7" csg @ 1,170' cmtd w/ 500 sx.

6 1/4" hole

San Andres perfs 1,330-1,411' (24)

 $4\frac{1}{2}$ " & $5\frac{1}{2}$ " csg @ 1,485' cmtd w/ 150 sx.

TD 1,485'

DATE: 2/4/2013

NEW MEXICO OIL CONSERVATION DIVISION DISTRICT 2 OFFICE 811 S. FIRST STREET ARTESIA, NM 88210 (575)748-1283

CONDITIONS OF APPROVAL FOR PLUGGING & ABANDONMENT

Operator: Vales Petroleum Corp Well Name & Number: Jackson Esteta BY #7 API#: 30-015-21812

- 1. Produced water <u>will not</u> be used during any part of the plugging & abandonment operation.
- 2. Notify NMOCD Dist. 2 office at least 24 hrs before beginning work.
- 3. Closed Loop System is to be used for entire plugging operation. Upon completion, contents of steel pit are to be hauled to a permitted disposal location.
- 4. Trucking companies being used to haul oilfield waste fluids to a disposal commercial or private shall have an approved NMOCD C-133 permit. A copy of this permit shall be available in each truck used to haul waste products. It is the responsibility of the operator, as well as the contractor, to verify that this permit is place prior to performing work. Drivers shall produce a copy upon request of NMOCD Field Inspectors.
- 5. A subsequent C-103 will serve as notification that the well bore has been plugged ONLY. A C-103 FINAL shall be filed before any bonding can be released on the well. Upon receipt of the Final, an inspection will be performed to verify that the location has been satisfactorily cleaned to NMOCD standards.
- 6. If work has not begun within 90 days of the approval of this procedure, an extension request must be filed, stating reason that well has not been plugged.
- 7. Every attempt must be made to clean the well bore out to below the perfs, before any plugs can be set, by whatever means possible.
- 8. Cement Retainers may not be used.

- 9. Squeeze pressures are not to exceed 500 PSI, unless approval is given by NMOCD.
- 10. Plugs may be combined after consulting with and getting approval from NMOCD.
- 11. Minimum WOC time for tag plugs will be 4 Hrs.

DATE: Mar 18 - 2013

APPROVED BY: Sold

GUIDELINES FOR PLUGGING AND ABANDONMENT

DISTRICT II / ARTESIA

- All cement plugs will be a minimum of 100' in length or a minimum of 25 sacks of cement, whichever is greater.
- Mud laden fluids must be placed between all cement plugs.
- Mud laden fluids must be mixed at 25 sacks of gel per 100 bbls of water.
- A cement plug is required to be set 50' below and 50' above all casing shoes and casing stubplugs. These plugs must be tagged.
- A CIBP with 35' of cement on top may be set in lieu of 100' cement plug.
- A plug as indicated above must be placed within 100' of top perforation. This plug must be tagged.
- Plugs set below and above salt zones must be tagged.
- No more than 2000' is to be allowed between cement plugs in open hole and no more than 3000' in cased hole.
- DV tools are required to have a 100' cement plug set 50' above and below the tool and must be tagged.
- Formations to be isolated with plugs placed at the top of each formation are:
 - o Fusselman
 - o Devonian
 - o Morrow
 - o Wolfcamp
 - o Bone Spring
 - o Delaware
 - Any Salt Section (Plug at top and bottom)
 - o Abo
 - o Glorieta
 - Yates (this plus is usually at base of salt section)
- If cement does not exist behind casing strings at recommended formation depths, the casing must be cut and pulled with plugs set at these depths or casing must be perforated and cement squeezed behind casing at the formation depths.
- In the R-111-P area (Potash Mine area) a solid cement plug must be set across the salt section. Fluid used to mix the cement shall be saturated with the salts common to the section penetrated and in suitable proportions, but not more than a 3% calcium chloride by weight of cement will be considered the desired mixture whenever possible (50' below and 50' above).