
			OCD Arte	sia			
	UNITED STATES	NTERIOR		OMB	M APPROVED NO. 1004-0135 es: July 31, 2010		
BUREAU OF LAND MANAGEMENT SUNDRY NOTICES AND REPORTS ON WELLS			5. Lease Serial No. NMNM02862				
Do not use this form for proposals to drill or to re-enter an abandoned well. Use form 3160-3 (APD) for such proposals.				6. If Indian, Allotte	e or Tribe Name		
SUBMIT IN TRIPLICATE - Other instructions on reverse side.				7. If Unit or CA/Ag 891000303X	greement, Name and/or No.		
1. Type of Well Gas Well Other				8. Well Name and N POKER LAKE			
2. Name of Operator BOPCO LP Contact: WHITNEY MCKEE E-Mail: wbmckee@basspet.com				9. API Well No. 30-015-41246	6-00-X1		
Ph: -			Phone No. (include area code) 10. Fie 432-221-7353 NAS		or Exploratory		
MIDLAND, TX 79702 4. Location of Well (Footage, Sec., T., R., M., or Survey Descriptio		<u> </u>		11. County or Paris	11. County or Parish, and State		
Sec 34 T24S R30E NENW 850FNL 2225FWL					EDDY COUNTY, NM		
12 CHECK AD	PROPRIATE BOX(ES) TO			OTICE REPORT OF OTH	ΈΡ ΔΑΤΑ		
TYPE OF SUBMISSION	12. CHECK APPROPRIATE BOX(ES) TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA TYPE OF SUBMISSION TYPE OF ACTION						
	Acidize			Production (Start/Resume)			
Notice of Intent	Alter Casing		acture Treat	□ Reclamation	□ Well Integrity		
Subsequent Report	Casing Repair		w Construction	□ Recomplete	Other		
Final Abandonment Notice	Change Plans	🗖 Plu	g and Abandon	Temporarily Abandon	Change to Original PD		
	Convert to Injection	🗖 Plu	ig Back	Water Disposal			
13. Describe Proposed or Completed O If the proposal is to deepen directio Attach the Bond under which the w following completion of the involvi testing has been completed. Final A determined that the site is ready for	nally or recomplete horizontally, ork will be performed or provide ed operations. If the operation re Abandonment Notices shall be fil-	give subsurface the Bond No. c sults in a multip	e locations and measur on file with BLM/BIA. ple completion or recor	ed and true vertical depths of all per Required subsequent reports shall appletion in a new interval, a Form 3	tinent markers and zones. be filed within 30 days 160-4 shall be filed once		
BOPCO, L.P. respectfully rea the Cameron MBS wellhead. The Cameron MBS wellhead hangers and test plugs will b nippled up on surface casing drilling operation, 250 psi low of the casing burst to ensure seals.	Attached is the Cameron will be installed on the 13 e supervised by Cameron and tested to the maximul or and 3,000 psi high. The i	MBS wellhe -3/8? surface field personr m pressures ntermediate string as wel	ead schematic that e casing. The weke nel. The BOP stac e expected at any p casing will be test If as test the multi- SEE	will be utilized. I, running of k will be oint in the ed to 70%	Whate 8/19 Scopped for rec NMOCD		
14. I hereby certify that the foregoing			by the BLM Well	Information System	······································		
0-	For B	BOPCO LP,s	ent to the Carlsbad	•			
Committed to AFMSS for processing by KU Name(Printed/Typed) BRIAN BRAUN			Title DRILLING ENGINEER				
Signature (Electronic	Submission)		Date 07/24/20				
	THIS SPACE FO	DR FEDER	AL OR STATE C				
Approved By_CHRISTOPHER WALLS			TitlePETROLEL		Date 08/06/20		
	Conditions of approval, if any, are attached. Approval of this notice does not warrar certify that the applicant holds legal or equitable title to those rights in the subject lewhich would entitle the applicant to conduct operations thereon.						

** BLM REVISED **



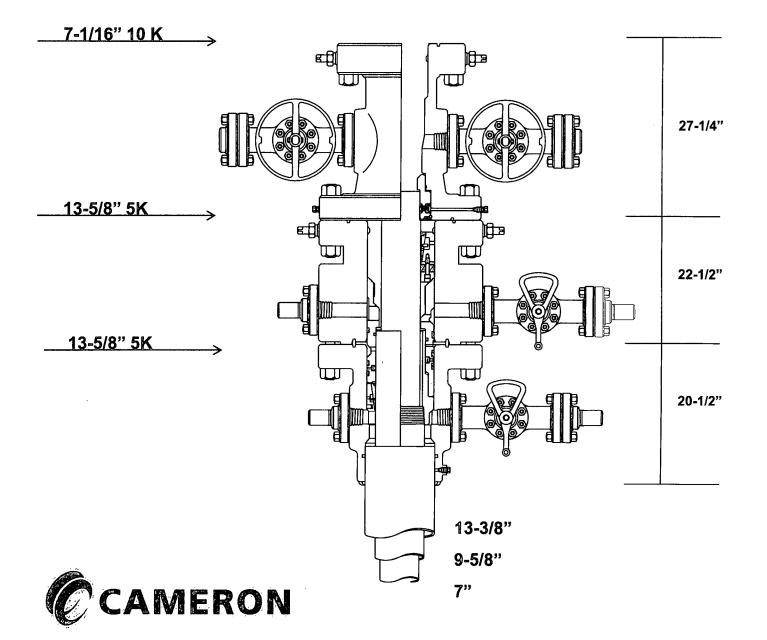

CONDITIONS OF APPROVAL

OPERATOR'S NAME:	BOPCO, L.P.
LEASE NO.:	NMNM-2862
WELL NAME & NO.:	Poker Lake Unit 428H
SURFACE HOLE FOOTAGE:	0850' FNL & 2225' FWL
BOTTOM HOLE FOOTAGE	1950' FNL & 1950' FEL Sec. 28, T. 24 S., R 30 E.
LOCATION:	Section 34, T. 24 S., R 30 E., NMPM
COUNTY:	Eddy County, New Mexico

A. PRESSURE CONTROL

- 1. All blowout preventer (BOP) and related equipment (BOPE) shall comply with well control requirements as described in Onshore Oil and Gas Order No. 2 and API RP 53 Sec. 17.
- 2. Variance approved to use flex line from BOP to choke manifold. Check condition of flexible line from BOP to choke manifold, replace if exterior is damaged or if line fails test. Line to be as straight as possible with no hard bends and is to be anchored according to Manufacturer's requirements. The flexible hose can be exchanged with a hose of equal size and equal or greater pressure rating. Anchor requirements, specification sheet and hydrostatic pressure test certification matching the hose in service, to be onsite for review. If the BLM inspector questions the straightness of the hose, a BLM engineer will be contacted and will review in the field or via picture supplied by inspector to determine if changes are required (operator shall expect delays if this occurs).
- 3. Operator has proposed a multi-bowl wellhead assembly. This assembly will only be tested when installed on the surface casing. Minimum working pressure of the blowout preventer (BOP) and related equipment (BOPE) required for drilling below the surface casing shoe shall be 3000 (3M) psi.
 - a. Wellhead shall be installed by manufacturer's representatives, submit documentation with subsequent sundry.
 - b. If the welding is performed by a third party, the manufacturer's representative shall monitor the temperature to verify that it does not exceed the maximum temperature of the seal.
 - c. Manufacturer representative shall install the test plug for the initial BOP test.
 - d. Operator shall perform the intermediate casing integrity test to 70% of the casing burst. This will test the multi-bowl seals.
 - e. If the cement does not circulate and one inch operations would have been possible with a standard wellhead, the well head shall be cut off, cementing operations performed and another wellhead installed.

 α

- 4. The appropriate BLM office shall be notified a minimum of 4 hours in advance for a representative to witness the tests.
 - a. In a water basin, for all casing strings utilizing slips, these are to be set as soon as the crew and rig are ready and any fallback cement remediation has been done. The casing cut-off and BOP installation can be initiated four hours after installing the slips, which will be approximately six hours after bumping the plug. For those casing strings not using slips, the minimum wait time before cut-off is eight hours after bumping the plug. BOP/BOPE testing can begin after cut-off or once cement reaches 500 psi compressive strength (including lead when specified), whichever is greater. However, if the float does not hold, cut-off cannot be initiated until cement reaches 500 psi compressive strength (including lead when specified).
 - b. The tests shall be done by an independent service company utilizing a test plug **not a cup or J-packer**. The operator also has the option of utilizing an independent tester to test without a plug (i.e. against the casing) pursuant to Onshore Order 2 with the pressure not to exceed 70% of the burst rating for the casing. Any test against the casing must meet the WOC time for water basin (18 hours) or potash (24 hours) or 500 pounds compressive strength, whichever is greater, prior to initiating the test (see casing segment as lead cement may be critical item).
 - c. The test shall be run on a 5000 psi chart for a 2-3M BOP/BOP, on a 10000 psi chart for a 5M BOP/BOPE and on a 15000 psi chart for a 10M BOP/BOPE. If a linear chart is used, it shall be a one hour chart. A circular chart shall have a maximum 2 hour clock.
 - d. The results of the test shall be reported to the appropriate BLM office.
 - e. All tests are required to be recorded on a calibrated test chart. A copy of the BOP/BOPE test chart and a copy of independent service company test will be submitted to the appropriate BLM office.
 - f. The BOP/BOPE test shall include a low pressure test from 250 to 300 psi. The test will be held for a minimum of 10 minutes if test is done with a test plug and 30 minutes without a test plug. This test shall be performed prior to the test at full stack pressure.

CRW 080613